



FACILITY COMPLIANCE AUDIT REPORT
Division of Waste Management
Solid Waste Section

UNIT TYPE:											
Lined MSWLF	<input checked="" type="checkbox"/>	LCID		YW		Transfer		Compos	<input checked="" type="checkbox"/>	SLAS	COUNTY: Iredell PERMIT NO.: 49-03 FILE TYPE: COMPLIANCE
Closed MSWLF		HHW		White goods	<input checked="" type="checkbox"/>	Inciner		T&P	<input checked="" type="checkbox"/>	FIRM	
CDLF	<input checked="" type="checkbox"/>	Tire T&P / Collection	<input checked="" type="checkbox"/>	Tire Monofill		Industrial Landfill		DEMO		SDTF	

Date of Audit: September 14, 2010

Date of Last Audit: August 27, 2010

FACILITY NAME AND ADDRESS:

Iredell County Landfill
 354 Twin Oaks Road
 Statesville, North Carolina 28625

GPS COORDINATES: N: 35.77114 W: 80.82346

FACILITY CONTACT NAME AND PHONE NUMBER:

David Lambert, Solid Waste Director (704) 878-5430

FACILITY CONTACT ADDRESS:

Same

AUDIT PARTICIPANTS:

David Lambert, Solid Waste Director
 Terry Church, Landfill Supervisor
 Charles Gerstell, NCDENR-Solid Waste Section

STATUS OF PERMIT:

The Permit to Operate a Municipal Solid Waste Landfill Unit Phase 4 was issued on July 30, 2008 and shall expire on July 30, 2013.

PURPOSE OF AUDIT:

Follow-up Audit

NOTICE OF VIOLATION(S):

No new violations

You are hereby advised that, pursuant to N.C.G.S. 130A-22, an administrative penalty of up to \$15,000 per day may be assessed for each violation of the Solid Waste Statute or Regulations. For the violation(s) noted here, you may be subject to enforcement actions including penalties, injunction from operation of a solid waste management facility or a solid waste collection service and any such further relief as may be necessary to achieve compliance with the North Carolina Solid Waste Management Act and Rules.

FACILITY COMPLIANCE AUDIT REPORT
Division of Waste Management
Solid Waste Section

Page 2 of 3

STATUS OF PAST NOTED VIOLATIONS:

15A North Carolina Administrative Code 13B .1626(8)(d) states: *Leachate shall be contained on site or properly treated prior to discharge. An NPDES permit may be required prior to the discharge of leachate to surface waters.*

During an inspection performed on August 10, 2010, a leachate outbreak was observed on the southern portion of Phase 4 near the transition from the inactive Phase 3. Leachate from this outbreak was observed flowing beyond the edge of liner marker. Therefore, leachate was not properly treated prior to discharge. Iredell County was found in violation of 15A NCAC 13B .1626(8)(d)

To achieve compliance, Iredell County was directed to complete the following actions.

1. Monitor to assure leachate is contained on site or properly treated prior to discharge in accordance with 15A NCAC 13B .1626(8)(d).
2. To assess the impact of the leachate release outside the waste cell, Iredell County shall acquire the services of a N.C. licensed geologist with experience in assessment and remediation of ground water contamination and submit a phased assessment plan to the Division. The professional geologist shall consult with the Solid Waste Section Hydrogeologist about the site prior to developing the plan. The Section will review the submitted plan, approve, or request more information or amendments before implementation. The plan shall be implemented as approved. Within 30 days, submit this plan to:

Ervin Lane, Compliance Hydrogeologist
NCDENR-Division of Waste Management
Solid Waste Section
410 Oberlin Road, Suite 150
1646 Mail Service Center
Raleigh, North Carolina 27699-1646

3. Within 30 days, submit a revised leachate management plan to detail procedures to identify and repair any future leachate seeps and to prevent a leachate release beyond the liner system. Submit the revised plan to:

Larry Frost, Regional Engineer
NCDENR-Division of Waste Management
Solid Waste Section
2090 US Highway 7
Swannanoa, NC 28778

A follow-up inspection performed on August 27, 2010 found no additional leachate outbreaks. A *Proposed Sample and Analysis Plan* was received by the Division on August 23, 2010 and approved on August 27, 2010. Please refer to the letter issued by Ervin Lane, Compliance Hydrogeologist, dated August 27, 2010. Therefore, items 1 and 2 had been addressed.

A document entitled "Repair of a Leachate Breakout" was submitted by Mr. David Lambert by electronic correspondence on September 2, 2010. This document was submitted to comply with the request for a revised leachate management plan and is currently under review. As a result, this violation is considered resolved.

15A North Carolina Administrative Code 13B .1626(2)(a) states: *Except as provided in (2)(b) of this Paragraph, the owners or operators of all MSWLF units must cover disposed solid waste with six inches of earthen material at the end of each operating day, or at more frequent intervals if necessary, to control disease vectors, fires, odors, blowing litter, and scavenging.*

FACILITY COMPLIANCE AUDIT REPORT
Division of Waste Management
Solid Waste Section

Page 3 of 3

Operational cover was inadequate on inactive areas south of the working face of the MSWLF unit during both inspections performed on August 10, 2010 and August 11, 2010. Therefore, Iredell County was found in violation of 15A NCAC 13B .1626(2)(a).

To achieve compliance, Iredell County was directed to cover all inactive areas with a minimum of six inches of earthen material within 5 days of issuance of the audit report with Notice of Violation(s).

During a follow-up inspection performed on August 27, 2010 the following was observed: All eroded gullies with exposed waste previously observed on August 10th and August 11th had been repaired. Good operational cover was observed on the slopes. Additional soil was also placed on inactive areas throughout the southern portion of the MSWLF. However, a significant amount plastic and other waste such as plastic bottles were observed on the surface of the soil. Mr. Lambert and Mr. Church explained that this waste had worked its way to the surface of the soil as a result of equipment traversing the inactive portions of the landfill to apply soil.

A second follow-up inspection performed on September 14, 2010 found good operational cover on all inactive areas throughout the landfill. Therefore, this violation is considered resolved.

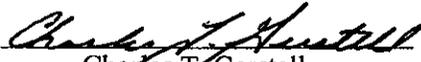
AREAS OF CONCERN AND COMMENTS:

1. This inspection was a follow-up audit to evaluate efforts to comply with the Notice of Violation(s) issued on August 18, 2010. Please see the above comments for details

Operations Inspection of the MSW Landfill Unit:

2. Waste was being placed in Phase 4 at the time of inspection.
3. The active working face was small and compact.
4. No unacceptable waste streams were observed.
5. Windblown waste was managed at the time of inspection.
6. An inactive working face was observed just south of the active working face during the inspection and was properly covered with Posi-Shell.

Please contact me if you have any questions or concerns regarding this audit report.


 Charles T. Gerstell
 Environmental Senior Specialist
 Regional Representative

Phone: (704) 235-2144

Delivered on : <u>9/24/10</u> by		Hand delivery	X	Electronic Correspondence		Certified No.
----------------------------------	--	---------------	----------	---------------------------	--	---------------

cc: Mark Poindexter, Field Operations Branch Supervisor
 Deb Aja, Western District Supervisor