

Facility ID#:

**UST CLOSURE  
INSPECTION CHECKLIST**

Inspector's Name K. Gage Date 3-9-93

**I SITE INFORMATION**

Facility/Site Name: Old Dominion Freight Lines  
 City/Town: Greensboro County: Guilford  
 Owner: Old Dominion Freight Phone: 919-855-6990  
 Operator: " Phone: "  
 Contractor: Four Seasons Industrial Phone: 919-273-2718  
 Laboratory: Pace Labs Phone: \_\_\_\_\_  
 Directions: \_\_\_\_\_

Date of scheduled UST Removal (from GW/UST-3): 1-18-93

**II UST STATUS**

Tank #:	1	2	3	4	5	6	7	8
Size:	<u>4K</u>	<u>15K</u>	<u>20K</u>	<u>20K</u>				
Product:	<u>waste oil</u>	<u>diesel</u>	<u>diesel</u>	<u>diesel</u>				

Remark Y (YES), N (NO), NA (NOT APPLICABLE), and U (UNKNOWN) for each of the following:

**III CLOSURE PROCEDURES**

U Tanks, tools, equipment bonded or grounded?  
U OSHA/Safety violations observed: \_\_\_\_\_  
 \_\_\_\_\_  
Y Product in piping drained into tank?  
Y Tanks properly purged? Method: \_\_\_\_\_  
Y Tanks emptied and cleaned properly?  
Y Accessible openings capped or plugged except 1/8" vent?  
NA UST(s) closed in place and filled with solid inert material?  
 Final destination of tank(s): Four Seasons Ind. - Patton Ave.  
 Final destination of product, contaminated soil, contaminated water, etc.:  
Four Seasons Ind. stockpiled site

**IV SITE DESCRIPTION**

Y Soil stained and/or petroleum odor?  
Y Contaminated soil excavated? Quantity? (estimate): \_\_\_\_\_  
N Soil samples taken of excavated soil left on site?  
 Excavated soil on plastic or trucked away? (Circle one)  
 Tank(s) condition: #1 - poor, #2 - good, #3 - good, #4 - good  
 Product line condition?:  
Pressure system (Believe lines run under bldg.)

**V SAMPLING LOCATION**

NA USTs < 20': one at each end?  
Y USTs > 20': one at each end & middle?  
N Samples every 20' of piping?  
N Samples under each tank island?  
N Water samples? (in lieu of soil samples)  
 Samples: floor, side, stockpiled soil?:

**VI SAMPLE COLLECTION QUALITY CONTROL**

Collection method: (Shovel, auger, back hoe):  
ICE How Preserved? (ice):  
Y Tools decontaminated: (soap, Di-H<sub>2</sub>O, MEOH, organic-free H<sub>2</sub>O).  
U Chain-of-Custody form (required):

**VII SUMMARY OF SITE CONDITIONS**

N Groundwater intersected?  
N Bedrock encountered?  
Y Contaminated soil?  
N Free product in excavation?

**VIII SAMPLES COLLECTED BY DEM PERSONNEL**


N Samples collected?  
 Sample locations:

**XV COMMENTS:**

4'x24' #1- very compacted, overburden stockpiled due to overfills on fill spout end.  
 & pitted, Buried ~1/2' deep, no obvious stains or odors; 0ppm PID  
 10'6"x24' #2- saturated soil (see map); originally registered as LSK gas - converted to diesel several yrs. ago  
 Slight odor fill & center; ABCPID vent end

**DIAGRAM OF SITE INVESTIGATION AT UST CLOSURE**

Diagram should include physical structures such as roads, buildings, etc.; former location of USTs, pumps, product lines; soil sampling locations; and location of excavated soil.

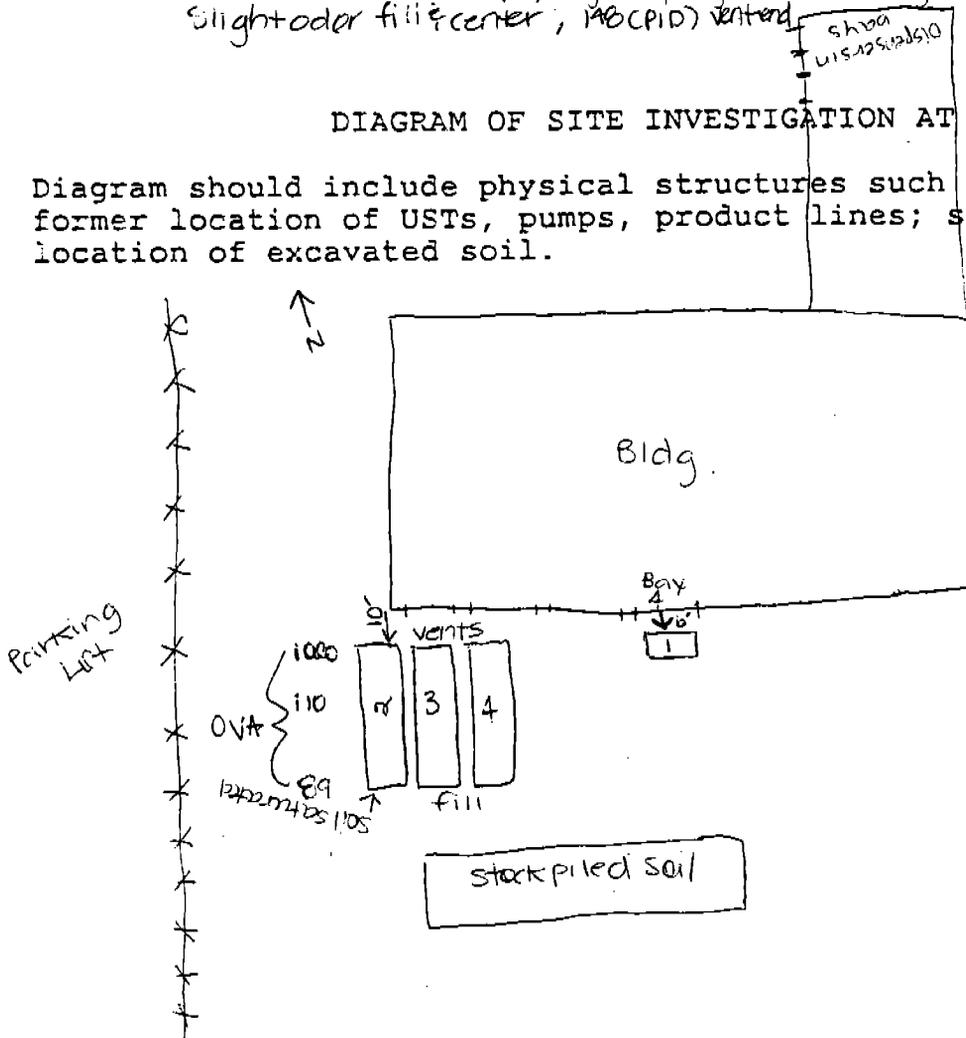

#3- 31'2  
 soil moist under  
 tank, possible overfill  
 and subsequent  
 seepage under tank  
 tank condition good  
 #4- 31'2  
 tank in good  
 condition  
 contamination  
 near vent  
 end