

DAACO, INC.

Pump and Tank Contractors

5212 West Market Street

Greensboro, N.C. 27409

Phone (919) 294-3199

Guilford County Emergency Services
P.O. Box 18807
Greensboro, N.C. 27419

ATTN: Sharon Cihak

RE: Site Closure at 211 Industrial Ave. for Nabisco Brands Inc.


Madam:


I am sorry it took so long to return this information but this job was done prior to computer filing and everything had to be pulled from boxes of old records. I have included a site map, laboratory results and a letter to Mr. Sandmeir with NABISCO. It seems there was no contamination from the fuel tank but someone physically poured burnt motor oil down a storm drain and down the side of the excavation. Terry Cole was called back out to examine the spill but I don't know if any further action was taken. DAACO gathered up the contaminated soil and placed it into a DOT approved drum and had Four Seasons Industrial Services dispose of it. I can not find a manifest for the drum, I suspect it was sent in with the bill of extras. A copy of the letter sent to Mr. Sandmeir describing the removal, waste oil and closure has been included. I hope this will be enough information to close out this case.

Please call if I can help or answer any questions.

Sincerely

DAACO, INC.

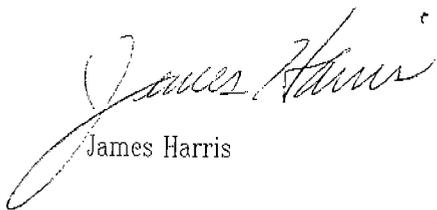
James Harris

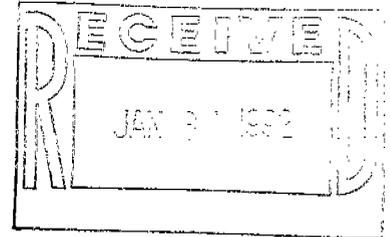

FAACO, INC.

Pump and Tank Contractors

5212 West Market Street

Greensboro, N.C. 27409

Phone (919) 294-3199

March 27, 1989

Nabisco Brands, Inc.
Attn: Bruce Sandmeir
200 DeForest Ave.
East Hanover, NJ 07936-1944

RE: Job Daily Progress Report and Completion Summary

Dear Mr. Sandmeir:

We arrived on the site March 15, to begin the excavation of your twelve thousand gallon tank. On the previous day, we had pumped the contents of the tank into our tank trailer and brought it to our yard for our own use.

Over night, the tenant in your building had cleaned out the storage shed and in doing so dumped waste oil sludge down the storm drain and into our pilot hole. (See photos #2 and 3) We informed Guilford County authorities of this infraction to insure no one thought we had done it. This soil was drummed and sent to Four Seasons Industrial Services for transport to a proper landfill.

Excavation of the tank was routine as no leaks or spills were found in any of the piping or soils. The remaining product in the piping was contained and returned to the tank. All pipes and conduits related to this system were removed and disposed of along with the concrete island and storage building pad at a registered demolition landfill.

Dry ice was introduced in the amount of 1.5 pounds per one hundred gallons of storage to render the tank inert for the haul to Colfax.

The tank was hoisted with a crane after being excavated, carefully inspected visually for holes (none were found) and loaded on one of our trailers and transported to Safeway Tank Disposal Co. in Colfax, NC.

When the tank was hoisted, the other excavation wall caved in, taking several fence posts with it. (See photos 8 and 9)

Soil samples were taken at this point from the bottom of the tank hole to be analyzed for total petroleum hydrocarbons.

The bottom of the excavation was wet and we chose to stabilize this situation with surge rap stone. Most of the

material removed from the hole was also wet and we co-mingled this soil with stone until we were left with the remaining wettest material which we spread out on the site to dry over night.

This was not enough time to dry the material but since the tank was not located in a paved area, we decided to let the soil settle for a few weeks before recompacting and reseeding.

This is the condition of the site presently. Sometime in the next two weeks we should be able to finish compacting and seed the area. The fence will be properly mended as well.


We are submitting our invoice in full with extra charges for the contaminated soil and fence repair listed as extras.

Thank you for the opportunity to be of service. If further information is required please call.


Best regards,

DAACO, Inc.

Davis A. Andrews, Jr.

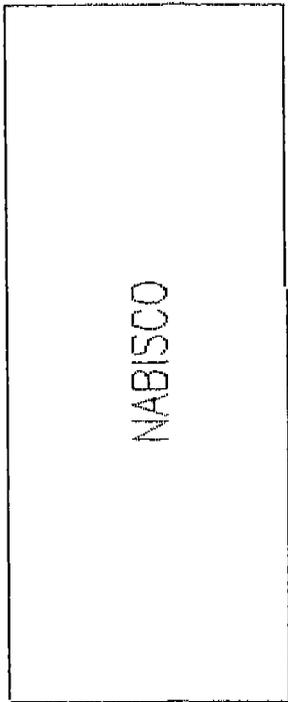


NABISCO

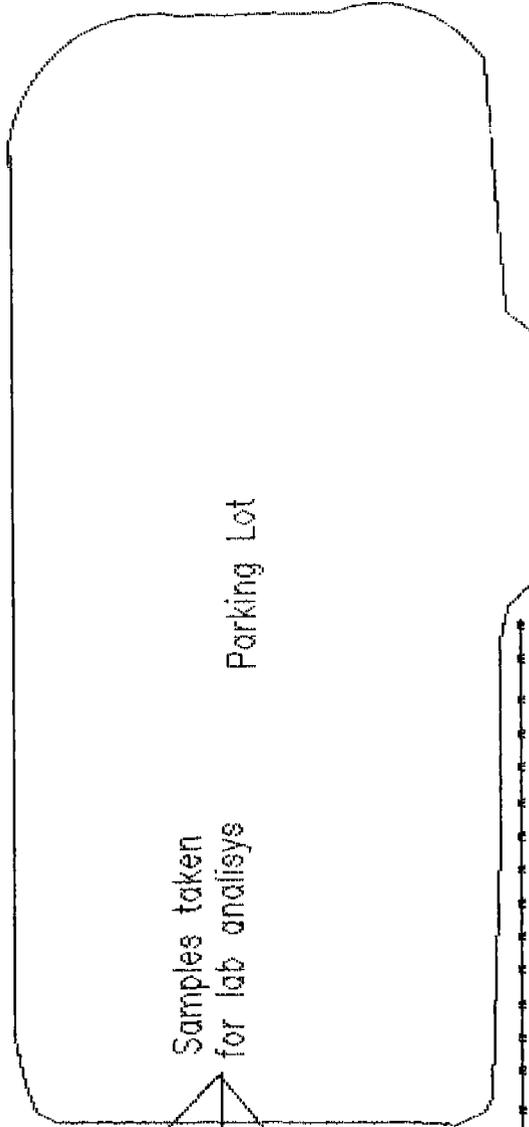

Parking Lot

Samples taken
for lab analysis

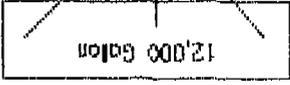

12,000 Gallon

211 Industrial Ave.



GUILFORD LABORATORIES, INC.
P.O. Box 9735/Plaza Station/Greensboro, N.C. 27408

April 6, 1989

REPORT OF ANALYSIS

JOB #: DA90316

CUSTOMER: Daaco Inc

ATTN: Dave Andrews

P.O.# :

SAMPLE: # 1951 SOIL RJR/NABISCO A
1952 SOIL RJR/NABISCO B
1953 SOIL RJR/NABISCO C

RESULTS

Total Petroleum Hydrocarbons (ppm)

1951

1952

1953

<4

<4

<4

Guilford Laboratories, Inc.

J. A. Rayburn
J. A. Rayburn

