

Bank of America
525 West Trade Street
Mail Stop NC1-023-05-23
Charlotte, NC 28255

**Phase I Environmental Site
Assessment**

950-1000 West Trade Street
Charlotte, North Carolina 28202
Mail Code: NCW-481

April 29, 2011



Sean D. Drain
Staff Scientist

Stephen P. McCarthy
Senior Environmental Scientist

The environmental assessment described herein was conducted by the undersigned of ARCADIS U.S., Inc. (ARCADIS). ARCADIS' investigation consisted solely of the activities described in the Introduction of this report, in accordance with the Bank of America Phase I Environmental Site Assessment Standard Scope of Work and Report Outline, and is subject to the Limitations and Service Constraints provided in Section 6.0 and the Terms and Conditions of the Standard Consulting Services Agreement signed prior to initiation of the assessment.

Phase I Environmental Site Assessment

Prepared for:
Bank of America
525 West Trade Street
Charlotte, NC 28255

Prepared by:
ARCADIS U.S., Inc.
194 Forbes Road
Braintree, MA 02184

Tel 781.356.7300
Fax 781.356.2211

Our Ref.:
HT118882.0003

Date:
April 29, 2011

This document is intended only for the use of the individual or entity for which it was prepared and may contain information that is privileged, confidential and exempt from disclosure under applicable law. Any dissemination, distribution or copying of this document is strictly prohibited.



Executive Summary of Findings	iv
1. Introduction	1
1.1 Purpose	1
1.2 Involved Parties	1
1.3 Scope of Work	2
2. General Site Characteristics	3
2.1 Site Ownership and Location	3
2.2 Adjacent Properties	4
2.3 Site Description and Current Site Uses/Operations	4
2.4 Former Site Uses/Operations	5
3. Environmental Setting	5
3.1 Regional Physiographic Conditions	5
3.2 Soil Conditions	5
3.3 Geologic Conditions	6
3.4 Surface Water and Groundwater Characteristics	6
4. Results of Investigation	6
4.1 Site Inspection Observations	6
4.2 Standard Environmental Record Sources	8
4.3 Results of Site History/Land Use Review	10
4.3.1 Personnel Site Interviews	10
4.3.2 Municipal File Review	11
4.3.3 Aerial Photographs	11
4.3.4 Fire Insurance Maps	12
4.3.5 City Directories	13
4.3.6 Topographic Maps	13
4.4 Synopsis of Previous Environmental Investigations	13



4.5	User Provided Information	14
4.5.1	Title Records	14
4.5.2	Environmental Liens or Activity and Use Limitations	14
4.5.3	Specialized Knowledge	14
4.5.4	Commonly Known or Reasonably Ascertainable Information	15
4.5.5	Valuation Reduction for Environmental Issues	15
4.5.6	Owner, Property Manager and Occupant Information	15
4.5.7	Reason for Performing Phase I	15
4.5.8	Other Information	15
4.6	Results of Limited ACM Screening	15
4.7	Results of Radon Investigation	16
4.8	Results of Mold Investigation	16
5.	Findings and Conclusions	16
5.1	Known or Suspect RECs	16
5.2	De minimis Conditions	16
5.3	Deviations/Data Gaps	16
5.4	Conclusions	17
6.	Limitations	17
7.	References	19
8.	Statement of Environmental Professional(s)	20

Figures

Figure 1 Vicinity Map

Figure 2 Site Plan

Appendices

- A Site Photographs
- B Regulatory Agency Database Information (EDR Report)
- C Historical Resources
- D User Provided Information
- E Qualifications of Environmental Professionals



Executive Summary of Findings

ARCADIS U.S., Inc. (ARCADIS) was retained by Bank of America to conduct a Phase I Environmental Site Assessment (ESA) of the property located at 950-1000 West Trade Street in Charlotte, Mecklenburg County, North Carolina ("the Site"). The Site is comprised of seven contiguous parcels totaling approximately 3.35 acres, the majority of which are utilized as a gravel parking lot, and an approximately 1.4 acre asphalt-paved parking lot. A vacant two-story, 5,530 square-foot commercial building and its associated asphalt-paved parking lot occupy the northeast corner of the 3.35-acre portion of the Site. The building, which was constructed circa 1961, is addressed as 125 North Irwin Avenue.

The majority of the 3.35-acre portion of the Site was improved with residential dwellings from at least 1929 until the 1960s. A gasoline station (1000 West Trade) occupied the southeast corner of this portion of the Site from circa 1936-1967. The vacant commercial building located on the northeast corner of this portion of the Site was occupied by Metrolina Contractors (2010), Big Ben Grocery (1980/85/95), and Lunsford Grocery (1961/67/70/75). The majority of this portion of the Site appeared to be undeveloped from at least 1973 until conversion to a parking lot in the early 2000s. A residential dwelling occupied the northeast portion of this property until circa 2000.

The 1.4-acre portion of the Site has been utilized as an asphalt-paved parking lot since the early 2000s. Historically, this portion of the Site was utilized for residential purposes from at least 1929 through 1940 and commercial and residential purposes from circa 1950 until conversion to a parking lot.

On March 1, 2011, Mr. Sean Drain of ARCADIS visited the Site to evaluate the possible presence of petroleum products or hazardous materials/wastes at the Site. ARCADIS' investigation included a reconnaissance of the Site and adjacent properties, background research, and review of available local, state and federal regulatory records regarding the presence of petroleum products or hazardous materials/wastes at or in the vicinity of the Site. ARCADIS did not observe the use or storage of hazardous substances or petroleum products at the Site or in the vicinity.

Based on the work completed, the following findings of environmental interest were identified:

- The Site was also identified on Environmental Data Resources, Inc. (EDR's) Historical Auto Stations database as Holcomb's Amoco Service at 1000 West Trade Street. A gasoline station is listed at this location from 1937-1964. This station occupied the southeast corner of the 3.35-acre portion of the Site. ARCADIS was unable to find additional records associated with the former gasoline station.



- A dry cleaner occupied a portion of the Site (924 West Trade Street) in the 1950s. No additional information pertaining to this former dry cleaner was discovered during this assessment.
- The Site is identified on the leaking underground storage tank (LUST) and Incident Management database (IMD) as Gateway Village #2, 950 West Trade Street. ARCADIS contacted the North Carolina Department of Environmental and Natural Resources (DENR) to review available records on file regarding this release. Based on documents obtained from the NCDENR, it appears two fuel oil USTs were discovered on the 1.4-acre portion of the Site during grading activities. ARCADIS reviewed a July 15, 2000 UST Closure Report, Gateway Village, 950 Block of West Trade Street, Charlotte, North Carolina, prepared by Law Engineering and Environmental Services, Inc. (LAW). According to the UST Closure Report, a 2,000-gallon heating oil UST was removed from the Site on June 11, 2002. Discolored soil and a strong fuel oil odor were noted during the excavation. Approximately 128 tons of petroleum-impacted soil was removed from the excavation. Two confirmatory soil samples collected from the excavation were submitted for laboratory analysis of volatile organic compounds (VOCs), polynuclear aromatic hydrocarbons (PAHs), extractable petroleum hydrocarbons (EPH) and volatile petroleum hydrocarbons (VPH). Laboratory results revealed low concentrations of EPH and VPH target compounds and naphthalene. Of the constituents detected, only C11-C22 aromatics were detected at a concentration (39 mg/kg) above the Soil-to-Groundwater Maximum Soil Contaminant Concentration of 34 mg/kg. Documentation reviewed indicated a Limited Site Assessment (LSA) was required to be submitted to the NCDENR. However, a copy of this document was not available for review.

The above-referenced document also included a brief summary of the closure of a 1,000-gallon UST that was discovered and removed in December 1999. According to the report, laboratory analytical results revealed petroleum hydrocarbons in soil above state action levels. As a result, LAW installed and sampled a monitoring well. Groundwater analytical results revealed the presence of benzene at 1.1 micrograms per liter (ug/L). According LAW no further assessment was required and the case was closed by the NCDENR. Documents associated with this UST closure were not available for review.

No other on-Site or off-Site environmental concerns were identified during the ESA.



Conclusion

ARCADIS has performed a Phase I ESA in general conformance with the scope and limitations of ASTM Practice E 1527 of 950-1000 West Trade Street in Charlotte, Mecklenburg County, North Carolina. Any exceptions to, or deletions from, this practice are described in Section 5.3 of this report. This assessment has revealed evidence of the following RECs in connection with the Site:

- A gasoline station occupied the southeast portion of the 3.35-acre portion of the Site from 1937-1964. The status of the USTs associated with this former gasoline station is unknown;
- A dry cleaner occupied a portion of the Site (924 West Trade Street) in the 1950s. No additional information pertaining to this former dry cleaner was discovered during this assessment; and,
- An open LUST case with residual contamination.



1. Introduction

ARCADIS U.S., Inc. (ARCADIS) performed a Phase I Environmental Site Assessment (ESA) of the property located at 950-1000 West Trade Street in Charlotte, Mecklenburg County, North Carolina (“the Site”). The Site is comprised of seven contiguous parcels totaling approximately 3.35 acres, the majority of which are utilized as a gravel parking lot, and an approximately 1.4 acre asphalt-paved parking lot. A vacant two-story, 5,530 square-foot commercial building and its associated asphalt-paved parking lot occupy the northeast corner of the 3.35-acre portion of the Site. The building, which was constructed circa 1961, is addressed as 125 North Irwin Avenue. This ESA document has been prepared and issued in a format as prescribed by and in accordance with Bank of America requirements.

The Site location is identified on Figure 1. The Site layout is detailed on Figure 2. Site photographs are included as Appendix A.

1.1 Purpose

The Phase I ESA has been requested by Bank of America (Client). The purpose of this Phase I ESA is to provide appropriate inquiry into the previous ownership and use of the Site consistent with good commercial and customary practice in an effort to minimize liability. ARCADIS assumes that the information provided by the Client, the site contact, the regulatory database provider, and local government agency is true and reliable.

The objective of the ESA was to identify recognized environmental conditions (RECs) in connection with the property, to the extent feasible pursuant to the processes prescribed in ASTM International E-1527-05 guidelines. The term “REC,” as defined by ASTM, is “the presence or likely presence of any hazardous substances or petroleum products on a property under conditions that indicate an existing release, a past release, or the material threat of a release of any hazardous substances or petroleum products into structures on the property or into the ground, groundwater, or surface water of the property.” The term includes hazardous substances or petroleum products even under conditions in compliance with laws. The term is not intended to include de minimis conditions that generally do not present a material risk of harm to public health or the environment and that generally would not be the subject of an enforcement action if brought to the attention of appropriate governmental agencies.

1.2 Involved Parties

This Phase I ESA was conducted for the use and reliance by Bank of America and its successors and assignees, and may be relied upon by such parties. No use of the information contained in this report by others is permissible without receiving prior written authorization to do so from ARCADIS. ARCADIS is not responsible for independent conclusions, opinions, or recommendations made by others or otherwise based on the findings presented in this report.



1.3 Scope of Work

To complete this assessment, ARCADIS' scope of services included the following:

- Review of Federal and State regulatory agency databases identified by ASTM for the Site and a selected radius around the Site.
- Contact with local environmental regulatory agencies to inquire about environmental conditions at the Site and its vicinity.
- Review of the Site history through available ASTM Standard Historical Sources.
- A reconnaissance of the Site to make surficial observations for evidence of recognized environmental conditions.
- A review of adjoining properties to identify the potential use of hazardous materials.
- Interviews with people knowledgeable about the Site regarding current and past site usage and facility operations.
- Preparation of this report.



2. General Site Characteristics

2.1 Site Ownership and Location

The Site is comprised of eight parcels that have frontage along West 5th Street to the north-northeast, North Sycamore Street to the west, and West Trade Street to the south-southeast. Additionally, North Irwin Avenue bisects the Site. According to information obtained from the Mecklenburg County Assessor’s Office, the Site parcels are summarized as follows:

Parcel #	Address	Acreage
07815301	1027 West 5 th Street	0.82
07815303	118 North Sycamore Street	0.37
07815304	110 North Sycamore Street	0.77
07815308	1012 West Trade Street	0.69
07815312	113 North Irwin Avenue	0.44
07815314	125 North Irwin Avenue	0.17
07815315	1009 West 5 th Street	0.09
07812401	900 West Trade Street	1.4

Seven of the Site parcels are owned by NationsBank. Parcel 07812401 is owned by Southport Investments, LLC.

Access to the Site is via North Irwin Avenue.



2.2 Adjacent Properties

The Site and surrounding properties are located in a mixed commercial and residential area of Charlotte, North Carolina. The use of the adjacent properties at the time of ARCADIS' investigation is summarized as follows:

North/Northeast: West 5th Street, beyond which is an oral surgeon office, a residential dwelling, an office building, a residential apartment building and two surface parking lots.

Northwest: West 5th Street, beyond which is vacant land. Further northwest of the Site is Irwin Creek.

West: North Sycamore Street, beyond which is undeveloped land and Irwin Creek.

South: West Trade Street, beyond which are residential condominiums and an office building.

East: A multi-tenant office building.

2.3 Site Description and Current Site Uses/Operations

The Site consists of approximately 3.35-acres, the majority of which is utilized as a gravel parking lot. A vacant two-story, 5,530 square-foot commercial building and its associated asphalt-paved parking lot occupy the northeast corner of this portion of the Site. The building, which was constructed circa 1961, is addressed as 125 North Irwin Avenue and is constructed of concrete block on a slab-on-grade concrete foundation. Due to the sloping topography, the second level of the building is at grade along its east side. Interior finishes generally include sheetrock walls with a suspended ceiling system containing lay-in acoustical tile and carpeting. Wrought-iron fencing is located along the perimeter of this portion of the Site and a security gate is located along North Irwin Avenue.

The Site also includes a 1.4-acre asphalt-paved parking lot that has frontage along West 5th Street, North Irwin Avenue and West Trade Street. Other improvements on this portion of the Site include landscaping along the north, west and south perimeters and a security gate along North Irwin Avenue.

The on-Site building is heated by natural gas and is connected to the municipal water and sewer systems provided by the Charlotte-Mecklenburg Utilities Department. Duke Energy provides electricity to the area.



2.4 Former Site Uses/Operations

The majority of the 3.35-acre portion of the Site was improved with residential dwellings from at least 1929 until the 1960s. A gasoline station (1000 West Trade) occupied the southeast corner of this portion of the Site from circa 1936-1967. In addition, a commercial building (125 North Irwin) has occupied the northeast corner of this portion of the Site since the early 1960s. Review of city directories reveal this structure was historically occupied by Metrolina Contractors (2010), Big Ben Grocery (1980/85/95), and Lunsford Grocery (1961/67/70/75). The majority of this portion of the Site appeared to have been undeveloped from at least 1973 until conversion to a parking lot in the early 2000s. A residential dwelling occupied the northeast portion of this property until circa 2000.

The 1.4-acre portion of the Site has been utilized as a parking lot since the early 2000s. Historically, this portion of the Site was utilized for residential purposes from at least 1929 through 1940 and commercial and residential purposes from circa 1950 until conversion to a parking lot. Review of city directories and Sanborn Fire Insurance (Sanborn) maps revealed the following commercial use of this portion of the Site:

- 112 North Irwin Avenue – a funeral home from 1961-1999;
- 116 North Irwin Avenue – Arrow Snacks (1961);
- 924 West Trade Street – King Chemical Co., janitorial supplies (1950), Segrest Cleaners (1953/55), boat motors (1961), Best Upholstery (1967), Bennetti's Upholstery (1975), and Charlotte Cab Company (1980/85); and,
- 920 West Trade Street – Rendevous Tourist Home (1967) and Charlotte Labor Temple (1950/55/61).

3. Environmental Setting

3.1 Regional Physiographic Conditions

The United States Geological Survey (USGS) 7.5 Minute Topographic Map of the Charlotte East, North Carolina Quadrangle depicts the site elevation as approximately 676 feet above mean sea level. The 1.4-acre Site parcel is relatively flat with a gently slope towards the west. The 3.35-acre portion of the Site slopes to the west-northwest.

3.2 Soil Conditions

According to the U.S. Department of Agriculture (USDA) Soil Survey data, the Site is comprised of Urban Land. Urban Land is described as an area where more than 85% of the surface is covered by asphalt, concrete, buildings, or other impervious surfaces. Soils and foundation materials are highly variable. Urban structures and works cover so much of this land type that identification of the soils is not practical. Most areas have been smoothed and the original soil material has been disturbed, filled over, or otherwise destroyed prior to construction.



3.3 Geologic Conditions

Based on review of the 1985 Geologic Map of North Carolina, the Site is located within the Charlotte Belt of the Piedmont Physiographic Province. The surficial geology within this Province generally consists of residual soils that have weathered in-place from the underlying bedrock. The topography of the Province consists of rolling hills and broad ridges. According to the geologic map, the bedrock underlying the subject property generally consists of massive to weakly foliated granitic rock.

3.4 Surface Water and Groundwater Characteristics

There are no surface water bodies on or adjacent to the Site. The closest water feature is Irwin Creek, which is located approximately 600 feet west of the Site.

Based on topography and nearby surface water features, groundwater is inferred to flow to the west. Groundwater is anticipated to be approximately 30-40 feet below ground surface (bgs).

4. Results of Investigation

Mr. Sean Drain of ARCADIS conducted a site inspection on March 1, 2011. The weather at the time of the investigation was sunny and a temperature of approximately 48 degrees Fahrenheit. Mr. Drain was accompanied by Ms. Dawn Reeves with Lincoln Harris during the site visit. At the time of the site visit, ARCADIS did not have access to the interior of the Site building.

4.1 Site Inspection Observations

Underground Storage Tanks (USTs) and Aboveground Storage Tanks (ASTs)

ARCADIS did not observe visual evidence of USTs (fill pipes, vent pipes, etc.) or ASTs at the Site.

Hazardous Substances and Petroleum Products

ARCADIS did not observe the use or storage of hazardous substances or petroleum products at the Site.

Unlabeled Drums/Containers

ARCADIS did not observe unlabeled drums or containers at the Site.



Staining/Corrosion

ARCADIS did not observe stained or corroded surfaces at the Site.

Stressed Vegetation

ARCADIS did not observe stressed vegetation at the Site.

Electrical Transformers/Equipment

ARCADIS observed a pole-mounted electrical transformer along the northeast edge of the Site property and on the east side of North Irwin Avenue. The transformers appeared to be in good condition. ARCADIS did not observe evidence of leaks or staining on or beneath the transformers, which are owned and maintained by Duke Power Company. The transformers were not labeled "Non-PCB."

ARCADIS did not observe other electrical transformers or hydraulic equipment at the Site.

Drywells, Sumps, Catch Basins and Floor Drains

ARCADIS did not observe drywells, sumps, or floor drains at the Site.

Drains for storm collection were observed on the 3.35-acre portion of the Site. ARCADIS did not observe evidence of staining around the storm drains, which discharge to the municipal storm water system.

Pits, Ponds, Lagoons and Pools of Liquid

ARCADIS did not observe pits, ponds, lagoons or pools of liquid at the Site.

Wells

ARCADIS did not observe evidence of groundwater monitoring wells, water supply wells, irrigation wells, or other wells at the Site.

Solid Waste

ARCADIS did not observe dumping of solid waste or construction debris on exterior portions of the Site.



Process Wastewater

ARCADIS did not observe the generation or discharge of process wastewater at the Site.

Septic Systems/Sewer

The Site building is connected to the Charlotte-Mecklenburg Utilities Department municipal sewer system. ARCADIS did not observe evidence of an on-site septic system.

Source of Potable Water

Potable water service is provided to the Site building by the Charlotte-Mecklenburg Utilities Department, although the water service was not on at the time of the site visit.

Heating and Cooling Systems

The Site building is heated by natural gas and cooled by electric condensers.

Other Observations

No other significant exterior observations were noted during the site inspection.

4.2 Standard Environmental Record Sources

ARCADIS contracted with Environmental Data Resources, Inc. (EDR) to conduct a search of state and federal regulatory databases that provide information on the regulatory status of a property and incidents involving the use, storage, spills or transportation of hazardous materials and petroleum products at properties located within the radii specified by ASTM E 1527-05. A compilation of Federal and State database listings is provided in the EDR Radius Map Report in Appendix B.



The Site is identified on the leaking underground storage tank (LUST) and Incident Management database (IMD) as Gateway Village #2, 950 West Trade Street. ARCADIS contacted the North Carolina Department of Environmental and Natural Resources (DENR) to review available records on file regarding this release. Based on documents obtained from the NCDENR, it appears two fuel oil USTs were discovered on the 1.4-acre portion of the Site during grading activities. ARCADIS reviewed a July 15, 2000 UST Closure Report, Gateway Village, 950 Block of West Trade Street, Charlotte, North Carolina, prepared by Law Engineering and Environmental Services, Inc. (LAW). According to the UST Closure Report, a 2,000-gallon heating oil UST was removed from the Site on June 11, 2002. Discolored soil and a strong fuel oil odor were noted during the excavation. Approximately 128 tons of petroleum-impacted soil was removed from the excavation. Two confirmatory soil samples collected from the excavation were submitted for laboratory analysis of volatile organic compounds (VOCs), polynuclear aromatic hydrocarbons (PAHs), extractable petroleum hydrocarbons (EPH) and volatile petroleum hydrocarbons (VPH). Laboratory results revealed low concentrations of EPH and VPH target compounds and naphthalene. Of the constituents detected, only C11-C22 aromatics were detected at a concentration (39 mg/kg) above the Soil-to-Groundwater Maximum Soil Contaminant Concentration of 34 mg/kg. Documentation reviewed indicated a Limited Site Assessment (LSA) was required to be submitted to the NCDENR. However, a copy of this document was not available for review.

The above-referenced document also included a brief summary of the closure of a 1,000-gallon UST that was discovered and removed in December 1999. According to the report, laboratory analytical results revealed petroleum hydrocarbons in soil above state action levels. As a result, LAW installed and sampled a monitoring well. Groundwater analytical results revealed the presence of benzene at 1.1 micrograms per liter (ug/L). According LAW no further assessment was required and the case was closed by the NCDENR. Documents associated with this UST closure were not available for review.

The Site was also identified on EDR's Historical Auto Stations database as Holcomb's Amoco Service at 1000 West Trade Street. A gasoline station is listed at this location from 1937-1964. This station occupied the southeast corner of the 3.35-acre portion of the Site. ARCADIS was unable to find additional records associated with the former gasoline station.

A dry cleaner occupied a portion of the Site (924 West Trade Street) in the 1950s. No additional information pertaining to this former dry cleaner was discovered during this assessment.



Based upon their distance, regulatory status and/or inferred direction of groundwater flow, none of the off-site properties identified by the database search represent an issue of environmental concern, except for the following:

- **RSA (B&K Investments)** at 900 West Trade Street abuts the Site to the east. This facility is listed on the LUST, UST and IMD databases. Soil contamination was discovered in 1992 during an UST closure. This property was developed with a large office building circa 2000. As a result, this release is not expected to represent an REC in connection with Site.
- **AAA Sunoco Service** at 933 West Trade Street is located to the south of the Site across West Trade Street. This facility is identified on EDR's Historical Auto Stations database. A gasoline station operated at this location from circa 1959-1967. This property was redeveloped with an office building in 1985. As a result, this release is not expected to represent an REC in connection with Site.
- **Segrest Cleaners** at 915 West 5th Street abuts the Site to the east. This facility is identified on EDR's Historical Cleaners database. A dry cleaner operated at this location from circa 1967-1984. This property was redeveloped with an office building in 2000. As a result, this release is not expected to represent an REC in connection with Site.
- **Wright One Hour Cleaners** at 912 West Trade abuts the Site to the southeast. This facility is identified on EDR's Historical Cleaners database. A dry cleaner operated at this location circa 1994. This property was redeveloped with an office building in 2000. As a result, this release is not expected to represent an REC in connection with Site.
- **The Boulevard Company #1** at 215 North Irwin Street is located approximately 200 feet northeast of the Site. This facility is listed on the LUST database. According to the database search, a heating oil UST was struck during grading activities. The database listing is currently classified as "closed." Based on the current regulatory status and direction, this facility does not represent an REC in connection with Site.

4.3 Results of Site History/Land Use Review

4.3.1 Personnel Site Interviews

Interview with Owner/Key Site Manager

ARCADIS interviewed the property manager for the Site who indicated that he was not aware of environmental issues at the property.



Interviews with Local Government Officials

ARCADIS visited various municipal offices to review available records on file for the Site. Refer to the section below for additional information.

4.3.2 Municipal File Review

ARCADIS visited the City of Charlotte municipal offices on March 2, 2011 in an attempt to review available documents on file for the Site. ARCADIS contacted the Land Use and Environmental Services Agency for records regarding the Site. No records relating to a septic system, USTs or other environmental issues were obtained. The Planning Department indicated the Site is zoned UMUD-Uptown Mixed Use District and is not in a distressed business district. According to Calvin Wright, Senior Fire Inspector with the Charlotte Fire Department (CFD), no records are on file regarding spills or hazardous materials at the Site and there have been no CFD responses involving petroleum or other hazardous materials. ARCADIS reviewed available building permits for the 900 block of West Trade Street on the Mecklenburg County Code Enforcement webpage. A demolition permit was applied for in November 1998 for the remaining structures on the 900 block of West Trade Street.

The Mooresville office of the NCDENR was contacted for information regarding the Site that has been discussed in Section 4.2.

4.3.3 Aerial Photographs

ARCADIS reviewed aerial photographs provided by EDR for the years 1950, 1968, 1973, 1983, 1988, 1996 and 2006 and identified the following information:

1950: The 1950 aerial photograph depicts the Site and surrounding area as improved with small structures.

1968: The 1968 aerial photograph depicts the Site and surrounding area as similar to the 1950 photograph.

1973: The majority of the 3.35 acre portion of the Site appears to be cleared of structures. A structure is depicted in the northeast corner of this portion of the Site. A few structures also appear to be located on the 1.4 acre portion of the Site. The surrounding area is developed with small structures.

1983: Due to the scale and quality of the photograph, observations are limited.



1988: The 1988 aerial photograph depicts the majority of the 3.35 acre portion of the Site as undeveloped; structures are depicted in the northeast corner. The 1.4 acre portion of the Site appears developed. Office buildings have been constructed southeast of the Site.

1996: Tree growth on the 3.35 acre portion of the Site limits observations; however, buildings appear in the northeast corner and the southeast corner appears cleared. Commercial-type structures are also present on the 1.4-acre portion of the Site. In the surrounding area, development activities appear underway southeast of the Site.

2006: The 2006 aerial photograph depicts the Site and surrounding area similar to conditions observed at the time of the site visit.

Refer to Appendix C for copies of the foregoing aerial photographs.

4.3.4 Fire Insurance Maps

ARCADIS reviewed historic Sanborn Fire Insurance (Sanborn) maps provided by EDR for the years 1929, 1950, 1953 and 1963 and identified the following information:

1929: The 1929 map depicts the Site with dwellings and detached garages. The surrounding area consists of residential-type dwellings.

1950: The 1950 map depicts the majority of the 3.35 acre portion of the Site as improved with residential dwellings and associated detached garages. A gasoline station at 1000 West Trade Street is depicted in the southeast corner of this portion of the Site. The majority of the 1.4 acre portion of the Site is improved with residential dwellings and associated detached garages, except for a building at 924 West Trade Street, which is labeled "Wholesale Chemicals." The area surrounding the Site is primarily residential, with a gasoline station located southwest of the Site.

1953: The 1953 map is essentially unchanged from the 1950 map, except the building at 924 West Trade Street is labeled "Dry Cleaning & Pressing" and the adjacent building at 920 West Trade Street is labeled "Labor Temple." A building labeled "printing" is located south-southeast of the Site.

1963: The 1963 map depicts the 3.35 acre portion of the Site essentially unchanged from the 1953 map. The 1.4 acre portion of the Site is improved with residential dwellings, buildings labeled "Upholstery", "Labor Temple", "undertaker" and a "store." The surrounding area is similar to the 1953 maps, however, a gasoline station has been constructed south-southeast of the Site and a small auto repair facility is present to the north across West 5th Street.

Refer to Appendix C for a copy of the Sanborn maps.



4.3.5 City Directories

ARCADIS reviewed city directories at the Charlotte-Mecklenburg Library at approximate five-year intervals for the years 1931 to 2010, as available.

Listings for the current Site building at 125 North Irwin included the following: Metrolina Contractors (2010); Big Ben Grocery (1980/85/95); and, Lunsford Grocery (1961/67/70/75).

Review of the city directories revealed numerous residential and commercial listings for the Site. Listings of potential environmental concern included the following:

1000 West Trade Street – a gasoline station was listed at this address from 1936-1967;

924 West Trade Street – King Chemical Co., janitorial supplies (1950), Segrest Cleaners (1955), boat motors (1961), Best Upholstery (1967), Bennetti's Upholstery (1975), and Charlotte Cab Company (1980/85); and,

112 North Irwin – a funeral home was listed at this address from 1961-2000;

4.3.6 Topographic Maps

Topographic maps were obtained from EDR for the years 1905, 1942, 1949, 1967, 1980 and 1988 and identified the following information:

1905: The 1905 map is a 15-minute map encompassing the Charlotte quadrangle and does not depict structures in the site vicinity.

1942: The 1942 map is a 30-minute map encompassing the Charlotte quadrangle and does not depict structures.

1949-1988: These maps are 7.5-minute maps encompassing the Charlotte East quadrangle. None of the maps depicts structures at the Site; the Site is depicted as being in an urban area.

The EDR Topographic Map report is included in Appendix D.

4.4 Synopsis of Previous Environmental Investigations

ARCADIS was not provided with prior ESA reports for the Site.



4.5 User Provided Information

Ms. Shirley Cato, Lincoln Harris Senior Manager, completed a User Questionnaire on behalf of Bank of America. The User Questionnaire is provided in Appendix D.

4.5.1 Title Records

Title records were not provided to ARCADIS.

4.5.2 Environmental Liens or Activity and Use Limitations

The representative of the client was asked the following questions as part of the assessment:

- Are you aware of any environmental cleanup liens that have been filed or recorded against the Site under federal, tribal, state, or local law? **Answer: No.**
- Are you aware of any activity or land use limitations, such as engineering controls, land use restrictions, or institutional controls, that are in place at the Site and/or have been filed or recorded against the Site in a registry under federal, tribal, state, or local law? **Answer: No.**

4.5.3 Specialized Knowledge

The representative of the client was asked the following questions as part of the assessment:

- Do you have any specialized knowledge or experience related to the Site or nearby properties? For example, are you involved in the same line of business as the current or former occupants of the Site or an adjoining property so that you would have specialized knowledge of the chemicals and processes used by this type of business? **Answer: No.**
- Are you aware of commonly known or reasonably ascertainable information about the Site that would help the environmental professional to identify conditions indicative of releases or threatened releases? **Answer: No.**
- Do you know the past uses of the Site? **Answer: Unknown.**
- Do you know of specific chemicals that are present or once were present at the Site? **Answer: No.**
- Do you know of spills or other chemical releases that have occurred at the Site? **Answer: Unknown.**
- Do you know of any environmental cleanups that have occurred at the Site? **Answer: No.**



- Do you know of any pending, threatened, or past litigation relevant to hazardous substances or petroleum products in, on, or from the Site? **Answer: No.**
- Do you know of any pending, threatened, or past administrative proceedings relevant to hazardous substances or petroleum products in, on, or from the Site? **Answer: No.**
- Do you know of any notices from any governmental entity regarding any possible violation of environmental laws or possible liability relating to hazardous substances or petroleum products? **Answer: No.**

4.5.4 Commonly Known or Reasonably Ascertainable Information

The representative of the client was asked the following questions as part of the assessment:

- Based on your knowledge and experience related to the Site, are there any obvious indicators that point to the presence or likely presence of contamination at the Site? **Answer: No.**

4.5.5 Valuation Reduction for Environmental Issues

Since Bank of America or related subsidiary is the current owner of the Site, Bank of America has not conducted an analysis of a hypothetical prospective purchase price.

4.5.6 Owner, Property Manager and Occupant Information

According to the Mecklenburg County Assessor's Office, the Site is owned by NationsBank and Southport Investments, LLC. The Site is utilized for parking.

4.5.7 Reason for Performing Phase I

The Phase I ESA is being performed to evaluate the present environmental status of the Site.

4.5.8 Other Information

No other pertinent information is available.

4.6 Results of Limited ACM Screening

Testing for ACM was not conducted as part of this assessment.



4.7 Results of Radon Investigation

Testing for radon was not conducted as part of this assessment.

4.8 Results of Mold Investigation

ARCADIS did not conduct a mold investigation as part of this assessment.

5. Findings and Conclusions

5.1 Known or Suspect RECs

Based upon the information obtained during the Phase I ESA, this assessment has not revealed environmental concerns in connection with the Site with the exception of the former gasoline fueling operations and auto repair activities conducted at the Site, the lack of UST closure and assessment documentation and the potential for dry cleaning to have been conducted on the Site.

5.2 De minimis Conditions

No *de minimis* conditions were identified during this assessment.

5.3 Deviations/Data Gaps

The report deviates from the ASTM E1527-05 standard in that it has been prepared in accordance with a table of contents recommended by Bank of America. The informational content of the report and the objective of the Phase I ESA generally conform to the standard.

Not being able to trace the use of the property back to its first developed use, not being able to ascertain the heating source(s) for the former structures at the Site, and the lack of records for the former gasoline station and dry cleaner represent data gaps as defined by ASTM E1527-05.



5.4 Conclusions

ARCADIS has performed a Phase I ESA in general conformance with the scope and limitations of ASTM Practice E 1527 of 950-1000 West Trade Street in Charlotte, Mecklenburg County, North Carolina. Any exceptions to, or deletions from, this practice are described in Section 5.3 of this report. This assessment has revealed evidence of the following RECs in connection with the Site:

- A gasoline station occupied the southeast portion of the 3.35-acre portion of the Site from 1937-1964. The status of the USTs associated with this former gasoline station is unknown;
- A dry cleaner occupied a portion of the Site (924 West Trade Street) in the 1950s. No additional information pertaining to this former dry cleaner was discovered during this assessment; and,
- An open LUST case with residual contamination.

6. Limitations

The opinions and recommendations presented in this report are based upon the scope of services, information obtained through the performance of the services, and the schedule as agreed upon by ARCADIS and the original party for whom this report was originally prepared. This report is an instrument of professional service and was prepared in accordance with the generally accepted standards and level of skill and care under similar conditions and circumstances established by the environmental consulting industry. To the extent that ARCADIS relied upon any information prepared by other parties not under contract to ARCADIS, ARCADIS makes no representation as to the accuracy or completeness of such information. Only the party for whom this report was originally prepared, and other specifically named parties, may make use of and rely upon the information in this report, in its entirety, for a period not to exceed 180 days in accordance with the American Society for Testing and Materials' (ASTM's) "Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process" ASTM Designation E 1527-00 dated May 10, 2000, ASTM's "Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process" ASTM Designation E 1527-05 dated November 1, 2005, and/or the Code of Federal Regulations (CFR) 40CFR Part 312 "Standards and Practices for All Appropriate Inquiries: Final Rule" dated November 1, 2005. After 180 days and prior to using the information contained herein, the report should be updated in accordance with ASTM Standards and Federal regulations.



The findings presented in this report apply solely to site conditions existing at the time when ARCADIS' assessment was performed. It must be recognized, however, that an Environmental Site Assessment ("ESA") is intended for the purpose of evaluating the potential for contamination through limited research and investigative activities and in no way represents a conclusive or complete site characterization. Conditions in other parts of the project site may vary from those at the locations where data were collected. ARCADIS' ability to interpret investigation results is related to the availability of the data and the extent of the investigation activities. As such, 100% confidence in ESA conclusions cannot reasonably be achieved.

ARCADIS, therefore, does not provide any guarantees, certifications, or warranties (express or implied) that a property is free from environmental contamination. Furthermore, nothing contained in this document shall relieve any other party of its responsibility to abide by contract documents and all applicable laws, codes, regulations, or standards.



7. References

Record of Personal Communications

Ms. Dawn Reeves, Property Manager with Lincoln Harris

Ms. Shirley Cato, Property Manager with Lincoln Harris

City of Charlotte:

- Fire Department
- Planning Department
- Zoning Administrator
- Land Use and Environmental Services
- Permitting

Mecklenburg County:

- Assessor's Office
- GIS Department
- Library

State of Connecticut:

- North Carolina Department of Environmental and Natural Resources, Mooreville's Office

Map, Aerial Photo and Other Geographic References

Environmental Data Resources, Inc. – Aerial Photographs, 1950, 1968, 1973, 1983, 1988, 1996 and 2006, Gateway Area, Charlotte, NC 28202, Inquiry Number 2999896.5, February 25, 2011.

Environmental Data Resources, Inc. – The EDR Radius Map with GeoCheck®, 950-1000 West Trade Street, Charlotte, NC 28202, Inquiry Number 3023111.1s, March 25, 2011.

Environmental Data Resources, Inc. – Certified Sanborn Map Report, 1929, 1950, 1953 and 1963, Gateway Area, Charlotte, NC 28202, Inquiry Number 2999896.3, February 25, 2011.

Environmental Data Resources, Inc. – City Directory Abstract – 1921 - 2005, Gateway Area, Charlotte, NC 28202, Inquiry Number 2999896.6, March 22, 2011.

Environmental Data Resources, Inc. – EDR Historical Topographic Map Report – 1905, 1942, 1949, 1967, 1980 and 1988, Gateway Area, Charlotte, NC 28202, Inquiry Number 2999896.4, February 25, 2011.



8. Statement of Environmental Professional(s)

I declare that, to the best of my professional knowledge and belief, I meet the definition of environmental professional as defined in §312.10 of 40 C.F.R. 312. I have the specific qualifications based on education, training, and experience to assess a property of the nature, history, and setting of the subject property. I have developed and performed the all appropriate inquiries in conformance with the standards and practices set forth in 40 C.F.R. Part 312.

A handwritten signature in black ink that reads "Sean Drain".


Sean D. Drain
Staff Scientist

A handwritten signature in black ink that reads "Stephen P. McCarthy".

Stephen P. McCarthy
Senior Environmental Scientist

ARCADIS

Figures

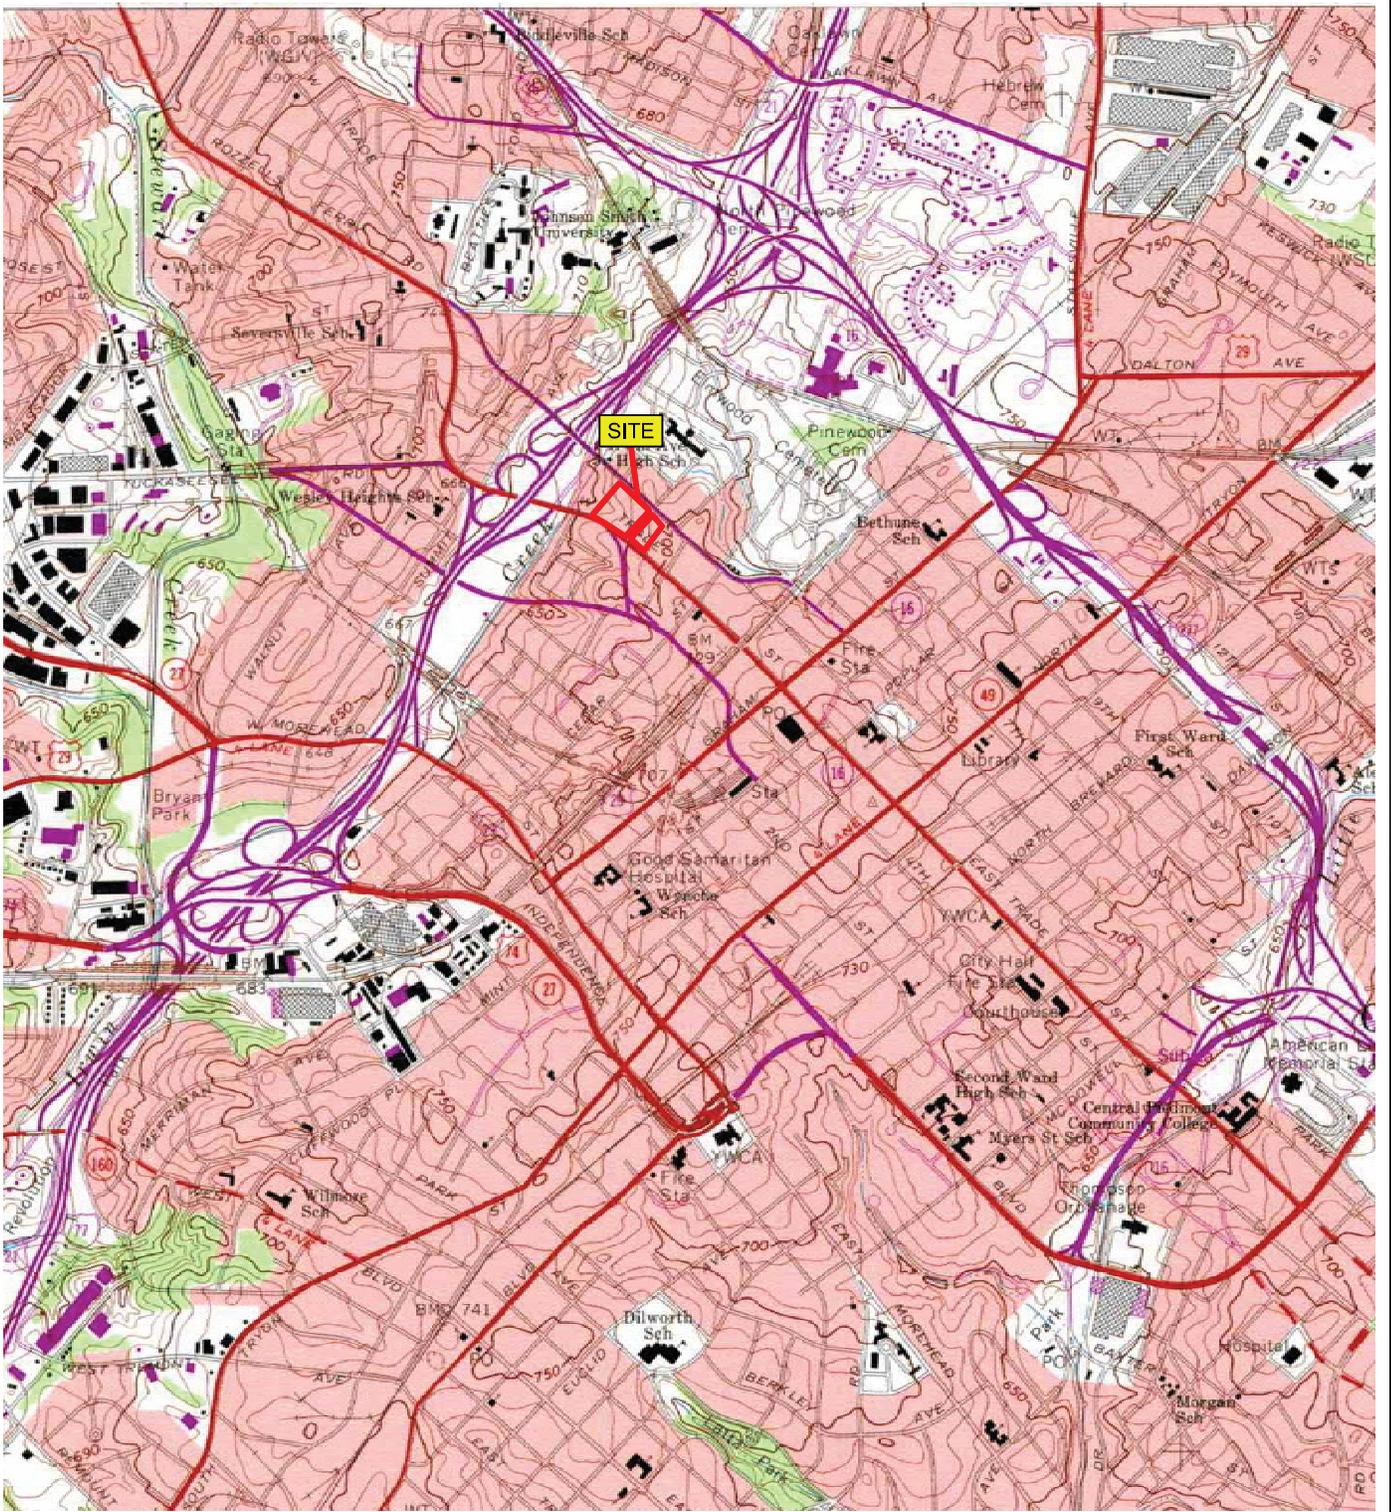


QUAD: CHARLOTTE EAST
DATED: 1988

NCW-481
950-1000 WEST TRADE STREET
CHARLOTTE, NC

SITE LOCATION MAP

	FIGURE 1
--	--------------------

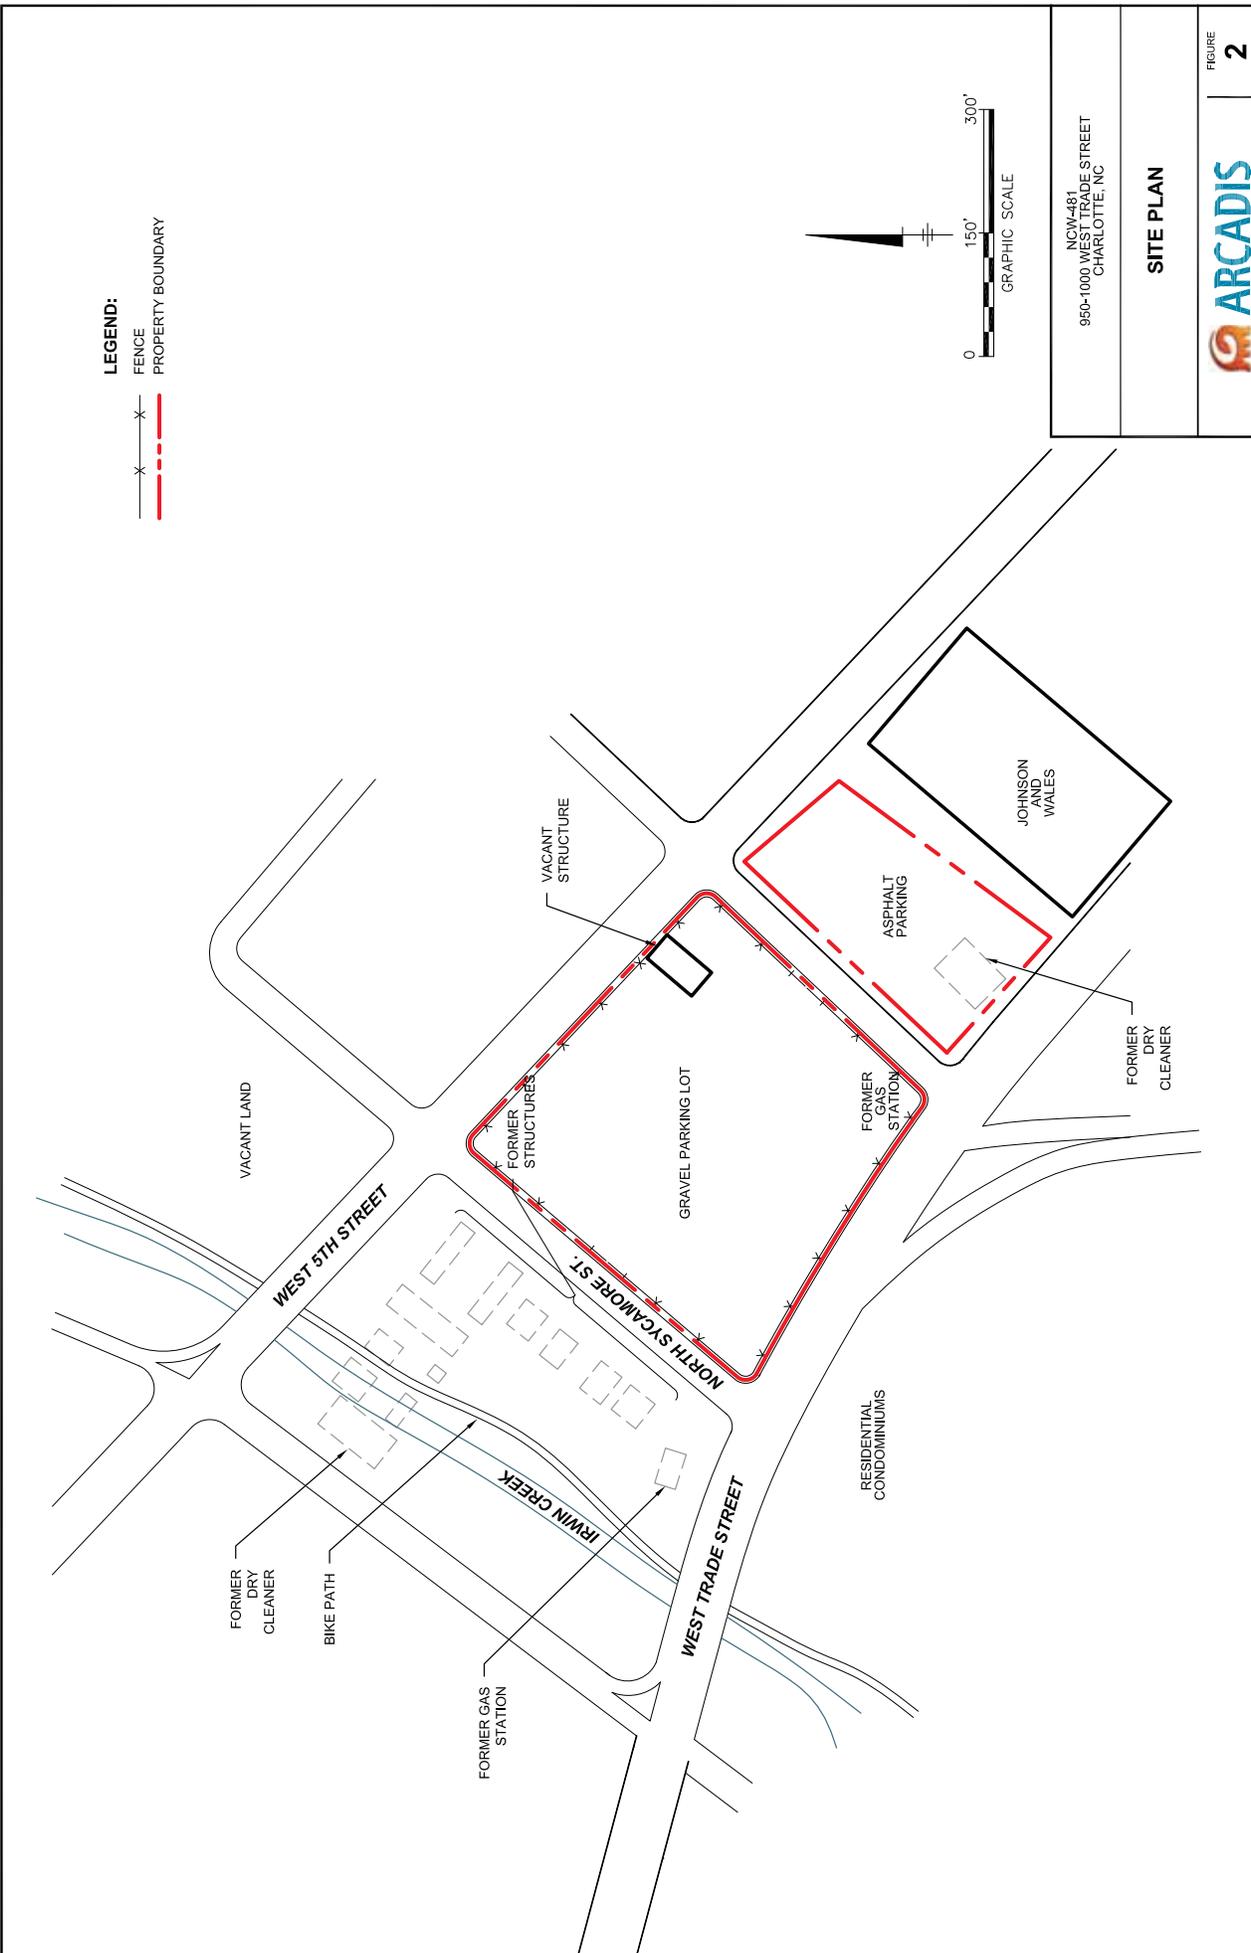

LEGEND:
 FENCE
 PROPERTY BOUNDARY

NCW-481
 950-1000 WEST TRADE STREET
 CHARLOTTE, NC

SITE PLAN


ARCADIS

FIGURE **2**

ARCADIS

Appendix A

Site Photographs

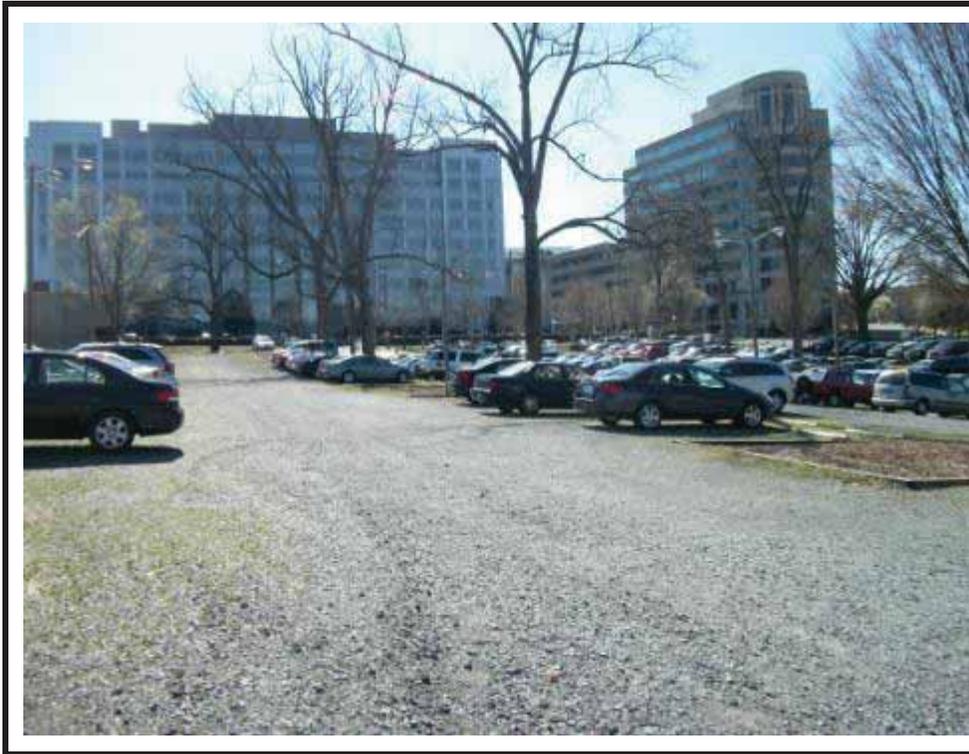

Photograph #1

Description of Photograph:

View across the Site from the north corner.

Site Location:

950-1000 W Trade Street
Charlotte, North Carolina

Photograph Taken By:

Sean Drain

Date of Photograph:

March 1, 2011



Photograph #2

Description of Photograph:

View of the vacant commercial building in the east corner of the north lot.

Site Location:

950-1000 W Trade Street
Charlotte, North Carolina

Photograph Taken By:

Sean Drain

Date of Photograph:

March 1, 2011



Photograph #3

Description of Photograph:

View across the western portion of the Site facing northwest.

Site Location:


950-1000 W Trade Street
Charlotte, North Carolina

Photograph Taken By:

Sean Drain

Date of Photograph:

March 1, 2011

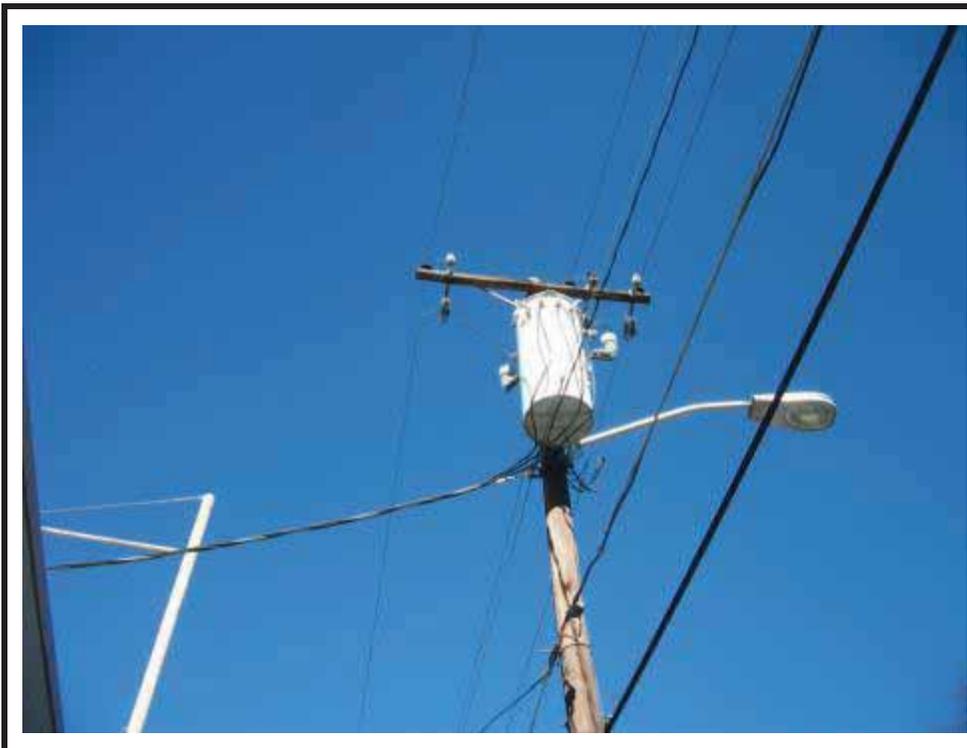

Photograph #4

Description of Photograph:

View of the pole mounted electrical transformer along the north side of the Site.

Site Location:

950-1000 W Trade Street
Charlotte, North Carolina

Photograph Taken By:

Sean Drain

Date of Photograph:

March 1, 2011



Photograph #5

Description of Photograph:

View of the west side of the vacant commercial building located on the Site.

Site Location:

950-1000 W Trade Street
Charlotte, North Carolina

Photograph Taken By:

Sean Drain

Date of Photograph:

March 1, 2011



Photograph #6

Description of Photograph:

View of the drainage system in the western portion of the Site.

Site Location:

950-1000 W Trade Street
Charlotte, North Carolina

Photograph Taken By:

Sean Drain

Date of Photograph:

March 1, 2011



Photograph #7

Description of Photograph:

View of the drainage system in the western portion of the Site.

Site Location:

950-1000 W Trade Street
Charlotte, North Carolina

Photograph Taken By:

Sean Drain

Date of Photograph:

March 1, 2011



Photograph #8

Description of Photograph:

View of the eastern portion of the Site facing southwest.

Site Location:

950-1000 W Trade Street
Charlotte, North Carolina

Photograph Taken By:

Sean Drain

Date of Photograph:

March 1, 2011



Photograph #9

Description of Photograph:

View of the Site property facing west.

Site Location:

950-1000 W Trade Street
Charlotte, North Carolina

Photograph Taken By:

Sean Drain

Date of Photograph:

March 1, 2011



Photograph #10

Description of Photograph:

North adjacent doctors office.

Site Location:

950-1000 W Trade Street
Charlotte, North Carolina

Photograph Taken By:

Sean Drain

Date of Photograph:

March 1, 2011



Photograph #11

Description of Photograph:
North adjacent parking area.

Site Location:
950-1000 W Trade Street
Charlotte, North Carolina

Photograph Taken By:
Sean Drain

Date of Photograph:
March 1, 2011



Photograph #12

Description of Photograph:
North adjacent parking area.

Site Location:
950-1000 W Trade Street
Charlotte, North Carolina

Photograph Taken By:
Sean Drain

Date of Photograph:
March 1, 2011



Photograph #13

Description of Photograph:

View of the north adjacent office building across West 5th Street.

Site Location:

950-1000 W Trade Street
Charlotte, North Carolina

Photograph Taken By:

Sean Drain

Date of Photograph:

March 1, 2011



Photograph #14

Description of Photograph:

View of the northeast adjacent residential apartments.

Site Location:


950-1000 W Trade Street
Charlotte, North Carolina

Photograph Taken By:

Sean Drain

Date of Photograph:

March 1, 2011

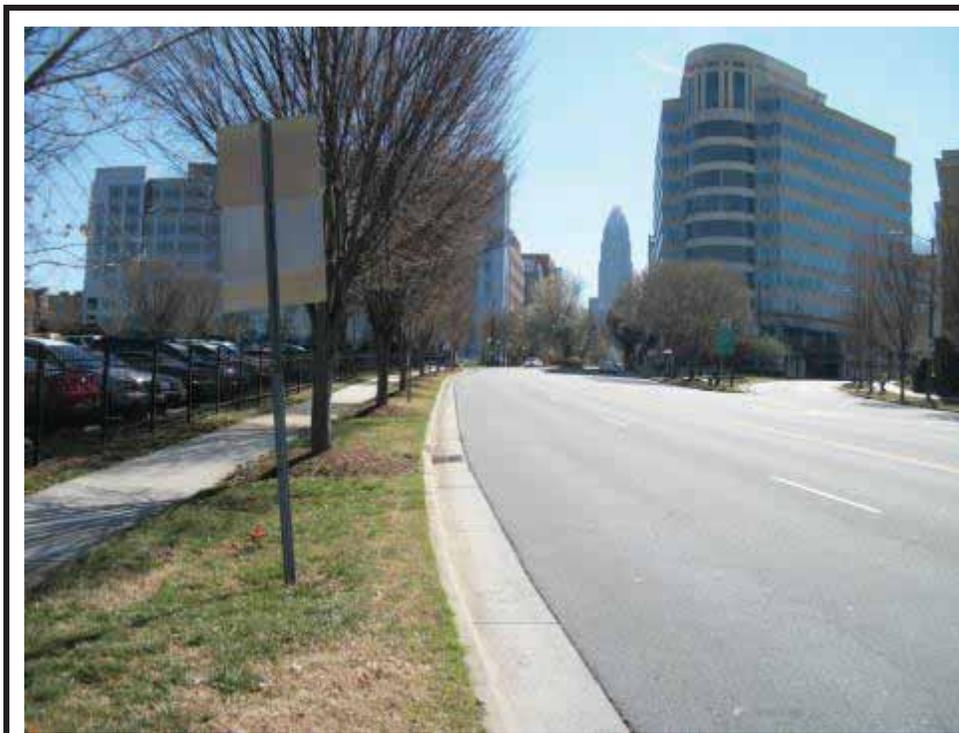

Photograph #15

Description of Photograph:

View of the southwest edge of the Site and the south adjacent properties.

Site Location:


950-1000 W Trade Street
Charlotte, North Carolina

Photograph Taken By:

Sean Drain

Date of Photograph:

March 1, 2011

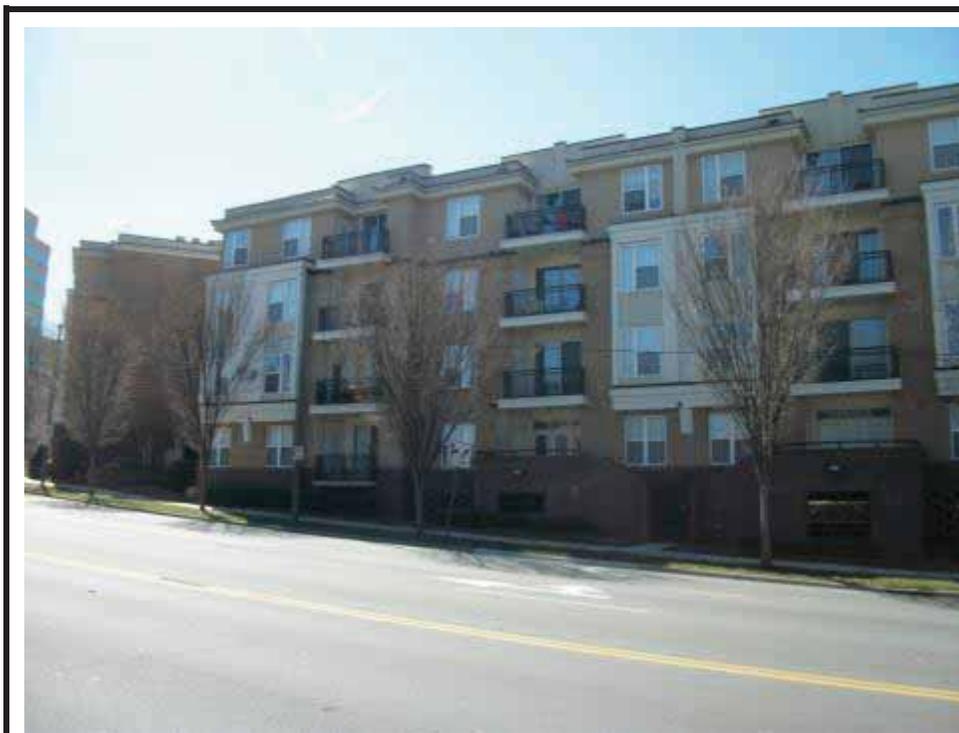

Photograph #16

Description of Photograph:

View of the southwest adjacent residential apartments across West Trade Street.

Site Location:

950-1000 W Trade Street
Charlotte, North Carolina

Photograph Taken By:

Sean Drain

Date of Photograph:

March 1, 2011



Photograph #17

Description of Photograph:
View of the east abutting office building loading dock area.

Site Location:
950-1000 W Trade Street
Charlotte, North Carolina

Photograph Taken By:
Sean Drain

Date of Photograph:
March 1, 2011



Photograph #18

Description of Photograph:
View of the east abutting office building.

Site Location:
950-1000 W Trade Street
Charlotte, North Carolina

Photograph Taken By:
Sean Drain

Date of Photograph:
March 1, 2011



Photograph #19

Description of Photograph:

View of the west corner of the Site and the west adjacent properties across North Sycamore Street.

Site Location:


950-1000 W Trade Street
Charlotte, North Carolina

Photograph Taken By:

Sean Drain

Date of Photograph:

March 1, 2011

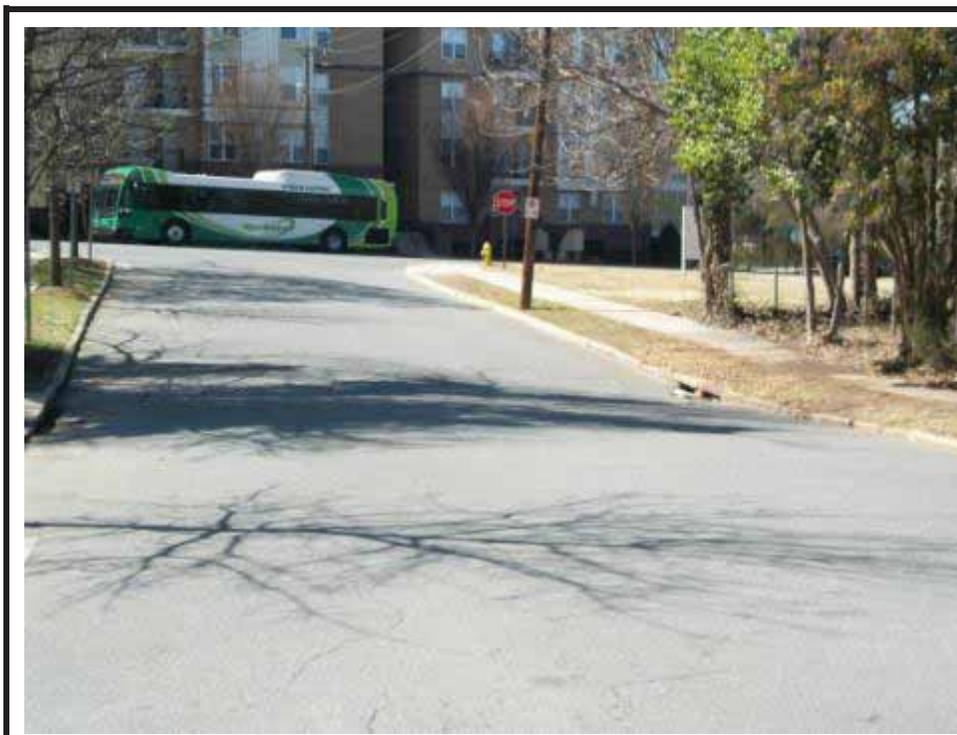

Photograph #20

Description of Photograph:

View of the west and southwest adjacent properties.

Site Location:

950-1000 W Trade Street
Charlotte, North Carolina

Photograph Taken By:

Sean Drain

Date of Photograph:

March 1, 2011

Appendix **B**


Regulatory Agency Database
Information (EDR Report)

NCW-481

950-1000 W Trade Street
Charlotte, NC 28202

Inquiry Number: 3023111.1s
March 25, 2011

The EDR Radius Map™ Report with GeoCheck®



440 Wheelers Farms Road
Milford, CT 06461
Toll Free: 800.352.0050
www.edrnet.com

TABLE OF CONTENTS

<u>SECTION</u>	<u>PAGE</u>
Executive Summary	ES1
Overview Map	2
Detail Map	3
Map Findings Summary	4
Map Findings	7
Orphan Summary	229
Government Records Searched/Data Currency Tracking	GR-1
 <u>GEOCHECK ADDENDUM</u>	
Physical Setting Source Addendum	A-1
Physical Setting Source Summary	A-2
Physical Setting SSURGO Soil Map	A-6
Physical Setting Source Map	A-13
Physical Setting Source Map Findings	A-15
Physical Setting Source Records Searched	A-31

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2011 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

EXECUTIVE SUMMARY

A search of available environmental records was conducted by Environmental Data Resources, Inc (EDR). The report was designed to assist parties seeking to meet the search requirements of EPA's Standards and Practices for All Appropriate Inquiries (40 CFR Part 312), the ASTM Standard Practice for Environmental Site Assessments (E 1527-05) or custom requirements developed for the evaluation of environmental risk associated with a parcel of real estate.

TARGET PROPERTY INFORMATION

ADDRESS

950-1000 W TRADE STREET
CHARLOTTE, NC 28202

COORDINATES

Latitude (North): 35.235500 - 35° 14' 7.8"
Longitude (West): 80.852200 - 80° 51' 7.9"
Universal Transverse Mercator: Zone 17
UTM X (Meters): 513448.6
UTM Y (Meters): 3898971.2
Elevation: 698 ft. above sea level

USGS TOPOGRAPHIC MAP ASSOCIATED WITH TARGET PROPERTY

Target Property Map: 35080-B7 CHARLOTTE EAST, NC
Most Recent Revision: 1988

West Map: 35080-B8 CHARLOTTE WEST, NC
Most Recent Revision: 1996

TARGET PROPERTY SEARCH RESULTS

The target property was identified in the following records. For more information on this property see page 7 of the attached EDR Radius Map report:

<u>Site</u>	<u>Database(s)</u>	<u>EPA ID</u>
HOLCOMBS AMOCO SERVICE 1000 W TRADE CHARLOTTE, NC	EDR Historical Auto Stations	N/A
GATEWAY VILLAGE 950 BLOCK OF W. TRADE ST CHARLOTTE, NC	IMD LUST Incident Phase: Follow Up Incident Phase: Response	N/A

EXECUTIVE SUMMARY

DATABASES WITH NO MAPPED SITES

No mapped sites were found in EDR's search of available ("reasonably ascertainable ") government records either on the target property or within the search radius around the target property for the following databases:

STANDARD ENVIRONMENTAL RECORDS

Federal NPL site list

NPL..... National Priority List
Proposed NPL..... Proposed National Priority List Sites
NPL LIENS..... Federal Superfund Liens

Federal Delisted NPL site list

Delisted NPL..... National Priority List Deletions

Federal CERCLIS list

CERCLIS..... Comprehensive Environmental Response, Compensation, and Liability Information System
FEDERAL FACILITY..... Federal Facility Site Information listing

Federal RCRA CORRACTS facilities list

CORRACTS..... Corrective Action Report

Federal RCRA non-CORRACTS TSD facilities list

RCRA-TSDF..... RCRA - Treatment, Storage and Disposal

Federal RCRA generators list

RCRA-LQG..... RCRA - Large Quantity Generators
RCRA-SQG..... RCRA - Small Quantity Generators
RCRA-CESQG..... RCRA - Conditionally Exempt Small Quantity Generator

Federal institutional controls / engineering controls registries

US ENG CONTROLS..... Engineering Controls Sites List
US INST CONTROL..... Sites with Institutional Controls

Federal ERNS list

ERNS..... Emergency Response Notification System

State and tribal landfill and/or solid waste disposal site lists

SWF/LF..... List of Solid Waste Facilities
OLI..... Old Landfill Inventory

State and tribal leaking storage tank lists

INDIAN LUST..... Leaking Underground Storage Tanks on Indian Land

EXECUTIVE SUMMARY

State and tribal registered storage tank lists

AST..... AST Database
INDIAN UST..... Underground Storage Tanks on Indian Land
FEMA UST..... Underground Storage Tank Listing

State and tribal institutional control / engineering control registries

INST CONTROL..... No Further Action Sites With Land Use Restrictions Monitoring

State and tribal voluntary cleanup sites

VCP..... Responsible Party Voluntary Action Sites
INDIAN VCP..... Voluntary Cleanup Priority Listing

ADDITIONAL ENVIRONMENTAL RECORDS

Local Brownfield lists

US BROWNFIELDS..... A Listing of Brownfields Sites

Local Lists of Landfill / Solid Waste Disposal Sites

DEBRIS REGION 9..... Torres Martinez Reservation Illegal Dump Site Locations
ODI..... Open Dump Inventory
HIST LF..... Solid Waste Facility Listing
INDIAN ODI..... Report on the Status of Open Dumps on Indian Lands

Local Lists of Hazardous waste / Contaminated Sites

US CDL..... Clandestine Drug Labs
US HIST CDL..... National Clandestine Laboratory Register

Local Land Records

LIENS 2..... CERCLA Lien Information
LUCIS..... Land Use Control Information System

Records of Emergency Release Reports

HMIRS..... Hazardous Materials Information Reporting System

Other Ascertainable Records

RCRA-NonGen..... RCRA - Non Generators
DOT OPS..... Incident and Accident Data
DOD..... Department of Defense Sites
FUDS..... Formerly Used Defense Sites
CONSENT..... Superfund (CERCLA) Consent Decrees
ROD..... Records Of Decision
UMTRA..... Uranium Mill Tailings Sites
MINES..... Mines Master Index File
TRIS..... Toxic Chemical Release Inventory System

EXECUTIVE SUMMARY

TSCA.....	Toxic Substances Control Act
FTTS.....	FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)
HIST FTTS.....	FIFRA/TSCA Tracking System Administrative Case Listing
SSTS.....	Section 7 Tracking Systems
ICIS.....	Integrated Compliance Information System
PADS.....	PCB Activity Database System
MLTS.....	Material Licensing Tracking System
RADINFO.....	Radiation Information Database
FINDS.....	Facility Index System/Facility Registry System
RAATS.....	RCRA Administrative Action Tracking System
UIC.....	Underground Injection Wells Listing
DRYCLEANERS.....	Drycleaning Sites
NPDES.....	NPDES Facility Location Listing
INDIAN RESERV.....	Indian Reservations
SCRD DRYCLEANERS.....	State Coalition for Remediation of Drycleaners Listing
PCB TRANSFORMER.....	PCB Transformer Registration Database
COAL ASH EPA.....	Coal Combustion Residues Surface Impoundments List
COAL ASH DOE.....	Sleam-Electric Plan Operation Data
COAL ASH.....	Coal Ash Disposal Sites

SURROUNDING SITES: SEARCH RESULTS

Surrounding sites were identified in the following databases.

Elevations have been determined from the USGS Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified. Sites with an elevation equal to or higher than the target property have been differentiated below from sites with an elevation lower than the target property.

Page numbers and map identification numbers refer to the EDR Radius Map report where detailed data on individual sites can be reviewed.

Sites listed in ***bold italics*** are in multiple databases.

Unmappable (orphan) sites are not considered in the foregoing analysis.

STANDARD ENVIRONMENTAL RECORDS

Federal CERCLIS NFRAP site List

CERC-NFRAP: Archived sites are sites that have been removed and archived from the inventory of CERCLIS sites. Archived status indicates that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list this site on the National Priorities List (NPL), unless information indicates this decision was not appropriate or other considerations require a recommendation for listing at a later time. This decision does not necessarily mean that there is no hazard associated with a given site; it only means that, based upon available information, the location is not judged to be a potential NPL site.

A review of the CERC-NFRAP list, as provided by EDR, and dated 10/28/2010 has revealed that there are 3 CERC-NFRAP sites within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
<i>CITY OF CHARLOTTE SMITH METAL&</i>	<i>301 & 700 S CEDAR ST</i>	<i>S 1/4 - 1/2 (0.270 mi.)</i>	<i>J42</i>	<i>59</i>
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
SUMMIT AVE SITE	420 S SUMMIT AVE	WSW 1/4 - 1/2 (0.447 mi.)	S80	162

EXECUTIVE SUMMARY

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
SOUTHERN MFG INC	1000 SEABOARD ST	NE 1/4 - 1/2 (0.453 mi.)	R83	173

State- and tribal - equivalent NPL

NC HSDS: The Hazardous Substance Disposal Sites list contains locations of uncontrolled and unregulated hazardous waste sites. The file contains sites on the national priority list as well as the state priority list. The data source is the North Carolina Center for Geographic Information and Analysis.

A review of the NC HSDS list, as provided by EDR, and dated 04/06/2006 has revealed that there are 11 NC HSDS sites within approximately 1 mile of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
ROWE CORP PROPERTY		SSW 1/2 - 1 (0.705 mi.)	0	13
CHARLOTTE COAL GAS PLANT NO. 1		SE 1/2 - 1 (0.783 mi.)	0	13
H.M. WADE FURNITURE		S 1/4 - 1/2 (0.484 mi.)	0	14
CHEROKEE OIL SITE		SW 1/2 - 1 (0.764 mi.)	0	14
TEXTILE CHEMICAL FACILITY		S 1/4 - 1/2 (0.428 mi.)	0	14
HESTA CARILLION PROJECT		SE 1/2 - 1 (0.550 mi.)	0	14
JONES CHEMICALS INC OF NORTH C		SSW 1/2 - 1 (0.513 mi.)	0	14
SMITH METAL & IRON CO		SSE 1/8 - 1/4 (0.209 mi.)	0	15
SUMMIT AVE SITE		WSW 1/4 - 1/2 (0.448 mi.)	0	15
SOUTHERN MANUFACTURING INC		NE 1/4 - 1/2 (0.380 mi.)	0	15
SINCLAIR AND VALENTINE CO		NW 1/2 - 1 (0.823 mi.)	0	15

State- and tribal - equivalent CERCLIS

SHWS: The State Hazardous Waste Sites records are the states' equivalent to CERCLIS. These sites may or may not already be listed on the federal CERCLIS list. Priority sites planned for cleanup using state funds (state equivalent of Superfund) are identified along with sites where cleanup will be paid for by potentially responsible parties. The data come from the Department of Environment & Natural Resources' Inactive Hazardous Sites Program.

A review of the SHWS list, as provided by EDR, and dated 01/06/2011 has revealed that there are 24 SHWS sites within approximately 1 mile of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
DIRTY LAUNDRY CLEANERS (FORMER SISKRON)	511, 513, 515 WEST TRAD 211 TUCKASEEGEE ROAD	SE 1/4 - 1/2 (0.381 mi.)	M58	101
FROEHLING AND ROBERTSON, INC.	208 N GRAHAM ST	WNW 1/4 - 1/2 (0.401 mi.)	P68	130
SOUTHERN MANUFACTURING, INC	1000 SEABOARD STREET	ENE 1/4 - 1/2 (0.414 mi.)	N70	134
ROWE CORP PROPERTY/BOULIGNY SI	433 W MOREHEAD ST	SSW 1/2 - 1 (0.695 mi.)	Q72	134
NATIONS BANK - SOLVENT	201 NORTH TRYON STREET	SE 1/2 - 1 (0.724 mi.)	91	197
200 NORTH TRYON STREET	200 N. TRYON STREET	SE 1/2 - 1 (0.726 mi.)	T92	198
DISCOVERY PLACE	301 NORTH TRYON STREET	SE 1/2 - 1 (0.738 mi.)	T93	200
BRIDGESTONE/FIRESTONE RETAIL S	530 S TRYON STREET	SSE 1/2 - 1 (0.766 mi.)	94	202
BROOKWOOD DEVELOPMENT	301 SOUTH COLLEGE STREE	SSE 1/2 - 1 (0.808 mi.)	96	213
EPICENTRE	210 E TRADE ST	SE 1/2 - 1 (0.840 mi.)	98	215
WEST MOREHEAD ST PESTICIDE	147 W MOREHEAD ST	SE 1/2 - 1 (0.840 mi.)	100	218
DIVERSEY WATER TECHNOLOGIES	1201 SOUTH GRAHAM STREE	SSW 1/2 - 1 (0.896 mi.)	103	221
INDUSTRIAL & TEXTILE SUPPLY (F	1300 S. MINT STREET	SSW 1/2 - 1 (0.962 mi.)	105	225
			107	226

EXECUTIVE SUMMARY

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
SUMMIT AVENUE SITE	420 SOUTH SUMMIT AVE	WSW 1/4 - 1/2 (0.447 mi.)	S81	163
JONES CHEMICALS INC. OF NORTH	610 MCNINCH STREET	SSW 1/2 - 1 (0.502 mi.)	88	192
BOXER TEXTILE MACHINERY CO	1000 WEST MOREHEAD STRESSW	1/2 - 1 (0.572 mi.)	89	192
VIRGINIA CAROLINA FREIGHT LINE	710 CALVERT STREET	SW 1/2 - 1 (0.611 mi.)	90	194
GRINNELL SUPPLY SALES 2	1431 WEST MOREHEAD ST.	SW 1/2 - 1 (0.748 mi.)	95	211
CHEROKEE OIL	925 SOUTH SUMMIT AVE	SW 1/2 - 1 (0.809 mi.)	99	218
SINCLAIR AND VALENTINE CO.	515 S TURNER AVE	WNW 1/2 - 1 (0.862 mi.)	101	218
CLOROX COMPANY	800 GESCO STREET	WNW 1/2 - 1 (0.866 mi.)	102	218
WORTH CHEMICAL	818 TUCKASEEGEE ROAD	W 1/2 - 1 (0.894 mi.)	104	221
FORSHAW CHEMICALS	650 STATE ST	WNW 1/2 - 1 (0.952 mi.)	106	226

State and tribal leaking storage tank lists

LUST: The Leaking Underground Storage Tank Incidents Management Database contains an inventory of reported leaking underground storage tank incidents. The data come from the Department of Environment, & Natural Resources' Incidents by Address.

A review of the LUST list, as provided by EDR, and dated 02/11/2011 has revealed that there are 39 LUST sites within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
THE BOULEVARD COMPANY 1 Incident Phase: Closed Out	215 NORTH IRWIN AVENUE	NE 0 - 1/8 (0.011 mi.)	A7	25
RSA (B & K INVESTMENTS) Incident Phase: Follow Up	900 WEST TRADE STREET	SE 0 - 1/8 (0.067 mi.)	C13	32
GATEWAY VILLAGE-FORMER GAS MT. MORIAH PRIMITIVE BAPTIST C Incident Phase: Closed Out	800 WEST TRADE STREET 747 WEST TRADE STREET	SE 1/8 - 1/4 (0.151 mi.) SE 1/8 - 1/4 (0.182 mi.)	F23 F29	41 49
MARGIE WILLIAMS PROPERTY Incident Phase: Closed Out	209 SOUTH CEDAR STREET	SSE 1/8 - 1/4 (0.183 mi.)	G30	52
GATEWAY VILLAGE-700 BLOCK ELMWOOD CEMETERY Incident Phase: Follow Up	700 WEST TRADE STREET 700 WEST 6TH STREET	SE 1/4 - 1/2 (0.277 mi.) ESE 1/4 - 1/2 (0.291 mi.)	K43 46	62 69
WEST TRADE VACANT LOT Incident Phase: Response	1501 W. TRADE STREET	WNW 1/4 - 1/2 (0.310 mi.)	L47	72
AMTRAK RAIL STATION Incident Phase: Closed Out	607 WEST 5TH STREET	SE 1/4 - 1/2 (0.316 mi.)	48	74
NCDOT WEST PARKING Incident Phase: Closed Out	531 WEST FOURTH STREET	SSE 1/4 - 1/2 (0.316 mi.)	49	77
MULTI-MODAL (PARCEL 14) Incident Phase: Closed Out	600 WEST TRADE STREET	SE 1/4 - 1/2 (0.326 mi.)	K50	80
GREYHOUND LINES TERMINAL Incident Phase: Follow Up	601 W TRADE STREET	SE 1/4 - 1/2 (0.335 mi.)	M51	83
SOUTH CENTRAL OIL PROPERTY Incident Phase: Closed Out	115 GRANDIN ROAD	WNW 1/4 - 1/2 (0.338 mi.)	L52	85
GRIFFIN BROS TIRE SALES INC Incident Phase: Response	1545 WEST TRADE STREET	WNW 1/4 - 1/2 (0.341 mi.)	L54	91
SERVCO #01615 Incident Phase: Follow Up	1601 WEST TRADE STREET	NW 1/4 - 1/2 (0.365 mi.)	55	93

EXECUTIVE SUMMARY

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
AMTRAK STATION PARKING LOT Incident Phase: Response	401 SMITH STREET	ESE 1/4 - 1/2 (0.377 mi.)	56	96
DAVE HANSFORD PROPERTY Incident Phase: Closed Out	1512 WEST 4TH STREET	W 1/4 - 1/2 (0.377 mi.)	57	99
MULTI-MODAL (PARCEL 5A) Incident Phase: Closed Out	511 WEST TRADE STREET	SE 1/4 - 1/2 (0.383 mi.)	M59	103
MULTI-MODAL (PARCEL 5A) UST1&2 Incident Phase: Closed Out	511 WEST TRADE STREET	SE 1/4 - 1/2 (0.383 mi.)	M60	105
511 THROUGH 515 WEST TRADE STR Incident Phase: Response	511-515 WEST TRADE STR	SE 1/4 - 1/2 (0.383 mi.)	M61	108
SPEIZMAN INDUSTRIES #2 (HEATIN Incident Phase: Closed Out Incident Phase: Closed Out	508 WEST FIFTH STREET	SE 1/4 - 1/2 (0.385 mi.)	N62	111
SERVCO SERVICE STATION Incident Phase: Follow Up	120 SOUTH GRAHAM STREET	SE 1/4 - 1/2 (0.388 mi.)	O64	117
JAMES K POLK BUILDING Incident Phase: Closed Out Incident Phase: Closed Out	500 WEST TRADE STREET S	SE 1/4 - 1/2 (0.389 mi.)	O65	119
CHARTER PROPERTIES, INC. Incident Phase: Response	W.TRADE STREET AND N. G	SE 1/4 - 1/2 (0.391 mi.)	O66	125
WEST 5TH STREET PARKING LOT Incident Phase: Closed Out	519 WEST 5TH ST/500 W T	SE 1/4 - 1/2 (0.391 mi.)	N67	128
SISKRON Incident Phase: Closed Out	211 TUCKASEEGEE ROAD	WNW 1/4 - 1/2 (0.401 mi.)	P68	130
FITZGERALD PROPERTY Incident Phase: Closed Out	315 S GRAHAM STREET	SSE 1/4 - 1/2 (0.416 mi.)	73	135
NCDOT-MCKEITHEN PROPERTY	600 W 8TH STREET	E 1/4 - 1/2 (0.424 mi.)	74	138
HOLLAND HOUSE-FORMER Incident Phase: Closed Out	307 NORTH GRAHAM STREET	ESE 1/4 - 1/2 (0.428 mi.)	75	141
TWO WAY SHOP AND GAS Incident Phase: Closed Out	1740 WEST TRADE STREET	NW 1/4 - 1/2 (0.448 mi.)	82	163
THE VUE Incident Phase: Closed Out	418 WEST FIFTH STREET	SE 1/4 - 1/2 (0.466 mi.)	85	180
NCF FINANCIAL CORP. PROPERTY/ Incident Phase: Closed Out	501 N. GRAHAM STREET	ESE 1/4 - 1/2 (0.491 mi.)	87	189
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
ELMER'S AUTO SERVICE Incident Phase: Closed Out	1100 WEST TRADE STREET	W 0 - 1/8 (0.004 mi.)	B5	16
THE BOULEVARD COMPANY 2 Incident Phase: Closed Out	1013 WEST 6TH STREET	NE 0 - 1/8 (0.068 mi.)	D14	35
QUICK N E-Z 2 Incident Phase: Closed Out	1419 WEST TRADE STREET	WNW 1/4 - 1/2 (0.280 mi.)	I44	65
MECKLENBURG COUNTY FLEET MANAG Incident Phase: Follow Up	900 WEST 12TH STREET	NE 1/4 - 1/2 (0.440 mi.)	R76	144
MECKLENBURG COUNTY FLEET FAC Incident Phase: Closed Out	900 W 12TH STREET	NE 1/4 - 1/2 (0.440 mi.)	R78	157

EXECUTIVE SUMMARY

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
B.B.A U.S. HOLDINGS, INC. Incident Phase: Closed Out	12TH ST AND HAMILTON	NE 1/4 - 1/2 (0.441 mi.)	R79	159
F & R OIL COMPANY INC Incident Phase: Response Incident Phase: Response	624 CEDAR ST	SSW 1/4 - 1/2 (0.490 mi.)	86	182

LUST TRUST: This database contains information about claims against the State Trust Funds for reimbursements for expenses incurred while remediating Leaking USTs.

A review of the LUST TRUST list, as provided by EDR, and dated 12/17/2010 has revealed that there are 4 LUST TRUST sites within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
ELMWOOD CEMETERY	700 WEST 6TH STREET	ESE 1/4 - 1/2 (0.291 mi.)	46	69
SERVCO #01615	1601 WEST TRADE STREET	NW 1/4 - 1/2 (0.365 mi.)	55	93
SERVCO SERVICE DIST. CO.	120 SOUTH GRAHAM ST.	SE 1/4 - 1/2 (0.388 mi.)	O63	116
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
F & R OIL COMPANY INC	624 CEDAR ST	SSW 1/4 - 1/2 (0.490 mi.)	86	182

LAST: A listing of leaking aboveground storage tank site locations.

A review of the LAST list, as provided by EDR, and dated 02/11/2011 has revealed that there is 1 LAST site within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
GATEWAY VILLAGE	WEST TRADE STREET & N C	SE 1/8 - 1/4 (0.154 mi.)	F25	45

State and tribal registered storage tank lists

UST: The Underground Storage Tank database contains registered USTs. USTs are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA). The data come from the Department of Environment & Natural Resources' Petroleum Underground Storage Tank Database.

A review of the UST list, as provided by EDR, and dated 12/21/2010 has revealed that there are 5 UST sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
R S A INC	900 WEST TRADE STREET	SE 0 - 1/8 (0.067 mi.)	C12	28
THE GATEWAY CENTER	901 WEST TRADE STREET	SE 0 - 1/8 (0.068 mi.)	C15	36
CHARLOTTE GATEWAY VILLAGE. LL	800 WEST TRADE ST (BPD	SE 1/8 - 1/4 (0.151 mi.)	F24	44
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
ELMER'S AUTO SERVICE	1100 WEST TRADE STREET	W 0 - 1/8 (0.004 mi.)	B5	16
IRWIN AVENUE	329 NORTH IRWIN AVENUE	NE 0 - 1/8 (0.082 mi.)	D16	38

EXECUTIVE SUMMARY

State and tribal Brownfields sites

BROWNFIELDS: A brownfield site is an abandoned, idled, or underused property where the threat of environmental contamination has hindered its redevelopment. All of the sites in the inventory are working toward a brownfield agreement for cleanup and liability control.

A review of the BROWNFIELDS list, as provided by EDR, and dated 03/31/2010 has revealed that there are 2 BROWNFIELDS sites within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
SMITH METAL & IRON	725 W. 4TH STREET	SSE 1/8 - 1/4 (0.221 mi.)	G34	56
SOUTHERN MANUFACTURING	1000 SEABOARD STREET	ENE 1/4 - 1/2 (0.414 mi.)	Q71	134

ADDITIONAL ENVIRONMENTAL RECORDS

Other Ascertainable Records

IMD: Incident Management Database.

A review of the IMD list, as provided by EDR, and dated 07/21/2006 has revealed that there are 40 IMD sites within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
<i>RSA (B & K INVESTMENTS)</i>	<i>900 WEST TRADE STREET</i>	<i>SE 0 - 1/8 (0.067 mi.)</i>	<i>C13</i>	<i>32</i>
<i>GATEWAY VILLAGE-FORMER GAS</i>	<i>800 WEST TRADE STREET</i>	<i>SE 1/8 - 1/4 (0.151 mi.)</i>	<i>F23</i>	<i>41</i>
<i>GATEWAY VILLAGE</i>	<i>WEST TRADE STREET & N C</i>	<i>SE 1/8 - 1/4 (0.154 mi.)</i>	<i>F25</i>	<i>45</i>
<i>MT. MORIAH PRIMITIVE BAPTIST C</i>	<i>747 WEST TRADE STREET</i>	<i>SE 1/8 - 1/4 (0.182 mi.)</i>	<i>F29</i>	<i>49</i>
<i>MARGIE WILLIAMS PROPERTY</i>	<i>209 SOUTH CEDAR STREET</i>	<i>SSE 1/8 - 1/4 (0.183 mi.)</i>	<i>G30</i>	<i>52</i>
<i>GATEWAY VILLAGE-700 BLOCK</i>	<i>700 WEST TRADE STREET</i>	<i>SE 1/4 - 1/2 (0.277 mi.)</i>	<i>K43</i>	<i>62</i>
<i>SWARTZ & SONS (SMITH METAL & I</i>	<i>W. 3RD AND CEDAR</i>	<i>S 1/4 - 1/2 (0.280 mi.)</i>	<i>J45</i>	<i>67</i>
<i>ELMWOOD CEMETERY</i>	<i>700 WEST 6TH STREET</i>	<i>ESE 1/4 - 1/2 (0.291 mi.)</i>	<i>46</i>	<i>69</i>
<i>WEST TRADE VACANT LOT</i>	<i>1501 W. TRADE STREET</i>	<i>WNW 1/4 - 1/2 (0.310 mi.)</i>	<i>L47</i>	<i>72</i>
<i>AMTRAK RAIL STATION</i>	<i>607 WEST 5TH STREET</i>	<i>SE 1/4 - 1/2 (0.316 mi.)</i>	<i>48</i>	<i>74</i>
<i>NCDOT WEST PARKING</i>	<i>531 WEST FOURTH STREET</i>	<i>SSE 1/4 - 1/2 (0.316 mi.)</i>	<i>49</i>	<i>77</i>
<i>MULTI-MODAL (PARCEL 14)</i>	<i>600 WEST TRADE STREET</i>	<i>SE 1/4 - 1/2 (0.326 mi.)</i>	<i>K50</i>	<i>80</i>
<i>GREYHOUND LINES TERMINAL</i>	<i>601 W TRADE STREET</i>	<i>SE 1/4 - 1/2 (0.335 mi.)</i>	<i>M51</i>	<i>83</i>
<i>SOUTH CENTRAL OIL PROPERTY</i>	<i>115 GRANDIN ROAD</i>	<i>WNW 1/4 - 1/2 (0.338 mi.)</i>	<i>L52</i>	<i>85</i>
<i>GRIFFIN BROS TIRE SALE INC</i>	<i>1545 W TRADE STREET</i>	<i>WNW 1/4 - 1/2 (0.341 mi.)</i>	<i>L53</i>	<i>88</i>
<i>SERVCO #01615</i>	<i>1601 WEST TRADE STREET</i>	<i>NW 1/4 - 1/2 (0.365 mi.)</i>	<i>55</i>	<i>93</i>
<i>AMTRAK STATION PARKING LOT</i>	<i>401 SMITH STREET</i>	<i>ESE 1/4 - 1/2 (0.377 mi.)</i>	<i>56</i>	<i>96</i>
<i>DAVE HANSFORD PROPERTY</i>	<i>1512 WEST 4TH STREET</i>	<i>W 1/4 - 1/2 (0.377 mi.)</i>	<i>57</i>	<i>99</i>
<i>DIRTY LAUNDRY CLEANERS (FORMER</i>	<i>511, 513, 515 WEST TRAD</i>	<i>SE 1/4 - 1/2 (0.381 mi.)</i>	<i>M58</i>	<i>101</i>
<i>MULTI-MODAL (PARCEL 5A)</i>	<i>511 WEST TRADE STREET</i>	<i>SE 1/4 - 1/2 (0.383 mi.)</i>	<i>M59</i>	<i>103</i>
<i>MULTI-MODAL (PARCEL 5A) UST1&2</i>	<i>511 WEST TRADE STREET</i>	<i>SE 1/4 - 1/2 (0.383 mi.)</i>	<i>M60</i>	<i>105</i>
<i>511 THROUGH 515 WEST TRADE STR</i>	<i>511-515 WEST TRADE STR</i>	<i>SE 1/4 - 1/2 (0.383 mi.)</i>	<i>M61</i>	<i>108</i>
<i>SPEIZMAN INDUSTRIES #2 (HEATIN</i>	<i>508 WEST FIFTH STREET</i>	<i>SE 1/4 - 1/2 (0.385 mi.)</i>	<i>N62</i>	<i>111</i>
<i>SERVCO SERVICE STATION</i>	<i>120 SOUTH GRAHAM STREET</i>	<i>SSE 1/4 - 1/2 (0.388 mi.)</i>	<i>O64</i>	<i>117</i>
<i>JAMES K POLK BUILDING</i>	<i>500 WEST TRADE STREET S</i>	<i>SE 1/4 - 1/2 (0.389 mi.)</i>	<i>O65</i>	<i>119</i>
<i>CHARTER PROPERTIES, INC.</i>	<i>W.TRADE STREET AND N. G</i>	<i>SE 1/4 - 1/2 (0.391 mi.)</i>	<i>O66</i>	<i>125</i>
<i>SISKRON</i>	<i>211 TUCKASEEGEE ROAD</i>	<i>WNW 1/4 - 1/2 (0.401 mi.)</i>	<i>P68</i>	<i>130</i>
<i>FORMER CITY PLUMBING & HEATING</i>	<i>211 TUCKASEEGEE ROAD</i>	<i>WNW 1/4 - 1/2 (0.401 mi.)</i>	<i>P69</i>	<i>132</i>
<i>SOUTHERN MANUFACTURING, INC</i>	<i>1000 SEABOARD STREET</i>	<i>ENE 1/4 - 1/2 (0.414 mi.)</i>	<i>Q72</i>	<i>134</i>
<i>FITZGERALD PROPERTY</i>	<i>315 S GRAHAM STREET</i>	<i>SSE 1/4 - 1/2 (0.416 mi.)</i>	<i>73</i>	<i>135</i>

EXECUTIVE SUMMARY

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
<i>NCDOT-MCKEITHEN PROPERTY</i>	<i>600 W 8TH STREET</i>	<i>E 1/4 - 1/2 (0.424 mi.)</i>	<i>74</i>	<i>138</i>
<i>HOLLAND HOUSE-FORMER</i>	<i>307 NORTH GRAHAM STREET</i>	<i>ESE 1/4 - 1/2 (0.428 mi.)</i>	<i>75</i>	<i>141</i>
<i>TWO WAY SHOP AND GAS</i>	<i>1740 WEST TRADE STREET</i>	<i>NW 1/4 - 1/2 (0.448 mi.)</i>	<i>82</i>	<i>163</i>
<i>TEXTILE CHEMICAL FACILITY</i>	<i>500 SOUTH GRAHAM STREET</i>	<i>S 1/4 - 1/2 (0.462 mi.)</i>	<i>84</i>	<i>179</i>
<i>NCF FINANCIAL CORP. PROPERTY/</i>	<i>501 N. GRAHAM STREET</i>	<i>ESE 1/4 - 1/2 (0.491 mi.)</i>	<i>87</i>	<i>189</i>
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
<i>ELMER'S AUTO SERVICE</i>	<i>1100 WEST TRADE STREET</i>	<i>W 0 - 1/8 (0.004 mi.)</i>	<i>B5</i>	<i>16</i>
<i>QUICK N E-Z 2</i>	<i>1419 WEST TRADE STREET</i>	<i>WNW 1/4 - 1/2 (0.280 mi.)</i>	<i>I44</i>	<i>65</i>
<i>MECKLENBURG COUNTY GARAGE</i>	<i>900 WEST 12TH STREET</i>	<i>NE 1/4 - 1/2 (0.440 mi.)</i>	<i>R77</i>	<i>145</i>
<i>B.B.A U.S. HOLDINGS, INC.</i>	<i>12TH ST AND HAMILTON</i>	<i>NE 1/4 - 1/2 (0.441 mi.)</i>	<i>R79</i>	<i>159</i>
<i>F & R OIL COMPANY INC</i>	<i>624 CEDAR ST</i>	<i>SSW 1/4 - 1/2 (0.490 mi.)</i>	<i>86</i>	<i>182</i>

EDR PROPRIETARY RECORDS

EDR Proprietary Records

Manufactured Gas Plants: The EDR Proprietary Manufactured Gas Plant Database includes records of coal gas plants (manufactured gas plants) compiled by EDR's researchers. Manufactured gas sites were used in the United States from the 1800's to 1950's to produce a gas that could be distributed and used as fuel. These plants used whale oil, rosin, coal, or a mixture of coal, oil, and water that also produced a significant amount of waste. Many of the byproducts of the gas production, such as coal tar (oily waste containing volatile and non-volatile chemicals), sludges, oils and other compounds are potentially hazardous to human health and the environment. The byproduct from this process was frequently disposed of directly at the plant site and can remain or spread slowly, serving as a continuous source of soil and groundwater contamination.

A review of the Manufactured Gas Plants list, as provided by EDR, has revealed that there is 1 Manufactured Gas Plants site within approximately 1 mile of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
CHARLOTTE MGP NO.1	200 SOUTH COLLEGE STREE	SE 1/2 - 1 (0.800 mi.)	97	215

EDR Historical Auto Stations: EDR has searched selected national collections of business directories and has collected listings of potential gas station/filling station/service station sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include gas station/filling station/service station establishments. The categories reviewed included, but were not limited to gas, gas station, gasoline station, filling station, auto, automobile repair, auto service station, service station, etc.

A review of the EDR Historical Auto Stations list, as provided by EDR, has revealed that there are 13 EDR Historical Auto Stations sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
A A A SUNOCO SERVICE	933 W TRADE	SE 0 - 1/8 (0.037 mi.)	C9	27
FIFTH STREET PURE OIL SERVICE	834 W 5TH	SE 0 - 1/8 (0.086 mi.)	E17	39
FIFTH STREET PURE OIL SERVICE	834 W 5TH ST	SE 0 - 1/8 (0.087 mi.)	E18	39
WEST TRADE EXXON	800 W TRADE ST	SE 1/8 - 1/4 (0.151 mi.)	F22	40
WILLIAMS ESSO SERVICE	800 W TRADE'	SE 1/8 - 1/4 (0.154 mi.)	F26	48
PUCKETT SERVICE STATION	801 W TRADE	SE 1/8 - 1/4 (0.154 mi.)	F27	49

EXECUTIVE SUMMARY

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
S H SHELL SERVICE STATION	750 W TRADE	SE 1/8 - 1/4 (0.201 mi.)	H31	55
KIKERS SERVICE STATION	740 W TRADE	SE 1/8 - 1/4 (0.211 mi.)	H33	56

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
ELMERS AUTO SERVICE	1100 W TRADE ST	W 0 - 1/8 (0.004 mi.)	B4	16
PUCKETTS TEXACO SERVICE	1100 W TRADE	WSW 0 - 1/8 (0.005 mi.)	B6	24
WESLEY HEIGHTS FILLING STATION	1308 W TRADE	WNW 1/8 - 1/4 (0.243 mi.)	I37	57
ROBERTS GULF SERVICE STATION	1319 W TRADE	WNW 1/8 - 1/4 (0.244 mi.)	I39	58
SIGMONS SERVICE CENTER	1329 W TRADE	WNW 1/8 - 1/4 (0.245 mi.)	I41	59

EDR Historical Cleaners: EDR has searched selected national collections of business directories and has collected listings of potential dry cleaner sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include dry cleaning establishments. The categories reviewed included, but were not limited to dry cleaners, cleaners, laundry, laundromat, cleaning/laundry, wash & dry etc.

A review of the EDR Historical Cleaners list, as provided by EDR, has revealed that there are 13 EDR Historical Cleaners sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
SEGREST CLEANERS LAUNDERERS	915 W 5TH ST	SE 0 - 1/8 (0.024 mi.)	8	27
SEGREST CLEANERS	924 W TRADE	SE 0 - 1/8 (0.043 mi.)	C10	28
WRIGHTS ONE HOUR CLEANERS (EDG	912 W TRADE ST	SE 0 - 1/8 (0.055 mi.)	C11	28
WRIGHTS LAUNDRY AND CLEANING S	831 W TRADE	SE 1/8 - 1/4 (0.128 mi.)	F19	39
SPRINGS DRY CLEANERS	825 W TRADE	SE 1/8 - 1/4 (0.133 mi.)	F20	40
WRIGHTS ONE HOUR CLEANING CO	801 W TRADE ST	SE 1/8 - 1/4 (0.151 mi.)	F21	40
ROYAL LAUNDRY (BR)	801 W TRADE	SE 1/8 - 1/4 (0.154 mi.)	F28	49
ONE HOUR MARTINIZING SERVICE	750 W TRADE	SE 1/8 - 1/4 (0.201 mi.)	H32	55
ELLIOTT C L CLEANERS	727 W TRADE	SE 1/8 - 1/4 (0.232 mi.)	H35	56
WEST TRADE LAUNDRY (HAND)	725 W TRADE	SE 1/8 - 1/4 (0.234 mi.)	H36	57


<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
JONES CLEANING SERVICE	1026 W 5TH ST	NE 0 - 1/8 (0.003 mi.)	A3	15
VALETERIA INC	1311 W TRADE	WNW 1/8 - 1/4 (0.243 mi.)	I38	58
VALETERIA CLEANING CO MAIN PLA	1326 W TRADE	WNW 1/8 - 1/4 (0.244 mi.)	I40	58

EXECUTIVE SUMMARY

Due to poor or inadequate address information, the following sites were not mapped. Count: 20 records.

<u>Site Name</u>	<u>Database(s)</u>
AMOCO TERMINAL-SLOP UST	IMD, LAST, LUST
MALLARD CREEK WWTP	IMD, LAST
HENSON'S, INC. MULCH & MORE	LF, HIST LF
NCDOT ASPHALT SITE #2 (CROWDER CON	HWS
ELMWOOD CIRCLE	HWS, IMD
HWY 49 BATTERY DUMP	HWS, IMD
QUEENS PROPERTY	HWS
DOW CHEMICAL CORP/ALLIED	HWS
CHARLOTTE COAL GAS PLANT NO.1	CERCLIS-NFRAP
C D SPANGLER CONSTRUCTION CO	LF
PERFECT GAS HOUSE - BREVARD	UST
B & G GROCERY	UST
QUIK SHOPPE 2	UST
DUKE POWER COMPANY	UST
WHER. RENA MARINA	UST
AVIS RENT-A-CAR	UST
BURGESS TRANSPORT INC	UST
LOVE AUTO PARTS	RCRA-NLR
RENTAL SERVICE CORP	FINDS, RCRA-CESQG
CHARLOTTE CITY DUMP	IMD

OVERVIEW MAP - 3023111.1s

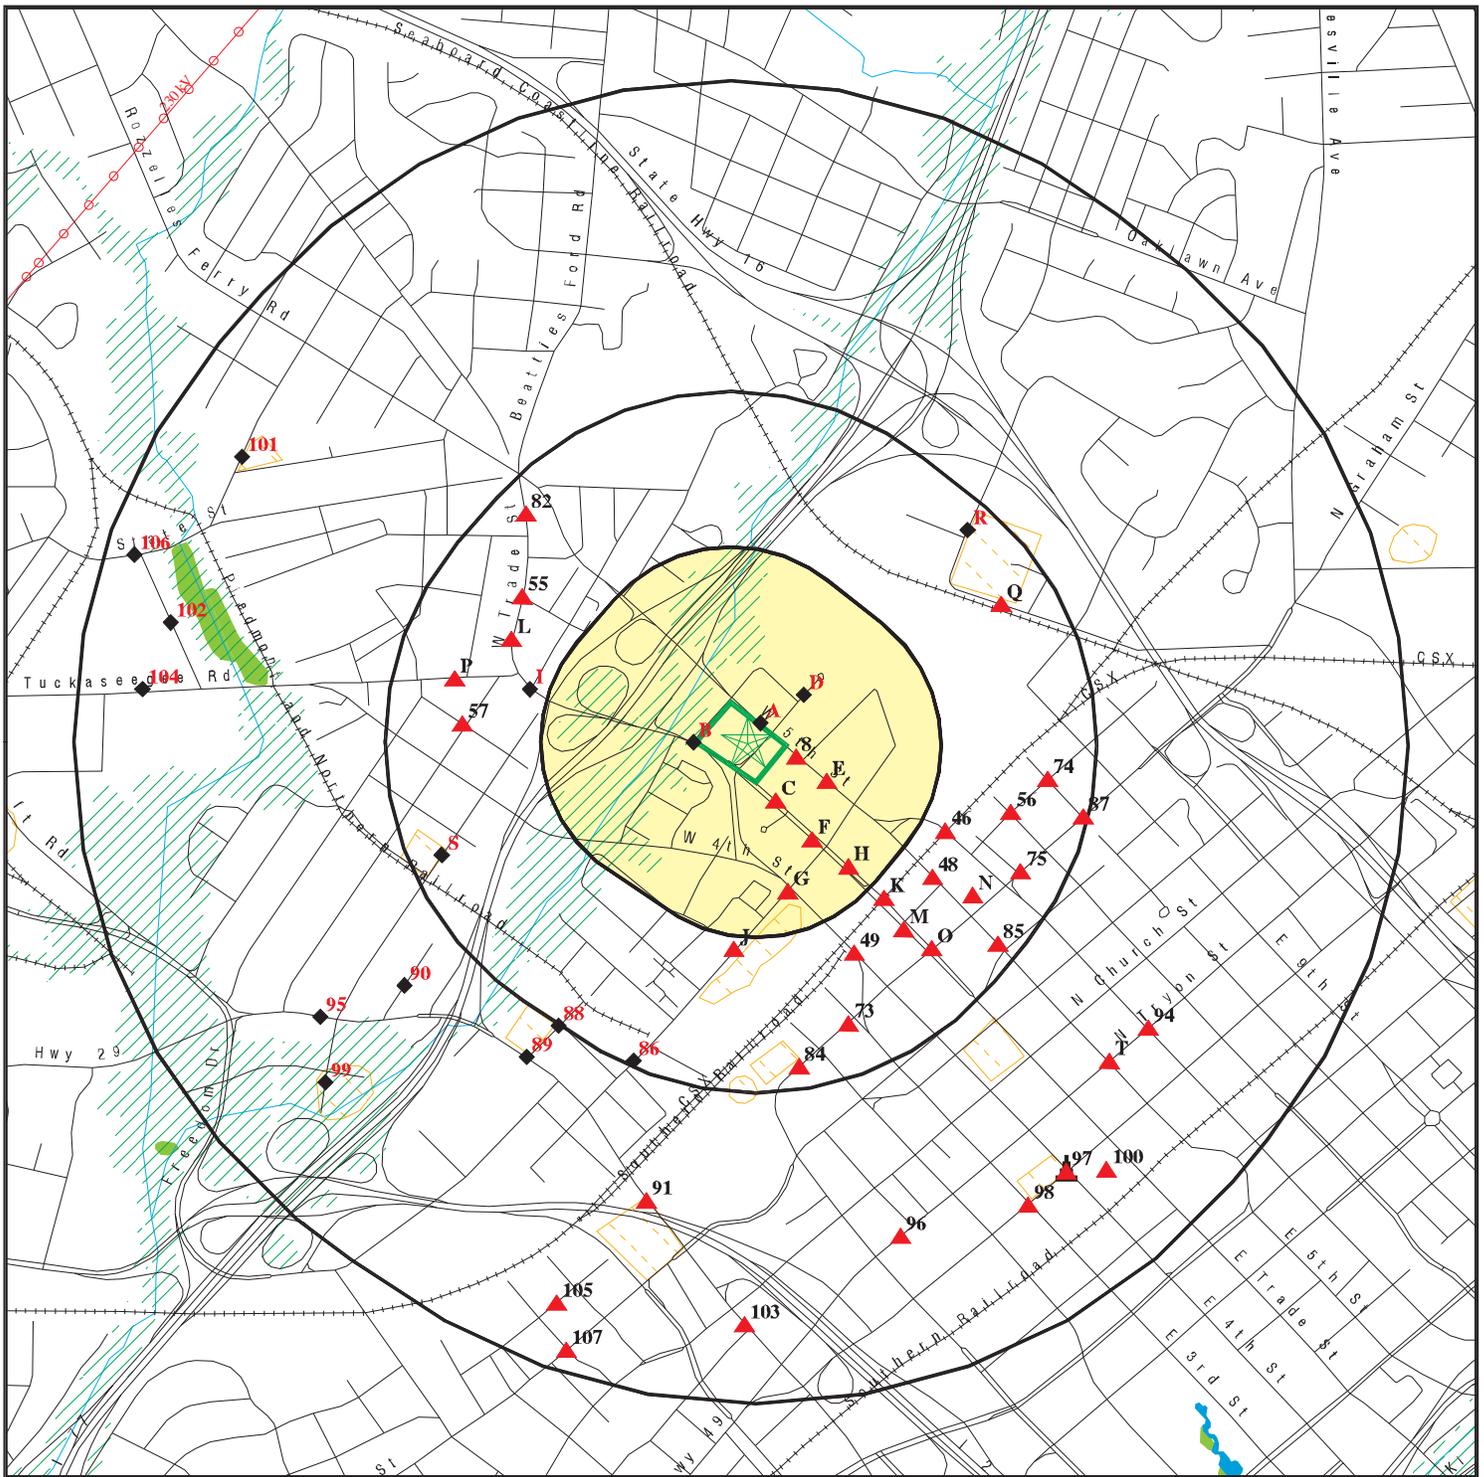

- Target Property
- Sites at elevations higher than or equal to the target property
- Sites at elevations lower than the target property
- Manufactured Gas Plants
- National Priority List Sites
- Dept. Defense Sites


- Indian Reservations BIA
- Power transmission lines
- Oil & Gas pipelines
- 100-year flood zone
- 500-year flood zone
- National Wetland Inventory
- State Wetlands

- Hazardous Substance Disposal Sites

SITE NAME: NCW-481
 ADDRESS: 950-1000 W Trade Street
 Charlotte NC 28202
 LAT/LONG: 35.2355 / 80.8522

CLIENT: ARCADIS U.S., Inc.
 CONTACT: Sean Drain
 INQUIRY #: 3023111.1s
 DATE: March 25, 2011 9:13 am


DETAIL MAP - 3023111.1s

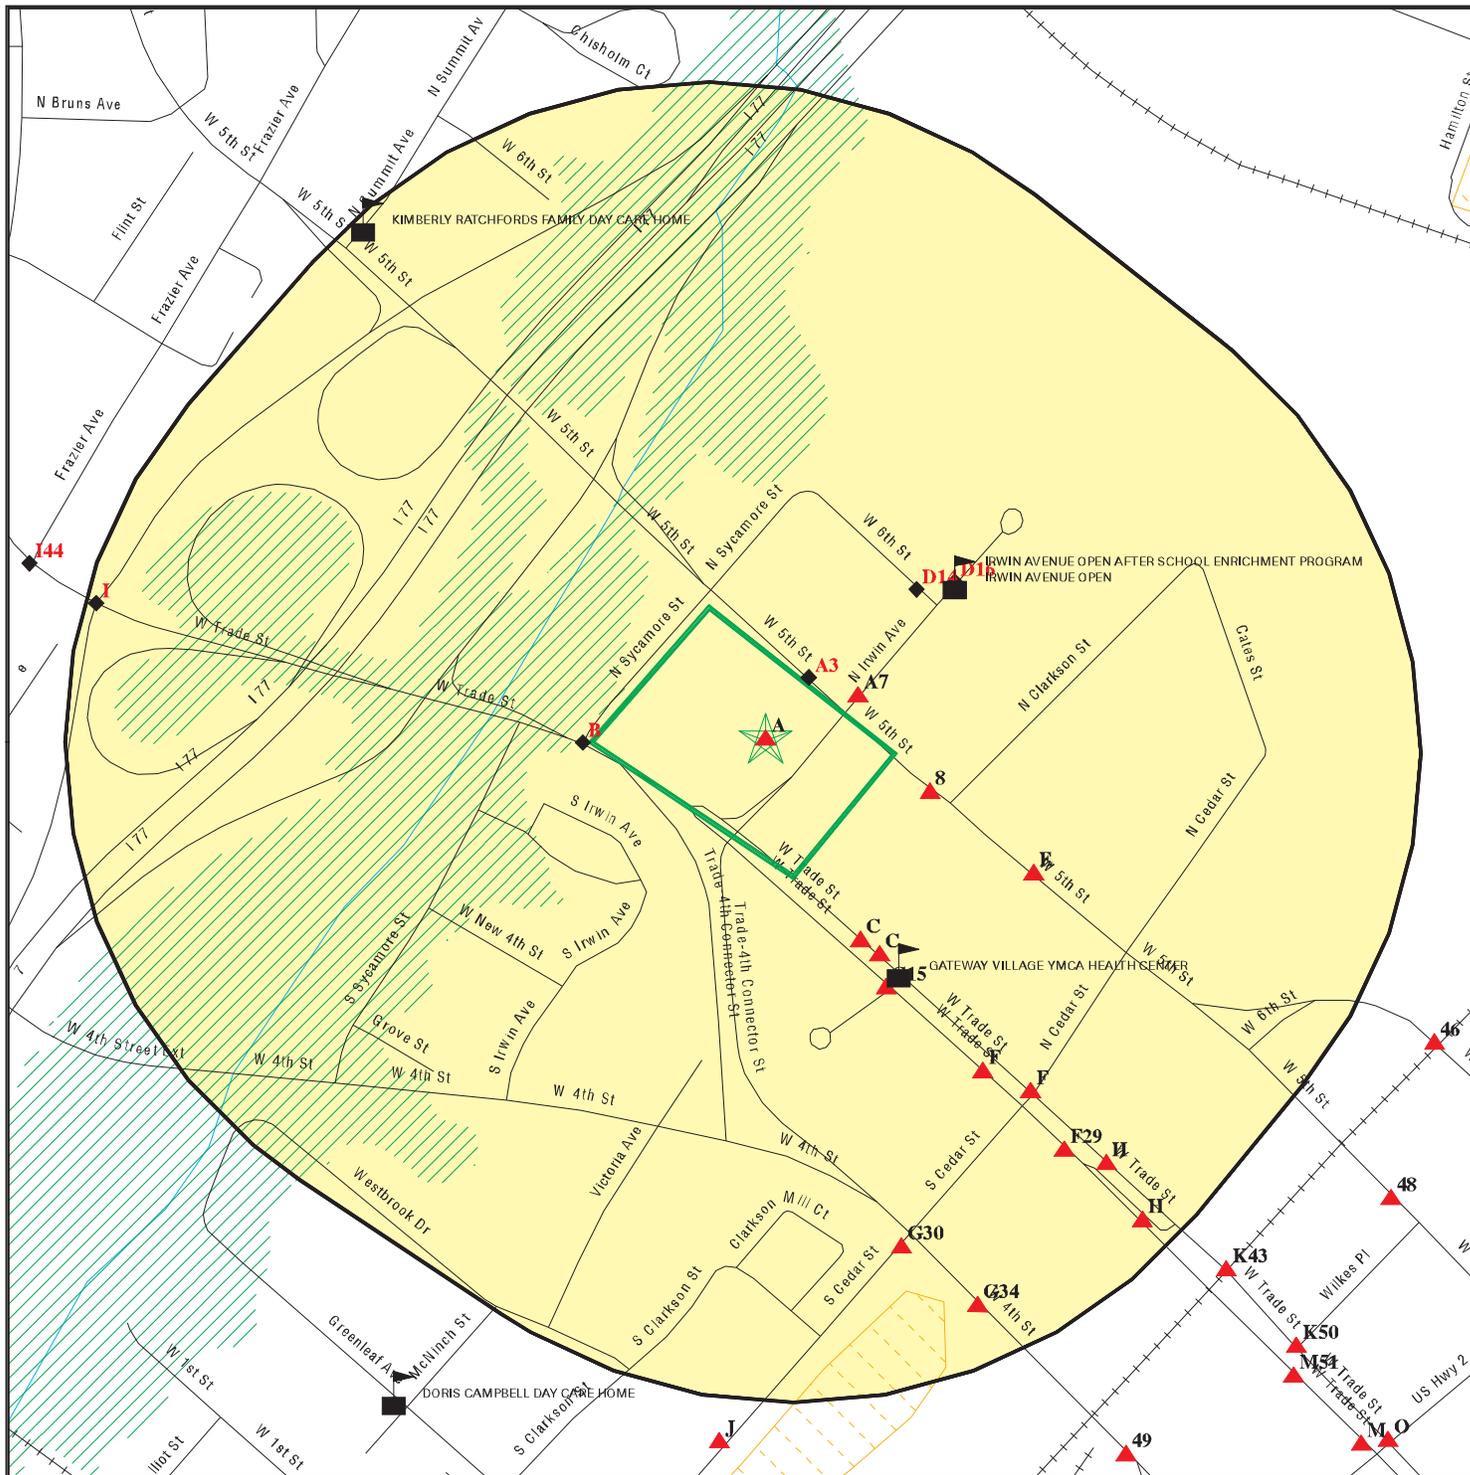

-  Target Property
-  Sites at elevations higher than or equal to the target property
-  Sites at elevations lower than the target property
-  Manufactured Gas Plants
-  Sensitive Receptors
-  National Priority List Sites
-  Dept. Defense Sites

-  Indian Reservations BIA
-  Oil & Gas pipelines
-  100-year flood zone
-  500-year flood zone

-  Hazardous Substance Disposal Sites



SITE NAME: NCW-481
 ADDRESS: 950-1000 W Trade Street
 Charlotte NC 28202
 LAT/LONG: 35.2355 / 80.8522

CLIENT: ARCADIS U.S., Inc.
 CONTACT: Sean Drain
 INQUIRY #: 3023111.1s
 DATE: March 25, 2011 9:14 am

MAP FINDINGS SUMMARY

Database	Target Property	Search Distance (Miles)	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
STANDARD ENVIRONMENTAL RECORDS								
<i>Federal NPL site list</i>								
NPL		1.000	0	0	0	0	NR	0
Proposed NPL		1.000	0	0	0	0	NR	0
NPL LIENS		TP	NR	NR	NR	NR	NR	0
<i>Federal Delisted NPL site list</i>								
Delisted NPL		1.000	0	0	0	0	NR	0
<i>Federal CERCLIS list</i>								
CERCLIS		0.500	0	0	0	NR	NR	0
FEDERAL FACILITY		1.000	0	0	0	0	NR	0
<i>Federal CERCLIS NFRAP site List</i>								
CERC-NFRAP		0.500	0	0	3	NR	NR	3
<i>Federal RCRA CORRACTS facilities list</i>								
CORRACTS		1.000	0	0	0	0	NR	0
<i>Federal RCRA non-CORRACTS TSD facilities list</i>								
RCRA-TSDF		0.500	0	0	0	NR	NR	0
<i>Federal RCRA generators list</i>								
RCRA-LQG		0.250	0	0	NR	NR	NR	0
RCRA-SQG		0.250	0	0	NR	NR	NR	0
RCRA-CESQG		0.250	0	0	NR	NR	NR	0
<i>Federal institutional controls / engineering controls registries</i>								
US ENG CONTROLS		0.500	0	0	0	NR	NR	0
US INST CONTROL		0.500	0	0	0	NR	NR	0
<i>Federal ERNS list</i>								
ERNS		TP	NR	NR	NR	NR	NR	0
<i>State- and tribal - equivalent NPL</i>								
NC HSDS		1.000	0	1	4	6	NR	11
<i>State- and tribal - equivalent CERCLIS</i>								
SHWS		1.000	0	0	5	19	NR	24
<i>State and tribal landfill and/or solid waste disposal site lists</i>								
SWF/LF		0.500	0	0	0	NR	NR	0
OLI		0.500	0	0	0	NR	NR	0
<i>State and tribal leaking storage tank lists</i>								
LUST	X	0.500	4	3	32	NR	NR	39

MAP FINDINGS SUMMARY

Database	Target Property	Search Distance (Miles)	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
LUST TRUST		0.500	0	0	4	NR	NR	4
LAST		0.500	0	1	0	NR	NR	1
INDIAN LUST		0.500	0	0	0	NR	NR	0
State and tribal registered storage tank lists								
UST		0.250	4	1	NR	NR	NR	5
AST		0.250	0	0	NR	NR	NR	0
INDIAN UST		0.250	0	0	NR	NR	NR	0
FEMA UST		0.250	0	0	NR	NR	NR	0
State and tribal institutional control / engineering control registries								
INST CONTROL		0.500	0	0	0	NR	NR	0
State and tribal voluntary cleanup sites								
VCP		0.500	0	0	0	NR	NR	0
INDIAN VCP		0.500	0	0	0	NR	NR	0
State and tribal Brownfields sites								
BROWNFIELDS		0.500	0	1	1	NR	NR	2
<u>ADDITIONAL ENVIRONMENTAL RECORDS</u>								
Local Brownfield lists								
US BROWNFIELDS		0.500	0	0	0	NR	NR	0
Local Lists of Landfill / Solid Waste Disposal Sites								
DEBRIS REGION 9		0.500	0	0	0	NR	NR	0
ODI		0.500	0	0	0	NR	NR	0
HIST LF		0.500	0	0	0	NR	NR	0
INDIAN ODI		0.500	0	0	0	NR	NR	0
Local Lists of Hazardous waste / Contaminated Sites								
US CDL		TP	NR	NR	NR	NR	NR	0
US HIST CDL		TP	NR	NR	NR	NR	NR	0
Local Land Records								
LIENS 2		TP	NR	NR	NR	NR	NR	0
LUCIS		0.500	0	0	0	NR	NR	0
Records of Emergency Release Reports								
HMIRS		TP	NR	NR	NR	NR	NR	0
Other Ascertainable Records								
RCRA-NonGen		0.250	0	0	NR	NR	NR	0
DOT OPS		TP	NR	NR	NR	NR	NR	0
DOD		1.000	0	0	0	0	NR	0
FUDS		1.000	0	0	0	0	NR	0

MAP FINDINGS SUMMARY

Database	Target Property	Search Distance (Miles)	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
CONSENT		1.000	0	0	0	0	NR	0
ROD		1.000	0	0	0	0	NR	0
UMTRA		0.500	0	0	0	NR	NR	0
MINES		0.250	0	0	NR	NR	NR	0
TRIS		TP	NR	NR	NR	NR	NR	0
TSCA		TP	NR	NR	NR	NR	NR	0
FTTS		TP	NR	NR	NR	NR	NR	0
HIST FTTS		TP	NR	NR	NR	NR	NR	0
SSTS		TP	NR	NR	NR	NR	NR	0
ICIS		TP	NR	NR	NR	NR	NR	0
PADS		TP	NR	NR	NR	NR	NR	0
MLTS		TP	NR	NR	NR	NR	NR	0
RADINFO		TP	NR	NR	NR	NR	NR	0
FINDS		TP	NR	NR	NR	NR	NR	0
RAATS		TP	NR	NR	NR	NR	NR	0
IMD	X	0.500	2	4	34	NR	NR	40
UIC		TP	NR	NR	NR	NR	NR	0
DRYCLEANERS		0.250	0	0	NR	NR	NR	0
NPDES		TP	NR	NR	NR	NR	NR	0
INDIAN RESERV		1.000	0	0	0	0	NR	0
SCRD DRYCLEANERS		0.500	0	0	0	NR	NR	0
PCB TRANSFORMER		TP	NR	NR	NR	NR	NR	0
COAL ASH EPA		0.500	0	0	0	NR	NR	0
COAL ASH DOE		TP	NR	NR	NR	NR	NR	0
COAL ASH		0.500	0	0	0	NR	NR	0

EDR PROPRIETARY RECORDS

EDR Proprietary Records

Manufactured Gas Plants		1.000	0	0	0	1	NR	1
EDR Historical Auto Stations	X	0.250	5	8	NR	NR	NR	13
EDR Historical Cleaners		0.250	4	9	NR	NR	NR	13

NOTES:

TP = Target Property

NR = Not Requested at this Search Distance

Sites may be listed in more than one database

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

A1
Target
Property

HOLCOMBS AMOCO SERVICE
1000 W TRADE
CHARLOTTE, NC

EDR Historical Auto Stations

1009031930
N/A

Site 1 of 4 in cluster A

Actual:
698 ft.

EDR Historical Auto Stations:

- Name: NANCE SERVICE STATION
Year: 1937
Type: GASOLINE AND OIL SERVICE STATIONS

- Name: NANCE SERVICE STATION
Year: 1937
Type: GASOLINE AND OIL SERVICE STATIONS

- Name: LEONARDS SERVICE STATION
Year: 1944
Type: GASOLINE AND OIL SERVICE STATIONS

- Name: LEONARDS SERVICE STATION
Year: 1944
Type: GASOLINE AND OIL SERVICE STATIONS

- Name: THOMPSONS FRIENDLY SERVICE
Year: 1949
Type: GASOLINE AND OIL SERVICE STATIONS

- Name: THOMPSONS FRIENDLY SERVICE
Year: 1949
Type: GASOLINE AND OIL SERVICE STATIONS

- Name: HOLCOMBS AMOCO SERVICE STATION
Year: 1953
Type: GASOLINE STATIONS

- Name: HOLCOMBS AMOCO SERVICE STATION
Year: 1953
Type: GASOLINE STATIONS

- Name: HOLCOMBS AMOCO SERVICE
Year: 1959
Type: GASOLINE STATIONS

- Name: HOLCOMBS AMOCO SERVICE
Year: 1959
Type: GASOLINE STATIONS

- Name: HOLCOMBS AMOCO SERVICE
Year: 1964
Type: GASOLINE STATIONS

- Name: HOLCOMBS AMOCO SERVICE
Year: 1964
Type: GASOLINE STATIONS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

A2 **GATEWAY VILLAGE**
Target **950 BLOCK OF W. TRADE ST**
Property **CHARLOTTE, NC**

IMD **S104547248**
LUST **N/A**

Site 2 of 4 in cluster A

Actual:
698 ft.

IMD:

Region: MOR
Facility ID: 21745
Date Occurred: 12/15/1999
Submit Date: 5/31/2000
GW Contam: No Groundwater Contamination detected
Soil Contam: Yes
Incident Desc: TPH AS HIGH AS 8000 MG/KG DPO REMAINS AFTER UST CLOSURE 28000 TPH DRO DETECTED DURING CLOSURE ACTIVITIES AND EXECAVATED
Operator: ANDREA ELLER
Contact Phone: Not reported
Owner Company: BANK OF AMERICA
Operator Address:525 N TRADE STREET
Operator City: CHARLOTTE
Oper City,St,Zip: CHARLOTTE, NC 28255
Ownership: Private
Operation: Commercial
Material: HEATING OIL
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Leak-underground
Type: Gasoline/diesel
Location: Facility
Setting: Urban
Risk Site: L
Site Priority: Not reported
Priority Code: Not reported
Priority Update: 5/31/2000
Dem Contact: ARL
Wells Affected: Not reported
Num Affected: Not reported
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: 35.23527777
Longitude: -80.85388888
Latitude Number: 351407
Longitude Number: 805114
Latitude Decimal: 35.2352777777778
Longitude Decimal: 80.8538888888889
GPS: NOD
Agency: DWM
Facility ID: 21745
Last Modified: Not reported
Incident Phase: Follow Up
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GATEWAY VILLAGE (Continued)

S104547248

Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

Region: MOR
Facility ID: 24446
Date Occurred: Not reported
Submit Date: 7/24/2002
GW Contam: No Groundwater Contamination detected
Soil Contam: Yes
Incident Desc: HEATING OIL UST WAS DISCOVERED DURING GRADING ACTIVITIES AT THE SITE.
SOIL CONTAMINATION REMAINS IN THE TANK BASIN AFTER 128 TONS OF SOIL
WAS EXCAVATED.

Operator: UNKNOWN
Contact Phone: Not reported
Owner Company: UNKNOWN
Operator Address: Not reported
Operator City: Not reported
Oper City, St, Zip: NC
Ownership: Private
Operation: Commercial
Material: Not reported
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Leak-underground
Type: Gasoline/diesel
Location: Facility
Setting: Urban
Risk Site: Unknown
Site Priority: U
Priority Code: Not reported
Priority Update: 7/25/2002
Dem Contact: AJS
Wells Affected: Not reported
Num Affected: Not reported
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported

7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: 35.23444444
Longitude: -80.85222222
Latitude Number: 351404
Longitude Number: 805108
Latitude Decimal: 35.23444444444444
Longitude Decimal: 80.85222222222222
GPS: 7
Agency: DWM
Facility ID: 24446
Last Modified: 7/24/2002
Incident Phase: RE
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GATEWAY VILLAGE (Continued)

S104547248

Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LUST:

Facility ID: Not reported
UST Number: MO-5916
Incident Number: 21745
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 2000-03-24 00:00:00
Date Occur: 1999-12-15 00:00:00
Cleanup: 1999-12-15 00:00:00
Closure Request: Not reported
Close Out: Not reported
Level Of Soil Cleanup Achieved: Industrial/Commercial
Tank Regulated Status: Non Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: NON COMMERCIAL
Risk Classification: L
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: 2001-04-17 00:00:00
Site Priority: E
Phase Of LSA Req: 1
Site Risk Reason: Not reported
Land Use: Industrial/commercial
MTBE: Not reported
MTBE1: Unknown
Flag: No
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in House
RBCA GW: Not reported
PETOPT: 4
RPL: True
CD Num: 0
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0
Error Code: Not reported
Valid: False
Lat/Long: 35 14 4.98 80 51 6.96
Lat/Long Decimal: 35.234721999999998 80.851944000000003
Testlat: Not reported
Regional Officer Project Mgr: BLM
Region: Mooresville
Company: BANK OF AMERICA
Contact Person: ANDREA ELLER

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GATEWAY VILLAGE (Continued)

S104547248

Telephone: Not reported
RP Address: 525 N TRADE STREET
RP City,St,Zip: CHARLOTTE, NC 28255
RP County: MECKLENBURG
Comments: 1-1000-gallon fuel oil ust
5 Min Quad: R66B

PIRF:

Facility Id: 21745
Date Occurred: 1999-12-15 00:00:00
Date Reported: 2000-05-31 00:00:00
Description Of Incident: TPH AS HIGH AS 8000 MG/KG DPO REMAINS AFTER UST CLOSURE 28000 TPH DRO
DETECTED DURING CLOSURE ACTIVITIES AND EXECAVATED

Owner/Operator: ANDREA ELLER
Ownership: 4
Operation Type: 6
Type: 4
Location: 1
Site Priority: Not reported
Priority Update: 2000-05-31 00:00:00
Wells Affected Y/N: Not reported
Samples Include: Not reported
7#5 Minute Quad: Not reported
5 Minute Quad: Not reported
Pirf/Min Soil: Not reported
Release Code: Not reported
Source Code: MIN_SOIL
Err Type: Not reported
Cause: Not reported
Source: Not reported
Ust Number: Not reported

Last Modified: Not reported
Incident Phase: Follow Up
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Signed: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

Facility ID: Not reported
UST Number: MO-6447
Incident Number: 24446
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 2002-07-24 00:00:00
Date Occur: Not reported
Cleanup: 2002-07-23 00:00:00
Closure Request: Not reported
Close Out: Not reported
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Non Regulated

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GATEWAY VILLAGE (Continued)

S104547248

Of Supply Wells: Not reported
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: U
Risk Class Based On Review: U
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: 2002-07-23 00:00:00
Site Priority: Not reported
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Not reported
MTBE: No
MTBE1: Unknown
Flag: No
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in House
RBCA GW: Not reported
PETOPT: 4
RPL: False
CD Num: 0
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0
Error Code: Not reported
Valid: False
Lat/Long: 35 14 3.96 80 51 7.98
Lat/Long Decimal: 35.234444000000003 80.852221999999998
Testlat: Not reported
Regional Officer Project Mgr: BLM
Region: Mooresville
Company: UNKNOWN
Contact Person: UNKNOWN
Telephone: Not reported
RP Address: Not reported
RP City,St,Zip: NC
RP County: Not reported
Comments: NHR/AJS/2/9/2005. ORPHAN TANK
5 Min Quad: Not reported

PIRF:

Facility Id: 24446
Date Occurred: 2002-06-11 00:00:00
Date Reported: 2002-07-24 00:00:00
Description Of Incident: HEATING OIL UST WAS DISCOVERED DURING GRADING ACTIVITIES AT THE SITE. SOIL CONTAMINATION REMAINS IN THE TANK BASIN AFTER 128 TONS OF SOIL WAS EXCAVATED.
Owner/Operator: UNKNOWN
Ownership: 4
Operation Type: 6
Type: 4
Location: 1
Site Priority: U
Priority Update: 2002-07-25 00:00:00
Wells Affected Y/N: Not reported
Samples Include: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GATEWAY VILLAGE (Continued)

S104547248

7#5 Minute Quad:	Not reported
5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Not reported
Err Type:	2
Cause:	Not reported
Source:	C
Ust Number:	C
Last Modified:	2002-07-24 00:00:00
Incident Phase:	Response
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

HSDS
Region
SSW
1/2-1
3723 ft.

ROWE CORP PROPERTY
, NC

NC HSDS **S102442779**
N/A

NC HSDS:
Site Type: Federal
Superfund ID: 980 838 379
Lat/Long: 35 13 25.849341 80 51 20.052737

HSDS
Region
SE
1/2-1
4132 ft.

CHARLOTTE COAL GAS PLANT NO. 1
, NC

NC HSDS **S102442777**
N/A

NC HSDS:
Site Type: Federal
Superfund ID: 986 188 811
Lat/Long: 35 13 30.862079 80 50 38.282821

MAP FINDINGS

Map ID Direction Distance Elevation	Site	Database(s)	EDR ID Number EPA ID Number
--	------	-------------	--------------------------------

HSDS Region South 1/4-1/2 2556 ft.	H.M. WADE FURNITURE , NC	NC HSDS	S102442775 N/A
---	--	----------------	--------------------------

NC HSDS:
 Site Type: State
 Superfund ID: 000 0073
 Lat/Long: 35 13 38.094305 80 51 9.167139

HSDS Region SW 1/2-1 4033 ft.	CHEROKEE OIL SITE , NC	NC HSDS	S102442774 N/A
--	--------------------------------------	----------------	--------------------------

NC HSDS:
 Site Type: Federal
 Superfund ID: 986 190 239
 Lat/Long: 35 13 38.006454 80 51 49.856720

HSDS Region South 1/4-1/2 2261 ft.	TEXTILE CHEMICAL FACILITY , NC	NC HSDS	S102442773 N/A
---	--	----------------	--------------------------

NC HSDS:
 Site Type: State
 Superfund ID: 000 0074
 Lat/Long: 35 13 40.460257 80 51 5.652124

HSDS Region SE 1/2-1 2906 ft.	HESTA CARILLION PROJECT , NC	NC HSDS	S102442772 N/A
--	--	----------------	--------------------------

NC HSDS:
 Site Type: State
 Superfund ID: 000 0042
 Lat/Long: 35 13 41.676691 80 50 43.736232

HSDS Region SSW 1/2-1 2709 ft.	JONES CHEMICALS INC OF NORTH CAROLINA , NC	NC HSDS	S102442771 N/A
---	--	----------------	--------------------------

NC HSDS:
 Site Type: Federal
 Superfund ID: 002 462 414
 Lat/Long: 35 13 43.205029 80 51 30.600108

MAP FINDINGS

Map ID
Direction
Distance
Elevation

Site

Database(s)

EDR ID Number
EPA ID Number

HSDS
Region
SSE
1/8-1/4
1101 ft.

SMITH METAL & IRON CO
, NC

NC HSDS **S102442768**
N/A

NC HSDS:
Site Type: Federal
Superfund ID: 024 488 025
Lat/Long: 35 13 49.875753 80 51 6.830750

HSDS
Region
WSW
1/4-1/2
2367 ft.

SUMMIT AVE SITE
, NC

NC HSDS **S102442765**
N/A

NC HSDS:
Site Type: Federal
Superfund ID: 980 503 155
Lat/Long: 35 13 58.050210 80 51 41.742467

HSDS
Region
NE
1/4-1/2
2004 ft.

SOUTHERN MANUFACTURING INC
, NC

NC HSDS **S102442757**
N/A

NC HSDS:
Site Type: Federal
Superfund ID: 990 715 658
Lat/Long: 35 14 23.136239 80 50 42.987556

HSDS
Region
NW
1/2-1
4347 ft.

SINCLAIR AND VALENTINE CO
, NC

NC HSDS **S102442752**
N/A

NC HSDS:
Site Type: Federal
Superfund ID: 083 678 631
Lat/Long: 35 14 31.612491 80 51 58.487847

A3
NE
< 1/8
0.003 mi.
17 ft.

JONES CLEANING SERVICE
1026 W 5TH ST
CHARLOTTE, NC
Site 3 of 4 in cluster A

EDR Historical Cleaners **1009150296**
N/A

Relative:
Lower

Actual:
692 ft.

EDR Historical Cleaners:
Name: JONES CLEANING SERVICE
Year: 1969
Type: CARPET AND RUG CLEANERS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

B4
West
< 1/8
0.004 mi.
21 ft.

ELMERS AUTO SERVICE
1100 W TRADE ST
CHARLOTTE, NC

EDR Historical Auto Stations 1009032351
N/A

Site 1 of 3 in cluster B

Relative:
Lower

EDR Historical Auto Stations:

Name: PUCKETTS TEXACO SERVICE
Year: 1969
Type: GASOLINE STATIONS

Name: PUCKETTS TEXACO SERVICE
Year: 1969
Type: GASOLINE STATIONS

Name: ELMERS AUTO SERVICE
Year: 1974
Type: GASOLINE STATIONS

Name: ELMERS AUTO SERVICE
Year: 1974
Type: GASOLINE STATIONS

Name: ELMERS AUTO SERVICE
Year: 1979
Type: GASOLINE STATIONS

Name: ELMERS AUTO SERVICE
Year: 1979
Type: GASOLINE STATIONS

Name: ELMERS AUTO SERVICE
Year: 1984
Type: GASOLINE STATIONS

Name: ELMERS AUTO SERVICE
Year: 1984
Type: GASOLINE STATIONS

Actual:
656 ft.

B5
West
< 1/8
0.004 mi.
21 ft.

ELMER'S AUTO SERVICE
1100 WEST TRADE STREET
CHARLOTTE, NC 28202

IMD U003144651
LUST N/A
UST

Site 2 of 3 in cluster B

Relative:
Lower

IMD:

Region: MOR
Facility ID: 21747
Date Occurred: 12/15/1999
Submit Date: 5/31/2000
GW Contam: No Groundwater Contamination detected
Soil Contam: Yes
Incident Desc: 430 MG/KG TPH GRO DETECTED AT UST CLOSURE
Operator: ANDREA ELLER
Contact Phone: 7043880179
Owner Company: BANK OF AMERICA
Operator Address: 525 NORTH TRYON
Operator City: CHORLOTTE
Oper City, St, Zip: CHORLOTTE, NC 28255
Ownership: Private

Actual:
656 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ELMER'S AUTO SERVICE (Continued)

U003144651

Operation: Commercial
Material: GASOLINE
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Leak-underground
Type: Gasoline/diesel
Location: Facility
Setting: Urban
Risk Site: L
Site Priority: Not reported
Priority Code: Not reported
Priority Update: 5/31/2000
Dem Contact: ARL
Wells Affected: Not reported
Num Affected: Not reported
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: 35.23555555
Longitude: -80.85416666
Latitude Number: 351408
Longitude Number: 805115
Latitude Decimal: 35.2355555555556
Longitude Decimal: 80.8541666666667
GPS: 7
Agency: DWM
Facility ID: 21747
Last Modified: 1/11/2001
Incident Phase: Closed Out
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: 12/5/2000

LUST:

Facility ID: 0-014974
UST Number: MO-5917
Incident Number: 21747
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 2000-03-24 00:00:00
Date Occur: 1999-12-15 00:00:00
Cleanup: 1999-12-15 00:00:00
Closure Request: 2000-11-22 00:00:00
Close Out: 2000-12-05 00:00:00
Level Of Soil Cleanup Achieved: Soil to Groundwater
Tank Regulated Status: Regulated

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ELMER'S AUTO SERVICE (Continued)

U003144651

Of Supply Wells: 0
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: L
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: 2000-05-31 00:00:00
Site Priority: Not reported
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Not reported
MTBE: No
MTBE1: Unknown
Flag: Yes
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in Archives
RBCA GW: Not reported
PETOPT: 3
RPL: False
CD Num: 80
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0
Error Code: Not reported
Valid: False
Lat/Long: 35 14 8.58 80 51 13.98
Lat/Long Decimal: 35.235737999999998 80.853897000000003
Testlat: Not reported
Regional Officer Project Mgr: ARL
Region: Mooresville
Company: BANK OF AMERICA
Contact Person: ANDREA ELLER
Telephone: 7043880179
RP Address: 525 NORTH TRYON
RP City,St,Zip: CHORLOTTE, NC 28255
RP County: MECKLENBURG
Comments: Not reported
5 Min Quad: R66B

PIRF:

Facility Id: 21747
Date Occurred: 1999-12-15 00:00:00
Date Reported: 2000-05-31 00:00:00
Description Of Incident: 430 MG/KG TPH GRO DETECTED AT UST CLOSURE
Owner/Operator: ANDREA ELLEN
Ownership: 4
Operation Type: 6
Type: 3
Location: 1
Site Priority: Not reported
Priority Update: 2000-05-31 00:00:00
Wells Affected Y/N: Not reported
Samples Include: Not reported
7#5 Minute Quad: Not reported
5 Minute Quad: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ELMER'S AUTO SERVICE (Continued)

U003144651

Pirf/Min Soil: Not reported
Release Code: Not reported
Source Code: MIN_SOIL
Err Type: Not reported
Cause: Not reported
Source: Not reported
Ust Number: Not reported

Last Modified: 2001-01-11 00:00:00
Incident Phase: Closed Out
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Signed: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: 2000-12-05 00:00:00

UST:

Facility ID: 0-014974
Region: 3
Facility Telephone: (704) 377-2074
Last Update: 1989-12-06 00:00:00
Owner Name: NCNB COMMUNITY DEVEL. CORP
Owner Address: 901 WEST TRADE ST
Owner City,St,Zip: CHARLOTTE, NC 28202
Owner Phone: (704) 536-3200
Latitude: 0
Latitude 1: Not reported
Longitude: 0
Longitude 1: Not reported
GPS String Confirmed: No
Initials of Individual Confirming GPS: Not reported

Tank ID: 1
Tank ID Number: Not reported
Tank Capacity: 2000
Status: Permanent Closed
Date installed: 1951-05-15 00:00:00
Date removed: 1990-08-31 00:00:00
Tank Product: Gasoline, Gasoline Mixture
Product Type: NON
Tank Material: Steel
Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: Not reported
Date Last Certified: Not reported
Begin Certified Number: Not reported
End Certified Number: Not reported
Interior Protection: Unknown
Exterior Protection: Unknown
Piping material: Unknown
Certify Type: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ELMER'S AUTO SERVICE (Continued)

U003144651

Leak Detection Type: Not reported
Leak Detection Piping 1: Not reported
Corrosn Protec Tank: Not reported
Corrosn Protec Pipe: Not reported
Spill and Overfill: Not reported
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Not reported
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Not reported
Corrosion Protection Tank Date: Not reported
Corrosion Protection Piping Date: Not reported
Spill Overfill Date: Not reported
Piping System Type Code: Not reported
Piping System Type Description: Not reported
Comment: Not reported

Tank ID: 2
Tank ID Number: Not reported
Tank Capacity: 2000
Status: Permanent Closed
Date installed: 1951-05-15 00:00:00
Date removed: 1990-08-31 00:00:00
Tank Product: Gasoline, Gasoline Mixture
Product Type: NON
Tank Material: Steel
Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: Not reported
Date Last Certified: Not reported
Begin Certified Number: Not reported
End Certified Number: Not reported
Interior Protection: Unknown
Exterior Protection: Unknown
Piping material: Unknown
Certify Type: Not reported
Leak Detection Type: Not reported
Leak Detection Piping 1: Not reported
Corrosn Protec Tank: Not reported
Corrosn Protec Pipe: Not reported
Spill and Overfill: Not reported
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Not reported
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Not reported
Corrosion Protection Tank Date: Not reported
Corrosion Protection Piping Date: Not reported
Spill Overfill Date: Not reported
Piping System Type Code: Not reported
Piping System Type Description: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ELMER'S AUTO SERVICE (Continued)

U003144651

Comment: Not reported

Tank ID: 3
Tank ID Number: Not reported
Tank Capacity: 2000
Status: Permanent Closed
Date installed: 1951-05-15 00:00:00
Date removed: 1990-08-31 00:00:00
Tank Product: Gasoline, Gasoline Mixture
Product Type: NON
Tank Material: Steel
Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: Not reported
Date Last Certified: Not reported
Begin Certified Number: Not reported
End Certified Number: Not reported
Interior Protection: Unknown
Exterior Protection: Unknown
Piping material: Unknown
Certify Type: Not reported
Leak Detection Type: Not reported
Leak Detection Piping 1: Not reported
Corrosn Protec Tank: Not reported
Corrosn Protec Pipe: Not reported
Spill and Overfill: Not reported
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Not reported
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Not reported
Corrosion Protection Tank Date: Not reported
Corrosion Protection Piping Date: Not reported
Spill Overfill Date: Not reported
Piping System Type Code: Not reported
Piping System Type Description: Not reported
Comment: Not reported

Tank ID: 4
Tank ID Number: Not reported
Tank Capacity: 2000
Status: Permanent Closed
Date installed: 1951-05-15 00:00:00
Date removed: 1990-08-31 00:00:00
Tank Product: Gasoline, Gasoline Mixture
Product Type: NON
Tank Material: Steel
Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: Not reported
Date Last Certified: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ELMER'S AUTO SERVICE (Continued)

U003144651

Begin Certified Number: Not reported
End Certified Number: Not reported
Interior Protection: Unknown
Exterior Protection: Unknown
Piping material: Unknown
Certify Type: Not reported
Leak Detection Type: Not reported
Leak Detection Piping 1: Not reported
Corrosn Protec Tank: Not reported
Corrosn Protec Pipe: Not reported
Spill and Overfill: Not reported
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Not reported
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Not reported
Corrosion Protection Tank Date: Not reported
Corrosion Protection Piping Date: Not reported
Spill Overfill Date: Not reported
Piping System Type Code: Not reported
Piping System Type Description: Not reported
Comment: Not reported

Tank ID: 5
Tank ID Number: Not reported
Tank Capacity: 4000
Status: Permanent Closed
Date installed: 1971-10-05 00:00:00
Date removed: 1990-08-31 00:00:00
Tank Product: Gasoline, Gasoline Mixture
Product Type: NON
Tank Material: Steel
Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: Not reported
Date Last Certified: Not reported
Begin Certified Number: Not reported
End Certified Number: Not reported
Interior Protection: Unknown
Exterior Protection: Unknown
Piping material: Steel
Certify Type: Not reported
Leak Detection Type: Not reported
Leak Detection Piping 1: Not reported
Corrosn Protec Tank: Not reported
Corrosn Protec Pipe: Not reported
Spill and Overfill: Not reported
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Not reported
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ELMER'S AUTO SERVICE (Continued)

U003144651

Overfill: Not reported
Corrosion Protection Tank Date: Not reported
Corrosion Protection Piping Date: Not reported
Spill Overfill Date: Not reported
Piping System Type Code: Not reported
Piping System Type Description: Not reported
Comment: Not reported

Tank ID: 6
Tank ID Number: Not reported
Tank Capacity: 4000
Status: Permanent Closed
Date installed: 1971-10-05 00:00:00
Date removed: 1990-08-31 00:00:00
Tank Product: Diesel, Diesel Mixture
Product Type: NON
Tank Material: Steel
Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: Not reported
Date Last Certified: Not reported
Begin Certified Number: Not reported
End Certified Number: Not reported
Interior Protection: Unknown
Exterior Protection: Unknown
Piping material: Steel
Certify Type: Not reported
Leak Detection Type: Not reported
Leak Detection Piping 1: Not reported
Corrosn Protec Tank: Not reported
Corrosn Protec Pipe: Not reported
Spill and Overfill: Not reported
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Not reported
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Not reported
Corrosion Protection Tank Date: Not reported
Corrosion Protection Piping Date: Not reported
Spill Overfill Date: Not reported
Piping System Type Code: Not reported
Piping System Type Description: Not reported
Comment: Not reported

Tank ID: 7
Tank ID Number: Not reported
Tank Capacity: 500
Status: Permanent Closed
Date installed: 1951-05-15 00:00:00
Date removed: 1990-08-31 00:00:00
Tank Product: Oil, New/Used/Mixture
Product Type: NON

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ELMER'S AUTO SERVICE (Continued)

U003144651

Tank Material: Steel
Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: Not reported
Date Last Certified: Not reported
Begin Certified Number: Not reported
End Certified Number: Not reported
Interior Protection: Unknown
Exterior Protection: Unknown
Piping material: Unknown
Certify Type: Not reported
Leak Detection Type: Not reported
Leak Detection Piping 1: Not reported
Corrosn Protec Tank: Not reported
Corrosn Protec Pipe: Not reported
Spill and Overfill: Not reported
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Not reported
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Not reported
Corrosion Protection Tank Date: Not reported
Corrosion Protection Piping Date: Not reported
Spill Overfill Date: Not reported
Piping System Type Code: Not reported
Piping System Type Description: Not reported
Comment: Not reported

B6
WSW
< 1/8
0.005 mi.
26 ft.

PUCKETTS TEXACO SERVICE
1100 W TRADE
CHARLOTTE, NC
Site 3 of 3 in cluster B

EDR Historical Auto Stations 1009030744
N/A

Relative:
Lower

EDR Historical Auto Stations:

Actual:
656 ft.

Name: PUCKETT ROBT L
Year: 1937
Type: GASOLINE AND OIL SERVICE STATIONS
Name: PUCKETT ROBT L
Year: 1937
Type: GASOLINE AND OIL SERVICE STATIONS
Name: LOWERY'S TEXACO SERVICE
Year: 1944
Type: GASOLINE AND OIL SERVICE STATIONS
Name: LIPE AND LOWERY SERVICE STATION
Year: 1944
Type: GASOLINE AND OIL SERVICE STATIONS
Name: LOWERY'S TEXACO SERVICE
Year: 1944
Type: GASOLINE AND OIL SERVICE STATIONS

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

PUCKETTS TEXACO SERVICE (Continued)

1009030744

Name: LIPE AND LOWERY SERVICE STATION
 Year: 1944
 Type: GASOLINE AND OIL SERVICE STATIONS

Name: LOWERY'S TEXACO SERVICE
 Year: 1949
 Type: GASOLINE AND OIL SERVICE STATIONS

Name: LOWERY'S TEXACO SERVICE
 Year: 1949
 Type: GASOLINE AND OIL SERVICE STATIONS

Name: LOWERY'S TEXACO SERVICE
 Year: 1953
 Type: GASOLINE STATIONS

Name: LOWERY'S TEXACO SERVICE
 Year: 1953
 Type: GASOLINE STATIONS

Name: PUCKETTS TEXACO SERVICE
 Year: 1959
 Type: GASOLINE STATIONS

Name: PUCKETTS TEXACO SERVICE
 Year: 1959
 Type: GASOLINE STATIONS

Name: PUCKETTS TEXACO SERVICE
 Year: 1964
 Type: GASOLINE STATIONS

Name: PUCKETTS TEXACO SERVICE
 Year: 1964
 Type: GASOLINE STATIONS

**A7
 NE
 < 1/8
 0.011 mi.
 60 ft.**

**THE BOULEVARD COMPANY 1
 215 NORTH IRWIN AVENUE
 CHARLOTTE, NC 28202**

**LUST S108664825
 N/A**

Site 4 of 4 in cluster A

**Relative:
 Higher**

LUST:
 Facility ID: Not reported
 UST Number: MO-7700
 Incident Number: 36332
 Contamination Type: Soil
 Source Type: Leak-underground
 Product Type: PETROLEUM
 Date Reported: 2007-06-18 00:00:00
 Date Occur: 2007-06-27 00:00:00
 Cleanup: 2007-06-13 00:00:00
 Closure Request: Not reported
 Close Out: 2007-08-09 00:00:00
 Level Of Soil Cleanup Achieved: Soil to Groundwater
 Tank Regulated Status: Non Regulated
 # Of Supply Wells: 0
 Commercial/NonCommercial UST Site: NON COMMERCIAL

**Actual:
 703 ft.**

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

THE BOULEVARD COMPANY 1 (Continued)

S108664825

Risk Classification: L
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: Not reported
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Residential
MTBE: No
MTBE1: Unknown
Flag: Yes
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in Archives
RBCA GW: Not reported
PETOPT: 4
RPL: True
CD Num: 357
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0
Error Code: N
Valid: False
Lat/Long: 35 14 10.74 80 51 4.56
Lat/Long Decimal: 35.236338000000003 80.851275000000001
Testlat: Not reported
Regional Officer Project Mgr: BLM
Region: Mooresville
Company: THE BOULEVARD COMPANY
Contact Person: PATRICK WOODS
Telephone: 7043488941
RP Address: 715 NORTH CHURCH ST., STE 110
RP City,St,Zip: CHARLOTTE, NC 28202
RP County: Not reported
Comments: HEATING OIL TANK STRUCK DURING GRADING ACTIVITIES CAUSING A RELEASE.
5 Min Quad: Not reported

PIRF:

Facility Id: 36332
Date Occurred: 2007-06-27 00:00:00
Date Reported: 2007-06-18 00:00:00
Description Of Incident: Not reported
Owner/Operator: Not reported
Ownership: 4
Operation Type: Not reported
Type: 4
Location: 7
Site Priority: Not reported
Priority Update: Not reported
Wells Affected Y/N: Not reported
Samples Include: Not reported
7#5 Minute Quad: Y
5 Minute Quad: Not reported
Pirf/Min Soil: Not reported
Release Code: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

THE BOULEVARD COMPANY 1 (Continued)

S108664825

Source Code: Not reported
Err Type: 9
Cause: Not reported
Source: Not reported
Ust Number: P

Last Modified: Not reported
Incident Phase: Closed Out
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Signed: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

8
SE
< 1/8
0.024 mi.
128 ft.

SEGREST CLEANERS LAUNDERERS FURRIERS INC
915 W 5TH ST
CHARLOTTE, NC

EDR Historical Cleaners **1009151205**
N/A

Relative:
Higher

EDR Historical Cleaners:

Name: SEGREST CLENERS LAUNDERERS
Year: 1969
Type: CLEANERS AND DYERS

Actual:
716 ft.

Name: SEGREST CLEANERS LAUNDERERS
Year: 1974
Type: CLEANERS AND DYERS

Name: SEGREST CLEANERS LAUNDERERS FURRIERS INC
Year: 1984
Type: CLEANERS AND DYERS

C9
SE
< 1/8
0.037 mi.
195 ft.

A A A SUNOCO SERVICE
933 W TRADE
CHARLOTTE, NC

EDR Historical Auto Stations **1009032796**
N/A

Site 1 of 6 in cluster C

Relative:
Higher

EDR Historical Auto Stations:

Name: FLOWERS SUNOCO SERVICE
Year: 1959
Type: GASOLINE STATIONS

Actual:
699 ft.

Name: FLOWERS SUNOCO SERVICE
Year: 1959
Type: GASOLINE STATIONS

Name: A A A SUNOCO SERVICE
Year: 1964
Type: GASOLINE STATIONS

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

A A A SUNOCO SERVICE (Continued)

1009032796

Name: A A A SUNOCO SERVICE
 Year: 1964
 Type: GASOLINE STATIONS

C10
SE
 < 1/8
 0.043 mi.
 229 ft.

SEGREST CLEANERS
924 W TRADE
CHARLOTTE, NC
 Site 2 of 6 in cluster C

EDR Historical Cleaners 1009152683
 N/A

Relative:
Higher

EDR Historical Cleaners:
 Name: SEGREST CLEANERS
 Year: 1953
 Type: CLEANERS AND DYERS

Actual:
 701 ft.

C11
SE
 < 1/8
 0.055 mi.
 289 ft.

WRIGHTS ONE HOUR CLEANERS (EDGAR A WRIGHT)
912 W TRADE ST
CHARLOTTE, NC
 Site 3 of 6 in cluster C

EDR Historical Cleaners 1009152234
 N/A

Relative:
Higher

EDR Historical Cleaners:
 Name: WRIGHTS ONE HOUR CLEANERS (EDGAR A WRIGHT)
 Year: 1994
 Type: CLEANERS

Actual:
 700 ft.

C12
SE
 < 1/8
 0.067 mi.
 352 ft.

R S A INC
900 WEST TRADE STREET
CHARLOTTE, NC 28202
 Site 4 of 6 in cluster C

UST U003135649
 N/A

Relative:
Higher

UST:
 Facility ID: 0-013953
 Region: 3
 Facility Telephone: (704) 377-2468
 Last Update: 1994-10-18 00:00:00
 Owner Name: B & K INVESTMENT CO
 Owner Address: 900 WEST TRADE STREET
 Owner City,St,Zip: CHARLOTTE, NC 28202
 Owner Phone: (704) 377-2468
 Latitude: 0
 Latitude 1: Not reported
 Longitude: 0
 Longitude 1: Not reported
 GPS String Confirmed: No
 Initials of Individual Confirming GPS: Not reported

Actual:
 699 ft.

Tank ID: 1
 Tank ID Number: Not reported
 Tank Capacity: 4000
Status: Permanent Closed
 Date installed: 1976-01-04 00:00:00
 Date removed: 1992-02-28 00:00:00
 Tank Product: Gasoline, Gasoline Mixture

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

R S A INC (Continued)

U003135649

Product Type: NON
Tank Material: Steel
Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: Not reported
Date Last Certified: Not reported
Begin Certified Number: Not reported
End Certified Number: Not reported
Interior Protection: None
Exterior Protection: Paint
Piping material: Steel
Certify Type: Not reported
Leak Detection Type: Not reported
Leak Detection Piping 1: Not reported
Corrosn Protec Tank: Not reported
Corrosn Protec Pipe: Not reported
Spill and Overfill: Not reported
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Not reported
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Not reported
Corrosion Protection Tank Date: Not reported
Corrosion Protection Piping Date: Not reported
Spill Overfill Date: Not reported
Piping System Type Code: Not reported
Piping System Type Description: Not reported
Comment: Not reported

Tank ID: 2
Tank ID Number: Not reported
Tank Capacity: 4000
Status: Permanent Closed
Date installed: 1976-01-04 00:00:00
Date removed: 1992-02-28 00:00:00
Tank Product: Gasoline, Gasoline Mixture
Product Type: NON
Tank Material: Steel
Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: Not reported
Date Last Certified: Not reported
Begin Certified Number: Not reported
End Certified Number: Not reported
Interior Protection: None
Exterior Protection: Paint
Piping material: Steel
Certify Type: Not reported
Leak Detection Type: Not reported
Leak Detection Piping 1: Not reported
Corrosn Protec Tank: Not reported
Corrosn Protec Pipe: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

R S A INC (Continued)

U003135649

Spill and Overfill: Not reported
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Not reported
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Not reported
Corrosion Protection Tank Date: Not reported
Corrosion Protection Piping Date: Not reported
Spill Overfill Date: Not reported
Piping System Type Code: Not reported
Piping System Type Description: Not reported
Comment: Not reported

Tank ID: 3
Tank ID Number: Not reported
Tank Capacity: 10000
Status: Permanent Closed
Date installed: 1981-03-31 00:00:00
Date removed: 1992-02-28 00:00:00
Tank Product: Gasoline, Gasoline Mixture
Product Type: NON
Tank Material: Steel
Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: Not reported
Date Last Certified: Not reported
Begin Certified Number: Not reported
End Certified Number: Not reported
Interior Protection: None
Exterior Protection: Paint
Piping material: Steel
Certify Type: Not reported
Leak Detection Type: Not reported
Leak Detection Piping 1: Not reported
Corrosn Protec Tank: Not reported
Corrosn Protec Pipe: Not reported
Spill and Overfill: Not reported
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Not reported
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Not reported
Corrosion Protection Tank Date: Not reported
Corrosion Protection Piping Date: Not reported
Spill Overfill Date: Not reported
Piping System Type Code: Not reported
Piping System Type Description: Not reported
Comment: Not reported

Tank ID: 4

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

R S A INC (Continued)

U003135649

Tank ID Number: Not reported
Tank Capacity: 10000
Status: Permanent Closed
Date installed: 1981-03-31 00:00:00
Date removed: 1992-02-28 00:00:00
Tank Product: Gasoline, Gasoline Mixture
Product Type: NON
Tank Material: Steel
Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: Not reported
Date Last Certified: Not reported
Begin Certified Number: Not reported
End Certified Number: Not reported
Interior Protection: None
Exterior Protection: Paint
Piping material: Steel
Certify Type: Not reported
Leak Detection Type: Not reported
Leak Detection Piping 1: Not reported
Corrosn Protec Tank: Not reported
Corrosn Protec Pipe: Not reported
Spill and Overfill: Not reported
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Not reported
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Not reported
Corrosion Protection Tank Date: Not reported
Corrosion Protection Piping Date: Not reported
Spill Overfill Date: Not reported
Piping System Type Code: Not reported
Piping System Type Description: Not reported
Comment: Not reported

Tank ID: 5
Tank ID Number: Not reported
Tank Capacity: 10000
Status: Permanent Closed
Date installed: 1976-01-04 00:00:00
Date removed: 1986-01-12 00:00:00
Tank Product: Gasoline, Gasoline Mixture
Product Type: NON
Tank Material: Steel
Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: Not reported
Date Last Certified: Not reported
Begin Certified Number: Not reported
End Certified Number: Not reported
Interior Protection: None
Exterior Protection: Paint

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

R S A INC (Continued)

U003135649

Piping material: Steel
 Certify Type: Not reported
 Leak Detection Type: Not reported
 Leak Detection Piping 1: Not reported
 Corrosn Protec Tank: Not reported
 Corrosn Protec Pipe: Not reported
 Spill and Overfill: Not reported
 Surface Water: Not reported
 Water Supply Well: Not reported
 Leak Detection Piping 2: Not reported
 Leak Detection Type 2: Not reported
 Corrosion Protection Tank1: Not reported
 Corrosion Piping: Not reported
 Overfill: Not reported
 Corrosion Protection Tank Date: Not reported
 Corrosion Protection Piping Date: Not reported
 Spill Overfill Date: Not reported
 Piping System Type Code: Not reported
 Piping System Type Description: Not reported
 Comment: Not reported

**C13
SE
< 1/8
0.067 mi.
352 ft.**

**RSA (B & K INVESTMENTS)
900 WEST TRADE STREET
CHARLOTTE, NC
Site 5 of 6 in cluster C**

**IMD S101572585
LUST N/A**

**Relative:
Higher**

IMD:
 Region: MOR
 Facility ID: 8793
 Date Occurred: 3/6/1992
 Submit Date: 7/30/1992
 GW Contam: No Groundwater Contamination detected
 Soil Contam: Yes
 Incident Desc: CONTAMINATION FROM UST CLOSURE
 Operator: ARVIND DESAI
 Contact Phone: Not reported
 Owner Company: RSA, INC.
 Operator Address: 900 WEST TRADE STREET
 Operator City: CHARLOTTE
 Oper City, St, Zip: CHARLOTTE, NC 28202
 Ownership: Private
 Operation: Commercial
 Material: GAS
 Qty Lost 1: Not reported
 Qty Recovered 1: Not reported
 Source: Leak-underground
 Type: Gasoline/diesel
 Location: Facility
 Setting: Urban
 Risk Site: L
 Site Priority: E
 Priority Code: L
 Priority Update: 5/30/1998
 Dem Contact: AJS
 Wells Affected: Not reported
 Num Affected: 0
 Wells Contam: Not reported

**Actual:
699 ft.**

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

RSA (B & K INVESTMENTS) (Continued)

S101572585

Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: 35.2337
Longitude: -80.8514
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: NOD
Agency: DWM
Facility ID: 8793
Last Modified: Not reported
Incident Phase: Follow Up
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LUST:

Facility ID: 0-013953
UST Number: MO-3533
Incident Number: 8793
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 1992-03-27 00:00:00
Date Occur: 1992-03-06 00:00:00
Cleanup: 1992-03-06 00:00:00
Closure Request: Not reported
Close Out: Not reported
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: L
Risk Class Based On Review: U
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: E
Phase Of LSA Req: 1
Site Risk Reason: Not reported
Land Use: Industrial/commercial
MTBE: Not reported
MTBE1: Unknown
Flag: Yes
Flag1: No
LUR Filed: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

RSA (B & K INVESTMENTS) (Continued)

S101572585

Release Detection: 0
Current Status: File Located in House
RBCA GW: Not reported
PETOPT: 3
RPL: False
CD Num: 0
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0
Error Code: Not reported
Valid: True
Lat/Long: 35 14 .66 80 51 .18
Lat/Long Decimal: 35.23351999999999 80.850055999999995
Testlat: Not reported
Regional Officer Project Mgr: DPB
Region: Mooresville
Company: RSA, INC.
Contact Person: ARVIND DESAI
Telephone: Not reported
RP Address: 900 WEST TRADE STREET
RP City,St,Zip: CHARLOTTE, NC 28202
RP County: ME
Comments: NHR/AJS/2/1/2005. NO PUMP ISLAND AND LINE SAMPLES. ALSO NO INFO ON HOW MUCH SOIL REMOVED AND WHERE DISPOSED OF.
5 Min Quad: Not reported

PIRF:

Facility Id: 8793
Date Occurred: 1992-02-28 00:00:00
Date Reported: 1992-07-30 00:00:00
Description Of Incident: CONTAMINATION FROM UST CLOSURE
Owner/Operator: B & K INVESTMENT COMPANY
Ownership: 4
Operation Type: 6
Type: 3
Location: 1
Site Priority: E
Priority Update: 1998-05-30 00:00:00
Wells Affected Y/N: Not reported
Samples Include: 0
7#5 Minute Quad: Not reported
5 Minute Quad: Not reported
Pirf/Min Soil: Not reported
Release Code: Not reported
Source Code: Min_Soil
Err Type: Not reported
Cause: Not reported
Source: Not reported
Ust Number: Not reported

Last Modified: Not reported
Incident Phase: Follow Up
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

RSA (B & K INVESTMENTS) (Continued)

S101572585

SOC Signed: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

**D14
NE
< 1/8
0.068 mi.
358 ft.**

**THE BOULEVARD COMPANY 2
1013 WEST 6TH STREET
CHARLOTTE, NC 28202**

**LUST S108664854
N/A**

Site 1 of 2 in cluster D

**Relative:
Lower**

LUST:

**Actual:
686 ft.**

Facility ID: Not reported
UST Number: MO-7701
Incident Number: 36333
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 2007-06-26 00:00:00
Date Occur: 2007-07-02 00:00:00
Cleanup: 2007-06-20 00:00:00
Closure Request: Not reported
Close Out: 2007-08-09 00:00:00
Level Of Soil Cleanup Achieved: Soil to Groundwater
Tank Regulated Status: Non Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: NON COMMERCIAL
Risk Classification: L
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: Not reported
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Residential
MTBE: No
MTBE1: Unknown
Flag: Yes
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in Archives
RBCA GW: Not reported
PETOPT: 4
RPL: True
CD Num: 357
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0
Error Code: N
Valid: False
Lat/Long: 35 14 12.96 80 51 3.84
Lat/Long Decimal: 35.236949000000003 80.851078999999999
Testlat: Not reported
Regional Officer Project Mgr: BLM

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

THE BOULEVARD COMPANY 2 (Continued)

S108664854

Region: Mooresville
Company: BOULEVARD COMPANY
Contact Person: PATRICK WOODS
Telephone: 7043488941
RP Address: 715 NORTH CHURCH ST. STE 110
RP City,St,Zip: CHARLOTTE, NC 28202
RP County: Not reported
Comments: 40 TONS OF IMPACTED SOIL REMOVED.
5 Min Quad: Not reported

PIRF:

Facility Id: 36333
Date Occurred: 2007-07-02 00:00:00
Date Reported: 2007-06-26 00:00:00
Description Of Incident: Not reported
Owner/Operator: Not reported
Ownership: 4
Operation Type: Not reported
Type: 4
Location: 7
Site Priority: Not reported
Priority Update: Not reported
Wells Affected Y/N: Not reported
Samples Include: Not reported
7#5 Minute Quad: Y
5 Minute Quad: Not reported
Pirf/Min Soil: Not reported
Release Code: Not reported
Source Code: Not reported
Err Type: 2
Cause: Not reported
Source: Not reported
Ust Number: P

Last Modified: Not reported
Incident Phase: Closed Out
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Signed: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

C15
SE
< 1/8
0.068 mi.
359 ft.

**THE GATEWAY CENTER
901 WEST TRADE STREET
CHARLOTTE, NC 28202**

Site 6 of 6 in cluster C

**UST U003138373
N/A**

**Relative:
Higher**

UST:
Facility ID: 0-035007
Region: 3
Facility Telephone: (704) 887-1272
Last Update: 2010-01-08 00:00:00

**Actual:
699 ft.**

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

THE GATEWAY CENTER (Continued)

U003138373

Owner Name: FIRST STATES INVESTORS 5200 LLC
Owner Address: 610 OLD YORK ROAD STE 300
Owner City,St,Zip: JENKINTOWN, PA 19046
Owner Phone: (215) 887-2280
Latitude: 35.23459
Latitude 1: 35 14 04.52
Longitude: 80.8524
Longitude 1: 80 51 08.66
GPS String Confirmed: Yes
Initials of Individual Confirming GPS: MAB

Tank ID: 1
Tank ID Number: Not reported
Tank Capacity: 2500
Status: Currently In Use
Date installed: 1988-08-31 00:00:00
Date removed: Not reported
Tank Product: Diesel, Diesel Mixture
Product Type: GEN
Tank Material: Steel
Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: 2011023020
Date Last Certified: 2010-12-30 00:00:00
Begin Certified Number: 2011-01-01 00:00:00
End Certified Number: Not reported
Interior Protection: None
Exterior Protection: Cathodic Protection
Piping material: Other
Certify Type: Not reported
Leak Detection Type: Not reported
Leak Detection Piping 1: Not reported
Corrosn Protec Tank: Sacrificial anode
Corrosn Protec Pipe: Dielectric coating
Spill and Overfill: Ball float valves
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Not reported
Corrosion Protection Tank1: D
Corrosion Piping: Not reported
Overfill: Catchment basins
Corrosion Protection Tank Date: 1988-08-31 00:00:00
Corrosion Protection Piping Date: 1988-08-31 00:00:00
Spill Overfill Date: 1998-12-31 00:00:00
Piping System Type Code: S
Piping System Type Description: Not reported
Comment: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

D16
NE
< 1/8
0.082 mi.
433 ft.

IRWIN AVENUE
329 NORTH IRWIN AVENUE
CHARLOTTE, NC 28202

Site 2 of 2 in cluster D

UST U003137396
N/A

Relative:
Lower

UST:

Facility ID: 0-021177
Region: 3
Facility Telephone: (704) 394-7371
Last Update: 1994-01-04 00:00:00
Owner Name: CHARLOTTE-MECK SCHOOL MAINT DEPT
Owner Address: 3301 STAFFORD DR
Owner City,St,Zip: CHARLOTTE, NC 28208
Owner Phone: (704) 343-6050
Latitude: 0
Latitude 1: Not reported
Longitude: 0
Longitude 1: Not reported
GPS String Confirmed: No
Initials of Individual Confirming GPS: Not reported

Actual:
685 ft.

Tank ID: 1
Tank ID Number: Not reported
Tank Capacity: 10000
Status: Permanent Closed
Date installed: 1971-11-24 00:00:00
Date removed: 1993-03-12 00:00:00
Tank Product: Fuel Oil
Product Type: HEA
Tank Material: Steel
Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: Not reported
Date Last Certified: Not reported
Begin Certified Number: Not reported
End Certified Number: Not reported
Interior Protection: Unknown
Exterior Protection: Paint
Piping material: Steel
Certify Type: Not reported
Leak Detection Type: Not reported
Leak Detection Piping 1: Not reported
Corrosn Protec Tank: Not reported
Corrosn Protec Pipe: Not reported
Spill and Overfill: Not reported
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Not reported
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Not reported
Corrosion Protection Tank Date: Not reported
Corrosion Protection Piping Date: Not reported
Spill Overfill Date: Not reported
Piping System Type Code: Not reported
Piping System Type Description: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

IRWIN AVENUE (Continued)

U003137396

Comment: Not reported

E17
SE
< 1/8
0.086 mi.
454 ft.

FIFTH STREET PURE OIL SERVICE
834 W 5TH
CHARLOTTE, NC

EDR Historical Auto Stations **1009031238**
N/A

Site 1 of 2 in cluster E

Relative:
Higher

EDR Historical Auto Stations:

Name: FIFTH STREET PURE OIL SERVICE
Year: 1964

Actual:
708 ft.

Type: GASOLINE STATIONS

Name: FIFTH STREET PURE OIL SERVICE
Year: 1964
Type: GASOLINE STATIONS

E18
SE
< 1/8
0.087 mi.
459 ft.

FIFTH STREET PURE OIL SERVICE
834 W 5TH ST
CHARLOTTE, NC

EDR Historical Auto Stations **1009032888**
N/A

Site 2 of 2 in cluster E

Relative:
Higher

EDR Historical Auto Stations:

Name: FIFTH STREET PURE OIL SERVICE
Year: 1969

Actual:
708 ft.

Type: GASOLINE STATIONS

Name: FIFTH STREET PURE OIL SERVICE
Year: 1969
Type: GASOLINE STATIONS

F19
SE
1/8-1/4
0.128 mi.
678 ft.

WRIGHTS LAUNDRY AND CLEANING SERVICE
831 W TRADE
CHARLOTTE, NC

EDR Historical Cleaners **1009150459**
N/A

Site 1 of 11 in cluster F

Relative:
Higher

EDR Historical Cleaners:

Name: QUEEN CITY CLEANERS
Year: 1937

Actual:
720 ft.

Type: CLOTHES PRESSERS AND CLEANERS

Name: WRIGHTS LAUNDRY AND CLEANING SERVICE
Year: 1944
Type: LAUNDRIES STEAM

MAP FINDINGS

Map ID
Direction
Distance
Elevation

Site

Database(s)

EDR ID Number
EPA ID Number

F20 **SPRINGS DRY CLEANERS** **EDR Historical Cleaners** **1009152684**
SE **825 W TRADE** **N/A**
1/8-1/4 **CHARLOTTE, NC**
0.133 mi.
704 ft. **Site 2 of 11 in cluster F**

Relative: EDR Historical Cleaners:
Higher Name: STANDARD CLEANERS
 Year: 1949
Actual: Type: CLEANERS AND DYERS
720 ft.

 Name: STANDARD CLEANERS
 Year: 1953
 Type: CLEANERS AND DYERS

 Name: SPRINGS DRY CLEANERS
 Year: 1959
 Type: CLOTHES PRESSERS AND CLEANERS

 Name: SPRINGS DRY CLEANERS
 Year: 1964
 Type: CLEANERS AND DYERS

F21 **WRIGHTS ONE HOUR CLEANING CO** **EDR Historical Cleaners** **1009151884**
SE **801 W TRADE ST** **N/A**
1/8-1/4 **CHARLOTTE, NC**
0.151 mi.
798 ft. **Site 3 of 11 in cluster F**

Relative: EDR Historical Cleaners:
Higher Name: ONE HOUR MARTINIZING
 Year: 1969
Actual: Type: CLEANERS AND DYERS
719 ft.

 Name: ONE HOUR MARTINIZING
 Year: 1974
 Type: CLEANERS AND DYERS

 Name: WRIGHTS ONE HOUR CLEANER
 Year: 1979
 Type: CLEANERS AND DYERS

 Name: WRIGHTS ONE HOUR CLEANING CO
 Year: 1984
 Type: CLEANERS AND DYERS

F22 **WEST TRADE EXXON** **EDR Historical Auto Stations** **1009032848**
SE **800 W TRADE ST** **N/A**
1/8-1/4 **CHARLOTTE, NC**
0.151 mi.
799 ft. **Site 4 of 11 in cluster F**

Relative: EDR Historical Auto Stations:
Higher Name: WILLIAMS ESSO SERVICE
 Year: 1969
Actual: Type: GASOLINE STATIONS
715 ft.

 Name: WILLIAMS ESSO SERVICE

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

WEST TRADE EXXON (Continued)

1009032848

Year: 1969
 Type: GASOLINE STATIONS

Name: WEST TRADE EXXON
 Year: 1974
 Type: GASOLINE STATIONS

Name: WEST TRADE EXXON
 Year: 1974
 Type: GASOLINE STATIONS

**F23
 SE
 1/8-1/4
 0.151 mi.
 799 ft.**

**GATEWAY VILLAGE-FORMER GAS
 800 WEST TRADE STREET
 CHARLOTTE, NC**

**IMD S107672008
 LUST N/A**

Site 5 of 11 in cluster F

**Relative:
 Higher**

IMD:

**Actual:
 715 ft.**

Region: Not reported
 Facility ID: 36004
 Date Occurred: Not reported
 Submit Date: 6/15/1999
 GW Contam: Yes, Groundwater Contamination has been detected
 Soil Contam: No
 Incident Desc: Not reported
 Operator: JERRI TUCK
 Contact Phone: 7043337755
 Owner Company: cousins properties inc.
 Operator Address: ONE INDEPENDENCE CTR, STE 1700
 Operator City: CHARLOTTE
 Oper City,St,Zip: CHARLOTTE, NC
 Ownership: Unknown
 Operation: Commercial
 Material: Not reported
 Qty Lost 1: Not reported
 Qty Recovered 1: Not reported
 Source: Leak-underground
 Type: Gasoline/diesel
 Location: Facility
 Setting: Not reported
 Risk Site: L
 Site Priority: Not reported
 Priority Code: Not reported
 Priority Update: Not reported
 Dem Contact: AJS
 Wells Affected: No
 Num Affected: Not reported
 Wells Contam: Not reported
 Sampled By: Y
 Samples Include: Not reported
 7.5 Min Quad: Not reported
 5 Min Quad: Not reported
 Latitude: Not reported
 Longitude: Not reported
 Latitude Number: Not reported
 Longitude Number: Not reported
 Latitude Decimal: Not reported
 Longitude Decimal: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GATEWAY VILLAGE-FORMER GAS (Continued)

S107672008

GPS: EST
Agency: DWM
Facility ID: Not reported
Last Modified: Not reported
Incident Phase: Not reported
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LUST:

Facility ID: Not reported
UST Number: MO-7347
Incident Number: 36004
Contamination Type: Groundwater/Both
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 1999-06-15 00:00:00
Date Occur: Not reported
Cleanup: 1998-05-07 00:00:00
Closure Request: Not reported
Close Out: Not reported
Level Of Soil Cleanup Achieved: Industrial/Commercial
Tank Regulated Status: Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: L
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: Not reported
Phase Of LSA Req: 2
Site Risk Reason: Not reported
Land Use: Not reported
MTBE: No
MTBE1: Unknown
Flag: No
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in House
RBCA GW: Cleanups to alternate standards
PETOPT: 3
RPL: True
CD Num: 0
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GATEWAY VILLAGE-FORMER GAS (Continued)

S107672008

Error Code: N
Valid: False
Lat/Long: 35 14 2.28 80 51 5.88
Lat/Long Decimal: 35.233969999999999 80.851640000000003
Testlat: Not reported
Regional Officer Project Mgr: DPB
Region: Mooresville
Company: cousins properties inc.
Contact Person: JERRI TUCK
Telephone: 7043337755
RP Address: ONE INDEPENDENCE CTR, STE 1700
RP City,St,Zip: CHARLOTTE, NC
RP County: Not reported
Comments: 3-6000-GALLON USTS. MOST SOIL REMOVED EXCEPT A SMALL AMOUNT EXCEEDING RESIDENTIAL STANDARDS
5 Min Quad: Not reported

PIRF:

Facility Id: 36004
Date Occurred: 1998-07-02 00:00:00
Date Reported: 1999-06-15 00:00:00
Description Of Incident: Not reported
Owner/Operator: Not reported
Ownership: 3
Operation Type: 6
Type: 3
Location: 1
Site Priority: Not reported
Priority Update: Not reported
Wells Affected Y/N: N
Samples Include: Not reported
7#5 Minute Quad: Y
5 Minute Quad: Not reported
Pirf/Min Soil: Not reported
Release Code: Not reported
Source Code: Not reported
Err Type: 2
Cause: Not reported
Source: Not reported
Ust Number: P

Last Modified: Not reported
Incident Phase: Not reported
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Signed: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

F24
SE
1/8-1/4
0.151 mi.
799 ft.

CHARLOTTE GATEWAY VILLAGE. LL
800 WEST TRADE ST (BPD 150-GWV)
CHARLOTTE, NC 28246

UST **U003698303**
 N/A

Site 6 of 11 in cluster F

Relative:
Higher

UST:

Facility ID: 0-036036
 Region: 3
 Facility Telephone: (704) 683-0621
 Last Update: 2008-01-15 00:00:00
 Owner Name: CHARLOTTE GATEWAY VILLAGE LLC
 Owner Address: 800 W TRADE ST STE 100
 Owner City,St,Zip: CHARLOTTE, NC 28202
 Owner Phone: (704) 683-1000
 Latitude: 0
 Latitude 1: Not reported
 Longitude: 0
 Longitude 1: Not reported
 GPS String Confirmed: No
 Initials of Individual Confirming GPS: Not reported

Actual:
715 ft.

Tank ID: 1
 Tank ID Number: Not reported
 Tank Capacity: 10000
Status: Currently In Use
 Date installed: 1999-08-09 00:00:00
 Date removed: Not reported
 Tank Product: Diesel, Diesel Mixture
 Product Type: GEN
 Tank Material: 7
 Compartment Tank: No
 Main Tank: No
 Tank Last Used Date: Not reported
 Tank Certified Number: 2010053780
 Date Last Certified: 2010-06-14 00:00:00
 Begin Certified Number: 2010-01-07 00:00:00
 End Certified Number: Not reported
 Interior Protection: Double Wall
 Exterior Protection: FRP
 Piping material: 10
 Certify Type: Installer certified by tank and piping manufacturers
 Leak Detection Type: Automatic tank guaging
 Leak Detection Piping 1: Not reported
 Corrosn Protec Tank: FRP tank/piping
 Corrosn Protec Pipe: Flexible Piping
 Spill and Overfill: Ball float valves
 Surface Water: Not reported
 Water Supply Well: Not reported
 Leak Detection Piping 2: Not reported
 Leak Detection Type 2: Interstitial monitoring/double-walled tank and/or piping
 Corrosion Protection Tank1: I
 Corrosion Piping: Not reported
 Overfill: Catchment basins
 Corrosion Protection Tank Date: 1999-08-09 00:00:00
 Corrosion Protection Piping Date: 1999-08-09 00:00:00
 Spill Overfill Date: 1999-08-09 00:00:00
 Piping System Type Code: P
 Piping System Type Description: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CHARLOTTE GATEWAY VILLAGE. LL (Continued)

U003698303

Comment: Not reported

Tank ID: 2
Tank ID Number: Not reported
Tank Capacity: 10000
Status: Currently In Use
Date installed: 1999-08-09 00:00:00
Date removed: Not reported
Tank Product: Diesel, Diesel Mixture
Product Type: GEN
Tank Material: 7
Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: 2010053780
Date Last Certified: 2010-06-14 00:00:00
Begin Certified Number: 2010-01-07 00:00:00
End Certified Number: Not reported
Interior Protection: Double Wall
Exterior Protection: FRP
Piping material: 10
Certify Type: Installer certified by tank and piping manufacturers
Leak Detection Type: Automatic tank gauging
Leak Detection Piping 1: Exempt under 280.41 (B)(2)(1)- (V) (piping only)
Corrosn Protec Tank: FRP tank/piping
Corrosn Protec Pipe: Flexible Piping
Spill and Overfill: Ball float valves
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Interstitial monitoring/double-walled tank and/or piping
Corrosion Protection Tank1: I
Corrosion Piping: Not reported
Overfill: Catchment basins
Corrosion Protection Tank Date: 1999-08-09 00:00:00
Corrosion Protection Piping Date: 1999-08-09 00:00:00
Spill Overfill Date: 1999-08-09 00:00:00
Piping System Type Code: P
Piping System Type Description: Not reported
Comment: Not reported

F25
SE
1/8-1/4
0.154 mi.
813 ft.

GATEWAY VILLAGE
WEST TRADE STREET & N CEDAR
CHARLOTTE, NC

IMD S103229245
LAST N/A

Site 7 of 11 in cluster F

Relative:
Higher

IMD:

Actual:
716 ft.

Region: MOR
Facility ID: 86109
Date Occurred: 3/5/2000
Submit Date: 2/19/2002
GW Contam: Yes, Groundwater Contamination has been detected
Soil Contam: Not reported
Incident Desc: INFO FROM LAW INDICATING SOLVENTS DISCOVERED IN SOIL AND GW AT DEVELOPMENT SITE. APPARENT SEPARATE NOTIFICATION OF 50 GALLON DIESEL SPILL, WHICH WAS EXCAVATED.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GATEWAY VILLAGE (Continued)

S103229245

Operator: ,
Contact Phone: Not reported
Owner Company: Not reported
Operator Address: Not reported
Operator City: Not reported
Oper City,St,Zip: Not reported
Ownership: Not Reported
Operation: Not Reported
Material: Not reported
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Unknown
Type: Other inorganics
Location: Not reported
Setting: Not reported
Risk Site: Not reported
Site Priority: Not reported
Priority Code: E
Priority Update: Not reported
Dem Contact: AHP
Wells Affected: No
Num Affected: 0
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: Not reported
Longitude: Not reported
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: EST
Agency: DWQ
Facility ID: 86109
Last Modified: 10/23/2002
Incident Phase: Discovery
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LAST:

Facility ID: Not reported
UST Number: MO-86109
Incident Number: 86109
Contamination Type: GW
Source Type: 19
Product Type: B

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GATEWAY VILLAGE (Continued)

S103229245

Date Reported: Not reported
Date Occur: Not reported
Cleanup: Not reported
Closure Request: Not reported
Close Out: Not reported
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Not reported
Of Supply Wells: 0
Commercial/NonCommercial UST Site: Not reported
Risk Classification: U
Risk Class Based On Review: U
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: 0
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: IND
MTBE: No
MTBE1: Unknown
Flag: No
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: C
RBCA GW: Not reported
PETOPT: 3
RPL: False
CD Num: 0
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0
Error Code: Not reported
Valid: False
Lat/Long: 35 13 57.96 80 50 58.98
Lat/Long Decimal: 35.232776999999999 80.849722
Testlat: Not reported
Regional Officer Project Mgr: DPB
Region: MOR
Company: Not reported
Contact Person: Not reported
Telephone: Not reported
RP Address: Not reported
RP City,St,Zip: NC
RP County: Not reported
Comments: INFO FROM LAW INDICATING SOLVENTS DISCOVERED IN SOIL AND GW AT DEVELOPMENT SITE. APPARENT SEPARATE NOTIFICATION OF 50 GALLON DIESEL SPILL, WHICH WAS EXCAVATED.
5 Min Quad: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

F26
SE
1/8-1/4
0.154 mi.
813 ft.

WILLIAMS ESSO SERVICE
800 W TRADE'
CHARLOTTE, NC

EDR Historical Auto Stations

1009032338
N/A

Site 8 of 11 in cluster F

Relative:
Higher

EDR Historical Auto Stations:

Actual:
716 ft.

- Name: WILLIAMS SERVICE STATION
- Year: 1937
- Type: GASOLINE AND OIL SERVICE STATIONS

- Name: WILLIAMS SERVICE STATION
- Year: 1937
- Type: GASOLINE AND OIL SERVICE STATIONS

- Name: WILLIAMS ESSO SERVICE
- Year: 1944
- Type: GASOLINE AND OIL SERVICE STATIONS

- Name: WILLIAMS ESSO SERVICE
- Year: 1944
- Type: GASOLINE AND OIL SERVICE STATIONS

- Name: WILLIAMS ESSO SERVICE
- Year: 1949
- Type: GASOLINE AND OIL SERVICE STATIONS

- Name: WILLIAMS ESSO SERVICE
- Year: 1949
- Type: GASOLINE AND OIL SERVICE STATIONS

- Name: WILLIAMS ESSO SERVICE
- Year: 1953
- Type: GASOLINE STATIONS

- Name: WILLIAMS ESSO SERVICE
- Year: 1953
- Type: GASOLINE STATIONS

- Name: WILLIAMS ESSO SERVICE
- Year: 1959
- Type: GASOLINE STATIONS

- Name: WILLIAMS ESSO SERVICE
- Year: 1959
- Type: GASOLINE STATIONS

- Name: WILLIAMS ESSO SERVICE
- Year: 1964
- Type: GASOLINE STATIONS

- Name: WILLIAMS ESSO SERVICE
- Year: 1964
- Type: GASOLINE STATIONS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

F27 **PUCKETT SERVICE STATION** **EDR Historical Auto Stations** **1009032089**
SE **801 W TRADE** **N/A**
1/8-1/4 **CHARLOTTE, NC**
0.154 mi.
814 ft. **Site 9 of 11 in cluster F**

Relative: EDR Historical Auto Stations:
Higher Name: PUCKELT TEXACO
 Year: 1949
Actual: Type: GASOLINE AND OIL SERVICE STATIONS
718 ft.

 Name: PUCKELT TEXACO
 Year: 1949
 Type: GASOLINE AND OIL SERVICE STATIONS

 Name: PUCKETT SERVICE STATION
 Year: 1953
 Type: GASOLINE STATIONS

 Name: PUCKETT SERVICE STATION
 Year: 1953
 Type: GASOLINE STATIONS

F28 **ROYAL LAUNDRY (BR)** **EDR Historical Cleaners** **1009150458**
SE **801 W TRADE** **N/A**
1/8-1/4 **CHARLOTTE, NC**
0.154 mi.
814 ft. **Site 10 of 11 in cluster F**

Relative: EDR Historical Cleaners:
Higher Name: ROYAL LAUNDRY (BR)
 Year: 1944
Actual: Type: LAUNDRIES STEAM
718 ft.

F29 **MT. MORIAH PRIMITIVE BAPTIST C** **IMD** **S105120545**
SE **747 WEST TRADE STREET** **LUST** **N/A**
1/8-1/4 **CHARLOTTE, NC**
0.182 mi.
962 ft. **Site 11 of 11 in cluster F**

Relative: **IMD:**
Higher Region: MOR
 Facility ID: 23623
Actual: Date Occurred: 7/24/2001
724 ft. Submit Date: 10/11/2001
 GW Contam: No Groundwater Contamination detected
 Soil Contam: Yes
 Incident Desc: SOIL CONTAMINATION DISCOVERED DURING UST INVESTIGATION/REMOVAL
 Operator: WILLIE ROBINSON
 Contact Phone: (704)376-8806
 Owner Company: MT. MORIAH PRIMITIVE BAPTIST C
 Operator Address: 747 WEST TRADE STREET
 Operator City: CHARLOTTE
 Oper City,St,Zip: CHARLOTTE, NC 28202
 Ownership: Private
 Operation: Educational/Religious
 Material: Not reported
 Qty Lost 1: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MT. MORIAH PRIMITIVE BAPTIST C (Continued)

S105120545

Qty Recovered 1: Not reported
Source: Leak-underground
Type: Gasoline/diesel
Location: 8
Setting: Residential
Risk Site: L
Site Priority: U
Priority Code: Not reported
Priority Update: 10/15/2001
Dem Contact: ARL
Wells Affected: No
Num Affected: Not reported
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: 35.23222222
Longitude: -80.85
Latitude Number: 351356
Longitude Number: 805100
Latitude Decimal: 35.23222222222222
Longitude Decimal: 80.85
GPS: 7
Agency: DWM
Facility ID: 23623
Last Modified: 12/17/2001
Incident Phase: Closed Out
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: 12/11/2001

LUST:

Facility ID: Not reported
UST Number: MO-6237
Incident Number: 23623
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 2001-09-04 00:00:00
Date Occur: 2001-07-24 00:00:00
Cleanup: 2001-07-24 00:00:00
Closure Request: 2001-12-04 00:00:00
Close Out: 2001-12-11 00:00:00
Level Of Soil Cleanup Achieved: Soil to Groundwater
Tank Regulated Status: Non Regulated
Of Supply Wells: Not reported
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: L

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MT. MORIAH PRIMITIVE BAPTIST C (Continued)

S105120545

Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: 2001-10-02 00:00:00
Site Priority: Not reported
Phase Of LSA Req: 1
Site Risk Reason: Not reported
Land Use: Residential
MTBE: No
MTBE1: No
Flag: No
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in Archives
RBCA GW: Not reported
PETOPT: 4
RPL: False
CD Num: 79
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0
Error Code: Not reported
Valid: False
Lat/Long: 35 13 55.98 80 5 60
Lat/Long Decimal: 35.232219999999998 80.849999999999994
Testlat: Not reported
Regional Officer Project Mgr: ARL
Region: Mooresville
Company: MT. MORIAH PRIMITIVE BAPTIST C
Contact Person: WILLIE ROBINSON
Telephone: (704)376-8806
RP Address: 747 WEST TRADE STREET
RP City,St,Zip: CHARLOTTE, NC 28202
RP County: Not reported
Comments: DURING GRADING, 3 USTS DISCOVERED, AFTER REMOVAL, SAMPLING DETECTED
17 PPM TPH GRO & 27 PPM DRO
5 Min Quad: Not reported

PIRF:

Facility Id: 23623
Date Occurred: 2001-07-24 00:00:00
Date Reported: 2001-10-11 00:00:00
Description Of Incident: SOIL CONTAMINATION DISCOVERED DURING UST INVESTIGATION/REMOVAL
Owner/Operator: WILLIE ROBINSON
Ownership: 4
Operation Type: 4
Type: 5
Location: 8
Site Priority: U
Priority Update: 2001-10-15 00:00:00
Wells Affected Y/N: N
Samples Include: Not reported
7#5 Minute Quad: Not reported
5 Minute Quad: Not reported
Pirf/Min Soil: Not reported
Release Code: Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

MT. MORIAH PRIMITIVE BAPTIST C (Continued)

S105120545

Source Code:	Not reported
Err Type:	9
Cause:	Not reported
Source:	C
Ust Number:	C
Last Modified:	2001-12-17 00:00:00
Incident Phase:	Closed Out
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	2001-12-11 00:00:00

G30
SSE
 1/8-1/4
 0.183 mi.
 964 ft.

MARGIE WILLIAMS PROPERTY
209 SOUTH CEDAR STREET
CHARLOTTE, NC

IMD S104914343
LUST N/A

Site 1 of 2 in cluster G

Relative:
Higher

IMD:

Actual:
707 ft.

Region:	MOR
Facility ID:	22235
Date Occurred:	7/21/2000
Submit Date:	9/26/2000
GW Contam:	No Groundwater Contamination detected
Soil Contam:	Yes
Incident Desc:	SOIL CONTAMINATION DISCOVERED DURING UST REMOVAL
Operator:	C/O WANDA MCCONNELL
Contact Phone:	7048735552
Owner Company:	MARGIE WILLIAMS
Operator Address:	1004 EAST BROAD STREET
Operator City:	STATESVILLE
Oper City,St,Zip:	STATESVILLE, NC 28677
Ownership:	Private
Operation:	Commercial
Material:	Not reported
Qty Lost 1:	Not reported
Qty Recovered 1:	Not reported
Source:	Leak-underground
Type:	Gasoline/diesel
Location:	Facility
Setting:	Urban
Risk Site:	L
Site Priority:	Not reported
Priority Code:	Not reported
Priority Update:	9/28/2000
Dem Contact:	CBC
Wells Affected:	No
Num Affected:	Not reported
Wells Contam:	Not reported
Sampled By:	Y
Samples Include:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MARGIE WILLIAMS PROPERTY (Continued)

S104914343

7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: 35.23166666
Longitude: -80.85111111
Latitude Number: 351354
Longitude Number: 805104
Latitude Decimal: 35.231666666667
Longitude Decimal: 80.85111111111111
GPS: NOD
Agency: DWM
Facility ID: 22235
Last Modified: 2/20/2004
Incident Phase: Closed Out
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LUST:

Facility ID: Not reported
UST Number: MO-5968
Incident Number: 22235
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 2000-08-18 00:00:00
Date Occur: 2000-07-21 00:00:00
Cleanup: 2000-07-21 00:00:00
Closure Request: 2000-08-18 00:00:00
Close Out: 2004-02-20 00:00:00
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: L
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: Not reported
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Not reported
MTBE: No
MTBE1: Unknown
Flag: Yes
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in Archives

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

MARGIE WILLIAMS PROPERTY (Continued)

S104914343

RBCA GW: Not reported
 PETOPT: 3
 RPL: False
 CD Num: 212
 Reel Num: 0
 RPOW: False
 RPOP: False
 Error Flag: 0
 Error Code: Not reported
 Valid: False
 Lat/Long: 35 13 54 80 51 3.96
 Lat/Long Decimal: 35.231670000000001 80.851110000000006
 Testlat: Not reported
 Regional Officer Project Mgr: CBC
 Region: Mooresville
 Company: MARGIE WILLIAMS
 Contact Person: C/O WANDA MCCONNELL
 Telephone: 7048735552
 RP Address: 1004 EAST BROAD STREET
 RP City,St,Zip: STATESVILLE, NC 28677
 RP County: IREDELL
 Comments: One 10,000-gallon diesel and one 2,000 gallon gas UST removed.
 Closure samples indicate 9.9 ppm.
 5 Min Quad: Not reported

PIRF:

Facility Id: 22235
 Date Occurred: 2000-07-21 00:00:00
 Date Reported: 2000-09-26 00:00:00
 Description Of Incident: SOIL CONTAMINATION DISCOVERED DURING UST REMOVAL
 Owner/Operator: MARGIE S. WILLIAMS
 Ownership: 4
 Operation Type: 6
 Type: 3
 Location: 1
 Site Priority: Not reported
 Priority Update: 2000-09-28 00:00:00
 Wells Affected Y/N: N
 Samples Include: Not reported
 7#5 Minute Quad: Y
 5 Minute Quad: Not reported
 Pirf/Min Soil: Not reported
 Release Code: Not reported
 Source Code: Not reported
 Err Type: 2
 Cause: Not reported
 Source: C
 Ust Number: C

Last Modified: 2004-02-20 00:00:00
Incident Phase: Closed Out
 NOV Issued: Not reported
 NORR Issued: Not reported
 45 Day Report: Not reported
 Public Meeting Held: Not reported
 Corrective Action Planned: Not reported
 SOC Signed: Not reported
 Reclassification Report: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MARGIE WILLIAMS PROPERTY (Continued)

S104914343

RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

H31
SE
1/8-1/4
0.201 mi.
1063 ft.

S H SHELL SERVICE STATION
750 W TRADE
CHARLOTTE, NC
Site 1 of 5 in cluster H

EDR Historical Auto Stations **1009029886**
N/A

Relative:
Higher

EDR Historical Auto Stations:

Name: ALLENS SHELL SERVICE
Year: 1944
Type: GASOLINE AND OIL SERVICE STATIONS

Actual:
728 ft.

Name: ALLENS SHELL SERVICE
Year: 1944
Type: GASOLINE AND OIL SERVICE STATIONS

Name: ALLENS SHELL SERVICE
Year: 1949
Type: GASOLINE AND OIL SERVICE STATIONS

Name: ALLENS SHELL SERVICE
Year: 1949
Type: GASOLINE AND OIL SERVICE STATIONS

Name: S H SHELL SERVICE STATION
Year: 1953
Type: GASOLINE STATIONS

Name: S H SHELL SERVICE STATION
Year: 1953
Type: GASOLINE STATIONS

H32
SE
1/8-1/4
0.201 mi.
1063 ft.

ONE HOUR MARTINIZING SERVICE
750 W TRADE
CHARLOTTE, NC
Site 2 of 5 in cluster H

EDR Historical Cleaners **1009151467**
N/A

Relative:
Higher

EDR Historical Cleaners:

Name: ONE HOUR MARTINIZING SERVICE
Year: 1964

Actual:
728 ft.

Type: CLEANERS AND DYERS

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

H33 **KIKERS SERVICE STATION** **EDR Historical Auto Stations** **1009032907**
SE **740 W TRADE** **N/A**
1/8-1/4 **CHARLOTTE, NC**
0.211 mi.
1115 ft. **Site 3 of 5 in cluster H**

Relative: EDR Historical Auto Stations:
Higher Name: SPURRIERS SERVICE STATION
 Year: 1937
Actual: Type: GASOLINE AND OIL SERVICE STATIONS
731 ft.

 Name: SPURRIERS SERVICE STATION
 Year: 1937
 Type: GASOLINE AND OIL SERVICE STATIONS

 Name: KIKERS SERVICE STATION
 Year: 1949
 Type: GASOLINE AND OIL SERVICE STATIONS

 Name: KIKERS SERVICE STATION
 Year: 1949
 Type: GASOLINE AND OIL SERVICE STATIONS

G34 **SMITH METAL & IRON** **BROWNFIELDS** **S105736139**
SSE **725 W. 4TH STREET** **N/A**
1/8-1/4 **CHARLOTTE, NC**
0.221 mi.
1168 ft. **Site 2 of 2 in cluster G**

Relative: BROWNFIELDS:
Higher Project Type: FINALIZED BROWNFIELDS AGREEMENTS
 Contact Type: PD:
Actual: Contact Name: City of Charlotte
726 ft. Comments: Former site of a scrap metal yard and of a waste cell created for the temporary disposal of impacted soil removed during the construction of the adjoining Carolina Panther s practice field. The waste in the cell has been removed, and minor chlorinated solvent impacts remain in site groundwater. PD intends to redevelop the site in high density residential with additional office, entertainment, and retail potential.

H35 **ELLIOTT C L CLEANERS** **EDR Historical Cleaners** **1009151407**
SE **727 W TRADE** **N/A**
1/8-1/4 **CHARLOTTE, NC**
0.232 mi.
1226 ft. **Site 4 of 5 in cluster H**

Relative: EDR Historical Cleaners:
Higher Name: ELLIOTT CHAS L
 Year: 1937
Actual: Type: CLOTHES PRESSERS AND CLEANERS
746 ft.

 Name: ELLIOTT C L CO
 Year: 1944
 Type: CLOTHES PRESSERS AND CLEANERS

 Name: ELLIOTT CHAS L
 Year: 1949

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ELLIOTT C L CLEANERS (Continued)

1009151407

Type: CLEANERS AND DYERS
Name: ELLIOTT CHAS L
Year: 1949
Type: CLOTHES PRESSERS AND CLEANERS
Name: ELLIOTT C L CLEANERS
Year: 1953
Type: CLEANERS AND DYERS
Name: ELLIOTT C L CLEANERS
Year: 1959
Type: CLOTHES PRESSERS AND CLEANERS

**H36
SE
1/8-1/4
0.234 mi.
1238 ft.**

**WEST TRADE LAUNDRY (HAND)
725 W TRADE
CHARLOTTE, NC**

EDR Historical Cleaners

**1009150382
N/A**

Site 5 of 5 in cluster H

**Relative:
Higher**

EDR Historical Cleaners:

Name: JUNG SLAM
Year: 1937
Type: LAUNDRIES CHINESE

**Actual:
746 ft.**

Name: JUNG CO
Year: 1944
Type: LAUNDRIES CHINESE

Name: RUNG WING
Year: 1949
Type: LAUNDRIES CHINESE

Name: WEST TRADE LAUNDRY (HAND)
Year: 1953
Type: LAUNDRIES

Name: WEST TRADE LAUNDRY (HAND)
Year: 1959
Type: LAUNDRIES

**I37
WNW
1/8-1/4
0.243 mi.
1284 ft.**

**WESLEY HEIGHTS FILLING STATIONS
1308 W TRADE
CHARLOTTE, NC**

EDR Historical Auto Stations

**1009031685
N/A**

Site 1 of 6 in cluster I

**Relative:
Lower**

EDR Historical Auto Stations:

Name: WESLEY HEIGHTS FILLING STATIONS
Year: 1925
Type: FILLING STATIONS

**Actual:
672 ft.**

MAP FINDINGS

Map ID			
Direction			
Distance			EDR ID Number
Elevation	Site	Database(s)	EPA ID Number

I38 WNW 1/8-1/4 0.243 mi. 1284 ft.	VALETERIA INC 1311 W TRADE CHARLOTTE, NC Site 2 of 6 in cluster I	EDR Historical Cleaners	1009152686 N/A
Relative: Lower	EDR Historical Cleaners: Name: VALETERIA INC Year: 1953		
Actual: 672 ft.	Type: CLEANERS AND DYERS		

I39 WNW 1/8-1/4 0.244 mi. 1287 ft.	ROBERTS GULF SERVICE STATION 1319 W TRADE CHARLOTTE, NC Site 3 of 6 in cluster I	EDR Historical Auto Stations	1009030345 N/A
Relative: Lower	EDR Historical Auto Stations: Name: GUIN JAS S Year: 1937		
Actual: 672 ft.	Type: GASOLINE AND OIL SERVICE STATIONS		
	Name: GUIN JAS S Year: 1937 Type: GASOLINE AND OIL SERVICE STATIONS		
	Name: BLANKENSHIP GULF SERVICE Year: 1949 Type: GASOLINE AND OIL SERVICE STATIONS		
	Name: BLANKENSHIP GULF SERVICE Year: 1949 Type: GASOLINE AND OIL SERVICE STATIONS		
	Name: ROBERTS GULF SERVICE STATION Year: 1953 Type: GASOLINE STATIONS		
	Name: ROBERTS GULF SERVICE STATION Year: 1953 Type: GASOLINE STATIONS		

I40 WNW 1/8-1/4 0.244 mi. 1289 ft.	VALETERIA CLEANING CO MAIN PLANT 1326 W TRADE CHARLOTTE, NC Site 4 of 6 in cluster I	EDR Historical Cleaners	1009150830 N/A
Relative: Lower	EDR Historical Cleaners: Name: VALETERIA CLEANING CO MAIN PLANT Year: 1949		
Actual: 673 ft.	Type: CLOTHES PRESSERS AND CLEANERS		

MAP FINDINGS

Map ID
Direction
Distance
Elevation

Site

Database(s)

EDR ID Number
EPA ID Number

I41
WNW
1/8-1/4
0.245 mi.
1291 ft.

SIGMONS SERVICE CENTER
1329 W TRADE
CHARLOTTE, NC

EDR Historical Auto Stations

1009120343
N/A

Site 5 of 6 in cluster I

Relative:
Lower

EDR Historical Auto Stations:

Name: SIGMONS SERVICE CENTER
Year: 1959
Type: GASOLINE STATIONS

Actual:
673 ft.

Name: SIGMONS SERVICE CENTER
Year: 1959
Type: GASOLINE STATIONS

Name: SIGMONS SERVICE CENTER
Year: 1964
Type: GASOLINE STATIONS

Name: SIGMONS SERVICE CENTER
Year: 1964
Type: GASOLINE STATIONS

J42
South
1/4-1/2
0.270 mi.
1426 ft.

CITY OF CHARLOTTE SMITH METAL&IRON SITE
301 & 700 S CEDAR ST
CHARLOTTE, NC 28202

CERC-NFRAP
RCRA-CESQG
FINDS

1000910941
NCD024488025

Site 1 of 2 in cluster J

Relative:
Higher

CERC-NFRAP:

Site ID: 0402711
Federal Facility: Not a Federal Facility
NPL Status: Not on the NPL
Non NPL Status: NFRAP-Site does not qualify for the NPL based on existing information

Actual:
716 ft.

CERCLIS-NFRAP Site Contact Details:

Contact Sequence ID: 4309067.00000
Person ID: 4270042.00000

Contact Sequence ID: 4356939.00000
Person ID: 4000084.00000

Contact Sequence ID: 4368464.00000
Person ID: 4270039.00000

Contact Sequence ID: 4428967.00000
Person ID: 4000312.00000

Contact Sequence ID: 4429884.00000
Person ID: 4000508.00000

Contact Sequence ID: 4537718.00000
Person ID: 4000533.00000

Contact Sequence ID: 4702904.00000
Person ID: 4000308.00000

Contact Sequence ID: 4756827.00000
Person ID: 4000275.00000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CITY OF CHARLOTTE SMITH METAL&IRON SITE (Continued)

1000910941

Contact Sequence ID: 4781127.00000
Person ID: 13002428.00000

Contact Sequence ID: 4831227.00000
Person ID: 4270104.00000

Contact Sequence ID: 13093337.00000
Person ID: 4272610.00000

CERCLIS-NFRAP Site Alias Name(s):

Alias Name: SMITH METAL & IRON CO
Alias Address: Not reported
MECKLENBURG, NC

CERCLIS-NFRAP Assessment History:

Action: DISCOVERY
Date Started: Not reported
Date Completed: 08/01/1980
Priority Level: Not reported

Action: PRELIMINARY ASSESSMENT
Date Started: Not reported
Date Completed: 12/24/1985
Priority Level: Low priority for further assessment

Action: ARCHIVE SITE
Date Started: Not reported
Date Completed: 05/24/1990
Priority Level: Not reported

Action: SITE INSPECTION
Date Started: Not reported
Date Completed: 05/24/1990
Priority Level: NFRAP-Site does not qualify for the NPL based on existing information

Action: INTEGRATED ASSESSMENT
Date Started: 07/06/1992
Date Completed: 07/06/1992
Priority Level: NFRAP-Site does not qualify for the NPL based on existing information

RCRA-CESQG:

Date form received by agency: 04/03/1995
Facility name: CITY OF CHARLOTTE SMITH METAL&IRON SITE
Facility address: 301 & 700 S CEDAR ST
CHARLOTTE, NC 28202
EPA ID: NCD024488025
Mailing address: E FOURTH ST
CHARLOTTE, NC 282022844
Contact: JAMES BLACKWELL
Contact address: 600 E FOURTH ST
CHARLOTTE, NC 282022844
Contact country: US
Contact telephone: (704) 336-3603
Contact email: Not reported
EPA Region: 04
Classification: Conditionally Exempt Small Quantity Generator

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CITY OF CHARLOTTE SMITH METAL&IRON SITE (Continued)

1000910941

Description: Handler: generates 100 kg or less of hazardous waste per calendar month, and accumulates 1000 kg or less of hazardous waste at any time; or generates 1 kg or less of acutely hazardous waste per calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste

Owner/Operator Summary:

Owner/operator name: CITY OF CHARLOTTE
Owner/operator address: 600 E FOURTH ST
CHARLOTTE, NC 28202
Owner/operator country: Not reported
Owner/operator telephone: (704) 336-3603
Legal status: Municipal
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): Unknown
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No
Off-site waste receiver: Verified to be non-commercial

Hazardous Waste Summary:

Waste code: D008
Waste name: LEAD

Violation Status: No violations found

FINDS:

Registry ID: 110007658212

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

CITY OF CHARLOTTE SMITH METAL&IRON SITE (Continued)

1000910941

Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

K43
SE
 1/4-1/2
 0.277 mi.
 1464 ft.

GATEWAY VILLAGE-700 BLOCK
700 WEST TRADE STREET
CHARLOTTE, NC

IMD S107672009
LUST N/A

Site 1 of 2 in cluster K

Relative:
Higher

IMD:

Actual:
740 ft.

Region: Not reported
 Facility ID: 36005
 Date Occurred: Not reported
 Submit Date: 6/17/1999
 GW Contam: Yes, Groundwater Contamination has been detected
 Soil Contam: No
 Incident Desc: Not reported
 Operator: Not reported
 Contact Phone: Not reported
 Owner Company: UNKNOWN
 Operator Address: Not reported
 Operator City: Not reported
 Oper City,St,Zip: NC
 Ownership: Unknown
 Operation: Commercial
 Material: Not reported
 Qty Lost 1: Not reported
 Qty Recovered 1: Not reported
 Source: Leak-underground
 Type: Gasoline/diesel
 Location: Facility
 Setting: Not reported
 Risk Site: Not reported
 Site Priority: Not reported
 Priority Code: Not reported
 Priority Update: Not reported
 Dem Contact: AJS
 Wells Affected: No
 Num Affected: Not reported
 Wells Contam: Not reported
 Sampled By: Y
 Samples Include: Not reported
 7.5 Min Quad: Not reported
 5 Min Quad: Not reported
 Latitude: Not reported
 Longitude: Not reported
 Latitude Number: Not reported
 Longitude Number: Not reported
 Latitude Decimal: Not reported
 Longitude Decimal: Not reported
 GPS: EST
 Agency: DWM
 Facility ID: Not reported
 Last Modified: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GATEWAY VILLAGE-700 BLOCK (Continued)

S107672009

Incident Phase: Not reported
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LUST:

Facility ID: Not reported
UST Number: MO-7348
Incident Number: 36005
Contamination Type: Groundwater/Both
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 1999-04-19 00:00:00
Date Occur: Not reported
Cleanup: Not reported
Closure Request: Not reported
Close Out: Not reported
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: U
Risk Class Based On Review: U
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: Not reported
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Not reported
MTBE: No
MTBE1: No
Flag: No
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in House
RBCA GW: Not reported
PETOPT: 3
RPL: False
CD Num: 0
Reel Num: 0
RPOW: True
RPOP: False
Error Flag: 0
Error Code: N
Valid: False
Lat/Long: 35 13 55.62 80 50 55.86
Lat/Long Decimal: 35.232120000000002 80.848849999999999

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GATEWAY VILLAGE-700 BLOCK (Continued)

S107672009

Testlat: Not reported
Regional Officer Project Mgr: DPB
Region: Mooresville
Company: UNKNOWN
Contact Person: Not reported
Telephone: Not reported
RP Address: Not reported
RP City,St,Zip: NC
RP County: Not reported
Comments: Not reported
5 Min Quad: Not reported

PIRF:
Facility Id: 36005
Date Occurred: 1999-02-23 00:00:00
Date Reported: 1999-06-17 00:00:00
Description Of Incident: Not reported
Owner/Operator: Not reported
Ownership: 3
Operation Type: 6
Type: 3
Location: 1
Site Priority: Not reported
Priority Update: Not reported
Wells Affected Y/N: N
Samples Include: Not reported
7#5 Minute Quad: Y
5 Minute Quad: Not reported
Pirf/Min Soil: Not reported
Release Code: Not reported
Source Code: Not reported
Err Type: 3
Cause: Not reported
Source: Not reported
Ust Number: P

Last Modified: Not reported
Incident Phase: Not reported
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Signed: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

I44
WNW
1/4-1/2
0.280 mi.
1479 ft.

QUICK N E-Z 2
1419 WEST TRADE STREET
CHARLOTTE, NC

Site 6 of 6 in cluster I

IMD S107672052
LUST N/A

Relative:
Lower

IMD:

Actual:
684 ft.

Region: Not reported
Facility ID: 36050
Date Occurred: 2/14/2006
Submit Date: 3/23/2006
GW Contam: No Groundwater Contamination detected
Soil Contam: Yes
Incident Desc: RELEASE DETECTED DURING COMPLIANCE SITE CHECK. 1-3K KEROSENE, 3-6K GASOLINE USTS.
Operator: PAULA WILSON
Contact Phone: Not reported
Owner Company: Not reported
Operator Address:1224 PEACHTREE ROAD
Operator City: CHARLOTTE
Oper City,St,Zip: CHARLOTTE, NC 282162737
Ownership: Private
Operation: Commercial
Material: Not reported
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Leak-underground
Type: Gasoline/diesel
Location: Facility
Setting: Not reported
Risk Site: Not reported
Site Priority: Not reported
Priority Code: Not reported
Priority Update: Not reported
Dem Contact: BLM
Wells Affected: Not reported
Num Affected: Not reported
Wells Contam: Not reported
Sampled By: Y
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: Not reported
Longitude: Not reported
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: EST
Agency: DWM
Facility ID: Not reported
Last Modified: Not reported
Incident Phase: Not reported
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

QUICK N E-Z 2 (Continued)

S107672052

Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LUST:

Facility ID: 0-035273
UST Number: MO-7388
Incident Number: 36050
Contamination Type: Groundwater/Both
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 2006-03-23 00:00:00
Date Occur: 2006-02-14 00:00:00
Cleanup: Not reported
Closure Request: Not reported
Close Out: 2007-10-15 00:00:00
Level Of Soil Cleanup Achieved: Residential
Tank Regulated Status: Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: U
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: Not reported
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Industrial/commercial
MTBE: No
MTBE1: Yes
Flag: No
Flag1: No
LUR Filed: 2007-10-18 00:00:00
Release Detection: 0
Current Status: File Located in Archives
RBCA GW: Cleanups to alternate standards
PETOPT: 3
RPL: False
CD Num: 387
Reel Num: 0
RPOW: True
RPOP: False
Error Flag: 0
Error Code: N
Valid: False
Lat/Long: 35 14 11.28 80 51 32.22
Lat/Long Decimal: 35.23648 80.858959999999996
Testlat: Not reported
Regional Officer Project Mgr: AJS
Region: Mooresville
Company: Not reported
Contact Person: PAULA WILSON
Telephone: Not reported
RP Address: 1224 PEACHTREE ROAD

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

QUICK N E-Z 2 (Continued)

S107672052

RP City,St,Zip: CHARLOTTE, NC 282162737
RP County: Not reported
Comments: UST'S STILL IN OPERATION. 1-3K KEROSENE, 3-6K GASOLINE. NOV WAS MAILED TO SHERIFF OF MECKLENBURG TO DELIVER TO RP ON 8/3/2006. 10-DAY LETTER MAILED BY SHERIFF DATED 10/11/2006.
5 Min Quad: Not reported
PIRF:
Facility Id: 36050
Date Occurred: 2006-02-14 00:00:00
Date Reported: 2006-03-23 00:00:00
Description Of Incident: RELEASE DETECTED DURING COMPLIANCE SITE CHECK. 1-3K KEROSENE, 3-6K GASOLINE USTS.
Owner/Operator: Not reported
Ownership: 4
Operation Type: 6
Type: 3
Location: 1
Site Priority: Not reported
Priority Update: Not reported
Wells Affected Y/N: Not reported
Samples Include: Not reported
7#5 Minute Quad: Y
5 Minute Quad: Not reported
Pirf/Min Soil: Not reported
Release Code: Not reported
Source Code: Not reported
Err Type: 9
Cause: Not reported
Source: Not reported
Ust Number: P

Last Modified: Not reported
Incident Phase: Closed Out
NOV Issued: 2006-06-09 00:00:00
NORR Issued: 2007-02-27 00:00:00
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Signed: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

J45
South
1/4-1/2
0.280 mi.
1479 ft.

**SWARTZ & SONS (SMITH METAL & I
W. 3RD AND CEDAR
CHARLOTTE, NC
Site 2 of 2 in cluster J**

**IMD S105911986
N/A**

**Relative:
Higher**

IMD:
Region: MOR
Facility ID: 8180
Date Occurred: 12/30/1988
Submit Date: 6/16/1992
GW Contam: Yes, Groundwater Contamination has been detected
Soil Contam: Yes

**Actual:
716 ft.**

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SWARTZ & SONS (SMITH METAL & I (Continued))

S105911986

Incident Desc: Not reported
Operator: CERCLA,
Contact Phone: Not reported
Owner Company: SWARTZ AND SONS
Operator Address: CERCLA
Operator City: Not reported
Oper City, St, Zip: Not reported
Ownership: Federal
Operation: 8
Material: PCBS
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Unknown
Type: Metals
Location: Facility
Setting: Urban
Risk Site: Not reported
Site Priority: Not reported
Priority Code: NOD
Priority Update: Not reported
Dem Contact: CER
Wells Affected: No
Num Affected: 0
Wells Contam: Not reported
Sampled By: Responsible Parties
Samples Include: Groundwater Samples
7.5 Min Quad: Not reported
5 Min Quad: R66
Latitude: Not reported
Longitude: Not reported
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: EST
Agency: DWQ
Facility ID: 8180
Last Modified: 6/11/1992
Incident Phase: Assessment
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Signed: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

46
ESE
1/4-1/2
0.291 mi.
1536 ft.

ELMWOOD CEMETERY
700 WEST 6TH STREET
CHARLOTTE, NC

IMD S101524208
LUST N/A
LUST TRUST

Relative:
Higher

IMD:

Actual:
738 ft.

Region: MOR
Facility ID: 10712
Date Occurred: Not reported
Submit Date: 8/13/1993
GW Contam: Yes, Groundwater Contamination has been detected
Soil Contam: No
Incident Desc: FREE PRODUCT FOUND IN MONITOR WELL.
Operator: MS. MICHELLE GREGOR
Contact Phone: Not reported
Owner Company: CITY OF CHARLOTTE
Operator Address: 600 EAST FOURTH STREET
Operator City: CHARLOTTE
Oper City, St, Zip: CHARLOTTE, NC 28202
Ownership: Municipal
Operation: Public Service
Material: GASOLINE
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Leak-underground
Type: Gasoline/diesel
Location: 8
Setting: Urban
Risk Site: L
Site Priority: 060E
Priority Code: L
Priority Update: 5/15/1998
Dem Contact: AJS
Wells Affected: No
Num Affected: 0
Wells Contam: Not reported
Sampled By: None
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: R66A
Latitude: 35.23888888
Longitude: -80.84916666
Latitude Number: 351420
Longitude Number: 805057
Latitude Decimal: 35.2388888888889
Longitude Decimal: 80.8491666666667
GPS: NOD
Agency: DWM
Facility ID: 10712
Last Modified: 9/27/1993
Incident Phase: Follow Up
NOV Issued: 8/18/1993
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ELMWOOD CEMETERY (Continued)

S101524208

RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LUST:

Facility ID: 0-017362
UST Number: MO-3861
Incident Number: 10712
Contamination Type: Groundwater/Both
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 1993-06-22 00:00:00
Date Occur: Not reported
Cleanup: 1993-06-22 00:00:00
Closure Request: Not reported
Close Out: Not reported
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: L
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: 1993-08-12 00:00:00
NORR Issue Date: Not reported
Site Priority: 060E
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Not reported
MTBE: Not reported
MTBE1: Unknown
Flag: No
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in House
RBCA GW: Not reported
PETOPT: 3
RPL: False
CD Num: 0
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0
Error Code: Not reported
Valid: False
Lat/Long: 35 14 4.98 80 50 49.98
Lat/Long Decimal: 35.234721999999998 80.847222000000002
Testlat: Not reported
Regional Officer Project Mgr: DPB
Region: Mooresville
Company: CITY OF CHARLOTTE
Contact Person: MS. MICHELLE GREGOR
Telephone: Not reported
RP Address: 600 EAST FOURTH STREET
RP City,St,Zip: CHARLOTTE, NC 28202

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ELMWOOD CEMETERY (Continued)

S101524208

RP County: MECKLENBURG
Comments: Not reported
5 Min Quad: R66A

PIRF:
Facility Id: 10712
Date Occurred: 1993-05-06 00:00:00
Date Reported: 1993-08-13 00:00:00
Description Of Incident: FREE PRODUCT FOUND IN MONITOR WELL.
Owner/Operator: MS. MICHELLE GREGOR
Ownership: 1
Operation Type: 1
Type: 3
Location: 8
Site Priority: 060E
Priority Update: 1998-05-15 00:00:00
Wells Affected Y/N: N
Samples Include: 0
7#5 Minute Quad: 5
5 Minute Quad: Not reported
Pirf/Min Soil: Not reported
Release Code: R66A
Source Code: Pirf
Err Type: Not reported
Cause: Not reported
Source: Not reported
Ust Number: Not reported

Last Modified: 1993-09-27 00:00:00
Incident Phase: Follow Up
NOV Issued: 1993-08-18 00:00:00
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Signed: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LUST TRUST:
Facility ID: 0-017362
Site ID: 10712
Site Note: Not reported
Site Eligible?: True
Commercial Find: 100% Commercial
Priority Rank: Low
Deductable Amount: 20000
3rd Party Deductable Amt: 0
Sum 3rd Party Amt Applied: 0

[Click this hyperlink](#) while viewing on your computer to access additional NC LUST TRUST: detail in the EDR Site Report.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

L47
WNW
1/4-1/2
0.310 mi.
1639 ft.

WEST TRADE VACANT LOT
1501 W. TRADE STREET
CHARLOTTE, NC

Site 1 of 4 in cluster L

IMD S103717604
LUST N/A

Relative:
Higher

IMD:

Actual:
701 ft.

Region: MOR
Facility ID: 19446
Date Occurred: 10/22/1998
Submit Date: 1/12/1999
GW Contam: No Groundwater Contamination detected
Soil Contam: Yes
Incident Desc: DURING UST REMOVAL, SOIL CONTAM. AS HIGH AS 2700 PPM (GAS) AND 550 PPM (DIESEL) WAS ENCOUNTERED
Operator: UNKNOWN
Contact Phone: Not reported
Owner Company: UNKNOWN
Operator Address: Not reported
Operator City: Not reported
Oper City, St, Zip: Not reported
Ownership: Not reported
Operation: Not reported
Material: GASOLINE
Qty Lost 1: Not reported
Qty Recovered 1: UNKNOWN
Source: Leak-underground
Type: Gasoline/diesel
Location: 8
Setting: Urban
Risk Site: Unknown
Site Priority: Not reported
Priority Code: Not reported
Priority Update: 1/29/1999
Dem Contact: AJS
Wells Affected: Not reported
Num Affected: Not reported
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: 35.23694444
Longitude: -80.86
Latitude Number: 351413
Longitude Number: 805136
Latitude Decimal: 35.23694444444444
Longitude Decimal: 80.86
GPS: 7
Agency: DWM
Facility ID: 19446
Last Modified: Not reported
Incident Phase: RE
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WEST TRADE VACANT LOT (Continued)

S103717604

Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LUST:

Facility ID: Not reported
UST Number: MO-5555
Incident Number: 19446
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 1999-01-12 00:00:00
Date Occur: 1998-10-22 00:00:00
Cleanup: 1998-10-22 00:00:00
Closure Request: Not reported
Close Out: Not reported
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: U
Risk Class Based On Review: U
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: Not reported
Phase Of LSA Req: 1
Site Risk Reason: Not reported
Land Use: Not reported
MTBE: Not reported
MTBE1: Unknown
Flag: No
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in House
RBCA GW: Not reported
PETOPT: 3
RPL: False
CD Num: 0
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0
Error Code: Not reported
Valid: False
Lat/Long: 35 14 12.96 80 51 36
Lat/Long Decimal: 35.236944000000001 80.859999999999999
Testlat: Not reported
Regional Officer Project Mgr: DPB
Region: Mooresville
Company: UNKNOWN
Contact Person: UNKNOWN
Telephone: Not reported
RP Address: Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

WEST TRADE VACANT LOT (Continued)

S103717604

RP City,St,Zip: Not reported
 RP County: Not reported
 Comments: NHR/AJS/2/22/2005
 5 Min Quad: R66B

PIRF:

Facility Id: 19446
 Date Occurred: 1998-10-22 00:00:00
 Date Reported: 1999-01-12 00:00:00
 Description Of Incident: DURING UST REMOVAL, SOIL CONTAM. AS HIGH AS 2700 PPM (GAS) AND 550 PPM (DIESEL) WAS ENCOUNTERED
 Owner/Operator: UNKNOWN
 Ownership: Not reported
 Operation Type: Not reported
 Type: 3
 Location: 8
 Site Priority: Not reported
 Priority Update: 1999-01-29 00:00:00
 Wells Affected Y/N: Not reported
 Samples Include: Not reported
 7#5 Minute Quad: Not reported
 5 Minute Quad: Not reported
 Pirf/Min Soil: Not reported
 Release Code: Not reported
 Source Code: MIN_SOIL
 Err Type: Not reported
 Cause: Not reported
 Source: Not reported
 Ust Number: Not reported

Last Modified: Not reported
Incident Phase: Response
 NOV Issued: Not reported
 NORR Issued: Not reported
 45 Day Report: Not reported
 Public Meeting Held: Not reported
 Corrective Action Planned: Not reported
 SOC Signed: Not reported
 Reclassification Report: Not reported
 RS Designation: Not reported
 Closure Request Date: Not reported
 Close-out Report: Not reported

48
 SE
 1/4-1/2
 0.316 mi.
 1669 ft.

**AMTRAK RAIL STATION
 607 WEST 5TH STREET
 CHARLOTTE, NC**

**IMD S106195904
 LUST N/A**

**Relative:
 Higher**

IMD:

Region: MOR
 Facility ID: 27625
 Date Occurred: 12/3/2003
 Submit Date: 12/31/2003
 GW Contam: No Groundwater Contamination detected
 Soil Contam: Yes
 Incident Desc: Removal of one 550-gallon orphan heating oil UST. Base sample indicates a release below action levels.

**Actual:
 745 ft.**

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AMTRAK RAIL STATION (Continued)

S106195904

Operator: Cyrus Parker
Contact Phone: 9192504088
Owner Company: NCDOT
Operator Address:1589 Mail Service Center
Operator City: Raleigh
Oper City,St,Zip: Raleigh, NC
Ownership: State
Operation: Commercial
Material: Not reported
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Leak-underground
Type: Gasoline/diesel
Location: 8
Setting: Not reported
Risk Site: L
Site Priority: Not reported
Priority Code: Not reported
Priority Update: Not reported
Dem Contact: CBC
Wells Affected: No
Num Affected: Not reported
Wells Contam: Not reported
Sampled By: Y
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: Not reported
Longitude: Not reported
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: 7
Agency: DWM
Facility ID: 27625
Last Modified: 1/8/2004
Incident Phase: Closed Out
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LUST:

Facility ID: Not reported
UST Number: MO-6901
Incident Number: 27625
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AMTRAK RAIL STATION (Continued)

S106195904

Date Reported: 2003-12-31 00:00:00
Date Occur: 2003-12-03 00:00:00
Cleanup: 2003-12-03 00:00:00
Closure Request: Not reported
Close Out: 2004-01-08 00:00:00
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Non Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: NON COMMERCIAL
Risk Classification: L
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: Not reported
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Not reported
MTBE: No
MTBE1: Unknown
Flag: Yes
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in Archives
RBCA GW: Not reported
PETOPT: 4
RPL: True
CD Num: 210
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0
Error Code: Not reported
Valid: False
Lat/Long: 35 13 55.92 80 50 49.86
Lat/Long Decimal: 35.232216999999999 80.8471969999999994
Testlat: Not reported
Regional Officer Project Mgr: CBC
Region: Mooresville
Company: NCDOT
Contact Person: Cyrus Parker
Telephone: 9192504088
RP Address: 1589 Mail Service Center
RP City,St,Zip: Raleigh, NC
RP County: Not reported
Comments: Removal of one 550-gallon orphan heating oil UST. Base sample indicates a release below action level.
5 Min Quad: Not reported

PIRF:

Facility Id: 27625
Date Occurred: 2003-12-03 00:00:00
Date Reported: 2003-12-31 00:00:00
Description Of Incident: Removal of one 550-gallon orphan heating oil UST. Base sample indicates a release below action levels.
Owner/Operator: Not reported
Ownership: 7

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

AMTRAK RAIL STATION (Continued)

S106195904

Operation Type:	6
Type:	4
Location:	8
Site Priority:	Not reported
Priority Update:	Not reported
Wells Affected Y/N:	N
Samples Include:	Not reported
7#5 Minute Quad:	Y
5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Not reported
Err Type:	2
Cause:	Not reported
Source:	C
Ust Number:	C
Last Modified:	2004-01-08 00:00:00
Incident Phase:	Closed Out
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

49
SSE
1/4-1/2
0.316 mi.
1670 ft.

NCDOT WEST PARKING
531 WEST FOURTH STREET
CHARLOTTE, NC

IMD S107031780
LUST N/A

Relative:
Higher

IMD:

Actual:
734 ft.

Region:	Not reported
Facility ID:	27926
Date Occurred:	8/4/2005
Submit Date:	8/26/2005
GW Contam:	No Groundwater Contamination detected
Soil Contam:	Yes
Incident Desc:	1-1,000K UST. LAST CONTENTS SUSPECTED TO BE HEATING OIL.
Operator:	TO BE DETERMINED
Contact Phone:	Not reported
Owner Company:	Not reported
Operator Address:	Not reported
Operator City:	Not reported
Oper City,St,Zip:	NC
Ownership:	Unknown
Operation:	Commercial
Material:	Not reported
Qty Lost 1:	Not reported
Qty Recovered 1:	Not reported
Source:	Leak-underground
Type:	Gasoline/diesel
Location:	Facility

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NCDOT WEST PARKING (Continued)

S107031780

Setting: Not reported
Risk Site: Not reported
Site Priority: Not reported
Priority Code: Not reported
Priority Update: Not reported
Dem Contact: BLM
Wells Affected: Not reported
Num Affected: Not reported
Wells Contam: Not reported
Sampled By: Y
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: Not reported
Longitude: Not reported
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: EST
Agency: DWM
Facility ID: Not reported
Last Modified: Not reported
Incident Phase: Not reported
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LUST:

Facility ID: Not reported
UST Number: MO-7264
Incident Number: 27926
Contamination Type: Groundwater/Both
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 2005-08-26 00:00:00
Date Occur: 2005-08-04 00:00:00
Cleanup: 2005-07-26 00:00:00
Closure Request: Not reported
Close Out: 2006-10-16 00:00:00
Level Of Soil Cleanup Achieved: Residential
Tank Regulated Status: Non Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: NON COMMERCIAL
Risk Classification: L
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NCDOT WEST PARKING (Continued)

S107031780

Site Priority: Not reported
Phase Of LSA Req: 1
Site Risk Reason: Not reported
Land Use: Industrial/commercial
MTBE: No
MTBE1: Unknown
Flag: No
Flag1: No
LUR Filed: 2006-10-20 00:00:00
Release Detection: 0
Current Status: File Located in Archives
RBCA GW: Cleanups to alternate standards
PETOPT: 4
RPL: False
CD Num: 321
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0
Error Code: N
Valid: False
Lat/Long: 35 13 48.6 80 50 57.9
Lat/Long Decimal: 35.230179 80.84943699999995
Testlat: Not reported
Regional Officer Project Mgr: BLM
Region: Mooresville
Company: Not reported
Contact Person: TO BE DETERMINED
Telephone: Not reported
RP Address: Not reported
RP City,St,Zip: NC
RP County: Not reported
Comments: PARCEL 3 C. 1,000K UST. LAST CONTENTS ARE SUSPECTED TO BE HEATING OIL
5 Min Quad: Not reported

PIRF:

Facility Id: 27926
Date Occurred: 2005-08-04 00:00:00
Date Reported: 2005-08-26 00:00:00
Description Of Incident: 1-1,000K UST. LAST CONTENTS SUSPECTED TO BE HEATING OIL.
Owner/Operator: Not reported
Ownership: 3
Operation Type: 6
Type: 4
Location: 1
Site Priority: Not reported
Priority Update: Not reported
Wells Affected Y/N: Not reported
Samples Include: Not reported
7#5 Minute Quad: Y
5 Minute Quad: Not reported
Pirf/Min Soil: Not reported
Release Code: Not reported
Source Code: Not reported
Err Type: 2
Cause: Not reported
Source: Not reported
Ust Number: P

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

NCDOT WEST PARKING (Continued)

S107031780

Last Modified:	Not reported
Incident Phase:	Closed Out
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

K50
SE
 1/4-1/2
 0.326 mi.
 1723 ft.

MULTI-MODAL (PARCEL 14)
600 WEST TRADE STREET
CHARLOTTE, NC

IMD S107405230
LUST N/A

Site 2 of 2 in cluster K

Relative:
Higher

IMD:

Actual:
754 ft.

Region:	Not reported
Facility ID:	27935
Date Occurred:	8/10/2005
Submit Date:	9/14/2005
GW Contam:	No Groundwater Contamination detected
Soil Contam:	Yes
Incident Desc:	2-12,000K USTS. SUSPECTED HEATING OIL.
Operator:	CYRUS PARKER
Contact Phone:	9192504088
Owner Company:	NC DOT
Operator Address:	1589 MAIL SERVICE CENTER
Operator City:	RALEIGH
Oper City,St,Zip:	RALEIGH, NC 276991589
Ownership:	Unknown
Operation:	Not reported
Material:	Not reported
Qty Lost 1:	Not reported
Qty Recovered 1:	Not reported
Source:	Leak-underground
Type:	Gasoline/diesel
Location:	Facility
Setting:	Not reported
Risk Site:	L
Site Priority:	Not reported
Priority Code:	Not reported
Priority Update:	Not reported
Dem Contact:	BLM
Wells Affected:	Not reported
Num Affected:	Not reported
Wells Contam:	Not reported
Sampled By:	Y
Samples Include:	Not reported
7.5 Min Quad:	Not reported
5 Min Quad:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Latitude Number:	Not reported
Longitude Number:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MULTI-MODAL (PARCEL 14) (Continued)

S107405230

Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: EST
Agency: DWM
Facility ID: 27935
Last Modified: Not reported
Incident Phase: Closed Out
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LUST:

Facility ID: Not reported
UST Number: MO-7272
Incident Number: 27935
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 2005-09-14 00:00:00
Date Occur: 2005-08-10 00:00:00
Cleanup: 2005-07-29 00:00:00
Closure Request: Not reported
Close Out: 2005-09-16 00:00:00
Level Of Soil Cleanup Achieved: Soil to Groundwater
Tank Regulated Status: Non Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: L
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: Not reported
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Not reported
MTBE: No
MTBE1: Unknown
Flag: Yes
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in Archives
RBCA GW: Not reported
PETOPT: 4
RPL: True
CD Num: 257
Reel Num: 0
RPOW: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MULTI-MODAL (PARCEL 14) (Continued)

S107405230

RPOP: False
Error Flag: 0
Error Code: N
Valid: False
Lat/Long: 35 13 53.76 80 50 52.14
Lat/Long Decimal: 35.231619000000002 80.84782599999998
Testlat: Not reported
Regional Officer Project Mgr: BLM
Region: Mooresville
Company: NC DOT
Contact Person: CYRUS PARKER
Telephone: 9192504088
RP Address: 1589 MAIL SERVICE CENTER
RP City,St,Zip: RALEIGH, NC 276991589
RP County: Not reported
Comments: 2-12,000K USTS. SUSPECTED TO STORE HEATING OIL. RP IS UNKNOWN AT THIS TIME.
5 Min Quad: Not reported

PIRF:

Facility Id: 27935
Date Occurred: 2005-08-10 00:00:00
Date Reported: 2005-09-14 00:00:00
Description Of Incident: 2-12,000K USTS. SUSPECTED HEATING OIL.
Owner/Operator: Not reported
Ownership: 3
Operation Type: Not reported
Type: Not reported
Location: 1
Site Priority: Not reported
Priority Update: Not reported
Wells Affected Y/N: Not reported
Samples Include: Not reported
7#5 Minute Quad: Y
5 Minute Quad: Not reported
Pirf/Min Soil: Not reported
Release Code: Not reported
Source Code: Not reported
Err Type: 2
Cause: Not reported
Source: Not reported
Ust Number: P

Last Modified: Not reported
Incident Phase: Closed Out
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Signed: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s) EDR ID Number
EPA ID Number

M51
SE
1/4-1/2
0.335 mi.
1771 ft.

GREYHOUND LINES TERMINAL
601 W TRADE STREET
CHARLOTTE, NC

IMD S106349110
LUST N/A

Site 1 of 5 in cluster M

Relative:
Higher

IMD:

Actual:
762 ft.

Region: MOR
Facility ID: 14771
Date Occurred: 8/7/1995
Submit Date: 4/9/1997
GW Contam: No Groundwater Contamination detected
Soil Contam: Yes
Incident Desc: SOIL SAMPLE WAS AS HIGH AS 2,500 PPM.
Operator: MR. JOHN HAMILTON
Contact Phone: Not reported
Owner Company: GREYHOUND LINES, INC.
Operator Address: 350 NORTH ST. PAUL STREET
Operator City: DALLAS
Oper City, St, Zip: DALLAS, TX 75201
Ownership: Private
Operation: Commercial
Material: DIESEL
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Leak-underground
Type: Gasoline/diesel
Location: Facility
Setting: Urban
Risk Site: L
Site Priority: 10E
Priority Code: L
Priority Update: 5/15/1998
Dem Contact: AJS
Wells Affected: No
Num Affected: 0
Wells Contam: Not reported
Sampled By: Responsible Parties
Samples Include: Soil Samples
7.5 Min Quad: Not reported
5 Min Quad: R66J
Latitude: 35.23055555
Longitude: -80.84861111
Latitude Number: 351350
Longitude Number: 805055
Latitude Decimal: 35.2305555555556
Longitude Decimal: 80.8486111111111
GPS: NOD
Agency: DWM
Facility ID: 14771
Last Modified: Not reported
Incident Phase: Follow Up
NOV Issued: Not reported
NORR Issued: 11/13/1995
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GREYHOUND LINES TERMINAL (Continued)

S106349110

RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LUST:

Facility ID: 0-013349
UST Number: MO-4487
Incident Number: 14771
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 1995-08-07 00:00:00
Date Occur: 1995-08-07 00:00:00
Cleanup: 1995-08-07 00:00:00
Closure Request: Not reported
Close Out: Not reported
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: L
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: 10E
Phase Of LSA Req: 1
Site Risk Reason: Not reported
Land Use: Industrial/commercial
MTBE: Not reported
MTBE1: Unknown
Flag: Yes
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in House
RBCA GW: Not reported
PETOPT: 3
RPL: False
CD Num: 0
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0
Error Code: Not reported
Valid: False
Lat/Long: 35 13 52.2 80 50 54.48
Lat/Long Decimal: 35.231181999999997 80.848474999999993
Testlat: Not reported
Regional Officer Project Mgr: DPB
Region: Mooresville
Company: GREYHOUND LINES, INC.
Contact Person: MR. JOHN HAMILTON
Telephone: Not reported
RP Address: 350 NORTH ST. PAUL STREET
RP City,St,Zip: DALLAS, TX 75201

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

GREYHOUND LINES TERMINAL (Continued)

S106349110

RP County:	Not reported	Not reported
Comments:	Not reported	
5 Min Quad:	R66j	
PIRF:		
Facility Id:	14771	
Date Occurred:	1995-05-01 00:00:00	
Date Reported:	1997-04-09 00:00:00	
Description Of Incident:	SOIL SAMPLE WAS AS HIGH AS 2,500 PPM.	
Owner/Operator:	MR. JOHN HAMILTON	
Ownership:	4	
Operation Type:	6	
Type:	3	
Location:	1	
Site Priority:	10E	
Priority Update:	1998-05-15 00:00:00	
Wells Affected Y/N:	N	
Samples Include:	0	
7#5 Minute Quad:	3	
5 Minute Quad:	2	
Pirf/Min Soil:	Not reported	
Release Code:	R66J	
Source Code:	Pirf	
Err Type:	Not reported	
Cause:	Not reported	
Source:	Not reported	
Ust Number:	Not reported	
Last Modified:	Not reported	
Incident Phase:	Follow Up	
NOV Issued:	Not reported	
NORR Issued:	1995-11-13 00:00:00	
45 Day Report:	Not reported	
Public Meeting Held:	Not reported	
Corrective Action Planned:	Not reported	
SOC Signed:	Not reported	
Reclassification Report:	Not reported	
RS Designation:	Not reported	
Closure Request Date:	Not reported	
Close-out Report:	Not reported	

L52
WNW
 1/4-1/2
 0.338 mi.
 1782 ft.

SOUTH CENTRAL OIL PROPERTY
115 GRANDIN ROAD
CHARLOTTE, NC
 Site 2 of 4 in cluster L

IMD S106682174
LUST N/A

Relative:
Higher

IMD:
 Region: Not reported
 Facility ID: 27792
 Date Occurred: 8/7/2001
 Submit Date: 8/5/2004
 GW Contam: No Groundwater Contamination detected
 Soil Contam: Yes
 Incident Desc: Not reported
 Operator: PASTOR WALTER HOWARD, JR.
 Contact Phone: Not reported
 Owner Company: GREATER BETHEL AME

Actual:
714 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOUTH CENTRAL OIL PROPERTY (Continued)

S106682174

Operator Address:201 GRANDIN ROAD
Operator City: CHARLOTTE
Oper City,St,Zip: CHARLOTTE, NC 28208
Ownership: Private
Operation: Residential
Material: Not reported
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Leak-underground
Type: Gasoline/diesel
Location: Residence
Setting: Not reported
Risk Site: L
Site Priority: Not reported
Priority Code: Not reported
Priority Update: Not reported
Dem Contact: AJS
Wells Affected: No
Num Affected: Not reported
Wells Contam: Not reported
Sampled By: Y
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: Not reported
Longitude: Not reported
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: 7
Agency: DWM
Facility ID: 27792
Last Modified: Not reported
Incident Phase: Closed Out
NOV Issued: Not reported
NORR Issued: 11/12/2004
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LUST:

Facility ID: Not reported
UST Number: MO-7097
Incident Number: 27792
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 2004-08-05 00:00:00
Date Occur: 2001-08-07 00:00:00
Cleanup: 2001-08-07 00:00:00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOUTH CENTRAL OIL PROPERTY (Continued)

S106682174

Closure Request: Not reported
Close Out: 2005-08-25 00:00:00
Level Of Soil Cleanup Achieved: Soil to Groundwater
Tank Regulated Status: Non Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: NON COMMERCIAL
Risk Classification: L
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: Not reported
Phase Of LSA Req: 1
Site Risk Reason: Not reported
Land Use: Residential
MTBE: No
MTBE1: Unknown
Flag: Yes
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in Archives
RBCA GW: Not reported
PETOPT: 4
RPL: False
CD Num: 256
Reel Num: 0
RPOW: True
RPOP: False
Error Flag: 0
Error Code: N
Valid: False
Lat/Long: 35 14 10.38 80 51 33.84
Lat/Long Decimal: 35.236229999999999 80.859414999999998
Testlat: Not reported
Regional Officer Project Mgr: AJS
Region: Mooresville
Company: GREATER BETHEL AME
Contact Person: PASTOR WALTER HOWARD, JR.
Telephone: Not reported
RP Address: 201 GRANDIN ROAD
RP City,St,Zip: CHARLOTTE, NC 28208
RP County: Not reported
Comments: RESIDENTIAL OIL USTS REMOVED. NATURAL GAS TO SITE 11/15/96 SO USED UP TO THAT TIME. CHURCH LAST OWNER OF USTS
5 Min Quad: Not reported

PIRF:

Facility Id: 27792
Date Occurred: 2001-08-07 00:00:00
Date Reported: 2004-08-05 00:00:00
Description Of Incident: Not reported
Owner/Operator: Not reported
Ownership: 4
Operation Type: 3
Type: 4
Location: 7
Site Priority: Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

SOUTH CENTRAL OIL PROPERTY (Continued)

S106682174

Priority Update:	Not reported
Wells Affected Y/N:	N
Samples Include:	Not reported
7#5 Minute Quad:	Y
5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Not reported
Err Type:	2
Cause:	Not reported
Source:	Not reported
Ust Number:	Not reported
Last Modified:	Not reported
Incident Phase:	Closed Out
NOV Issued:	Not reported
NORR Issued:	2004-11-12 00:00:00
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

L53
WNW
1/4-1/2
0.341 mi.
1799 ft.

GRIFFIN BROS TIRE SALE INC
1545 W TRADE STREET
CHARLOTTE, NC 28216
Site 3 of 4 in cluster L

IMD U001438877
UST N/A

Relative:
Higher

IMD:
 Region: MOR
 Facility ID: 14222
 Date Occurred: 11/30/1993
 Submit Date: 7/10/1995
 GW Contam: No Groundwater Contamination detected
 Soil Contam: Yes
 Incident Desc: SOIL CONTAM. FOUND AROUND USTS.
 Operator: MR. LARRY GRIFFIN
 Contact Phone: Not reported
 Owner Company: GRIFFIN BROTHERS, INC.
 Operator Address: 1545 WEST TRADE STREET
 Operator City: CHARLOTTE
 Oper City,St,Zip: CHARLOTTE, NC 28216
 Ownership: Private
 Operation: Commercial
 Material: WASTE OIL
 Qty Lost 1: Not reported
 Qty Recovered 1: Not reported
 Material: FUEL OIL
 Qty Lost: Not reported
 Qty Recovered: Not reported
 Material: GASOLINE
 Qty Lost: Not reported
 Qty Recovered 3: Not reported
 Source: Leak-underground

Actual:
709 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRIFFIN BROS TIRE SALE INC (Continued)

U001438877

Type: Gasoline/diesel
Location: Facility
Setting: Urban
Risk Site: L
Site Priority: E
Priority Code: L
Priority Update: 5/30/1998
Dem Contact: AJS
Wells Affected: Not reported
Num Affected: 0
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: 35.2377
Longitude: -80.8591
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: NOD
Agency: DWM
Facility ID: 14222
Last Modified: Not reported
Incident Phase: RE
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

UST:

Facility ID: 0-026867
Region: 3
Facility Telephone: (704) 375-5758
Last Update: 1990-08-03 00:00:00
Owner Name: GRIFFIN BROS TIRE SALE. INC
Owner Address: 1545 WEST TRADE STREET
Owner City,St,Zip: CHARLOTTE, NC 28216
Owner Phone: (704) 375-5758
Latitude: 0
Latitude 1: Not reported
Longitude: 0
Longitude 1: Not reported
GPS String Confirmed: No
Initials of Individual Confirming GPS: Not reported

Tank ID: 1
Tank ID Number: Not reported
Tank Capacity: 550

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRIFFIN BROS TIRE SALE INC (Continued)

U001438877

Status: Permanent Closed
Date installed: 1964-01-01 00:00:00
Date removed: 1993-11-29 00:00:00
Tank Product: Oil, New/Used/Mixture
Product Type: NON
Tank Material: Steel
Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: Not reported
Date Last Certified: Not reported
Begin Certified Number: Not reported
End Certified Number: Not reported
Interior Protection: Unknown
Exterior Protection: Unknown
Piping material: Unknown
Certify Type: Not reported
Leak Detection Type: Not reported
Leak Detection Piping 1: Not reported
Corrosn Protec Tank: Not reported
Corrosn Protec Pipe: Not reported
Spill and Overfill: Not reported
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Not reported
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Not reported
Corrosion Protection Tank Date: Not reported
Corrosion Protection Piping Date: Not reported
Spill Overfill Date: Not reported
Piping System Type Code: Not reported
Piping System Type Description: Not reported
Comment: Not reported

Tank ID: 2
Tank ID Number: Not reported
Tank Capacity: 550
Status: Permanent Closed
Date installed: 1964-01-01 00:00:00
Date removed: 1993-11-30 00:00:00
Tank Product: Oil, New/Used/Mixture
Product Type: NON
Tank Material: Steel
Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: Not reported
Date Last Certified: Not reported
Begin Certified Number: Not reported
End Certified Number: Not reported
Interior Protection: Unknown
Exterior Protection: Unknown
Piping material: Unknown
Certify Type: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRIFFIN BROS TIRE SALE INC (Continued)

U001438877

Leak Detection Type: Not reported
Leak Detection Piping 1: Not reported
Corrosn Protec Tank: Not reported
Corrosn Protec Pipe: Not reported
Spill and Overfill: Not reported
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Not reported
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Not reported
Corrosion Protection Tank Date: Not reported
Corrosion Protection Piping Date: Not reported
Spill Overfill Date: Not reported
Piping System Type Code: Not reported
Piping System Type Description: Not reported
Comment: Not reported

**L54
WNW
1/4-1/2
0.341 mi.
1799 ft.**

**GRIFFIN BROS TIRE SALES INC
1545 WEST TRADE STREET
CHARLOTTE, NC 28202**

**LUST S106799538
N/A**

Site 4 of 4 in cluster L

**Relative:
Higher**

LUST:

**Actual:
709 ft.**

Facility ID: 0-026867
UST Number: MO-4397
Incident Number: 14222
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 1994-01-28 00:00:00
Date Occur: 1993-11-30 00:00:00
Cleanup: 1993-11-30 00:00:00
Closure Request: Not reported
Close Out: Not reported
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Both at same site
Of Supply Wells: 0
Commercial/NonCommercial UST Site: BOTH
Risk Classification: L
Risk Class Based On Review: U
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: E
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Not reported
MTBE: Not reported
MTBE1: Unknown
Flag: No
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in House
RBCA GW: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRIFFIN BROS TIRE SALES INC (Continued)

S106799538

PETOPT: 4
RPL: False
CD Num: 0
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0
Error Code: Not reported
Valid: False
Lat/Long: 35 14 16.68 80 51 32.88
Lat/Long Decimal: 35.237979000000003 80.859146999999993
Testlat: Not reported
Regional Officer Project Mgr: BLM
Region: Mooresville
Company: GRIFFIN BROTHERS, INC.
Contact Person: MR. LARRY GRIFFIN
Telephone: Not reported
RP Address: 1545 WEST TRADE STREET
RP City,St,Zip: CHARLOTTE, NC 28216
RP County: ME
Comments: UST. HEATING OIL UST LEAKED
5 Min Quad: Not reported

PIRF:

Facility Id: 14222
Date Occurred: 1993-11-30 00:00:00
Date Reported: 1995-07-10 00:00:00
Description Of Incident: SOIL CONTAM. FOUND AROUND USTS.
Owner/Operator: MR. LARRY GRIFFIN
Ownership: 4
Operation Type: 6
Type: 3
Location: 1
Site Priority: E
Priority Update: 1998-05-30 00:00:00
Wells Affected Y/N: Not reported
Samples Include: 0
7#5 Minute Quad: Not reported
5 Minute Quad: Not reported
Pirf/Min Soil: Not reported
Release Code: Not reported
Source Code: Pirf
Err Type: Not reported
Cause: Not reported
Source: Not reported
Ust Number: Not reported

Last Modified: Not reported
Incident Phase: Response
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Signed: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRIFFIN BROS TIRE SALES INC (Continued)

S106799538

Close-out Report: Not reported

55
NW
1/4-1/2
0.365 mi.
1926 ft.

SERVCO #01615
1601 WEST TRADE STREET
CHARLOTTE, NC

IMD S105707374
LUST N/A
LUST TRUST

Relative:
Higher

IMD:

Actual:
735 ft.

Region: MOR
Facility ID: 27302
Date Occurred: 11/12/2002
Submit Date: 12/3/2002
GW Contam: Yes, Groundwater Contamination has been detected
Soil Contam: No
Incident Desc: SOIL AND GROUNWATER WAS DISCOVERED ADJACENT TO AN OPERATING UST SYSTEM
IN A PHASE II ENVIRONMENTAL SITE ASSESSMENT
Operator: UNKNOWN
Contact Phone: Not reported
Owner Company: SERVICE DISTRIBUTING COMPANY
Operator Address: PO BOX 310
Operator City: ALBEMARLE
Oper City, St, Zip: ALBEMARLE, NC 28001
Ownership: Private
Operation: Commercial
Material: Not reported
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Leak-underground
Type: Gasoline/diesel
Location: Facility
Setting: Not reported
Risk Site: I
Site Priority: Not reported
Priority Code: Not reported
Priority Update: Not reported
Dem Contact: AJS
Wells Affected: No
Num Affected: Not reported
Wells Contam: Not reported
Sampled By: Y
Samples Include: G
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: 35.23888888
Longitude: -80.85888888
Latitude Number: 351420
Longitude Number: 805132
Latitude Decimal: 35.2388888888889
Longitude Decimal: 80.8588888888889
GPS: 7
Agency: DWM
Facility ID: 27302
Last Modified: Not reported
Incident Phase: Follow Up
NOV Issued: Not reported
NORR Issued: 12/17/2002
45 Day Report: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SERVCO #01615 (Continued)

S105707374

Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LUST:

Facility ID: 0-014072
UST Number: MO-6618
Incident Number: 27302
Contamination Type: Groundwater/Both
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 2002-12-03 00:00:00
Date Occur: 2002-11-12 00:00:00
Cleanup: 2002-11-12 00:00:00
Closure Request: Not reported
Close Out: Not reported
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: I
Risk Class Based On Review: I
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: Not reported
Phase Of LSA Req: 2
Site Risk Reason: Gross contaminant levels
Land Use: Not reported
MTBE: No
MTBE1: Yes
Flag: No
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in House
RBCA GW: Not reported
PETOPT: 3
RPL: False
CD Num: 0
Reel Num: 0
RPOW: True
RPOP: False
Error Flag: 0
Error Code: Not reported
Valid: False
Lat/Long: 35 14 22.08 80 51 31.44
Lat/Long Decimal: 35.23948 80.858748000000006
Testlat: Not reported
Regional Officer Project Mgr: DPB
Region: Mooresville
Company: Servco Distributing Company

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

SERVCO #01615 (Continued)

S105707374

Contact Person:	Steve Saunders
Telephone:	Not reported
RP Address:	PO Box 310
RP City,St,Zip:	Albemarle, NC 28001
RP County:	Not reported
Comments:	New well to repace destroyed mw-6, still not product. 9-2009 UST'S REMOVED IN 1/2006 AND 5/2006. FOUR FEET OF FREE PRODUCT FOUND AT SITE AS OF 11/8/2005. GCL EXCEEDED FOR BENZENE IN TMW-3 (old coor 35.1420 80.5132)
5 Min Quad:	Not reported
PIRF:	
Facility Id:	27302
Date Occurred:	2002-11-12 00:00:00
Date Reported:	2002-12-03 00:00:00
Description Of Incident:	SOIL AND GROUNDWATER WAS DISCOVERED ADJACENT TO AN OPERATING UST SYSTEM IN A PHASE II ENVIRONMENTAL SITE ASSESSMENT
Owner/Operator:	Not reported
Ownership:	4
Operation Type:	6
Type:	3
Location:	1
Site Priority:	Not reported
Priority Update:	Not reported
Wells Affected Y/N:	N
Samples Include:	Not reported
7#5 Minute Quad:	Y
5 Minute Quad:	G
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Not reported
Err Type:	3
Cause:	Not reported
Source:	E
Ust Number:	E
Last Modified:	Not reported
Incident Phase:	Follow Up
NOV Issued:	2007-03-02 00:00:00
NORR Issued:	2002-12-17 00:00:00
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported
LUST TRUST:	
Facility ID:	0-014072
Site ID:	27302
Site Note:	Commercial; \$20,000 deductible; 100% eligible for costs that exceed the \$20,000 deductible.[CGS 5/4/10]
Site Eligible?:	True
Commercial Find:	100% Commercial
Priority Rank:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SERVCO #01615 (Continued)

S105707374

Deductable Amount: 20000
3rd Party Deductable Amt: 0
Sum 3rd Party Amt Applied: 0

[Click this hyperlink](#) while viewing on your computer to access additional NC LUST TRUST: detail in the EDR Site Report.

56
ESE
1/4-1/2
0.377 mi.
1989 ft.

AMTRAK STATION PARKING LOT
401 SMITH STREET
CHARLOTTE, NC

IMD S104914490
LUST N/A

Relative:
Higher

IMD:

Actual:
761 ft.

Region: MOR
Facility ID: 22442
Date Occurred: Not reported
Submit Date: 10/20/2000
GW Contam: No Groundwater Contamination detected
Soil Contam: Yes
Incident Desc: SOIL CONTAMINATION DISCOVERED DURING UST EXAMINATION
Operator: GREG SMITH
Contact Phone: 9192504088
Owner Company: NCDOT
Operator Address: PO BOX 25201
Operator City: RALEIGH
Oper City, St, Zip: RALEIGH, NC 276115201
Ownership: State
Operation: Public Service
Material: Not reported
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Dredge Spoil
Type: Gasoline/diesel
Location: Facility
Setting: Urban
Risk Site: Not reported
Site Priority: Not reported
Priority Code: Not reported
Priority Update: 10/20/2000
Dem Contact: AJS
Wells Affected: No
Num Affected: Not reported
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: 35.25166666
Longitude: -80.84361111
Latitude Number: 351506
Longitude Number: 805037
Latitude Decimal: 35.251666666667
Longitude Decimal: 80.843611111111
GPS: 7
Agency: DWM
Facility ID: 22442
Last Modified: 10/20/2000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AMTRAK STATION PARKING LOT (Continued)

S104914490

Incident Phase: RE
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LUST:

Facility ID: Not reported
UST Number: MO-6015
Incident Number: 22442
Contamination Type: Soil
Source Type: Dredge Spoil
Product Type: PETROLEUM
Date Reported: 2000-03-01 00:00:00
Date Occur: Not reported
Cleanup: 2000-03-01 00:00:00
Closure Request: Not reported
Close Out: Not reported
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: U
Risk Class Based On Review: U
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: Not reported
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Not reported
MTBE: No
MTBE1: Unknown
Flag: No
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in House
RBCA GW: Not reported
PETOPT: 3
RPL: False
CD Num: 0
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0
Error Code: Not reported
Valid: False
Lat/Long: 35 14 6 80 50 36.96
Lat/Long Decimal: 35.23499999999999 80.843610999999996

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AMTRAK STATION PARKING LOT (Continued)

S104914490

Testlat: Not reported
Regional Officer Project Mgr: DPB
Region: Mooresville
Company: NCDOT
Contact Person: GREG SMITH
Telephone: 9192504088
RP Address: PO BOX 25201
RP City,St,Zip: RALEIGH, NC 276115201
RP County: Not reported
Comments: NHR/AJS/2/1/2005. 6 DIFFERENT SOURCE AREAS AT SITE.
5 Min Quad: Not reported

PIRF:

Facility Id: 22442
Date Occurred: 1999-11-12 00:00:00
Date Reported: 2000-10-20 00:00:00
Description Of Incident: SOIL CONTAMINATION DISCOVERED DURING UST EXAMINATION
Owner/Operator: GREG SMITH
Ownership: 7
Operation Type: 1
Type: 3
Location: 1
Site Priority: Not reported
Priority Update: 2000-10-20 00:00:00
Wells Affected Y/N: N
Samples Include: Not reported
7#5 Minute Quad: Not reported
5 Minute Quad: Not reported
Pirf/Min Soil: Not reported
Release Code: Not reported
Source Code: Not reported
Err Type: 9
Cause: Not reported
Source: E
Ust Number: E

Last Modified: 2000-10-20 00:00:00

Incident Phase: Response
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Signed: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s) EDR ID Number
EPA ID Number

57
West
1/4-1/2
0.377 mi.
1991 ft.

DAVE HANSFORD PROPERTY
1512 WEST 4TH STREET
CHARLOTTE, NC

IMD S107672040
LUST N/A

Relative:
Higher

IMD:

Actual:
710 ft.

Region: Not reported
Facility ID: 36037
Date Occurred: Not reported
Submit Date: 3/2/2006
GW Contam: No Groundwater Contamination detected
Soil Contam: Yes
Incident Desc: Not reported
Operator: NEAL GREEN-CFO
Contact Phone: Not reported
Owner Company: GREATER BETHEL AME
Operator Address: 201 GRANDIN ROAD
Operator City: CHARLOTTE
Oper City, St, Zip: CHARLOTTE, NC 28208
Ownership: Private
Operation: Residential
Material: Not reported
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Leak-underground
Type: Gasoline/diesel
Location: Residence
Setting: Not reported
Risk Site: L
Site Priority: Not reported
Priority Code: Not reported
Priority Update: Not reported
Dem Contact: AJS
Wells Affected: No
Num Affected: Not reported
Wells Contam: Not reported
Sampled By: Y
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: Not reported
Longitude: Not reported
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: EST
Agency: DWM
Facility ID: 36037
Last Modified: Not reported
Incident Phase: Closed Out
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DAVE HANSFORD PROPERTY (Continued)

S107672040

RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LUST:

Facility ID: Not reported
UST Number: MO-7375
Incident Number: 36037
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 2004-07-22 00:00:00
Date Occur: 2004-07-22 00:00:00
Cleanup: 2005-01-28 00:00:00
Closure Request: Not reported
Close Out: 2006-03-02 00:00:00
Level Of Soil Cleanup Achieved: Soil to Groundwater
Tank Regulated Status: Non Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: L
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: Not reported
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Residential
MTBE: No
MTBE1: Unknown
Flag: No
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in Archives
RBCA GW: Not reported
PETOPT: 4
RPL: False
CD Num: 290
Reel Num: 0
RPOW: True
RPOP: False
Error Flag: 0
Error Code: N
Valid: False
Lat/Long: Not reported
Lat/Long Decimal: 0 0
Testlat: Not reported
Regional Officer Project Mgr: AJS
Region: Mooresville
Company: GREATER BETHEL AME
Contact Person: NEAL GREEN-CFO
Telephone: Not reported
RP Address: 201 GRANDIN ROAD
RP City,St,Zip: CHARLOTTE, NC 28208

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DAVE HANSFORD PROPERTY (Continued)

S107672040

RP County: Not reported
Comments: CONTAMINATED SOILS FROM INCIDENT #27743 WERE PUT ON MR. HANSFORDS PROPERTY. SOILS WERE REMOVED BETWEEN 1/28/2005 AND 3/4/2005. SITE NOW CLEAN
5 Min Quad: Not reported
PIRF:
Facility Id: 36037
Date Occurred: 2004-07-22 00:00:00
Date Reported: 2006-03-02 00:00:00
Description Of Incident: Not reported
Owner/Operator: Not reported
Ownership: 4
Operation Type: 3
Type: 4
Location: 7
Site Priority: Not reported
Priority Update: Not reported
Wells Affected Y/N: N
Samples Include: Not reported
7#5 Minute Quad: Y
5 Minute Quad: Not reported
Pirf/Min Soil: Not reported
Release Code: Not reported
Source Code: Not reported
Err Type: 4
Cause: Not reported
Source: Not reported
Ust Number: P

Last Modified: Not reported
Incident Phase: Closed Out
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Signed: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

M58
SE
1/4-1/2
0.381 mi.
2011 ft.

DIRTY LAUNDRY CLEANERS (FORMER NIXON PRO
511, 513, 515 WEST TRADE STREE
CHARLOTTE, NC
Site 2 of 5 in cluster M

SHWS S105201476
IMD N/A

Relative:
Higher

SHWS:
Facility ID: NONCD0001607
Facility Type: Inactive Hazardous Sites and Pollutant-Only Sites
Lat/Longitude: 35.230277 / -80.8475
Geolocation Method: UNKNOWN

Actual:
758 ft.

IMD:
Region: MOR
Facility ID: 86007

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DIRTY LAUNDRY CLEANERS (FORMER NIXON PRO (Continued))

S105201476

Date Occurred: 12/14/2001
Submit Date: 12/18/2001
GW Contam: Yes, Groundwater Contamination has been detected
Soil Contam: Not reported
Incident Desc: SAMPLING (RELATED TO CHARLOTTE MULTI-MODAL STATION R-O-W CLEARANCE)
DETECTED PCE @ 1.1 PPB IN GW. REPORT REFERS TO OLD DRY CLEANER AT SITE
AS POTENTIAL SOURCE S
Operator: ,
Contact Phone: Not reported
Owner Company: Not reported
Operator Address: Not reported
Operator City: Not reported
Oper City, St, Zip: Not reported
Ownership: Not Reported
Operation: Not Reported
Material: Not reported
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Unknown
Type: Other inorganics
Location: Not reported
Setting: Not reported
Risk Site: Not reported
Site Priority: Not reported
Priority Code: E
Priority Update: Not reported
Dem Contact: DWM
Wells Affected: No
Num Affected: 0
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: Not reported
Longitude: Not reported
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: EST
Agency: DWQ
Facility ID: 86007
Last Modified: 12/18/2001
Incident Phase: Discovery
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

M59
SE
1/4-1/2
0.383 mi.
2022 ft.

MULTI-MODAL (PARCEL 5A)
511 WEST TRADE STREET
CHARLOTTE, NC

IMD S107405231
LUST N/A

Site 3 of 5 in cluster M

Relative:
Higher

IMD:

Actual:
757 ft.

Region: Not reported
Facility ID: 27936
Date Occurred: 6/24/2005
Submit Date: 8/26/2005
GW Contam: No Groundwater Contamination detected
Soil Contam: Yes
Incident Desc: 1-550 gallon tank. Suspected to be heating oil.
Operator: CYRUS PARKER
Contact Phone: 9192504088
Owner Company: NC DOT
Operator Address: 1598 MAIL SERVICE CENTER
Operator City: RALEIGH
Oper City, St, Zip: RALEIGH, NC 276991589
Ownership: Unknown
Operation: Not reported
Material: Not reported
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Leak-underground
Type: Gasoline/diesel
Location: 8
Setting: Not reported
Risk Site: L
Site Priority: Not reported
Priority Code: Not reported
Priority Update: Not reported
Dem Contact: BLM
Wells Affected: Not reported
Num Affected: Not reported
Wells Contam: Not reported
Sampled By: y
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: Not reported
Longitude: Not reported
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: EST
Agency: DWM
Facility ID: 27936
Last Modified: Not reported
Incident Phase: Closed Out
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MULTI-MODAL (PARCEL 5A) (Continued)

S107405231

RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LUST:

Facility ID: Not reported
UST Number: MO-7274
Incident Number: 27936
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 2005-08-26 00:00:00
Date Occur: 2005-06-24 00:00:00
Cleanup: 2005-06-16 00:00:00
Closure Request: Not reported
Close Out: 2006-01-06 00:00:00
Level Of Soil Cleanup Achieved: Soil to Groundwater
Tank Regulated Status: Non Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: NON COMMERCIAL
Risk Classification: L
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: Not reported
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Not reported
MTBE: No
MTBE1: Unknown
Flag: Yes
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in Archives
RBCA GW: Not reported
PETOPT: 4
RPL: True
CD Num: 289
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0
Error Code: N
Valid: False
Lat/Long: 35 13 50.16 80 50 51.48
Lat/Long Decimal: 35.230615 80.847646999999995
Testlat: Not reported
Regional Officer Project Mgr: BLM
Region: Mooresville
Company: NC DOT
Contact Person: CYRUS PARKER
Telephone: 9192504088
RP Address: 1598 MAIL SERVICE CENTER
RP City,St,Zip: RALEIGH, NC 276991589

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

MULTI-MODAL (PARCEL 5A) (Continued)

S107405231

RP County: Not reported
 Comments: 1-550 GALLON TANK SUSPECTED TO BE HEATING OIL.
 5 Min Quad: Not reported

PIRF:

Facility Id: 27936
 Date Occurred: 2005-06-24 00:00:00
 Date Reported: 2005-08-26 00:00:00
 Description Of Incident: 1-550 gallon tank. Suspected to be heating oil.
 Owner/Operator: Not reported
 Ownership: 3
 Operation Type: Not reported
 Type: Not reported
 Location: 8
 Site Priority: Not reported
 Priority Update: Not reported
 Wells Affected Y/N: Not reported
 Samples Include: Not reported
 7#5 Minute Quad: y
 5 Minute Quad: Not reported
 Pirf/Min Soil: Not reported
 Release Code: Not reported
 Source Code: Not reported
 Err Type: 2
 Cause: Not reported
 Source: Not reported
 Ust Number: P

Last Modified: Not reported
Incident Phase: Closed Out
 NOV Issued: Not reported
 NORR Issued: Not reported
 45 Day Report: Not reported
 Public Meeting Held: Not reported
 Corrective Action Planned: Not reported
 SOC Signed: Not reported
 Reclassification Report: Not reported
 RS Designation: Not reported
 Closure Request Date: Not reported
 Close-out Report: Not reported

M60
SE
1/4-1/2
0.383 mi.
2022 ft.

MULTI-MODAL (PARCEL 5A) UST1&2
511 WEST TRADE STREET
CHARLOTTE, NC

IMD S107672015
LUST N/A

Site 4 of 5 in cluster M

Relative:
Higher

IMD:

Region: Not reported
 Facility ID: 36011
 Date Occurred: 4/28/2005
 Submit Date: 1/6/2006
 GW Contam: No Groundwater Contamination detected
 Soil Contam: Yes
 Incident Desc: UST-1 AND UST-2. TANKS AND CONTAMINATED SOIL WERE REMOVED.
 Operator: CYRUS PARKER
 Contact Phone: 9192504088
 Owner Company: NC DOT

Actual:
757 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MULTI-MODAL (PARCEL 5A) UST1&2 (Continued)

S107672015

Operator Address:1589 MAIL SERVICE CENTER
Operator City: RALEIGH
Oper City,St,Zip: RALEIGH, NC 27699
Ownership: Unknown
Operation: Not reported
Material: Not reported
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Leak-underground
Type: Gasoline/diesel
Location: Facility
Setting: Not reported
Risk Site: L
Site Priority: Not reported
Priority Code: Not reported
Priority Update: Not reported
Dem Contact: BLM
Wells Affected: Not reported
Num Affected: Not reported
Wells Contam: Not reported
Sampled By: Y
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: Not reported
Longitude: Not reported
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: EST
Agency: DWM
Facility ID: Not reported
Last Modified: Not reported
Incident Phase: Not reported
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LUST:

Facility ID: Not reported
UST Number: MO-7352
Incident Number: 36011
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 2006-01-05 00:00:00
Date Occur: 2005-04-28 00:00:00
Cleanup: 2005-04-22 00:00:00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MULTI-MODAL (PARCEL 5A) UST1&2 (Continued)

S107672015

Closure Request: Not reported
Close Out: 2006-01-06 00:00:00
Level Of Soil Cleanup Achieved: Soil to Groundwater
Tank Regulated Status: Non Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: NON COMMERCIAL
Risk Classification: L
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: Not reported
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Industrial/commercial
MTBE: No
MTBE1: Unknown
Flag: Yes
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in Archives
RBCA GW: Not reported
PETOPT: 4
RPL: True
CD Num: 289
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0
Error Code: N
Valid: False
Lat/Long: 35 13 50.28 80 50 51.18
Lat/Long Decimal: 35.230643000000001 80.847558000000006
Testlat: Not reported
Regional Officer Project Mgr: BLM
Region: Mooresville
Company: NC DOT
Contact Person: CYRUS PARKER
Telephone: 9192504088
RP Address: 1589 MAIL SERVICE CENTER
RP City,St,Zip: RALEIGH, NC 27699
RP County: Not reported
Comments: UST 1-200 GALLONS UST 2-560 GALLONS. SUSPECTED TO BE HEATING OIL.
UST-3 CLOSURE AND REMOVAL ACTIVITIES ARE DOCUMENTED UNDER SEPARATE
INCIDENT. DETECTABLE AMOUNTS OF DICHLORODIFLUOROMETHANE.
5 Min Quad: Not reported

PIRF:

Facility Id: 36011
Date Occurred: 2005-04-28 00:00:00
Date Reported: 2006-01-06 00:00:00
Description Of Incident: UST-1 AND UST-2. TANKS AND CONTAMINATED SOIL WERE REMOVED.
Owner/Operator: Not reported
Ownership: 3
Operation Type: Not reported
Type: 4
Location: 1

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

MULTI-MODAL (PARCEL 5A) UST1&2 (Continued)

S107672015

Site Priority: Not reported
 Priority Update: Not reported
 Wells Affected Y/N: Not reported
 Samples Include: Not reported
 7#5 Minute Quad: Y
 5 Minute Quad: Not reported
 Pirf/Min Soil: Not reported
 Release Code: Not reported
 Source Code: Not reported
 Err Type: 2
 Cause: Not reported
 Source: Not reported
 Ust Number: P

Last Modified: Not reported
Incident Phase: Closed Out
 NOV Issued: Not reported
 NORR Issued: Not reported
 45 Day Report: Not reported
 Public Meeting Held: Not reported
 Corrective Action Planned: Not reported
 SOC Signed: Not reported
 Reclassification Report: Not reported
 RS Designation: Not reported
 Closure Request Date: Not reported
 Close-out Report: Not reported

M61
SE
 1/4-1/2
 0.383 mi.
 2022 ft.

511 THROUGH 515 WEST TRADE STR
511-515 WEST TRADE STREET
CHARLOTTE, NC

IMD S105764915
LUST N/A

Site 5 of 5 in cluster M

Relative:
Higher

IMD:

Actual:
757 ft.

Region: MOR
 Facility ID: 23701
 Date Occurred: Not reported
 Submit Date: 10/29/2001
 GW Contam: No Groundwater Contamination detected
 Soil Contam: Yes
 Incident Desc: SOIL CONTAMINATION DISCOVERED DURING UST REMOVAL
 Operator: Not reported
 Contact Phone: Not reported
 Owner Company: UNKNOWN
 Operator Address: Not reported
 Operator City: Not reported
 Oper City,St,Zip: NC
 Ownership: Unknown
 Operation: Commercial
 Material: Not reported
 Qty Lost 1: Not reported
 Qty Recovered 1: Not reported
 Source: Leak-underground
 Type: Gasoline/diesel
 Location: Facility
 Setting: Industrial
 Risk Site: L
 Site Priority: L

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

511 THROUGH 515 WEST TRADE STR (Continued)

S105764915

Priority Code: L
Priority Update: 11/1/2001
Dem Contact: AJS
Wells Affected: No
Num Affected: Not reported
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: 35.39694444
Longitude: -81.40805555
Latitude Number: 352349
Longitude Number: 808429
Latitude Decimal: 35.39694444444444
Longitude Decimal: 81.40805555555555
GPS: 7
Agency: DWM
Facility ID: 23701
Last Modified: 10/29/2001
Incident Phase: RE
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LUST:

Facility ID: Not reported
UST Number: MO-6253
Incident Number: 23701
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 2001-10-18 00:00:00
Date Occur: Not reported
Cleanup: 2001-10-18 00:00:00
Closure Request: Not reported
Close Out: Not reported
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Non Regulated
Of Supply Wells: Not reported
Commercial/NonCommercial UST Site: NON COMMERCIAL
Risk Classification: L
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: Not reported
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

511 THROUGH 515 WEST TRADE STR (Continued)

S105764915

Land Use: Not reported
MTBE: No
MTBE1: Unknown
Flag: No
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in House
RBCA GW: Not reported
PETOPT: 4
RPL: False
CD Num: 0
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0
Error Code: Not reported
Valid: False
Lat/Long: 35 13 49.74 80 50 50.22
Lat/Long Decimal: 35.230490000000003 80.847290000000001
Testlat: Not reported
Regional Officer Project Mgr: BLM
Region: Mooresville
Company: UNKNOWN
Contact Person: Not reported
Telephone: Not reported
RP Address: Not reported
RP City,St,Zip: NC
RP County: Not reported
Comments: ORPHAN UST FOUND AS NCDOT WAS GRADING. APPEARS TO BE A 550-GALLON HEATING OIL UST. UST WAS REMOVED AND ODORS AND STAINING WAS NOTED
5 Min Quad: Not reported

PIRF:

Facility Id: 23701
Date Occurred: 2001-10-18 00:00:00
Date Reported: 2001-10-29 00:00:00
Description Of Incident: SOIL CONTAMINATION DISCOVERED DURING UST REMOVAL
Owner/Operator: Not reported
Ownership: 3
Operation Type: 6
Type: 4
Location: 1
Site Priority: L
Priority Update: 2001-11-01 00:00:00
Wells Affected Y/N: N
Samples Include: Not reported
7#5 Minute Quad: Not reported
5 Minute Quad: Not reported
Pirf/Min Soil: Not reported
Release Code: Not reported
Source Code: Not reported
Err Type: 2
Cause: Not reported
Source: C
Ust Number: C
Last Modified: 2001-10-29 00:00:00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

511 THROUGH 515 WEST TRADE STR (Continued)

S105764915

Incident Phase:	Response
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

N62
SE
1/4-1/2
0.385 mi.
2032 ft.

SPEIZMAN INDUSTRIES #2 (HEATIN
508 WEST FIFTH STREET
CHARLOTTE, NC

IMD S104914418
LUST N/A

Site 1 of 3 in cluster N

Relative:
Higher

IMD:

Actual:
748 ft.

Region: MOR
Facility ID: 22337
Date Occurred: 8/26/2000
Submit Date: 9/28/2000
GW Contam: No Groundwater Contamination detected
Soil Contam: Yes
Incident Desc: SOIL CONTAMINATION DISCOVERED DURING UST REMOVAL
Operator: Not reported
Contact Phone: Not reported
Owner Company: Not reported
Operator Address: Not reported
Operator City: Not reported
Oper City,St,Zip: NC
Ownership: Private
Operation: Industrial
Material: Not reported
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Leak-underground
Type: Gasoline/diesel
Location: Facility
Setting: Industrial
Risk Site: L
Site Priority: L
Priority Code: L
Priority Update: 9/29/2000
Dem Contact: AJS
Wells Affected: No
Num Affected: Not reported
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: 35.2325
Longitude: -80.84611111
Latitude Number: 351357
Longitude Number: 805046
Latitude Decimal: 35.2325

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SPEIZMAN INDUSTRIES #2 (HEATIN (Continued))

S104914418

Longitude Decimal: 80.84611111111111
GPS: 7
Agency: DWM
Facility ID: 22337
Last Modified: 11/14/2000
Incident Phase: Closed Out
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: 10/27/2000

Region: MOR
Facility ID: 22338
Date Occurred: Not reported
Submit Date: 9/28/2000
GW Contam: No Groundwater Contamination detected
Soil Contam: Yes
Incident Desc: SOIL CONTAMINATION DISCOVERED DURING UST REMOVAL
Operator: Not reported
Contact Phone: Not reported
Owner Company: Not reported
Operator Address: Not reported
Operator City: Not reported
Oper City,St,Zip: NC
Ownership: Private
Operation: Industrial
Material: Not reported
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Leak-underground
Type: Gasoline/diesel
Location: Facility
Setting: Industrial
Risk Site: L
Site Priority: L
Priority Code: L
Priority Update: 9/29/2000
Dem Contact: AJS
Wells Affected: No
Num Affected: Not reported
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: 35.2325
Longitude: -80.84611111
Latitude Number: 351357
Longitude Number: 805046
Latitude Decimal: 35.2325

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SPEIZMAN INDUSTRIES #2 (HEATIN (Continued))

S104914418

Longitude Decimal: 80.84611111111111
GPS: 7
Agency: DWM
Facility ID: 22338
Last Modified: 9/29/2000
Incident Phase: Closed Out
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: 9/18/2000

LUST:

Facility ID: Not reported
UST Number: MO-5986
Incident Number: 22337
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 2000-09-11 00:00:00
Date Occur: 2000-08-26 00:00:00
Cleanup: 2000-08-26 00:00:00
Closure Request: 2000-10-24 00:00:00
Close Out: 2000-10-27 00:00:00
Level Of Soil Cleanup Achieved: Residential
Tank Regulated Status: Non Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: NON COMMERCIAL
Risk Classification: L
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: Not reported
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Not reported
MTBE: No
MTBE1: Unknown
Flag: No
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in Archives
RBCA GW: Not reported
PETOPT: 4
RPL: False
CD Num: 80
Reel Num: 0
RPOW: False
RPOP: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SPEIZMAN INDUSTRIES #2 (HEATIN (Continued))

S104914418

Error Flag: 0
Error Code: Not reported
Valid: False
Lat/Long: 35 13 51.36 80 50 45.72
Lat/Long Decimal: 35.230947 80.846046999999999
Testlat: Not reported
Regional Officer Project Mgr: AJS
Region: Mooresville
Company: Not reported
Contact Person: Not reported
Telephone: Not reported
RP Address: Not reported
RP City,St,Zip: NC
RP County: Not reported
Comments: Not reported
5 Min Quad: Not reported

PIRF:

Facility Id: 22337
Date Occurred: 2000-08-26 00:00:00
Date Reported: 2000-09-28 00:00:00
Description Of Incident: SOIL CONTAMINATION DISCOVERED DURING UST REMOVAL
Owner/Operator: JOHN ANGELELLA
Ownership: 4
Operation Type: 5
Type: 4
Location: 1
Site Priority: L
Priority Update: 2000-09-29 00:00:00
Wells Affected Y/N: N
Samples Include: Not reported
7#5 Minute Quad: Not reported
5 Minute Quad: Not reported
Pirf/Min Soil: Not reported
Release Code: Not reported
Source Code: Not reported
Err Type: Not reported
Cause: Not reported
Source: Not reported
Ust Number: Not reported

Last Modified: 2000-11-14 00:00:00
Incident Phase: Closed Out
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Signed: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: 2000-10-27 00:00:00

Facility ID: 0-014540
UST Number: MO-5987
Incident Number: 22338
Contamination Type: Soil

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SPEIZMAN INDUSTRIES #2 (HEATIN (Continued))

S104914418

Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 1990-04-03 00:00:00
Date Occur: Not reported
Cleanup: 1990-04-03 00:00:00
Closure Request: 2000-09-18 00:00:00
Close Out: 2000-09-18 00:00:00
Level Of Soil Cleanup Achieved: Soil to Groundwater
Tank Regulated Status: Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: L
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: Not reported
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Not reported
MTBE: No
MTBE1: Unknown
Flag: Yes
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in Archives
RBCA GW: Not reported
PETOPT: 3
RPL: False
CD Num: 80
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0
Error Code: Not reported
Valid: False
Lat/Long: 35 13 51.48 80 50 44.04
Lat/Long Decimal: 35.230978999999998 80.845589000000004
Testlat: Not reported
Regional Officer Project Mgr: AJS
Region: Mooresville
Company: Not reported
Contact Person: Not reported
Telephone: Not reported
RP Address: Not reported
RP City,St,Zip: NC
RP County: Not reported
Comments: Not reported
5 Min Quad: Not reported

PIRF:

Facility Id: 22338
Date Occurred: 1990-04-13 00:00:00
Date Reported: 2000-09-28 00:00:00
Description Of Incident: SOIL CONTAMINATION DISCOVERED DURING UST REMOVAL
Owner/Operator: JOHN ANGELELLA
Ownership: 4

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

SPEIZMAN INDUSTRIES #2 (HEATIN (Continued))

S104914418

Operation Type:	5
Type:	3
Location:	1
Site Priority:	L
Priority Update:	2000-09-29 00:00:00
Wells Affected Y/N:	N
Samples Include:	Not reported
7#5 Minute Quad:	Not reported
5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Not reported
Err Type:	Not reported
Cause:	Not reported
Source:	Not reported
Ust Number:	Not reported
Last Modified:	2000-09-29 00:00:00
Incident Phase:	Closed Out
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	2000-09-18 00:00:00

O63
 SE
 1/4-1/2
 0.388 mi.
 2047 ft.

**SERVCO SERVICE DIST. CO.
 120 SOUTH GRAHAM ST.
 CHARLOTTE, NC**

**LUST TRUST S105218326
 N/A**

Site 1 of 4 in cluster O

**Relative:
 Higher**

LUST TRUST:	
Facility ID:	0-014070
Site ID:	8097
Site Note:	Not reported
Site Eligible?:	True
Commercial Find:	100% Commercial
Priority Rank:	Low
Deductable Amount:	50000
3rd Party Deductable Amt:	100000
Sum 3rd Party Amt Applied:	0

**Actual:
 753 ft.**

[Click this hyperlink](#) while viewing on your computer to access additional NC LUST TRUST: detail in the EDR Site Report.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

O64
SE
1/4-1/2
0.388 mi.
2047 ft.

SERVCO SERVICE STATION
120 SOUTH GRAHAM STREET
CHARLOTTE, NC

IMD S101523547
LUST N/A

Site 2 of 4 in cluster O

Relative:
Higher

IMD:

Actual:
753 ft.

Region: MOR
Facility ID: 8097
Date Occurred: 5/16/1991
Submit Date: 6/3/1992
GW Contam: Yes, Groundwater Contamination has been detected
Soil Contam: No
Incident Desc: SOIL SAMPLE DURING TANK REMOVAL INDICATED PETROLEUM CONTAMINATION. GW IN TANK PIT HAD PETROLEUM SHEEN.
Operator: SERVICE DISTRIBUTING COMPANY
Contact Phone: 704-982-2197
Owner Company: MR. RICK SMITH
Operator Address: PO BOX 310
Operator City: ALBEMARLE
Oper City, St, Zip: ALBEMARLE, NC 28001
Ownership: Private
Operation: Commercial
Material: PETROLEUM
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Leak-underground
Type: Gasoline/diesel
Location: Facility
Setting: Urban
Risk Site: L
Site Priority: 110E
Priority Code: L
Priority Update: 5/15/1998
Dem Contact: EGL
Wells Affected: No
Num Affected: 0
Wells Contam: Not reported
Sampled By: Responsible Parties
Samples Include: Groundwater Samples
7.5 Min Quad: Not reported
5 Min Quad: R 66 J
Latitude: 35.23055555
Longitude: -80.84722222
Latitude Number: 351350
Longitude Number: 805050
Latitude Decimal: 35.2305555555556
Longitude Decimal: 80.8472222222222
GPS: 7
Agency: DWM
Facility ID: 8097
Last Modified: Not reported
Incident Phase: Follow Up
NOV Issued: 8/13/2002
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SERVCO SERVICE STATION (Continued)

S101523547

Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LUST:

Facility ID: 0-014070
UST Number: MO-3214
Incident Number: 8097
Contamination Type: Groundwater/Both
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 1991-07-05 00:00:00
Date Occur: 1991-05-16 00:00:00
Cleanup: 1991-05-16 00:00:00
Closure Request: Not reported
Close Out: Not reported
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: L
Risk Class Based On Review: I
Corrective Action Plan Type: Not reported
NOV Issue Date: 1991-08-06 00:00:00
NORR Issue Date: Not reported
Site Priority: 110E
Phase Of LSA Req: Not reported
Site Risk Reason: Gross contaminant levels
Land Use: Not reported
MTBE: Not reported
MTBE1: Unknown
Flag: Yes
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in House
RBCA GW: Not reported
PETOPT: 3
RPL: False
CD Num: 0
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0
Error Code: Not reported
Valid: False
Lat/Long: 35 13 48.48 80 50 52.8
Lat/Long Decimal: 35.230145999999998 80.848015000000004
Testlat: Not reported
Regional Officer Project Mgr: DPB
Region: Mooresville
Company: MR. RICK SMITH
Contact Person: SERVICE DISTRIBUTING COMPANY
Telephone: 704-982-2197
RP Address: PO BOX 310

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

SERVCO SERVICE STATION (Continued)

S101523547

RP City,St,Zip: ALBEMARLE, NC 28001
 RP County: Not reported
 Comments: NOV 8/13/02 for failure to submit FR recovery report. Due 8/26/02.
 Received FPRR 7/17/03 and put on semi-annual schedule Jan & July
 reporting. Passive skimmer in MW-2 with monthly site visits to
 service. No soil data by risk based methods. (old Coor 35.1350
 80.5050)
 5 Min Quad: R66J

PIRF:

Facility Id: 8097
 Date Occurred: 1991-05-16 00:00:00
 Date Reported: 1992-06-03 00:00:00
 Description Of Incident: SOIL SAMPLE DURING TANK REMOVAL INDICATED PETROLEUM CONTAMINATION. GW
 IN TANK PIT HAD PETROLEUM SHEEN.
 Owner/Operator: SERVICE DISTRIBUTING COMPANY
 Ownership: 4
 Operation Type: 6
 Type: 3
 Location: 1
 Site Priority: 110E
 Priority Update: 1998-05-15 00:00:00
 Wells Affected Y/N: N
 Samples Include: 0
 7#5 Minute Quad: 3
 5 Minute Quad: 1
 Pirf/Min Soil: Not reported
 Release Code: R 66 J
 Source Code: Pirf
 Err Type: Not reported
 Cause: Not reported
 Source: Not reported
 Ust Number: Not reported

Last Modified: Not reported
Incident Phase: Follow Up
 NOV Issued: 2002-08-13 00:00:00
 NORR Issued: Not reported
 45 Day Report: Not reported
 Public Meeting Held: Not reported
 Corrective Action Planned: Not reported
 SOC Signed: Not reported
 Reclassification Report: Not reported
 RS Designation: Not reported
 Closure Request Date: Not reported
 Close-out Report: Not reported

O65
SE
 1/4-1/2
 0.389 mi.
 2053 ft.

JAMES K POLK BUILDING
500 WEST TRADE STREET SUITE 37
CHARLOTTE, NC
 Site 3 of 4 in cluster O

IMD S103916812
LUST N/A

Relative:
Higher

IMD:
 Region: MOR
 Facility ID: 20127
 Date Occurred: 1/8/1999
 Submit Date: 6/7/1999

Actual:
760 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

JAMES K POLK BUILDING (Continued)

S103916812

GW Contam: No Groundwater Contamination detected
Soil Contam: Yes
Incident Desc: 500 GAL DIESEL TANK REMOVED; TPH HIGH BY 5030/3550; COULD ONLY SAMPLE IN SOUTH & EAST ENDS OF CONCRETE PADS DUE TO CLOSE PROXIMITY TO BLDG.
Operator: ROY HIGGINS
Contact Phone: 704.342.6366
Owner Company: NC DEPT OF ADMINISTRATION
Operator Address: 500 WEST TRADE ST. SUITE 371
Operator City: CHARLOTTE
Oper City, St, Zip: CHARLOTTE, NC 28202
Ownership: Private
Operation: Industrial
Material: DIESEL
Qty Lost 1: Not reported
Qty Recovered 1: UNKNOWN
Source: Leak-underground
Type: Gasoline/diesel
Location: Facility
Setting: Urban
Risk Site: L
Site Priority: Not reported
Priority Code: Not reported
Priority Update: 6/21/1999
Dem Contact: BDM
Wells Affected: Not reported
Num Affected: Not reported
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: 35.23083333
Longitude: -80.84722222
Latitude Number: 351351
Longitude Number: 805050
Latitude Decimal: 35.23083333333333
Longitude Decimal: 80.84722222222222
GPS: 7
Agency: DWM
Facility ID: 20127
Last Modified: 9/27/1999
Incident Phase: Closed Out
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighed: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: 9/22/1999

Region: Not reported
Facility ID: 27999
Date Occurred: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

JAMES K POLK BUILDING (Continued)

S103916812

Submit Date: 8/18/2005
GW Contam: Yes, Groundwater Contamination has been detected
Soil Contam: No
Incident Desc: Not reported
Operator: UNKNOWN
Contact Phone: Not reported
Owner Company: UNKNOWN
Operator Address: Not reported
Operator City: Not reported
Oper City, St, Zip: NC
Ownership: Private
Operation: Commercial
Material: Not reported
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Leak-underground
Type: Gasoline/diesel
Location: Facility
Setting: Not reported
Risk Site: L
Site Priority: Not reported
Priority Code: Not reported
Priority Update: Not reported
Dem Contact: AJS
Wells Affected: No
Num Affected: Not reported
Wells Contam: Not reported
Sampled By: Y
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: Not reported
Longitude: Not reported
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: EST
Agency: DWM
Facility ID: Not reported
Last Modified: Not reported
Incident Phase: Not reported
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LUST:

Facility ID: 0-001081
UST Number: MO-5718

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

JAMES K POLK BUILDING (Continued)

S103916812

Incident Number: 20127
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 1999-06-03 00:00:00
Date Occur: 1999-01-08 00:00:00
Cleanup: 1999-01-08 00:00:00
Closure Request: 1999-09-16 00:00:00
Close Out: 1999-09-22 00:00:00
Level Of Soil Cleanup Achieved: Industrial/Commercial
Tank Regulated Status: Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: L
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: 1999-06-07 00:00:00
Site Priority: Not reported
Phase Of LSA Req: 1
Site Risk Reason: Not reported
Land Use: Not reported
MTBE: Not reported
MTBE1: Unknown
Flag: No
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in Archives
RBCA GW: Not reported
PETOPT: 3
RPL: False
CD Num: 76
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0
Error Code: Not reported
Valid: False
Lat/Long: 35 13 51.42 80 50 48.9
Lat/Long Decimal: 35.230964999999998 80.846922000000006
Testlat: Not reported
Regional Officer Project Mgr: BDM
Region: Mooresville
Company: NC DEPT OF ADMINISTRATION
Contact Person: ROY HIGGINS
Telephone: 704.342.6366
RP Address: 500 WEST TRADE ST. SUITE 371
RP City,St,Zip: CHARLOTTE, NC 28202
RP County: MECK
Comments: 1-500-GALLON EMERGENCY GENERATOR UST
5 Min Quad: R66J

PIRF:

Facility Id: 20127
Date Occurred: 1999-01-08 00:00:00
Date Reported: 1999-06-07 00:00:00
Description Of Incident: 500 GAL DIESEL TANK REMOVED; TPH HIGH BY 5030/3550; COULD ONLY SAMPLE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

JAMES K POLK BUILDING (Continued)

S103916812

IN SOUTH & EAST ENDS OF CONCRETE PADS DUE TO CLOSE PROXIMITY TO BLDG.
NC DEPT OF ADMINISTRATION
Owner/Operator: 4
Ownership: 5
Operation Type: 3
Type: 1
Location: Not reported
Site Priority: 1999-06-21 00:00:00
Priority Update: Not reported
Wells Affected Y/N: Not reported
Samples Include: Not reported
7#5 Minute Quad: Not reported
5 Minute Quad: Not reported
Pirf/Min Soil: Not reported
Release Code: Not reported
Source Code: MIN_SOIL
Err Type: Not reported
Cause: Not reported
Source: Not reported
Ust Number: Not reported

Last Modified: 1999-09-27 00:00:00
Incident Phase: Closed Out
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Signed: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: 1999-09-22 00:00:00

Facility ID: Not reported
UST Number: MO-7342
Incident Number: 27999
Contamination Type: Groundwater/Both
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 2005-08-18 00:00:00
Date Occur: Not reported
Cleanup: 2008-02-14 00:00:00
Closure Request: Not reported
Close Out: 2008-05-20 00:00:00
Level Of Soil Cleanup Achieved: Residential
Tank Regulated Status: Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: U
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: Not reported
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Industrial/commercial

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

JAMES K POLK BUILDING (Continued)

S103916812

MTBE: No
MTBE1: No
Flag: No
Flag1: No
LUR Filed: 2008-05-22 00:00:00
Release Detection: 0
Current Status: File Located in House
RBCA GW: Cleanups to alternate standards
PETOPT: 3
RPL: False
CD Num: 0
Reel Num: 0
RPOW: True
RPOP: True
Error Flag: 0
Error Code: N
Valid: False
Lat/Long: 35 13 55.56 80 50 49.74
Lat/Long Decimal: 35.232109999999999 80.847149999999999
Testlat: Not reported
Regional Officer Project Mgr: AJS
Region: Mooresville
Company: UNKNOWN
Contact Person: UNKNOWN
Telephone: Not reported
RP Address: Not reported
RP City,St,Zip: NC
RP County: Not reported
Comments: OLD GAS STATION AT SITE BETWEEN 1920'S AND 1950'S. USTS PREVIOUSLY
REMOVED PROBABLY WHEN POLK BUILDING BUILT
5 Min Quad: Not reported

PIRF:

Facility Id: 27999
Date Occurred: 2005-06-10 00:00:00
Date Reported: 2005-08-18 00:00:00
Description Of Incident: Not reported
Owner/Operator: Not reported
Ownership: 4
Operation Type: 6
Type: 3
Location: 1
Site Priority: Not reported
Priority Update: Not reported
Wells Affected Y/N: N
Samples Include: Not reported
7#5 Minute Quad: Y
5 Minute Quad: Not reported
Pirf/Min Soil: Not reported
Release Code: Not reported
Source Code: Not reported
Err Type: 3
Cause: Not reported
Source: Not reported
Ust Number: P

Last Modified: Not reported
Incident Phase: Closed Out

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

JAMES K POLK BUILDING (Continued)

S103916812

NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Signed: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

O66
SE
1/4-1/2
0.391 mi.
2063 ft.

CHARTER PROPERTIES, INC.
W.TRADE STREET AND N. GRAHAM
CHARLOTTE, NC

Site 4 of 4 in cluster O

IMD S101168228
LUST N/A

Relative:
Higher

IMD:

Actual:
758 ft.

Region: MOR
Facility ID: 6921
Date Occurred: Not reported
Submit Date: 9/17/1991
GW Contam: Yes, Groundwater Contamination has been detected
Soil Contam: No
Incident Desc: PETROLEUM HYDROCARBONS WERE PRESENT IN THE SAMPLES TAKEN FROM SITE.
Operator: MR. JIM HOMAN
Contact Phone: Not reported
Owner Company: CHARTER PROPERTIES
Operator Address: 1100 SOUTH TRYON ST. SUITE 300
Operator City: CHARLOTTE
Oper City,St,Zip: CHARLOTTE, NC 282034239
Ownership: Private
Operation: Commercial
Material: GASOLINE
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Leak-underground
Type: Gasoline/diesel
Location: Facility
Setting: Urban
Risk Site: L
Site Priority: 050E
Priority Code: L
Priority Update: 5/15/1998
Dem Contact: EGL
Wells Affected: No
Num Affected: 0
Wells Contam: Not reported
Sampled By: Responsible Parties
Samples Include: Groundwater Samples
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: 35.22972222
Longitude: -80.84583333
Latitude Number: 351347
Longitude Number: 805045
Latitude Decimal: 35.229722222222
Longitude Decimal: 80.845833333333

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CHARTER PROPERTIES, INC. (Continued)

S101168228

GPS: 7
Agency: DWM
Facility ID: 6921
Last Modified: Not reported
Incident Phase: RE
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LUST:

Facility ID: Not reported
UST Number: MO-3115
Incident Number: 6921
Contamination Type: Groundwater/Both
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 1989-11-22 00:00:00
Date Occur: Not reported
Cleanup: 1989-11-22 00:00:00
Closure Request: Not reported
Close Out: Not reported
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: L
Risk Class Based On Review: I
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: 2010-10-21 00:00:00
Site Priority: 050E
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Not reported
MTBE: Not reported
MTBE1: Unknown
Flag: No
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in House
RBCA GW: Not reported
PETOPT: 3
RPL: False
CD Num: 0
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CHARTER PROPERTIES, INC. (Continued)

S101168228

Error Code: Not reported
Valid: False
Lat/Long: 35 13 51.06 80 50 43.26
Lat/Long Decimal: 35.230851999999999 80.845359999999999
Testlat: Not reported
Regional Officer Project Mgr: DPB
Region: Mooresville
Company: City View Associates, LLC
Contact Person: Jeff LaPiana
Telephone: Not reported
RP Address: 201 S Tryon St, Suite 550
RP City,St,Zip: Charlotte, NC 282034239
RP County: MECKLENBURG

Comments: current property owner has hired consultant. New wells are needed Charter Property was formerly owned by Trailways and Four States Realty Co. both known fuel users and operators of bus lines. Named TCI, Inc. (Trailways) as RP. Four USTs at corner of N. Graham and W. Trade. Two large USTs along W. Fifth Street by Old Garage. Soil contamination reported at all locations. Free product near W. Fifth Street may be from adjoining Blackmon Property that has same RP. Tanks #4-1K, #5A-3K, #5B-3K, #5C-3K, #5D-3K, #7-10K gas, #8-6K gas. Soil was excavated to 2 ft below tank sample tanken and soil put back in pit. 2.17.2004 Soil Cleanup Plan submitted on behalf of City View Associates, LLC documenting voluntary soil removal activity by the property owner and a plan for free product recovery was being developed. Student dorm to be built on site. (old Coor 35.1347 80.5045)
5 Min Quad: R66J

PIRF:

Facility Id: 6921
Date Occurred: 1989-09-01 00:00:00
Date Reported: 1991-09-17 00:00:00
Description Of Incident: PETROLEUM HYDROCARBONS WERE PRESENT IN THE SAMPLES TAKEN FROM SITE.
Owner/Operator: MR. JIM HOMAN
Ownership: 4
Operation Type: 6
Type: 3
Location: 1
Site Priority: 050E
Priority Update: 1998-05-15 00:00:00
Wells Affected Y/N: N
Samples Include: 0
7#5 Minute Quad: 3
5 Minute Quad: 1
Pirf/Min Soil: Not reported
Release Code: Not reported
Source Code: Pirf
Err Type: Not reported
Cause: Not reported
Source: Not reported
Ust Number: Not reported

Last Modified: Not reported
Incident Phase: Response
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CHARTER PROPERTIES, INC. (Continued)

S101168228

Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Signed: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

N67
SE
1/4-1/2
0.391 mi.
2063 ft.

WEST 5TH STREET PARKING LOT
519 WEST 5TH ST/500 W TRADE
CHARLOTTE, NC 28202

LUST S108493037
N/A

Site 2 of 3 in cluster N

Relative:
Higher

LUST:

Actual:
757 ft.

Facility ID: Not reported
UST Number: MO-7580
Incident Number: 36218
Contamination Type: Groundwater/Both
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 2007-02-23 00:00:00
Date Occur: Not reported
Cleanup: 2008-02-25 00:00:00
Closure Request: Not reported
Close Out: 2008-05-27 00:00:00
Level Of Soil Cleanup Achieved: Residential
Tank Regulated Status: Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: I
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: Not reported
Phase Of LSA Req: Not reported
Site Risk Reason: Gross contaminant levels
Land Use: Residential
MTBE: No
MTBE1: No
Flag: Yes
Flag1: No
LUR Filed: 2007-05-28 00:00:00
Release Detection: 0
Current Status: File Located in House
RBCA GW: Cleanups to alternate standards
PETOPT: 3
RPL: True
CD Num: 0
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0
Error Code: N
Valid: False
Lat/Long: 35 13 54.48 80 50 48.66
Lat/Long Decimal: 35.231808000000001 80.846855000000005

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WEST 5TH STREET PARKING LOT (Continued)

S108493037

Testlat: Not reported
Regional Officer Project Mgr: AJS
Region: Mooresville
Company: CITY OF CHARLOTTE
Contact Person: Not reported
Telephone: 7043362291
RP Address: 600 EAST 4TH STREET
RP City,St,Zip: CHARLOTTE, NC 28202
RP County: Not reported
Comments: SANBORN MAPS INDICATE SYMBOLS IN THE AREA OF PETROLEUM CONTAMINATION
CONSISTENT WITH USTS.
5 Min Quad: Not reported

PIRF:
Facility Id: 36218
Date Occurred: Not reported
Date Reported: 2007-02-23 00:00:00
Description Of Incident: SANBORN MAPS INDICATE USTS HOWEVER SPECIFICS UNKNOWN
Owner/Operator: Not reported
Ownership: 1
Operation Type: Not reported
Type: Not reported
Location: 1
Site Priority: Not reported
Priority Update: Not reported
Wells Affected Y/N: Not reported
Samples Include: Not reported
7#5 Minute Quad: Y
5 Minute Quad: Not reported
Pirf/Min Soil: Not reported
Release Code: Not reported
Source Code: Not reported
Err Type: 9
Cause: Not reported
Source: Not reported
Ust Number: P

Last Modified: Not reported
Incident Phase: Closed Out
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Signed: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

P68
WNW
1/4-1/2
0.401 mi.
2119 ft.

SISKRON
211 TUCKASEEGEE ROAD
CHARLOTTE, NC

SHWS **S102001197**
IMD **N/A**
LUST

Site 1 of 2 in cluster P

Relative:
Higher

SHWS:

Facility ID: NONCD0001507
Facility Type: Inactive Hazardous Sites and Pollutant-Only Sites
Lat/Longitude: 35.236666 / -80.860555
Geolocation Method: UNKNOWN

Actual:
726 ft.

IMD:

Region: MOR
Facility ID: 15246
Date Occurred: 2/1/1996
Submit Date: 3/28/1996
GW Contam: Yes, Groundwater Contamination has been detected
Soil Contam: No
Incident Desc: AFTER UST REMOVAL SOIL SAMPLES CONFIRMED CONTAMINATION.
Operator: MRS. ELEANOR SISKRON
Contact Phone: Not reported
Owner Company: Not reported
Operator Address: 5600 SARDIS ROAD
Operator City: CHARLOTTE
Oper City, St, Zip: CHARLOTTE, NC 28270
Ownership: Private
Operation: Commercial
Material: PETROLEUM
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Leak-underground
Type: Gasoline/diesel
Location: Facility
Setting: Urban
Risk Site: L
Site Priority: Not reported
Priority Code: Not reported
Priority Update: Not reported
Dem Contact: AJS
Wells Affected: Not reported
Num Affected: 0
Wells Contam: Not reported
Sampled By: Responsible Parties
Samples Include: Soil Samples
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: Not reported
Longitude: Not reported
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: NOD
Agency: DWM
Facility ID: 15246
Last Modified: 7/18/2001
Incident Phase: Closed Out
NOV Issued: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SISKRON (Continued)

S102001197

NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: 5/11/2001

LUST:

Facility ID: Not reported
UST Number: MO-4557
Incident Number: 15246
Contamination Type: Groundwater/Both
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 1996-03-28 00:00:00
Date Occur: 1996-02-01 00:00:00
Cleanup: 1996-02-01 00:00:00
Closure Request: 2001-04-19 00:00:00
Close Out: 2001-05-11 00:00:00
Level Of Soil Cleanup Achieved: Industrial/Commercial
Tank Regulated Status: Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: L
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: E?
Phase Of LSA Req: 1
Site Risk Reason: Not reported
Land Use: Industrial/commercial
MTBE: Not reported
MTBE1: Unknown
Flag: No
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in Archives
RBCA GW: Cleanups to alternate standards
PETOPT: 3
RPL: False
CD Num: 78
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0
Error Code: Not reported
Valid: False
Lat/Long: 35 14 12.18 80 51 39.06
Lat/Long Decimal: 35.236730000000001 80.860866000000001
Testlat: Not reported
Regional Officer Project Mgr: AJS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SISKRON (Continued)

S102001197

Region: Mooresville
Company: Not reported
Contact Person: MRS. ELEANOR SISKRON
Telephone: Not reported
RP Address: 5600 SARDIS ROAD
RP City,St,Zip: CHARLOTTE, NC 28270
RP County: ME
Comments: Not reported
5 Min Quad: Not reported

PIRF:

Facility Id: 15246
Date Occurred: 1996-02-01 00:00:00
Date Reported: 1996-03-28 00:00:00
Description Of Incident: AFTER UST REMOVAL SOIL SAMPLES CONFIRMED CONTAMINATION.
Owner/Operator: ELEANOR SISKRON
Ownership: 4
Operation Type: 6
Type: 3
Location: 1
Site Priority: Not reported
Priority Update: Not reported
Wells Affected Y/N: Not reported
Samples Include: 0
7#5 Minute Quad: 3
5 Minute Quad: 2
Pirf/Min Soil: Not reported
Release Code: Not reported
Source Code: Pirf
Err Type: Not reported
Cause: Not reported
Source: Not reported
Ust Number: Not reported

Last Modified: 2001-07-18 00:00:00
Incident Phase: Closed Out
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Signed: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: 2001-05-11 00:00:00

P69
WNW
1/4-1/2
0.401 mi.
2119 ft.

FORMER CITY PLUMBING & HEATING
211 TUCKASEEGEE ROAD
CHARLOTTE, NC
Site 2 of 2 in cluster P

IMD S105043243
N/A

Relative:
Higher

IMD:
Region: MOR
Facility ID: 85736
Date Occurred: 5/17/2001
Submit Date: 5/17/2001

Actual:
726 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FORMER CITY PLUMBING & HEATING (Continued)

S105043243

GW Contam: Yes, Groundwater Contamination has been detected
Soil Contam: Not reported
Incident Desc: UST SITE #15246 (SISKRON) WAS CLOSED BY RISK. HOWEVER, MW1 CONTAINED LOW, BUT >2L LEVELS OF PCE & LEAD.
Operator: UNKNOWN,
Contact Phone: Not reported
Owner Company: Not reported
Operator Address: Not reported
Operator City: Not reported
Oper City, St, Zip: Not reported
Ownership: Not Reported
Operation: Not Reported
Material: Not reported
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Unknown
Type: Other inorganics
Location: Not reported
Setting: Not reported
Risk Site: Not reported
Site Priority: Not reported
Priority Code: E
Priority Update: Not reported
Dem Contact: AHP
Wells Affected: No
Num Affected: 0
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: Not reported
Longitude: Not reported
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: EST
Agency: DWQ
Facility ID: 85736
Last Modified: 5/17/2001
Incident Phase: Discovery
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Signed: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

MAP FINDINGS

Map ID			EDR ID Number
Direction			EPA ID Number
Distance			
Elevation	Site	Database(s)	

N70 SE 1/4-1/2 0.410 mi. 2163 ft.	FROEHLING AND ROBERTSON, INC. 208 N GRAHAM ST CHARLOTTE, NC Site 3 of 3 in cluster N	SHWS	S104918990 N/A
---	---	-------------	---------------------------------

Relative: Higher	SHWS: Facility ID:	NCD024473423 Facility Type: SITES REQUIRING NO FURTHER Lat/Longitude: Not reported Geolocation Method: Not reported
Actual: 751 ft.		

Q71 ENE 1/4-1/2 0.414 mi. 2188 ft.	SOUTHERN MANUFACTURING 1000 SEABOARD STREET CHARLOTTE, NC Site 1 of 2 in cluster Q	BROWNFIELDS	S106032104 N/A
--	---	--------------------	---------------------------------

Relative: Higher	BROWNFIELDS: Project Type:	FINALIZED BROWNFIELDS AGREEMENTS PD: Contact Name: Fiber Mills, LLC Comments: This 9-acre site located in inner Charlotte was a former asbestos tile manufacturing facility. Asbestos was discontinued in 1986, and the facility was closed in 1999. The site has asbestos contamination in soils. Intended reuse of the site includes an outdoor amphitheater, a technical business park, or a mixed-use development with industrial, commercial, and residential uses.
Actual: 728 ft.		

Q72 ENE 1/4-1/2 0.414 mi. 2188 ft.	SOUTHERN MANUFACTURING, INC 1000 SEABOARD STREET CHARLOTTE, NC Site 2 of 2 in cluster Q	SHWS IMD	S103554562 N/A
--	--	---------------------------	---------------------------------

Relative: Higher	SHWS: Facility ID:	NCD990715658 Facility Type: Inactive Hazardous Sites and Pollutant-Only Sites Lat/Longitude: 35.2557903539781 / -80.845274321111 Geolocation Method: HARD COPY MAP
Actual: 728 ft.		

IMD:	
Region:	MOR
Facility ID:	85674
Date Occurred:	5/15/2001
Submit Date:	5/15/2001
GW Contam:	No data entered (data entry person submitted a blank field)
Soil Contam:	Not reported
Incident Desc:	NO FILE AT MRO. INACTIVE HAZ WASTE SITE, CONTACT DWM IN RALEIGH FOR ADDITIONAL INFO. 2/03: ELIGIBLE FOR BROWNFIELDS.
Operator:	,
Contact Phone:	Not reported
Owner Company:	Not reported
Operator Address:	Not reported
Operator City:	Not reported
Oper City,St,Zip:	Not reported
Ownership:	Not Reported
Operation:	Not Reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOUTHERN MANUFACTURING, INC (Continued)

S103554562

Material: Not reported
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Unknown
Type: Other inorganics
Location: Not reported
Setting: Not reported
Risk Site: Not reported
Site Priority: Not reported
Priority Code: NOD
Priority Update: Not reported
Dem Contact: DWM
Wells Affected: No
Num Affected: 0
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: Not reported
Longitude: Not reported
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: EST
Agency: DWQ
Facility ID: 85674
Last Modified: 2/21/2003
Incident Phase: NOD
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

73
SSE
1/4-1/2
0.416 mi.
2195 ft.

**FITZGERALD PROPERTY
315 S GRAHAM STREET
CHARLOTTE, NC**

**IMD S102443467
LUST N/A**

**Relative:
Higher**

IMD:

**Actual:
734 ft.**

Region: MOR
Facility ID: 16646
Date Occurred: 1/16/1996
Submit Date: 12/18/1996
GW Contam: No Groundwater Contamination detected
Soil Contam: Yes
Incident Desc: 2,000 GALLON TANK WAS REMOVED AND TPH DIESEL FOUND AT 51PPM.
Operator: JOHN GRANT
Contact Phone: 704-875-5496

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FITZGERALD PROPERTY (Continued)

S102443467

Owner Company: DUKE POWER
Operator Address:13339 HAGERS FERRY ROAD
Operator City: HUNTERSVILLE
Oper City,St,Zip: HUNTERSVILLE, NC 28078
Ownership: Private
Operation: Commercial
Material: Not reported
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Leak-underground
Type: Gasoline/diesel
Location: Residence
Setting: Urban
Risk Site: L
Site Priority: 020E
Priority Code: L
Priority Update: 5/30/1998
Dem Contact: AJS
Wells Affected: Not reported
Num Affected: 0
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: Not reported
Longitude: Not reported
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: NOD
Agency: DWM
Facility ID: 16646
Last Modified: 2/24/1999
Incident Phase: Closed Out
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: 12/17/1996

LUST:

Facility ID: Not reported
UST Number: MO-4901
Incident Number: 16646
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 1996-12-18 00:00:00
Date Occur: 1996-01-16 00:00:00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FITZGERALD PROPERTY (Continued)

S102443467

Cleanup: 1996-01-16 00:00:00
Closure Request: Not reported
Close Out: 1996-12-17 00:00:00
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Non Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: L
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: 020E
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Not reported
MTBE: Not reported
MTBE1: Unknown
Flag: No
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in Archives
RBCA GW: Not reported
PETOPT: Not reported
RPL: False
CD Num: 5
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0
Error Code: Not reported
Valid: False
Lat/Long: 35 13 42.54 80 50 57.12
Lat/Long Decimal: 35.228496999999997 80.849200999999994
Testlat: Not reported
Regional Officer Project Mgr: AJS
Region: Mooresville
Company: DUKE POWER
Contact Person: JOHN GRANT
Telephone: 704-875-5496
RP Address: 13339 HAGERS FERRY ROAD
RP City,St,Zip: HUNTERVILLE, NC 28078
RP County: MECKLENBURG
Comments: Not reported
5 Min Quad: Not reported

PIRF:

Facility Id: 16646
Date Occurred: 1996-11-16 00:00:00
Date Reported: 1996-12-18 00:00:00
Description Of Incident: 2,000 GALLON TANK WAS REMOVED AND TPH DIESEL FOUND AT 51PPM.
Owner/Operator: JOHN GRANT
Ownership: 4
Operation Type: 6
Type: 3
Location: 7
Site Priority: 020E

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

FITZGERALD PROPERTY (Continued)

S102443467

Priority Update: 1998-05-30 00:00:00
 Wells Affected Y/N: Not reported
 Samples Include: 0
 7#5 Minute Quad: Not reported
 5 Minute Quad: Not reported
 Pirf/Min Soil: Not reported
 Release Code: Not reported
 Source Code: Min_Soil
 Err Type: Not reported
 Cause: Not reported
 Source: Not reported
 Ust Number: Not reported

Last Modified: 1999-02-24 00:00:00
Incident Phase: Closed Out
 NOV Issued: Not reported
 NORR Issued: Not reported
 45 Day Report: Not reported
 Public Meeting Held: Not reported
 Corrective Action Planned: Not reported
 SOC Signed: Not reported
 Reclassification Report: Not reported
 RS Designation: Not reported
 Closure Request Date: Not reported
 Close-out Report: 1996-12-17 00:00:00

74
East
1/4-1/2
0.424 mi.
2241 ft.

NCDOT-MCKEITHEN PROPERTY
600 W 8TH STREET
CHARLOTTE, NC

IMD S107672005
LUST N/A

Relative:
Higher

IMD:
 Region: Not reported
 Facility ID: 36001
 Date Occurred: Not reported
 Submit Date: 5/6/1999
 GW Contam: No Groundwater Contamination detected
 Soil Contam: Yes
 Incident Desc: Not reported
 Operator: Not reported
 Contact Phone: Not reported
 Owner Company: Not reported
 Operator Address: Not reported
 Operator City: Not reported
 Oper City,St,Zip: NC
 Ownership: Unknown
 Operation: Industrial
 Material: Not reported
 Qty Lost 1: Not reported
 Qty Recovered 1: Not reported
 Source: Leak-underground
 Type: Gasoline/diesel
 Location: Facility
 Setting: Not reported
 Risk Site: L
 Site Priority: Not reported
 Priority Code: Not reported

Actual:
761 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NCDOT-MCKEITHEN PROPERTY (Continued)

S107672005

Priority Update: Not reported
Dem Contact: AJS
Wells Affected: No
Num Affected: Not reported
Wells Contam: Not reported
Sampled By: Y
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: Not reported
Longitude: Not reported
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: EST
Agency: DWM
Facility ID: Not reported
Last Modified: Not reported
Incident Phase: Not reported
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LUST:

Facility ID: Not reported
UST Number: MO-7344
Incident Number: 36001
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 1999-05-06 00:00:00
Date Occur: 1999-05-06 00:00:00
Cleanup: 1999-11-09 00:00:00
Closure Request: Not reported
Close Out: Not reported
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: L
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: Not reported
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Industrial/commercial

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NCDOT-MCKEITHEN PROPERTY (Continued)

S107672005

MTBE: No
MTBE1: Unknown
Flag: No
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in House
RBCA GW: Not reported
PETOPT: 3
RPL: False
CD Num: 0
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0
Error Code: N
Valid: False
Lat/Long: 35 14 4.92 80 50 37.2
Lat/Long Decimal: 35.23469999999997 80.843680000000006
Testlat: Not reported
Regional Officer Project Mgr: DPB
Region: Mooresville
Company: Not reported
Contact Person: Not reported
Telephone: Not reported
RP Address: Not reported
RP City,St,Zip: NC
RP County: Not reported
Comments: 1-FORMER WASTE OIL UST (AREA 6) AND 1-FORMER DIESEL FUEL UST (AREA(4/5))
5 Min Quad: Not reported

PIRF:

Facility Id: 36001
Date Occurred: 1998-09-18 00:00:00
Date Reported: 1999-05-06 00:00:00
Description Of Incident: Not reported
Owner/Operator: Not reported
Ownership: 3
Operation Type: 5
Type: 3
Location: 1
Site Priority: Not reported
Priority Update: Not reported
Wells Affected Y/N: N
Samples Include: Not reported
7#5 Minute Quad: Y
5 Minute Quad: Not reported
Pirf/Min Soil: Not reported
Release Code: Not reported
Source Code: Not reported
Err Type: 3
Cause: Not reported
Source: Not reported
Ust Number: P

Last Modified: Not reported
Incident Phase: Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

NCDOT-MCKEITHEN PROPERTY (Continued)

S107672005

NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

75
ESE
1/4-1/2
0.428 mi.
2260 ft.

HOLLAND HOUSE-FORMER
307 NORTH GRAHAM STREET
CHARLOTTE, NC

IMD S102554490
LUST N/A

Relative:
Higher

IMD:

Actual:
733 ft.

Region:	MOR
Facility ID:	16923
Date Occurred:	10/9/1996
Submit Date:	3/4/1997
GW Contam:	Yes, Groundwater Contamination has been detected
Soil Contam:	No
Incident Desc:	DURING CLOSURE SOIL CONTAM. WAS CONFIRMED.
Operator:	CHRIS LOEB
Contact Phone:	704-377-8343
Owner Company:	ROBINSON, BRADSHAW, AND HINSON
Operator Address:	101 N. TRYON ST. SUITE 1900
Operator City:	CHARLOTTE
Oper City,St,Zip:	CHARLOTTE, NC 28246
Ownership:	Private
Operation:	Residential
Material:	#2 FUEL OIL
Qty Lost 1:	Not reported
Qty Recovered 1:	Not reported
Source:	Leak-underground
Type:	Gasoline/diesel
Location:	Residence
Setting:	Residential
Risk Site:	L
Site Priority:	E
Priority Code:	L
Priority Update:	5/30/1998
Dem Contact:	AJS
Wells Affected:	No
Num Affected:	0
Wells Contam:	Not reported
Sampled By:	Responsible Parties
Samples Include:	Soil Samples
7.5 Min Quad:	Not reported
5 Min Quad:	R66J
Latitude:	35.23222222
Longitude:	-80.845
Latitude Number:	351356
Longitude Number:	805042
Latitude Decimal:	35.232222222222
Longitude Decimal:	80.845

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HOLLAND HOUSE-FORMER (Continued)

S102554490

GPS: 7
Agency: DWM
Facility ID: 16923
Last Modified: 1/25/1999
Incident Phase: Closed Out
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: 1/6/1999
Close-out Report: 1/8/1999

LUST:

Facility ID: Not reported
UST Number: MO-4970
Incident Number: 16923
Contamination Type: Groundwater/Both
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 1997-03-04 00:00:00
Date Occur: 1996-10-09 00:00:00
Cleanup: 1996-10-09 00:00:00
Closure Request: 1999-01-06 00:00:00
Close Out: 1999-01-08 00:00:00
Level Of Soil Cleanup Achieved: Residential
Tank Regulated Status: Non Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: NON COMMERCIAL
Risk Classification: L
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: E
Phase Of LSA Req: 1
Site Risk Reason: Not reported
Land Use: Not reported
MTBE: Not reported
MTBE1: No
Flag: No
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in Archives
RBCA GW: Not reported
PETOPT: 4
RPL: False
CD Num: 75
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HOLLAND HOUSE-FORMER (Continued)

S102554490

Error Code: Not reported
Valid: False
Lat/Long: 35 13 56.64 80 50 41.34
Lat/Long Decimal: 35.232413999999999 80.844825999999998
Testlat: Not reported
Regional Officer Project Mgr: AJS
Region: Mooresville
Company: ROBINSON, BRADSHAW, AND HINSON
Contact Person: CHRIS LOEB
Telephone: 704-377-8343
RP Address: 101 N. TRYON ST. SUITE 1900
RP City,St,Zip: CHARLOTTE, NC 28246
RP County: MECKLENBURG
Comments: Not reported
5 Min Quad: R66J

PIRF:

Facility Id: 16923
Date Occurred: 1996-10-07 00:00:00
Date Reported: 1997-03-04 00:00:00
Description Of Incident: DURING CLOSURE SOIL CONTAM. WAS CONFIRMED.
Owner/Operator: CHRIS LOEB
Ownership: 4
Operation Type: 3
Type: 4
Location: 7
Site Priority: E
Priority Update: 1998-05-30 00:00:00
Wells Affected Y/N: N
Samples Include: 0
7#5 Minute Quad: 3
5 Minute Quad: 2
Pirf/Min Soil: Not reported
Release Code: R66J
Source Code: Pirf
Err Type: Not reported
Cause: Not reported
Source: Not reported
Ust Number: Not reported

Last Modified: 1999-01-25 00:00:00
Incident Phase: Closed Out
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Signed: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: 1999-01-06 00:00:00
Close-out Report: 1999-01-08 00:00:00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

R76
NE
1/4-1/2
0.440 mi.
2323 ft.

MECKLENBURG COUNTY FLEET MANAGEMENT
900 WEST 12TH STREET
CHARLOTTE, NC 28206

LUST S106799537
N/A

Site 1 of 5 in cluster R

Relative:
Lower

LUST:

Actual:
697 ft.

Facility ID: 0-035539
UST Number: MO-4377
Incident Number: 14170
Contamination Type: Groundwater/Both
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 1995-10-14 00:00:00
Date Occur: 1995-10-14 00:00:00
Cleanup: 1995-10-14 00:00:00
Closure Request: Not reported
Close Out: Not reported
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: U
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: E
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Industrial/commercial
MTBE: Not reported
MTBE1: Yes
Flag: No
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in House
RBCA GW: Not reported
PETOPT: 3
RPL: False
CD Num: 0
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0
Error Code: Not reported
Valid: False
Lat/Long: 35 14 28.2 80 50 42.06
Lat/Long Decimal: 35.24118 80.845029999999994
Testlat: Not reported
Regional Officer Project Mgr: DPB
Region: Mooresville
Company: MECKLENBURG COUNTY MANAGER
Contact Person: MR. GERALD FOX
Telephone: Not reported
RP Address: PO BOX 31787
RP City,St,Zip: CHARLOTTE, NC 28231
RP County: MECKLENBURG

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MECKLENBURG COUNTY FLEET MANAGEMENT (Continued)

S106799537

Comments: NHR/AJS/2/9/2005
5 Min Quad: Not reported

PIRF:

Facility Id: 14170
Date Occurred: 1994-08-30 00:00:00
Date Reported: 1995-06-27 00:00:00
Description Of Incident: CONTAM. SOIL CONFIRMED DURING TANK REMOVAL.
Owner/Operator: MR. GERALD FOX
Ownership: 6
Operation Type: 1
Type: 3
Location: 1
Site Priority: E
Priority Update: 1998-05-30 00:00:00
Wells Affected Y/N: Not reported
Samples Include: 0
7#5 Minute Quad: Not reported
5 Minute Quad: Not reported
Pirf/Min Soil: Not reported
Release Code: Not reported
Source Code: Pirf
Err Type: Not reported
Cause: Not reported
Source: Not reported
Ust Number: Not reported

Last Modified: Not reported
Incident Phase: Follow Up
NOV Issued: Not reported
NORR Issued: 1995-06-29 00:00:00
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Signed: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

R77
NE
1/4-1/2
0.440 mi.
2323 ft.

MECKLENBURG COUNTY GARAGE
900 WEST 12TH STREET
CHARLOTTE, NC 28206

IMD 1000271236
UST N/A

Site 2 of 5 in cluster R

Relative:
Lower

IMD:

Actual:
697 ft.

Region: MOR
Facility ID: 14170
Date Occurred: 10/14/1995
Submit Date: 6/27/1995
GW Contam: Yes, Groundwater Contamination has been detected
Soil Contam: No
Incident Desc: CONTAM. SOIL CONFIRMED DURING TANK REMOVAL.
Operator: MR. GERALD FOX
Contact Phone: Not reported
Owner Company: MECKLENBURG COUNTY MANAGER
Operator Address: PO BOX 31787

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MECKLENBURG COUNTY GARAGE (Continued)

1000271236

Operator City: CHARLOTTE
Oper City,St,Zip: CHARLOTTE, NC 28231
Ownership: County
Operation: Public Service
Material: GASOLINE
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Material: DIESEL
Qty Lost: Not reported
Qty Recovered: Not reported
Source: Leak-underground
Type: Gasoline/diesel
Location: Facility
Setting: Residential
Risk Site: L
Site Priority: E
Priority Code: L
Priority Update: 5/30/1998
Dem Contact: AJS
Wells Affected: Not reported
Num Affected: 0
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: 35.239
Longitude: -80.844
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: NOD
Agency: DWM
Facility ID: 14170
Last Modified: Not reported
Incident Phase: Follow Up
NOV Issued: Not reported
NORR Issued: 6/29/1995
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

UST:

Facility ID: 0-013925
Region: 3
Facility Telephone: (704) 432-3000
Last Update: 2009-05-27 00:00:00
Owner Name: MECKLENBURG COUNTY
Owner Address: 3205 FREEDOM DR/STE 101
Owner City,St,Zip: CHARLOTTE, NC 28208

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MECKLENBURG COUNTY GARAGE (Continued)

1000271236

Owner Phone: (704) 432-3000
Latitude: 35.23966
Latitude 1: 35 14 22.76
Longitude: 80.84419
Longitude 1: 80 50 39.10
GPS String Confirmed: Yes
Initials of Individual Confirming GPS: MAB

Tank ID: 01
Tank ID Number: Not reported
Tank Capacity: 10000
Status: Currently In Use
Date installed: 1994-01-09 00:00:00
Date removed: Not reported
Tank Product: Gasoline, Gasoline Mixture
Product Type: NON
Tank Material: Fiberglass Reinforced Plastic
Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: 201004705O
Date Last Certified: 2010-03-06 00:00:00
Begin Certified Number: 2010-01-07 00:00:00
End Certified Number: Not reported
Interior Protection: FRP
Exterior Protection: FRP
Piping material: FRP
Certify Type: Manufacturer's installation work checklists completed
Leak Detection Type: Interstitial monitoring/double-walled tank and/or piping
Leak Detection Piping 1: Interstitial monitoring/double-walled tank and/or piping
Corrosn Protec Tank: FRP tank/piping
Corrosn Protec Pipe: FRP tank/piping
Spill and Overfill: Automatic shutoff devices
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Not reported
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Catchment basins
Corrosion Protection Tank Date: 1994-11-09 00:00:00
Corrosion Protection Piping Date: 1994-11-09 00:00:00
Spill Overfill Date: 1994-11-09 00:00:00
Piping System Type Code: Not reported
Piping System Type Description: Not reported
Comment: Not reported

Tank ID: 02
Tank ID Number: Not reported
Tank Capacity: 10000
Status: Currently In Use
Date installed: 1994-01-09 00:00:00
Date removed: Not reported
Tank Product: Gasoline, Gasoline Mixture
Product Type: NON
Tank Material: Fiberglass Reinforced Plastic

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MECKLENBURG COUNTY GARAGE (Continued)

1000271236

Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: 2010047050
Date Last Certified: 2010-03-06 00:00:00
Begin Certified Number: 2010-01-07 00:00:00
End Certified Number: Not reported
Interior Protection: FRP
Exterior Protection: FRP
Piping material: FRP
Certify Type: Manufacturer's installation work checklists completed
Leak Detection Type: Interstitial monitoring/double-walled tank and/or piping
Leak Detection Piping 1: Interstitial monitoring/double-walled tank and/or piping
Corrosn Protec Tank: FRP tank/piping
Corrosn Protec Pipe: FRP tank/piping
Spill and Overfill: Automatic shutoff devices
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Not reported
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Catchment basins
Corrosion Protection Tank Date: 1994-01-09 00:00:00
Corrosion Protection Piping Date: 1994-01-09 00:00:00
Spill Overfill Date: 1994-01-09 00:00:00
Piping System Type Code: Not reported
Piping System Type Description: Not reported
Comment: Not reported

Tank ID: 03
Tank ID Number: Not reported
Tank Capacity: 10000
Status: Currently In Use
Date installed: 1994-01-09 00:00:00
Date removed: Not reported
Tank Product: Gasoline, Gasoline Mixture
Product Type: NON
Tank Material: Fiberglass Reinforced Plastic
Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: 2010047050
Date Last Certified: 2010-03-06 00:00:00
Begin Certified Number: 2010-01-07 00:00:00
End Certified Number: Not reported
Interior Protection: FRP
Exterior Protection: FRP
Piping material: FRP
Certify Type: Manufacturer's installation work checklists completed
Leak Detection Type: Automatic tank guaging
Leak Detection Piping 1: Interstitial monitoring/double-walled tank and/or piping
Corrosn Protec Tank: FRP tank/piping
Corrosn Protec Pipe: FRP tank/piping
Spill and Overfill: Automatic shutoff devices
Surface Water: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MECKLENBURG COUNTY GARAGE (Continued)

1000271236

Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Not reported
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Catchment basins
Corrosion Protection Tank Date: 1994-01-09 00:00:00
Corrosion Protection Piping Date: 1994-01-09 00:00:00
Spill Overfill Date: 1994-01-09 00:00:00
Piping System Type Code: Not reported
Piping System Type Description: Not reported
Comment: Not reported

Tank ID: 04
Tank ID Number: Not reported
Tank Capacity: 10000
Status: Currently In Use
Date installed: 1994-01-09 00:00:00
Date removed: Not reported
Tank Product: Gasoline, Gasoline Mixture
Product Type: NON
Tank Material: Fiberglass Reinforced Plastic
Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: 2010047050
Date Last Certified: 2010-03-06 00:00:00
Begin Certified Number: 2010-01-07 00:00:00
End Certified Number: Not reported
Interior Protection: FRP
Exterior Protection: FRP
Piping material: FRP
Certify Type: Manufacturer's installation work checklists completed
Leak Detection Type: Interstitial monitoring/double-walled tank and/or piping
Leak Detection Piping 1: Interstitial monitoring/double-walled tank and/or piping
Corrosn Protec Tank: FRP tank/piping
Corrosn Protec Pipe: FRP tank/piping
Spill and Overfill: Automatic shutoff devices
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Not reported
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Catchment basins
Corrosion Protection Tank Date: 1994-01-09 00:00:00
Corrosion Protection Piping Date: 1994-01-09 00:00:00
Spill Overfill Date: 1994-01-09 00:00:00
Piping System Type Code: Not reported
Piping System Type Description: Not reported
Comment: Not reported

Tank ID: 05
Tank ID Number: Not reported
Tank Capacity: 6000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MECKLENBURG COUNTY GARAGE (Continued)

1000271236

Status: Permanent Closed
Date installed: 1990-12-30 00:00:00
Date removed: 2009-03-17 00:00:00
Tank Product: Other, Hazardous
Product Type: HAZ
Tank Material: Unknown
Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: 1996123640
Date Last Certified: 1996-12-30 00:00:00
Begin Certified Number: 1996-12-30 00:00:00
End Certified Number: Not reported
Interior Protection: Unknown
Exterior Protection: Unknown
Piping material: Unknown
Certify Type: Not reported
Leak Detection Type: Inventory control
Leak Detection Piping 1: Other
Corrosn Protec Tank: FRP tank/piping
Corrosn Protec Pipe: Not reported
Spill and Overfill: Overfill alarms
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Automatic tank gauging
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Catchment basins
Corrosion Protection Tank Date: Not reported
Corrosion Protection Piping Date: Not reported
Spill Overfill Date: Not reported
Piping System Type Code: Not reported
Piping System Type Description: Not reported
Comment: MASQUITO LARVICIDE

Tank ID: 06
Tank ID Number: Not reported
Tank Capacity: 8000
Status: Permanent Closed
Date installed: 1990-12-30 00:00:00
Date removed: 2009-03-17 00:00:00
Tank Product: Motor oil
Product Type: NON
Tank Material: Fiberglass Reinforced Plastic
Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: 2008045400
Date Last Certified: 2008-05-06 00:00:00
Begin Certified Number: 2008-01-07 00:00:00
End Certified Number: Not reported
Interior Protection: FRP
Exterior Protection: FRP
Piping material: FRP
Certify Type: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MECKLENBURG COUNTY GARAGE (Continued)

1000271236

Leak Detection Type: Inventory control
Leak Detection Piping 1: Other
Corrosn Protec Tank: FRP tank/piping
Corrosn Protec Pipe: FRP tank/piping
Spill and Overfill: Ball float valves
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Automatic tank gauging
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Catchment basins
Corrosion Protection Tank Date: 1990-12-30 00:00:00
Corrosion Protection Piping Date: 1990-12-30 00:00:00
Spill Overfill Date: 1990-12-30 00:00:00
Piping System Type Code: Not reported
Piping System Type Description: Not reported
Comment: Not reported

Tank ID: 07
Tank ID Number: Not reported
Tank Capacity: 1000
Status: Currently In Use
Date installed: 1990-12-30 00:00:00
Date removed: Not reported
Tank Product: Oil, New/Used/Mixture
Product Type: NON
Tank Material: Unknown
Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: 201004705O
Date Last Certified: 2010-03-06 00:00:00
Begin Certified Number: 2010-01-07 00:00:00
End Certified Number: Not reported
Interior Protection: Unknown
Exterior Protection: Unknown
Piping material: Unknown
Certify Type: Not reported
Leak Detection Type: Inventory control
Leak Detection Piping 1: Other
Corrosn Protec Tank: FRP tank/piping
Corrosn Protec Pipe: Not reported
Spill and Overfill: Overfill alarms
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Automatic tank gauging
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Catchment basins
Corrosion Protection Tank Date: 1994-01-09 00:00:00
Corrosion Protection Piping Date: 1994-01-09 00:00:00
Spill Overfill Date: 1994-01-09 00:00:00
Piping System Type Code: Not reported
Piping System Type Description: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MECKLENBURG COUNTY GARAGE (Continued)

1000271236

Comment: Not reported

Tank ID: 1
Tank ID Number: Not reported
Tank Capacity: 10000
Status: Permanent Closed
Date installed: 1978-08-03 00:00:00
Date removed: 1994-10-09 00:00:00
Tank Product: Gasoline, Gasoline Mixture
Product Type: NON
Tank Material: Steel
Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: Not reported
Date Last Certified: Not reported
Begin Certified Number: Not reported
End Certified Number: Not reported
Interior Protection: Unknown
Exterior Protection: Cathodic Protection
Piping material: Steel
Certify Type: Not reported
Leak Detection Type: Not reported
Leak Detection Piping 1: Not reported
Corrosn Protec Tank: Not reported
Corrosn Protec Pipe: Not reported
Spill and Overfill: Not reported
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Not reported
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Not reported
Corrosion Protection Tank Date: Not reported
Corrosion Protection Piping Date: Not reported
Spill Overfill Date: Not reported
Piping System Type Code: Not reported
Piping System Type Description: Not reported
Comment: Not reported

Tank ID: 2
Tank ID Number: Not reported
Tank Capacity: 10000
Status: Permanent Closed
Date installed: 1978-08-03 00:00:00
Date removed: 1994-10-09 00:00:00
Tank Product: Gasoline, Gasoline Mixture
Product Type: NON
Tank Material: Steel
Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: Not reported
Date Last Certified: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MECKLENBURG COUNTY GARAGE (Continued)

1000271236

Begin Certified Number: Not reported
End Certified Number: Not reported
Interior Protection: Unknown
Exterior Protection: Cathodic Protection
Piping material: Steel
Certify Type: Not reported
Leak Detection Type: Not reported
Leak Detection Piping 1: Not reported
Corrosn Protec Tank: Not reported
Corrosn Protec Pipe: Not reported
Spill and Overfill: Not reported
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Not reported
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Not reported
Corrosion Protection Tank Date: Not reported
Corrosion Protection Piping Date: Not reported
Spill Overfill Date: Not reported
Piping System Type Code: Not reported
Piping System Type Description: Not reported
Comment: Not reported

Tank ID: 3
Tank ID Number: Not reported
Tank Capacity: 10000
Status: Permanent Closed
Date installed: 1978-08-03 00:00:00
Date removed: 1994-10-09 00:00:00
Tank Product: Gasoline, Gasoline Mixture
Product Type: NON
Tank Material: Steel
Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: Not reported
Date Last Certified: Not reported
Begin Certified Number: Not reported
End Certified Number: Not reported
Interior Protection: Unknown
Exterior Protection: Cathodic Protection
Piping material: Steel
Certify Type: Not reported
Leak Detection Type: Not reported
Leak Detection Piping 1: Not reported
Corrosn Protec Tank: Not reported
Corrosn Protec Pipe: Not reported
Spill and Overfill: Not reported
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Not reported
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MECKLENBURG COUNTY GARAGE (Continued)

1000271236

Overfill: Not reported
Corrosion Protection Tank Date: Not reported
Corrosion Protection Piping Date: Not reported
Spill Overfill Date: Not reported
Piping System Type Code: Not reported
Piping System Type Description: Not reported
Comment: Not reported

Tank ID: 4
Tank ID Number: Not reported
Tank Capacity: 10000
Status: Permanent Closed
Date installed: 1978-08-03 00:00:00
Date removed: 1994-10-09 00:00:00
Tank Product: Gasoline, Gasoline Mixture
Product Type: NON
Tank Material: Steel
Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: Not reported
Date Last Certified: Not reported
Begin Certified Number: Not reported
End Certified Number: Not reported
Interior Protection: Unknown
Exterior Protection: Cathodic Protection
Piping material: Steel
Certify Type: Not reported
Leak Detection Type: Not reported
Leak Detection Piping 1: Not reported
Corrosn Protec Tank: Not reported
Corrosn Protec Pipe: Not reported
Spill and Overfill: Not reported
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Not reported
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Not reported
Corrosion Protection Tank Date: Not reported
Corrosion Protection Piping Date: Not reported
Spill Overfill Date: Not reported
Piping System Type Code: Not reported
Piping System Type Description: Not reported
Comment: Not reported

Tank ID: 5
Tank ID Number: Not reported
Tank Capacity: 8000
Status: Permanent Closed
Date installed: 1978-08-03 00:00:00
Date removed: 1990-12-30 00:00:00
Tank Product: Motor oil
Product Type: NON

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MECKLENBURG COUNTY GARAGE (Continued)

1000271236

Tank Material: Fiberglass Reinforced Plastic
Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: Not reported
Date Last Certified: Not reported
Begin Certified Number: Not reported
End Certified Number: Not reported
Interior Protection: FRP
Exterior Protection: FRP
Piping material: FRP
Certify Type: Not reported
Leak Detection Type: Inventory control
Leak Detection Piping 1: Exempt under 280.41 (B)(2)(1)- (V) (piping only)
Corrosn Protec Tank: FRP tank/piping
Corrosn Protec Pipe: FRP tank/piping
Spill and Overfill: Automatic shutoff devices
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Automatic tank gauging
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Catchment basins
Corrosion Protection Tank Date: Not reported
Corrosion Protection Piping Date: Not reported
Spill Overfill Date: Not reported
Piping System Type Code: Not reported
Piping System Type Description: Not reported
Comment: Not reported

Tank ID: 6
Tank ID Number: Not reported
Tank Capacity: 6000
Status: Permanent Closed
Date installed: 1978-08-03 00:00:00
Date removed: 1997-01-14 00:00:00
Tank Product: Other, Hazardous
Product Type: EXE
Tank Material: Fiberglass Reinforced Plastic
Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: Not reported
Date Last Certified: Not reported
Begin Certified Number: Not reported
End Certified Number: Not reported
Interior Protection: FRP
Exterior Protection: FRP
Piping material: FRP
Certify Type: Not reported
Leak Detection Type: Inventory control
Leak Detection Piping 1: Exempt under 280.41 (B)(2)(1)- (V) (piping only)
Corrosn Protec Tank: FRP tank/piping
Corrosn Protec Pipe: FRP tank/piping
Spill and Overfill: Automatic shutoff devices

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MECKLENBURG COUNTY GARAGE (Continued)

1000271236

Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Automatic tank guaging
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Catchment basins
Corrosion Protection Tank Date: Not reported
Corrosion Protection Piping Date: Not reported
Spill Overfill Date: Not reported
Piping System Type Code: Not reported
Piping System Type Description: Not reported
Comment: ANTI-FREEZE

Tank ID: 7
Tank ID Number: Not reported
Tank Capacity: 1000
Status: Permanent Closed
Date installed: 1978-08-03 00:00:00
Date removed: 1990-12-30 00:00:00
Tank Product: Oil, New/Used/Mixture
Product Type: NON
Tank Material: Fiberglass Reinforced Plastic
Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: Not reported
Date Last Certified: Not reported
Begin Certified Number: Not reported
End Certified Number: Not reported
Interior Protection: FRP
Exterior Protection: FRP
Piping material: FRP
Certify Type: Not reported
Leak Detection Type: Inventory control
Leak Detection Piping 1: Other
Corrosn Protec Tank: FRP tank/piping
Corrosn Protec Pipe: FRP tank/piping
Spill and Overfill: Overfill alarms
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Automatic tank guaging
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Catchment basins
Corrosion Protection Tank Date: Not reported
Corrosion Protection Piping Date: Not reported
Spill Overfill Date: Not reported
Piping System Type Code: Not reported
Piping System Type Description: Not reported
Comment: Not reported

Tank ID: 8
Tank ID Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MECKLENBURG COUNTY GARAGE (Continued)

1000271236

Tank Capacity: 1000
Status: Permanent Closed
Date installed: 1978-08-03 00:00:00
Date removed: 1990-12-30 00:00:00
Tank Product: Oil, New/Used/Mixture
Product Type: NON
Tank Material: Steel
Compartment Tank: No
Main Tank: No
Tank Last Used Date: 1981-01-06 00:00:00
Tank Certified Number: Not reported
Date Last Certified: Not reported
Begin Certified Number: Not reported
End Certified Number: Not reported
Interior Protection: Unknown
Exterior Protection: Unknown
Piping material: Unknown
Certify Type: Not reported
Leak Detection Type: Not reported
Leak Detection Piping 1: Not reported
Corrosn Protec Tank: Not reported
Corrosn Protec Pipe: Not reported
Spill and Overfill: Not reported
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Not reported
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Not reported
Corrosion Protection Tank Date: Not reported
Corrosion Protection Piping Date: Not reported
Spill Overfill Date: Not reported
Piping System Type Code: Not reported
Piping System Type Description: Not reported
Comment: Not reported

R78
NE
1/4-1/2
0.440 mi.
2323 ft.

MECKLENBURG COUNTY FLEET FAC
900 W 12TH STREET
CHARLOTTE, NC 28208

LUST S109567522
N/A

Site 3 of 5 in cluster R

Relative:
Lower

LUST:

Actual:
697 ft.

Facility ID: 0-013925
UST Number: MO-8073
Incident Number: 36669
Contamination Type: Soil
Source Type: Leak-underground
Product Type: BOTH
Date Reported: 2009-05-11 00:00:00
Date Occur: 2009-04-05 00:00:00
Cleanup: 2009-03-17 00:00:00
Closure Request: Not reported
Close Out: 2009-05-21 00:00:00
Level Of Soil Cleanup Achieved: Soil to Groundwater
Tank Regulated Status: Regulated
Of Supply Wells: 0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MECKLENBURG COUNTY FLEET FAC (Continued)

S109567522

Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: U
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: Not reported
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Industrial/commercial
MTBE: No
MTBE1: Unknown
Flag: Yes
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in House
RBCA GW: Not reported
PETOPT: 5
RPL: False
CD Num: 0
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0
Error Code: N
Valid: False
Lat/Long: 35 14 27.06 80 50 39.06
Lat/Long Decimal: 35.240856999999998 80.844192000000007
Testlat: Not reported
Regional Officer Project Mgr: AJS
Region: Mooresville
Company: Not reported
Contact Person: Not reported
Telephone: Not reported
RP Address: Not reported
RP City,St,Zip: NC
RP County: Not reported
Comments: REMOVAL OF ONE 8000-GALLON MOTOR OIL UST AND ONE 6000-GALLON ANTIFREEZE UST. 11PPM TPH WAS FOUND IN ONE SAMPLE BELOW THE MOTOR OIL UST. ANOTHER SOIL SAMPLE WAS RUN FOR RISK BASED AND WAS CLEAN.

5 Min Quad: Not reported

PIRF:

Facility Id: 36669
Date Occurred: 2009-04-05 00:00:00
Date Reported: 2009-05-11 00:00:00
Description Of Incident: Not reported
Owner/Operator: Not reported
Ownership: 1
Operation Type: 1
Type: 5
Location: 1
Site Priority: Not reported
Priority Update: Not reported
Wells Affected Y/N: N
Samples Include: Not reported
7#5 Minute Quad: N

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

MECKLENBURG COUNTY FLEET FAC (Continued)

S109567522

5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Not reported
Err Type:	2
Cause:	2
Source:	G
Ust Number:	P
Last Modified:	Not reported
Incident Phase:	Closed Out
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

R79
NE
1/4-1/2
0.441 mi.
2328 ft.

B.B.A U.S. HOLDINGS, INC.
12TH ST AND HAMILTON
CHARLOTTE, NC
Site 4 of 5 in cluster R

IMD S105764793
LUST N/A

Relative:
Lower

IMD:

Region:	MOR
Facility ID:	17180
Date Occurred:	Not reported
Submit Date:	4/16/1997
GW Contam:	No Groundwater Contamination detected
Soil Contam:	Yes
Incident Desc:	SOIL CONTAMINATION DISCOVERD AS HIGH AS 4160 PPM (3550). REMOVAL OF TWO ABANDONED USTS. SOIL EXCAVATED AND CLOUSRE SAMPLES BELOW SSE VALUE. SITE IS CLOSED.

Actual:
696 ft.

Operator:	UNKNOWN
Contact Phone:	Not reported
Owner Company:	B.B.A. U.S. HOLDINGS INC.
Operator Address:	840 S.E. MAIN ST.
Operator City:	SIMPSONVILLE
Oper City,St,Zip:	SIMPSONVILLE, SC 29681
Ownership:	Private
Operation:	Commercial
Material:	KEROSENE/HEATING OIL
Qty Lost 1:	Not reported
Qty Recovered 1:	Not reported
Source:	Leak-underground
Type:	Gasoline/diesel
Location:	8
Setting:	Urban
Risk Site:	L
Site Priority:	E
Priority Code:	L
Priority Update:	12/4/1998
Dem Contact:	GSB

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

B.B.A U.S. HOLDINGS, INC. (Continued)

S105764793

Wells Affected: Not reported
Num Affected: 0
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: Not reported
Longitude: Not reported
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: NOD
Agency: DWM
Facility ID: 17180
Last Modified: 5/5/1997
Incident Phase: Closed Out
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: 4/15/1997

LUST:

Facility ID: Not reported
UST Number: MO-5082
Incident Number: 17180
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 1997-01-17 00:00:00
Date Occur: Not reported
Cleanup: 1997-01-17 00:00:00
Closure Request: Not reported
Close Out: 1997-04-15 00:00:00
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Non Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: NON COMMERCIAL
Risk Classification: L
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: E
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Not reported
MTBE: Not reported
MTBE1: Unknown

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

B.B.A U.S. HOLDINGS, INC. (Continued)

S105764793

Flag: Yes
 Flag1: No
 LUR Filed: Not reported
 Release Detection: 0
 Current Status: File Located in Archives
 RBCA GW: Not reported
 PETOPT: Not reported
 RPL: False
 CD Num: 4
 Reel Num: 0
 RPOW: False
 RPOP: False
 Error Flag: 0
 Error Code: Not reported
 Valid: False
 Lat/Long: 35 14 29.28 80 50 44.88
 Lat/Long Decimal: 35.241483000000002 80.845817999999994
 Testlat: Not reported
 Regional Officer Project Mgr: GSB
 Region: Mooresville
 Company: B.B.A. U.S. HOLDINGS INC.
 Contact Person: UNKNOWN
 Telephone: Not reported
 RP Address: 840 S.E. MAIN ST.
 RP City,St,Zip: SIMPSONVILLE, SC 29681
 RP County: Not reported
 Comments: Not reported
 5 Min Quad: Not reported

PIRF:

Facility Id: 17180
 Date Occurred: 1997-01-31 00:00:00
 Date Reported: 1997-04-16 00:00:00
 Description Of Incident: SOIL CONTAMINATION DISCOVERD AS HIGH AS 4160 PPM (3550). REMOVAL OF TWO ABANDONED USTS. SOIL EXCAVATED AND CLOUSRE SAMPLES BELOW SSE VALUE. SITE IS CLOSED.
 Owner/Operator: UNKNOWN
 Ownership: 4
 Operation Type: 6
 Type: 4
 Location: 8
 Site Priority: E
 Priority Update: 1998-12-04 00:00:00
 Wells Affected Y/N: Not reported
 Samples Include: 0
 7#5 Minute Quad: Not reported
 5 Minute Quad: Not reported
 Pirf/Min Soil: Not reported
 Release Code: Not reported
 Source Code: Min_Soil
 Err Type: Not reported
 Cause: Not reported
 Source: Not reported
 Ust Number: Not reported
 Last Modified: 1997-05-05 00:00:00
Incident Phase: Closed Out
 NOV Issued: Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

B.B.A U.S. HOLDINGS, INC. (Continued)

S105764793

NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	1997-04-15 00:00:00

S80
WSW
 1/4-1/2
 0.447 mi.
 2359 ft.

SUMMIT AVE SITE
420 S SUMMIT AVE
CHARLOTTE, NC 28202
 Site 1 of 2 in cluster S

CERC-NFRAP **1003868317**
NCD980503155

Relative:
Lower

CERC-NFRAP:
 Site ID: 0402999
 Federal Facility: Not a Federal Facility

Actual:
676 ft.

NPL Status: Not on the NPL
 Non NPL Status: NFRAP-Site does not qualify for the NPL based on existing information

CERCLIS-NFRAP Site Contact Details:

Contact Sequence ID:	4309344.00000
Person ID:	4270042.00000
Contact Sequence ID:	4357216.00000
Person ID:	4000084.00000
Contact Sequence ID:	4368744.00000
Person ID:	4270039.00000
Contact Sequence ID:	4429248.00000
Person ID:	4000312.00000
Contact Sequence ID:	4430165.00000
Person ID:	4000508.00000
Contact Sequence ID:	4537999.00000
Person ID:	4000533.00000
Contact Sequence ID:	4702948.00000
Person ID:	4000308.00000
Contact Sequence ID:	4757099.00000
Person ID:	4000275.00000
Contact Sequence ID:	4781369.00000
Person ID:	13002428.00000
Contact Sequence ID:	4830840.00000
Person ID:	4270104.00000
Contact Sequence ID:	13093473.00000
Person ID:	4272610.00000

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

SUMMIT AVE SITE (Continued)

1003868317

CERCLIS-NFRAP Site Alias Name(s):

Alias Name: SUMMIT AVE SITE
 Alias Address: Not reported
 MECKLENBURG, NC

CERCLIS-NFRAP Assessment History:

Action: DISCOVERY
 Date Started: Not reported
 Date Completed: 01/01/1979
 Priority Level: Not reported

Action: SITE INSPECTION
 Date Started: Not reported
 Date Completed: 01/01/1979
 Priority Level: NFRAP-Site does not qualify for the NPL based on existing information

Action: ARCHIVE SITE
 Date Started: Not reported
 Date Completed: 11/07/1987
 Priority Level: Not reported

Action: PRELIMINARY ASSESSMENT
 Date Started: Not reported
 Date Completed: 11/07/1987
 Priority Level: NFRAP-Site does not qualify for the NPL based on existing information

Action: DISCOVERY
 Date Started: Not reported
 Date Completed: 12/17/1998
 Priority Level: Not reported

S81
WSW
 1/4-1/2
 0.447 mi.
 2361 ft.

SUMMIT AVENUE SITE
420 SOUTH SUMMIT AVE
CHARLOTTE, NC
 Site 2 of 2 in cluster S

SHWS 1000300440
 N/A

Relative:
Lower

Actual:
677 ft.

SHWS:
 Facility ID: NCD980503155
 Facility Type: SITES REQUIRING NO FURTHER
 Lat/Longitude: Not reported
 Geolocation Method: Not reported

82
NW
 1/4-1/2
 0.448 mi.
 2367 ft.

TWO WAY SHOP AND GAS
1740 WEST TRADE STREET
CHARLOTTE, NC 28216

IMD U003135489
LUST N/A
UST

Relative:
Higher

Actual:
762 ft.

IMD:
 Region: MOR
 Facility ID: 14260
 Date Occurred: 5/16/1992
 Submit Date: 7/12/1995
 GW Contam: No Groundwater Contamination detected

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TWO WAY SHOP AND GAS (Continued)

U003135489

Soil Contam: Yes
Incident Desc: MINOR SOIL CONTAMINATION CONFIRMED AFTER REMOVAL OF 3 UST'S.
Operator: MR. SIDNEY SMITH
Contact Phone: Not reported
Owner Company: TWO-WAY SHOP & GAS
Operator Address: 1740 WEST TRADE STREET
Operator City: CHARLOTTE
Oper City, St, Zip: CHARLOTTE, NC 28216
Ownership: Private
Operation: Commercial
Material: GASOLINE
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Leak-underground
Type: Gasoline/diesel
Location: Facility
Setting: Residential
Risk Site: L
Site Priority: E?
Priority Code: L
Priority Update: 12/4/1998
Dem Contact: MT
Wells Affected: Not reported
Num Affected: 0
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: Not reported
Longitude: Not reported
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: NOD
Agency: DWM
Facility ID: 14260
Last Modified: 7/17/1996
Incident Phase: Closed Out
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: 12/3/1993

LUST:

Facility ID: 0-013328
UST Number: MO-4405
Incident Number: 14260
Contamination Type: Soil

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TWO WAY SHOP AND GAS (Continued)

U003135489

Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 1992-06-10 00:00:00
Date Occur: 1992-05-16 00:00:00
Cleanup: 1992-05-16 00:00:00
Closure Request: Not reported
Close Out: 1993-12-03 00:00:00
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: L
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: 1992-07-14 00:00:00
Site Priority: E?
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Not reported
MTBE: Not reported
MTBE1: Unknown
Flag: No
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in Archives
RBCA GW: Not reported
PETOPT: 3
RPL: False
CD Num: 3
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0
Error Code: Not reported
Valid: False
Lat/Long: Not reported
Lat/Long Decimal: 0 0
Testlat: Not reported
Regional Officer Project Mgr: MT
Region: Mooresville
Company: TWO-WAY SHOP & GAS
Contact Person: MR. SIDNEY SMITH
Telephone: Not reported
RP Address: 1740 WEST TRADE STREET
RP City,St,Zip: CHARLOTTE, NC 28216
RP County: ME
Comments: Not reported
5 Min Quad: Not reported

PIRF:

Facility Id: 14260
Date Occurred: 1992-06-18 00:00:00
Date Reported: 1995-07-12 00:00:00
Description Of Incident: MINOR SOIL CONTAMINATION CONFIRMED AFTER REMOVAL OF 3 UST'S.
Owner/Operator: MR. SIDNEY SMITH
Ownership: 4

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TWO WAY SHOP AND GAS (Continued)

U003135489

Operation Type: 6
Type: 3
Location: 1
Site Priority: E?
Priority Update: 1998-12-04 00:00:00
Wells Affected Y/N: Not reported
Samples Include: 0
7#5 Minute Quad: Not reported
5 Minute Quad: Not reported
Pirf/Min Soil: Not reported
Release Code: Not reported
Source Code: Min_Soil
Err Type: Not reported
Cause: Not reported
Source: Not reported
Ust Number: Not reported

Last Modified: 1996-07-17 00:00:00
Incident Phase: Closed Out
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Signed: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: 1993-12-03 00:00:00

UST:

Facility ID: 0-013328
Region: 3
Facility Telephone: (704) 377-4142
Last Update: 2010-09-30 00:00:00
Owner Name: MADIE M SMITH ATTN:JASON K PARK
Owner Address: 1740 WEST TRADE STREET/SUITE A
Owner City,St,Zip: CHARLOTTE, NC 28216
Owner Phone: (704) 577-0994
Latitude: 35.2404
Latitude 1: 35 14 25.33
Longitude: -80.8587
Longitude 1: 80 51 31.40
GPS String Confirmed: No
Initials of Individual Confirming GPS: Not reported

Tank ID: 1
Tank ID Number: Not reported
Tank Capacity: 4000
Status: Permanent Closed
Date installed: 1961-04-28 00:00:00
Date removed: 1993-10-27 00:00:00
Tank Product: Gasoline, Gasoline Mixture
Product Type: NON
Tank Material: Steel
Compartment Tank: No
Main Tank: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TWO WAY SHOP AND GAS (Continued)

U003135489

Tank Last Used Date: Not reported
Tank Certified Number: 199607843O
Date Last Certified: 1996-06-27 00:00:00
Begin Certified Number: 1996-01-07 00:00:00
End Certified Number: Not reported
Interior Protection: None
Exterior Protection: Unknown
Piping material: Unknown
Certify Type: Not reported
Leak Detection Type: Not reported
Leak Detection Piping 1: Not reported
Corrosn Protec Tank: Not reported
Corrosn Protec Pipe: Not reported
Spill and Overfill: Not reported
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Not reported
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Not reported
Corrosion Protection Tank Date: Not reported
Corrosion Protection Piping Date: Not reported
Spill Overfill Date: Not reported
Piping System Type Code: Not reported
Piping System Type Description: Not reported
Comment: Not reported

Tank ID: 2
Tank ID Number: Not reported
Tank Capacity: 3000
Status: Permanent Closed
Date installed: 1961-04-28 00:00:00
Date removed: 1993-10-27 00:00:00
Tank Product: Gasoline, Gasoline Mixture
Product Type: NON
Tank Material: Steel
Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: 199607843O
Date Last Certified: 1996-06-27 00:00:00
Begin Certified Number: 1996-01-07 00:00:00
End Certified Number: Not reported
Interior Protection: None
Exterior Protection: Unknown
Piping material: Unknown
Certify Type: Not reported
Leak Detection Type: Not reported
Leak Detection Piping 1: Not reported
Corrosn Protec Tank: Not reported
Corrosn Protec Pipe: Not reported
Spill and Overfill: Not reported
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TWO WAY SHOP AND GAS (Continued)

U003135489

Leak Detection Type 2: Not reported
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Not reported
Corrosion Protection Tank Date: Not reported
Corrosion Protection Piping Date: Not reported
Spill Overfill Date: Not reported
Piping System Type Code: Not reported
Piping System Type Description: Not reported
Comment: Not reported

Tank ID: 3
Tank ID Number: Not reported
Tank Capacity: 3000
Status: Permanent Closed
Date installed: 1961-04-28 00:00:00
Date removed: 1993-10-27 00:00:00
Tank Product: Gasoline, Gasoline Mixture
Product Type: NON
Tank Material: Steel
Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: 1996078430
Date Last Certified: 1996-06-27 00:00:00
Begin Certified Number: 1996-01-07 00:00:00
End Certified Number: Not reported
Interior Protection: None
Exterior Protection: Unknown
Piping material: Unknown
Certify Type: Not reported
Leak Detection Type: Not reported
Leak Detection Piping 1: Not reported
Corrosn Protec Tank: Not reported
Corrosn Protec Pipe: Not reported
Spill and Overfill: Not reported
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Not reported
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Not reported
Corrosion Protection Tank Date: Not reported
Corrosion Protection Piping Date: Not reported
Spill Overfill Date: Not reported
Piping System Type Code: Not reported
Piping System Type Description: Not reported
Comment: Not reported

Tank ID: 4
Tank ID Number: Not reported
Tank Capacity: 4000
Status: Permanent Closed
Date installed: 1976-04-24 00:00:00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TWO WAY SHOP AND GAS (Continued)

U003135489

Date removed: 1993-10-27 00:00:00
Tank Product: Gasoline, Gasoline Mixture
Product Type: NIU
Tank Material: Steel
Compartment Tank: No
Main Tank: No
Tank Last Used Date: 1973-12-31 00:00:00
Tank Certified Number: Not reported
Date Last Certified: Not reported
Begin Certified Number: Not reported
End Certified Number: Not reported
Interior Protection: None
Exterior Protection: Unknown
Piping material: Unknown
Certify Type: Not reported
Leak Detection Type: Not reported
Leak Detection Piping 1: Not reported
Corrosn Protec Tank: Not reported
Corrosn Protec Pipe: Not reported
Spill and Overfill: Not reported
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Not reported
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Not reported
Corrosion Protection Tank Date: Not reported
Corrosion Protection Piping Date: Not reported
Spill Overfill Date: Not reported
Piping System Type Code: Not reported
Piping System Type Description: Not reported
Comment: Not reported

Tank ID: 5
Tank ID Number: Not reported
Tank Capacity: 550
Status: Permanent Closed
Date installed: 1961-04-28 00:00:00
Date removed: 1993-10-27 00:00:00
Tank Product: Oil, New/Used/Mixture
Product Type: NIU
Tank Material: Steel
Compartment Tank: No
Main Tank: No
Tank Last Used Date: 1973-12-31 00:00:00
Tank Certified Number: Not reported
Date Last Certified: Not reported
Begin Certified Number: Not reported
End Certified Number: Not reported
Interior Protection: None
Exterior Protection: Unknown
Piping material: Unknown
Certify Type: Not reported
Leak Detection Type: Not reported
Leak Detection Piping 1: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TWO WAY SHOP AND GAS (Continued)

U003135489

Corrosn Protec Tank: Not reported
Corrosn Protec Pipe: Not reported
Spill and Overfill: Not reported
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Not reported
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Not reported
Corrosion Protection Tank Date: Not reported
Corrosion Protection Piping Date: Not reported
Spill Overfill Date: Not reported
Piping System Type Code: Not reported
Piping System Type Description: Not reported
Comment: Not reported

Tank ID: A1
Tank ID Number: A1
Tank Capacity: 8000
Status: Currently In Use
Date installed: 1993-10-27 00:00:00
Date removed: Not reported
Tank Product: Gasoline, Gasoline Mixture
Product Type: NON
Tank Material: Steel
Compartment Tank: Yes
Main Tank: Yes
Tank Last Used Date: Not reported
Tank Certified Number: 2010079750
Date Last Certified: 2010-12-14 00:00:00
Begin Certified Number: 2010-12-14 00:00:00
End Certified Number: Not reported
Interior Protection: None
Exterior Protection: Cathodic Protection
Piping material: FRP
Certify Type: Installer certified by tank and piping manufacturers
Leak Detection Type: Other
Leak Detection Piping 1: Automatic line leak detectors
Corrosn Protec Tank: Sacrificial anode
Corrosn Protec Pipe: FRP tank/piping
Spill and Overfill: Ball float valves
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: I
Leak Detection Type 2: Not reported
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Catchment basins
Corrosion Protection Tank Date: 1993-10-27 00:00:00
Corrosion Protection Piping Date: 1993-10-27 00:00:00
Spill Overfill Date: Not reported
Piping System Type Code: Not reported
Piping System Type Description: Not reported
Comment: COMPARTMENT TANK

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TWO WAY SHOP AND GAS (Continued)

U003135489

Tank ID: A1B
Tank ID Number: A1
Tank Capacity: 3000
Status: Temporary Closed
Date installed: 1993-10-27 00:00:00
Date removed: Not reported
Tank Product: Gasoline, Gasoline Mixture
Product Type: NON
Tank Material: Steel
Compartment Tank: Yes
Main Tank: No
Tank Last Used Date: 2010-09-16 00:00:00
Tank Certified Number: 200907185O
Date Last Certified: 2009-07-09 00:00:00
Begin Certified Number: 2009-01-10 00:00:00
End Certified Number: Not reported
Interior Protection: None
Exterior Protection: Cathodic Protection
Piping material: FRP
Certify Type: Installer certified by tank and piping manufacturers
Leak Detection Type: Other
Leak Detection Piping 1: Automatic line leak detectors
Corrosn Protec Tank: Sacrificial anode
Corrosn Protec Pipe: FRP tank/piping
Spill and Overfill: Ball float valves
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: I
Leak Detection Type 2: Not reported
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Catchment basins
Corrosion Protection Tank Date: 1993-10-27 00:00:00
Corrosion Protection Piping Date: 1993-10-27 00:00:00
Spill Overfill Date: Not reported
Piping System Type Code: Not reported
Piping System Type Description: Not reported
Comment: Not reported

Tank ID: A1C
Tank ID Number: A1
Tank Capacity: 4000
Status: Temporary Closed
Date installed: 1993-10-27 00:00:00
Date removed: Not reported
Tank Product: Gasoline, Gasoline Mixture
Product Type: NON
Tank Material: Steel
Compartment Tank: Yes
Main Tank: No
Tank Last Used Date: 2010-09-16 00:00:00
Tank Certified Number: 200907185O
Date Last Certified: 2009-07-09 00:00:00
Begin Certified Number: 2009-01-10 00:00:00
End Certified Number: Not reported
Interior Protection: None

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TWO WAY SHOP AND GAS (Continued)

U003135489

Exterior Protection: Cathodic Protection
Piping material: FRP
Certify Type: Installer certified by tank and piping manufacturers
Leak Detection Type: Other
Leak Detection Piping 1: Automatic line leak detectors
Corrosn Protec Tank: Sacrificial annone
Corrosn Protec Pipe: FRP tank/piping
Spill and Overfill: Ball float valves
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: I
Leak Detection Type 2: Not reported
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Catchment basins
Corrosion Protection Tank Date: 1993-10-27 00:00:00
Corrosion Protection Piping Date: 1993-10-27 00:00:00
Spill Overfill Date: Not reported
Piping System Type Code: Not reported
Piping System Type Description: Not reported
Comment: Not reported

Tank ID: A2
Tank ID Number: Not reported
Tank Capacity: 550
Status: Temporary Closed
Date installed: 1993-10-27 00:00:00
Date removed: Not reported
Tank Product: Kerosene, Kerosene Mixture
Product Type: NON
Tank Material: Fiberglass Reinforced Plastic
Compartment Tank: No
Main Tank: No
Tank Last Used Date: 2010-09-16 00:00:00
Tank Certified Number: 2009071850
Date Last Certified: 2009-07-09 00:00:00
Begin Certified Number: 2009-01-10 00:00:00
End Certified Number: Not reported

Interior Protection: FRP
Exterior Protection: FRP
Piping material: FRP
Certify Type: Installer certified by tank and piping manufacturers
Leak Detection Type: Periodic tank tightness testing
Leak Detection Piping 1: Exempt under 280.41 (B)(2)(1)- (V) (piping only)
Corrosn Protec Tank: FRP tank/piping
Corrosn Protec Pipe: FRP tank/piping
Spill and Overfill: Ball float valves
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Inventory control
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Catchment basins
Corrosion Protection Tank Date: 1993-10-27 00:00:00
Corrosion Protection Piping Date: 1993-10-27 00:00:00

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

TWO WAY SHOP AND GAS (Continued)

U003135489

Spill Overfill Date: Not reported
 Piping System Type Code: Not reported
 Piping System Type Description: Not reported
 Comment: Not reported

**R83
 NE
 1/4-1/2
 0.453 mi.
 2394 ft.**

**SOUTHERN MFG INC
 1000 SEABOARD ST
 CHARLOTTE, NC 28206**

Site 5 of 5 in cluster R

**CERC-NFRAP
 RCRA-NonGen
 FINDS
 UST**

**1000408040
 NCD990715658**

**Relative:
 Lower**

CERC-NFRAP:

Site ID: 0403137
 Federal Facility: Not a Federal Facility

**Actual:
 693 ft.**

NPL Status: Not on the NPL
 Non NPL Status: NFRAP-Site does not qualify for the NPL based on existing information

CERCLIS-NFRAP Site Contact Details:

Contact Sequence ID:	4309467.00000
Person ID:	4270042.00000
Contact Sequence ID:	4357345.00000
Person ID:	4000084.00000
Contact Sequence ID:	4368873.00000
Person ID:	4270039.00000
Contact Sequence ID:	4429378.00000
Person ID:	4000312.00000
Contact Sequence ID:	4430293.00000
Person ID:	4000508.00000
Contact Sequence ID:	4538129.00000
Person ID:	4000533.00000
Contact Sequence ID:	4702912.00000
Person ID:	4000308.00000
Contact Sequence ID:	4756907.00000
Person ID:	4000275.00000
Contact Sequence ID:	4781191.00000
Person ID:	13002428.00000
Contact Sequence ID:	4831043.00000
Person ID:	4270104.00000
Contact Sequence ID:	13094444.00000
Person ID:	4272610.00000

CERCLIS-NFRAP Site Alias Name(s):

Alias Name: SOUTHERN MANUFACTURING, INC.
 Alias Address: Not reported
 MECKLENBURG, NC

Alias Name: SOUTHERN TEXTILE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOUTHERN MFG INC (Continued)

1000408040

Alias Address: Not reported
MECKLENBURG, NC

CERCLIS-NFRAP Assessment History:

Action: DISCOVERY
Date Started: Not reported
Date Completed: 07/01/1980
Priority Level: Not reported

Action: PRELIMINARY ASSESSMENT
Date Started: Not reported
Date Completed: 12/24/1985
Priority Level: Low priority for further assessment

Action: SITE INSPECTION
Date Started: Not reported
Date Completed: 07/17/1989
Priority Level: NFRAP-Site does not qualify for the NPL based on existing information

Action: ARCHIVE SITE
Date Started: Not reported
Date Completed: 07/17/1989
Priority Level: Not reported

RCRA-NonGen:

Date form received by agency: 11/23/1999
Facility name: SOUTHERN MFG INC
Facility address: 1000 SEABOARD ST
CHARLOTTE, NC 28206
EPA ID: NCD990715658
Mailing address: PO BOX 32427
CHARLOTTE, NC 28232
Contact: RICK FAULCONER
Contact address: 1000 SEABOARD ST
CHARLOTTE, NC 28206
Contact country: US
Contact telephone: (704) 372-2880
Contact email: Not reported
EPA Region: 04
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: SOUTHERN MANUFACTURING INC
Owner/operator address: 1000 SEABOARD ST
CHARLOTTE, NC 28206
Owner/operator country: Not reported
Owner/operator telephone: (704) 372-2880
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOUTHERN MFG INC (Continued)

1000408040

Mixed waste (haz. and radioactive): Unknown
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No
Off-site waste receiver: Verified to be non-commercial

Hazardous Waste Summary:

Waste code: D000
Waste name: Not Defined

Waste code: D001
Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

Waste code: D035
Waste name: METHYL ETHYL KETONE

Waste code: P041
Waste name: DIETHYL-P-NITROPHENYL PHOSPHATE

Waste code: P058
Waste name: ACETIC ACID, FLUORO-, SODIUM SALT

Waste code: P115
Waste name: SULFURIC ACID, DITHALLIUM(1+) SALT

Waste code: U002
Waste name: ACETONE (I)

Waste code: U020
Waste name: BENZENESULFONIC ACID CHLORIDE (C,R)

Waste code: U044
Waste name: CHLOROFORM

Waste code: U110
Waste name: DIPROPYLAMINE (I)

Waste code: U122
Waste name: FORMALDEHYDE

Waste code: U134

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOUTHERN MFG INC (Continued)

1000408040

Waste name: HYDROFLUORIC ACID (C,T)
Waste code: U144
Waste name: ACETIC ACID, LEAD(2+) SALT
Waste code: U190
Waste name: 1,3-ISOBENZOFURANDIONE
Violation Status: No violations found

FINDS:

Registry ID: 110001479837

Environmental Interest/Information System

AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AIRS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

UST:

Facility ID: 0-034489
Region: 3
Facility Telephone: (704) 372-2880
Last Update: 1999-01-12 00:00:00
Owner Name: SALEPREP II INC C/O SOUTHERN
Owner Address: 920 HAMILTON STREET
Owner City,St,Zip: CHARLOTTE, NC 28206
Owner Phone: (000) 000-0000
Latitude: 35.241
Latitude 1: 35 14 27.56
Longitude: -80.8458
Longitude 1: 80 50 44.73
GPS String Confirmed: No
Initials of Individual Confirming GPS: Not reported

Tank ID: 1
Tank ID Number: Not reported
Tank Capacity: 30000
Status: Currently In Use
Date installed: 1977-12-31 00:00:00
Date removed: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOUTHERN MFG INC (Continued)

1000408040

Tank Product: Heating Oil/ Fuel
Product Type: HEA
Tank Material: Steel
Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: 199902193O
Date Last Certified: 1999-07-01 00:00:00
Begin Certified Number: 1999-07-01 00:00:00
End Certified Number: Not reported
Interior Protection: Unknown
Exterior Protection: Unknown
Piping material: Other
Certify Type: Not reported
Leak Detection Type: Manual tank guaging
Leak Detection Piping 1: Not reported
Corrosn Protec Tank: None
Corrosn Protec Pipe: None
Spill and Overfill: Not reported
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Not reported
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: None
Corrosion Protection Tank Date: Not reported
Corrosion Protection Piping Date: Not reported
Spill Overfill Date: Not reported
Piping System Type Code: Not reported
Piping System Type Description: Not reported
Comment: Not reported

Tank ID: 2
Tank ID Number: Not reported
Tank Capacity: 10000
Status: Currently In Use
Date installed: 1977-12-31 00:00:00
Date removed: Not reported
Tank Product: Heating Oil/ Fuel
Product Type: HEA
Tank Material: Steel
Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: 199902193O
Date Last Certified: 1999-07-01 00:00:00
Begin Certified Number: 1999-07-01 00:00:00
End Certified Number: Not reported
Interior Protection: Unknown
Exterior Protection: Unknown
Piping material: Other
Certify Type: Not reported
Leak Detection Type: Manual tank guaging
Leak Detection Piping 1: Not reported
Corrosn Protec Tank: None

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOUTHERN MFG INC (Continued)

1000408040

Corrosn Protec Pipe: Not reported
Spill and Overfill: Not reported
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Not reported
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: None
Corrosion Protection Tank Date: Not reported
Corrosion Protection Piping Date: Not reported
Spill Overfill Date: Not reported
Piping System Type Code: Not reported
Piping System Type Description: Not reported
Comment: Not reported

Tank ID: 3
Tank ID Number: Not reported
Tank Capacity: 10000
Status: Currently In Use
Date installed: 1979-12-31 00:00:00
Date removed: Not reported
Tank Product: Heating Oil/ Fuel
Product Type: HEA
Tank Material: Steel
Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: 199902193O
Date Last Certified: 1999-07-01 00:00:00
Begin Certified Number: 1999-07-01 00:00:00
End Certified Number: Not reported
Interior Protection: Unknown
Exterior Protection: Unknown
Piping material: Other
Certify Type: Not reported
Leak Detection Type: Manual tank gauging
Leak Detection Piping 1: Not reported
Corrosn Protec Tank: None
Corrosn Protec Pipe: Not reported
Spill and Overfill: Not reported
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Not reported
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: None
Corrosion Protection Tank Date: Not reported
Corrosion Protection Piping Date: Not reported
Spill Overfill Date: Not reported
Piping System Type Code: Not reported
Piping System Type Description: Not reported
Comment: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

84
South
1/4-1/2
0.462 mi.
2440 ft.

TEXTILE CHEMICAL FACILITY
500 SOUTH GRAHAM STREET
CHARLOTTE, NC

IMD S105516864
N/A

Relative:
Higher

IMD:

Actual:
728 ft.

Region: MOR
Facility ID: 85690
Date Occurred: 5/15/2001
Submit Date: 5/15/2001
GW Contam: Yes, Groundwater Contamination has been detected
Soil Contam: Not reported
Incident Desc: ONLY LIMITED FILE AT MRO (NO NEW INFO SINCE 1991). INACTIVE HAZ WASTE SITE, CONTACT DWM IN RALEIGH FOR ADDITIONAL INFO.
Operator: ,
Contact Phone: Not reported
Owner Company: Not reported
Operator Address: Not reported
Operator City: Not reported
Oper City, St, Zip: Not reported
Ownership: Not Reported
Operation: Not Reported
Material: Not reported
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Unknown
Type: Other inorganics
Location: Not reported
Setting: Not reported
Risk Site: Not reported
Site Priority: Not reported
Priority Code: E
Priority Update: Not reported
Dem Contact: DWM
Wells Affected: No
Num Affected: 0
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: Not reported
Longitude: Not reported
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: EST
Agency: DWQ
Facility ID: 85690
Last Modified: 7/3/2002
Incident Phase: NOD
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TEXTILE CHEMICAL FACILITY (Continued)

S105516864

Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

**85
SE
1/4-1/2
0.466 mi.
2458 ft.**

**THE VUE
418 WEST FIFTH STREET
CHARLOTTE, NC 28202**

**LUST S108966413
N/A**

**Relative:
Higher**

LUST:

**Actual:
745 ft.**

Facility ID: Not reported
UST Number: MO-7798
Incident Number: 36417
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 2008-01-10 00:00:00
Date Occur: 2007-11-27 00:00:00
Cleanup: 2007-11-12 00:00:00
Closure Request: Not reported
Close Out: 2008-04-17 00:00:00
Level Of Soil Cleanup Achieved: Residential
Tank Regulated Status: Non Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: NON COMMERCIAL
Risk Classification: U
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: Not reported
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Residential
MTBE: No
MTBE1: Unknown
Flag: No
Flag1: No
LUR Filed: 2008-04-23 00:00:00
Release Detection: 0
Current Status: File Located in House
RBCA GW: Cleanups to alternate standards
PETOPT: 4
RPL: False
CD Num: 0
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0
Error Code: N
Valid: False
Lat/Long: 35 13 52.14 80 50 42
Lat/Long Decimal: 35.231164 80.845017999999996
Testlat: Not reported
Regional Officer Project Mgr: BLM

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

THE VUE (Continued)

S108966413

Region: Mooresville
 Company: TBD
 Contact Person: Not reported
 Telephone: Not reported
 RP Address: Not reported
 RP City,St,Zip: NC
 RP County: Not reported

Comments: TWO USTS LOCATED ADJACENT TO FORMER BOILER. B-1 COLLECTED AT 20 FEET BGS. WATER APPEARED TO COLLECT IN BASIN AT 20 FEET DEEP. THEREFORE NEED MW IN SOURCE AND DEPENDING ON WATER LEVEL AND SAMPLING RESULTS WILL DETERMINE IF FULL LSA IS NEEDED. SITE WAS FORWARDED TO ALLEN SCHIFF FOR POTENTIAL NON-UST RELEASE IN THE AREA.

5 Min Quad: Not reported

PIRF:

Facility Id: 36417
 Date Occurred: 2007-11-27 00:00:00
 Date Reported: 2008-01-10 00:00:00
 Description Of Incident: TWO USTS DISCOVERED ADJACENT TO FORMER BOILER.
 Owner/Operator: Not reported
 Ownership: 4
 Operation Type: Not reported
 Type: 4
 Location: 1
 Site Priority: Not reported
 Priority Update: Not reported
 Wells Affected Y/N: Not reported
 Samples Include: Not reported
 7#5 Minute Quad: Y
 5 Minute Quad: Not reported
 Pirf/Min Soil: Not reported
 Release Code: Not reported
 Source Code: Not reported
 Err Type: 2
 Cause: Not reported
 Source: Not reported
 Ust Number: P

Last Modified: Not reported
Incident Phase: Closed Out
 NOV Issued: Not reported
 NORR Issued: Not reported
 45 Day Report: Not reported
 Public Meeting Held: Not reported
 Corrective Action Planned: Not reported
 SOC Signed: Not reported
 Reclassification Report: Not reported
 RS Designation: Not reported
 Closure Request Date: Not reported
 Close-out Report: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

86
SSW
1/4-1/2
0.490 mi.
2585 ft.

F & R OIL COMPANY INC
624 CEDAR ST
CHARLOTTE, NC 28202

IMD U003160824
LUST N/A
LUST TRUST
UST

Relative:
Lower

IMD:

Actual:
687 ft.

Region: MOR
Facility ID: 18556
Date Occurred: 1/3/1994
Submit Date: 3/4/1994
GW Contam: No Groundwater Contamination detected
Soil Contam: Yes
Incident Desc: SOIL CONTAM. DISCOVERED DURING UST CLOSURE.
Operator: MS. LEIGH BLACK
Contact Phone: Not reported
Owner Company: F & R OIL COMPANY
Operator Address: 2120 N CHURCH STREET
Operator City: CHARLOTTE
Oper City, St, Zip: CHARLOTTE, NC 28206
Ownership: Private
Operation: Commercial
Material: KEROSENE
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Material: GASOLINE
Qty Lost: Not reported
Qty Recovered: Not reported
Material: VARSOL
Qty Lost: Not reported
Qty Recovered 3: Not reported
Source: Leak-underground
Type: Gasoline/diesel
Location: Facility
Setting: Urban
Risk Site: L
Site Priority: E
Priority Code: L
Priority Update: 5/15/1998
Dem Contact: AJS
Wells Affected: Not reported
Num Affected: 0
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: 35.2282
Longitude: -80.8552
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: NOD
Agency: DWM
Facility ID: 18556
Last Modified: Not reported
Incident Phase: RE
NOV Issued: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

F & R OIL COMPANY INC (Continued)

U003160824

NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LUST:

Facility ID: 0-000293
UST Number: MO-5347
Incident Number: 18556
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 1994-02-28 00:00:00
Date Occur: 1994-01-03 00:00:00
Cleanup: 1994-01-03 00:00:00
Closure Request: Not reported
Close Out: Not reported
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: L
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: E
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Not reported
MTBE: Not reported
MTBE1: Unknown
Flag: No
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in House
RBCA GW: Not reported
PETOPT: 3
RPL: False
CD Num: 0
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0
Error Code: Not reported
Valid: False
Lat/Long: 35 14 34.98 80 51 20.94
Lat/Long Decimal: 35.243056000000003 80.855833000000004
Testlat: Not reported
Regional Officer Project Mgr: DPB

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

F & R OIL COMPANY INC (Continued)

U003160824

Region: Mooresville
Company: F & R OIL COMPANY
Contact Person: MS. LEIGH BLACK
Telephone: Not reported
RP Address: 2120 N CHURCH STREET
RP City,St,Zip: CHARLOTTE, NC 28206
RP County: ME
Comments: 2-12,000-GALLON USTS(1-GAS, 1-KERO)
5 Min Quad: Not reported

PIRF:

Facility Id: 18556
Date Occurred: 1994-01-03 00:00:00
Date Reported: 1994-03-04 00:00:00
Description Of Incident: SOIL CONTAM. DISCOVERED DURING UST CLOSURE.
Owner/Operator: MS. LEIGH BLACK
Ownership: 4
Operation Type: 6
Type: 3
Location: 1
Site Priority: E
Priority Update: 1998-05-15 00:00:00
Wells Affected Y/N: Not reported
Samples Include: 0
7#5 Minute Quad: Not reported
5 Minute Quad: Not reported
Pirf/Min Soil: Not reported
Release Code: Not reported
Source Code: Pirf
Err Type: Not reported
Cause: Not reported
Source: Not reported
Ust Number: Not reported

Last Modified: Not reported
Incident Phase: Response
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Signed: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

Facility ID: 0-000293
UST Number: MO-3151
Incident Number: 7152
Contamination Type: Groundwater/Both
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 1989-08-07 00:00:00
Date Occur: Not reported
Cleanup: 1989-08-07 00:00:00
Closure Request: Not reported
Close Out: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

F & R OIL COMPANY INC (Continued)

U003160824

Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: L
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: 1992-01-28 00:00:00
NORR Issue Date: Not reported
Site Priority: 060E
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Not reported
MTBE: Not reported
MTBE1: Unknown
Flag: Yes
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in House
RBCA GW: Not reported
PETOPT: 3
RPL: False
CD Num: 0
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0
Error Code: Not reported
Valid: False
Lat/Long: 35 13 41.94 80 51 20.76
Lat/Long Decimal: 35.228335999999999 80.855770000000007
Testlat: Not reported
Regional Officer Project Mgr: DPB
Region: Mooresville
Company: F & R OIL COMPANY
Contact Person: MS. LEIGH BLACK
Telephone: Not reported
RP Address: 2120 N CHURCH STREET
RP City,St,Zip: CHARLOTTE, NC 28206
RP County: ME
Comments: 2-1000-GALLON USTS
5 Min Quad: R66I

PIRF:

Facility Id: 7152
Date Occurred: 1992-01-27 00:00:00
Date Reported: 1992-01-29 00:00:00
Description Of Incident: UPON REMOVAL OF 2 USTS, CONTAM. SOIL WAS DISCOVERED.
Owner/Operator: MS. LEIGH BLACK
Ownership: 4
Operation Type: 6
Type: 3
Location: 1
Site Priority: 060E
Priority Update: 1998-05-15 00:00:00
Wells Affected Y/N: N
Samples Include: 0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

F & R OIL COMPANY INC (Continued)

U003160824

7#5 Minute Quad: 3
5 Minute Quad: 2
Pirf/Min Soil: Not reported
Release Code: Not reported
Source Code: Pirf
Err Type: Not reported
Cause: Not reported
Source: Not reported
Ust Number: Not reported

Last Modified: Not reported
Incident Phase: Response
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Signed: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LUST TRUST:

Facility ID: Not reported
Site ID: 11820
Site Note: Not reported
Site Eligible?: True
Commercial Find: 100% Commercial
Priority Rank: Low
Deductable Amount: 50000
3rd Party Deductable Amt: 100000
Sum 3rd Party Amt Applied: 0

[Click this hyperlink](#) while viewing on your computer to access additional NC LUST TRUST: detail in the EDR Site Report.

UST:

Facility ID: 0-000293
Region: 3
Facility Telephone: (704) 333-6177
Last Update: 1993-03-11 00:00:00
Owner Name: F & R OIL COMPANY INC
Owner Address: PO BOX 32756
Owner City,St,Zip: CHARLOTTE, NC 28232
Owner Phone: (704) 333-6177
Latitude: 0
Latitude 1: Not reported
Longitude: 0
Longitude 1: Not reported
GPS String Confirmed: No
Initials of Individual Confirming GPS: Not reported

Tank ID: 010
Tank ID Number: Not reported
Tank Capacity: 12000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

F & R OIL COMPANY INC (Continued)

U003160824

Status: Permanent Closed
Date installed: 1964-01-01 00:00:00
Date removed: 1994-03-01 00:00:00
Tank Product: Kerosene, Kerosene Mixture
Product Type: NON
Tank Material: Steel
Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: Not reported
Date Last Certified: Not reported
Begin Certified Number: Not reported
End Certified Number: Not reported
Interior Protection: Unknown
Exterior Protection: Unknown
Piping material: Steel
Certify Type: Not reported
Leak Detection Type: Not reported
Leak Detection Piping 1: Not reported
Corrosn Protec Tank: Not reported
Corrosn Protec Pipe: Not reported
Spill and Overfill: Not reported
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Not reported
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Not reported
Corrosion Protection Tank Date: Not reported
Corrosion Protection Piping Date: Not reported
Spill Overfill Date: Not reported
Piping System Type Code: Not reported
Piping System Type Description: Not reported
Comment: Not reported

Tank ID: 011
Tank ID Number: Not reported
Tank Capacity: 12000
Status: Permanent Closed
Date installed: 1964-01-01 00:00:00
Date removed: 1994-03-01 00:00:00
Tank Product: Gasoline, Gasoline Mixture
Product Type: NON
Tank Material: Steel
Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: Not reported
Date Last Certified: Not reported
Begin Certified Number: Not reported
End Certified Number: Not reported
Interior Protection: Unknown
Exterior Protection: Unknown
Piping material: Steel
Certify Type: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

F & R OIL COMPANY INC (Continued)

U003160824

Leak Detection Type: Not reported
Leak Detection Piping 1: Not reported
Corrosn Protec Tank: Not reported
Corrosn Protec Pipe: Not reported
Spill and Overfill: Not reported
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Not reported
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Not reported
Corrosion Protection Tank Date: Not reported
Corrosion Protection Piping Date: Not reported
Spill Overfill Date: Not reported
Piping System Type Code: Not reported
Piping System Type Description: Not reported
Comment: Not reported

Tank ID: 3
Tank ID Number: Not reported
Tank Capacity: 1000
Status: Permanent Closed
Date installed: 1964-01-01 00:00:00
Date removed: 1991-07-29 00:00:00
Tank Product: Unknown
Product Type: NON
Tank Material: Unknown
Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: Not reported
Date Last Certified: Not reported
Begin Certified Number: Not reported
End Certified Number: Not reported
Interior Protection: Unknown
Exterior Protection: Unknown
Piping material: Unknown
Certify Type: Not reported
Leak Detection Type: Not reported
Leak Detection Piping 1: Not reported
Corrosn Protec Tank: Not reported
Corrosn Protec Pipe: Not reported
Spill and Overfill: Not reported
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Not reported
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Not reported
Corrosion Protection Tank Date: Not reported
Corrosion Protection Piping Date: Not reported
Spill Overfill Date: Not reported
Piping System Type Code: Not reported
Piping System Type Description: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

F & R OIL COMPANY INC (Continued)

U003160824

Comment: Not reported

Tank ID: 4
Tank ID Number: Not reported
Tank Capacity: 1000
Status: Permanent Closed
Date installed: 1964-01-01 00:00:00
Date removed: 1991-07-29 00:00:00
Tank Product: Unknown
Product Type: NON
Tank Material: Unknown
Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: Not reported
Date Last Certified: Not reported
Begin Certified Number: Not reported
End Certified Number: Not reported
Interior Protection: Unknown
Exterior Protection: Unknown
Piping material: Unknown
Certify Type: Not reported
Leak Detection Type: Not reported
Leak Detection Piping 1: Not reported
Corrosn Protec Tank: Not reported
Corrosn Protec Pipe: Not reported
Spill and Overfill: Not reported
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Not reported
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Not reported
Corrosion Protection Tank Date: Not reported
Corrosion Protection Piping Date: Not reported
Spill Overfill Date: Not reported
Piping System Type Code: Not reported
Piping System Type Description: Not reported
Comment: Not reported

87
ESE
1/4-1/2
0.491 mi.
2594 ft.

**NCF FINANCIAL CORP. PROPERTY/
501 N. GRAHAM STREET
CHARLOTTE, NC**

**IMD S101522488
LUST N/A**

**Relative:
Higher**

IMD:

**Actual:
764 ft.**

Region: MOR
Facility ID: 5016
Date Occurred: Not reported
Submit Date: 4/27/1989
GW Contam: Yes, Groundwater Contamination has been detected
Soil Contam: No
Incident Desc: CONTAM. SOIL WAS DISCOVERED DURING SITE ASSESSMENT.
Operator: MR. ROBERT T. FLOWE
Contact Phone: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NCF FINANCIAL CORP. PROPERTY/ (Continued)

S101522488

Owner Company: NCF FINANCIAL CORPORATION
Operator Address: PO BOX 668000
Operator City: CHARLOTTE
Oper City, St, Zip: CHARLOTTE, NC 282668000
Ownership: Unknown
Operation: Not reported
Material: HEATING OIL
Qty Lost 1: Not reported
Qty Recovered 1: NONE
Source: Leak-underground
Type: Gasoline/diesel
Location: Facility
Setting: Urban
Risk Site: L
Site Priority: 025E
Priority Code: L
Priority Update: 5/15/1998
Dem Contact: AJS
Wells Affected: No
Num Affected: 0
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: 35.23055555
Longitude: -80.84166666
Latitude Number: 351350
Longitude Number: 805030
Latitude Decimal: 35.2305555555556
Longitude Decimal: 80.8416666666667
GPS: 7
Agency: DWM
Facility ID: 5016
Last Modified: Not reported
Incident Phase: RE
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LUST:

Facility ID: Not reported
UST Number: MO-2866
Incident Number: 5016
Contamination Type: Groundwater/Both
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 1989-04-27 00:00:00
Date Occur: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NCF FINANCIAL CORP. PROPERTY/ (Continued)

S101522488

Cleanup: 1989-04-25 00:00:00
Closure Request: Not reported
Close Out: 2009-09-22 00:00:00
Level Of Soil Cleanup Achieved: Residential
Tank Regulated Status: Non Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: NON COMMERCIAL
Risk Classification: L
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: 025E
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Residential
MTBE: Not reported
MTBE1: Unknown
Flag: No
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in House
RBCA GW: Not reported
PETOPT: 4
RPL: False
CD Num: 0
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0
Error Code: Not reported
Valid: True
Lat/Long: 35 14 2.76 80 50 34.14
Lat/Long Decimal: 35.234102999999998 80.842836000000005
Testlat: Not reported
Regional Officer Project Mgr: BLM
Region: Mooresville
Company: NCF FINANCIAL CORPORATION
Contact Person: MR. ROBERT T. FLOWE
Telephone: Not reported
RP Address: PO BOX 668000
RP City,St,Zip: CHARLOTTE, NC 282668000
RP County: MECKLENBURG
Comments: Not reported
5 Min Quad: Not reported

PIRF:

Facility Id: 5016
Date Occurred: 1989-04-20 00:00:00
Date Reported: 1989-04-27 00:00:00
Description Of Incident: CONTAM. SOIL WAS DISCOVERED DURING SITE ASSESSMENT.
Owner/Operator: MR. ROBERT T. FLOWE
Ownership: 3
Operation Type: Not reported
Type: 4
Location: 1
Site Priority: 025E

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

NCF FINANCIAL CORP. PROPERTY/ (Continued)

S101522488

Priority Update: 1998-05-15 00:00:00
 Wells Affected Y/N: N
 Samples Include: 0
 7#5 Minute Quad: Not reported
 5 Minute Quad: Not reported
 Pirf/Min Soil: Not reported
 Release Code: Not reported
 Source Code: Pirf
 Err Type: Not reported
 Cause: Not reported
 Source: Not reported
 Ust Number: Not reported

Last Modified: Not reported
Incident Phase: Closed Out
 NOV Issued: Not reported
 NORR Issued: 2008-02-21 00:00:00
 45 Day Report: Not reported
 Public Meeting Held: Not reported
 Corrective Action Planned: Not reported
 SOC Signed: Not reported
 Reclassification Report: Not reported
 RS Designation: Not reported
 Closure Request Date: Not reported
 Close-out Report: Not reported

88
SSW
 1/2-1
 0.502 mi.
 2650 ft.

JONES CHEMICALS INC. OF NORTH
610 MCNINCH STREET
CHARLOTTE, NC

SHWS 1003056274
 N/A

Relative:
Lower

SHWS:
 Facility ID: NCD002462414
 Facility Type: SITES REQUIRING NO FURTHER
Actual: Lat/Longitude: Not reported
 662 ft. Geolocation Method: Not reported

89
SSW
 1/2-1
 0.572 mi.
 3022 ft.

BOXER TEXTILE MACHINERY CO
1000 WEST MOREHEAD STREET
CHARLOTTE, NC

SHWS S103916978
IMD N/A

Relative:
Lower

SHWS:
 Facility ID: NONCD0001372
 Facility Type: Inactive Hazardous Sites and Pollutant-Only Sites
Actual: Lat/Longitude: 35.245277 / -80.858888
 667 ft. Geolocation Method: UNKNOWN

IMD:

Region: MOR
 Facility ID: 20184
 Date Occurred: 6/10/1999
 Submit Date: 6/22/1999
 GW Contam: Yes, Groundwater Contamination has been detected

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOXER TEXTILE MACHINERY CO (Continued)

S103916978

Soil Contam: Not reported
Incident Desc: RP UNKNOWN-REQUEST AFFIDAVIT FROM BOXER-AFFIDAVIT INDICATES USE OF SOLVENTS AT BOXER SINCE 1978-NOV ISSUED TO BOXER.
Operator: BOXER, BETTY
Contact Phone: Not reported
Owner Company: BOXER TEXTILE MACHINERY CO
Operator Address:1000 WEST MOREHEAD ST
Operator City: CHARLOTTE
Oper City,St,Zip: CHARLOTTE, NC
Ownership: Federal
Operation: Mining
Material: TCE
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Unknown
Type: Other inorganics
Location: Facility
Setting: Industrial
Risk Site: No
Site Priority: Not reported
Priority Code: E
Priority Update: 7/2/1999
Dem Contact: AHP
Wells Affected: No
Num Affected: 0
Wells Contam: Not reported
Sampled By: Responsible Parties
Samples Include: Groundwater Samples
7.5 Min Quad: Not reported
5 Min Quad: R66I
Latitude: Not reported
Longitude: Not reported
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: EST
Agency: DWQ
Facility ID: 20184
Last Modified: 5/9/2001
Incident Phase: Follow Up
NOV Issued: 6/28/1999
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

90
SW
1/2-1
0.611 mi.
3224 ft.

VIRGINIA CAROLINA FREIGHT LINE
710 CALVERT STREET
CHARLOTTE, NC

SHWS **S101523894**
IMD **N/A**
LUST

Relative:
Lower

SHWS:

Facility ID: NONCD0002674
Facility Type: Inactive Hazardous Sites and Pollutant-Only Sites
Lat/Longitude: 35.23 / -80.863055
Geolocation Method: UNKNOWN

Actual:
659 ft.

IMD:

Region: MOR
Facility ID: 19513
Date Occurred: 2/1/1999
Submit Date: 2/8/1999
GW Contam: Yes, Groundwater Contamination has been detected
Soil Contam: Not reported
Incident Desc: TCE AT 5 PPB IN MONITOR WELL. NOTE, THIS SITE IS CLOSE TO #17998 ALSO A SOLVENT SITE WITH AN UNDETERMINED SOURCE.
Operator: UNKNOWN,
Contact Phone: Not reported
Owner Company: UNKNOWN
Operator Address: UNKNOWN
Operator City: UNKNOWN
Oper City,St,Zip: UNKNOWN
Ownership: Federal
Operation: 8
Material: TCE
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Unknown
Type: Other inorganics
Location: Facility
Setting: Industrial
Risk Site: No
Site Priority: Not reported
Priority Code: E
Priority Update: 2/18/1999
Dem Contact: MJH
Wells Affected: No
Num Affected: 0
Wells Contam: Not reported
Sampled By: Other
Samples Include: Groundwater Samples
7.5 Min Quad: Not reported
5 Min Quad: R66L
Latitude: Not reported
Longitude: Not reported
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: EST
Agency: DWQ
Facility ID: 19513
Last Modified: 7/24/2001
Incident Phase: Discovery

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

VIRGINIA CAROLINA FREIGHT LINE (Continued)

S101523894

NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighed: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

Region: MOR
Facility ID: 9609
Date Occurred: 2/27/1992
Submit Date: 1/8/1993
GW Contam: Yes, Groundwater Contamination has been detected
Soil Contam: No
Incident Desc: UPON REMOVAL OF UST, SOIL CONTAM. WAS CONFIRMED.
Operator: VIRGINIA-CAROLINA(BANKRUPT)
Contact Phone: Not reported
Owner Company: BANKRUPT
Operator Address: BANKRUPT
Operator City: BANKRUPT
Oper City,St,Zip: BANKRUPT, BA
Ownership: Private
Operation: Commercial
Material: DIESEL
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Leak-underground
Type: Gasoline/diesel
Location: Facility
Setting: Urban
Risk Site: L
Site Priority: E
Priority Code: L
Priority Update: 3/8/1999
Dem Contact: AJS
Wells Affected: Not reported
Num Affected: 0
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: 35.23
Longitude: -80.86305555
Latitude Number: 351348
Longitude Number: 805147
Latitude Decimal: 35.23
Longitude Decimal: 80.8630555555556
GPS: 7
Agency: DWM
Facility ID: 9609
Last Modified: 1/28/1999
Incident Phase: Closed Out

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

VIRGINIA CAROLINA FREIGHT LINE (Continued)

S101523894

NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: 1/19/1999
Close-out Report: 1/20/1999

LUST:

Facility ID: 0-017228
UST Number: MO-3709
Incident Number: 9609
Contamination Type: Groundwater/Both
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 1992-04-15 00:00:00
Date Occur: 1992-02-27 00:00:00
Cleanup: 1992-02-27 00:00:00
Closure Request: 1999-01-19 00:00:00
Close Out: 1999-01-20 00:00:00
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: L
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: E
Phase Of LSA Req: 2
Site Risk Reason: Not reported
Land Use: Not reported
MTBE: Not reported
MTBE1: Unknown
Flag: Yes
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in Archives
RBCA GW: Not reported
PETOPT: 3
RPL: False
CD Num: 75
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0
Error Code: Not reported
Valid: False
Lat/Long: 35 13 47.88 80 51 43.5
Lat/Long Decimal: 35.229984999999999 80.862094999999997
Testlat: Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

VIRGINIA CAROLINA FREIGHT LINE (Continued)

S101523894

Regional Officer Project Mgr:	AJS
Region:	Mooreville
Company:	BANKRUPT
Contact Person:	VIRGINIA-CAROLINA(BANKRUPT)
Telephone:	Not reported
RP Address:	BANKRUPT
RP City,St,Zip:	BANKRUPT, BA
RP County:	BANKRUPT
Comments:	Not reported
5 Min Quad:	R66I
 PIRF:	
Facility Id:	9609
Date Occurred:	1992-02-27 00:00:00
Date Reported:	1993-01-08 00:00:00
Description Of Incident:	UPON REMOVAL OF UST, SOIL CONTAM. WAS CONFIRMED.
Owner/Operator:	VIRGINIA-CAROLINA(BANKRUPT)
Ownership:	4
Operation Type:	6
Type:	3
Location:	1
Site Priority:	E
Priority Update:	1999-03-08 00:00:00
Wells Affected Y/N:	Not reported
Samples Include:	0
7#5 Minute Quad:	Not reported
5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Pirf
Err Type:	Not reported
Cause:	Not reported
Source:	Not reported
Ust Number:	Not reported
Last Modified:	1999-01-28 00:00:00
Incident Phase:	Closed Out
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	1999-01-19 00:00:00
Close-out Report:	1999-01-20 00:00:00

91
 SSW
 1/2-1
 0.695 mi.
 3671 ft.

ROWE CORP PROPERTY/BOULIGNY SITE
433 W MOREHEAD ST
CHARLOTTE, NC

SHWS S103554532
N/A

Relative:
Higher

Actual:
729 ft.

SHWS:
 Facility ID: NCD980838379
 Facility Type: Inactive Hazardous Sites and Pollutant-Only Sites
 Lat/Longitude: 35.2391265472791 / -80.8555702047222

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ROWE CORP PROPERTY/BOULIGNY SITE (Continued)

S103554532

Geolocation Method: HARD COPY MAP

**T92
SE
1/2-1
0.724 mi.
3821 ft.**

**NATIONS BANK - SOLVENT
201 NORTH TRYON STREET
CHARLOTTE, NC**

**SHWS S104913964
IMD N/A
LAST**

Site 1 of 2 in cluster T

**Relative:
Higher**

SHWS:
Facility ID: NONCD0002121
Facility Type: Inactive Hazardous Sites and Pollutant-Only Sites
Lat/Longitude: 35.228611 / -80.841944
Geolocation Method: UNKNOWN

**Actual:
787 ft.**

IMD:

Region: MOR
Facility ID: 85445
Date Occurred: 12/15/1995
Submit Date: 2/7/2001
GW Contam: Yes, Groundwater Contamination has been detected
Soil Contam: Not reported
Incident Desc: SOLVENTS IN GW; SEE UST SITE #15734 FOR DETAILS. GW INCIDENT #S 19804 AND 5300 ARE ADJACENT AND HAVE SHOWN SOLVENTS AS WELL.
Operator: UNKNOWN,
Contact Phone: Not reported
Owner Company: Not reported
Operator Address: Not reported
Operator City: Not reported
Oper City, St, Zip: Not reported
Ownership: Not Reported
Operation: Not Reported
Material: Not reported
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Unknown
Type: Other inorganics
Location: Not reported
Setting: Not reported
Risk Site: Not reported
Site Priority: Not reported
Priority Code: E
Priority Update: Not reported
Dem Contact: AHP
Wells Affected: No
Num Affected: 0
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: Not reported
Longitude: Not reported
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: EST

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NATIONS BANK - SOLVENT (Continued)

S104913964

Agency: DWQ
Facility ID: 85445
Last Modified: 2/7/2001
Incident Phase: Discovery
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighed: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LAST:

Facility ID: Not reported
UST Number: MO-85445
Incident Number: 85445
Contamination Type: GW
Source Type: 1
Product Type: N
Date Reported: Not reported
Date Occur: Not reported
Cleanup: Not reported
Closure Request: Not reported
Close Out: Not reported
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Not reported
Of Supply Wells: 0
Commercial/NonCommercial UST Site: Not reported
Risk Classification: Not reported
Risk Class Based On Review: Not reported
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: Not reported
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Not reported
MTBE: No
MTBE1: Unknown
Flag: No
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: C
RBCA GW: Not reported
PETOPT: Not reported
RPL: False
CD Num: 0
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0
Error Code: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NATIONS BANK - SOLVENT (Continued)

S104913964

Valid: False
 Lat/Long: 35.228611 -80.841944
 Lat/Long Decimal: 0 0
 Testlat: Not reported
 Regional Officer Project Mgr: DPB
 Region: MOR
 Company: Not reported
 Contact Person: UNKNOWN
 Telephone: Not reported
 RP Address: Not reported
 RP City,St,Zip: NC
 RP County: Not reported
 Comments: SOLVENTS IN GW; SEE UST SITE #15734 FOR DETAILS. GW INCIDENT #S 19804 AND 5300 ARE ADJACENT AND HAVE SHOWN SOLVENTS AS WELL.
 5 Min Quad: Not reported

T93
SE
1/2-1
0.726 mi.
3831 ft.

200 NORTH TRYON STREET
200 N. TRYON STREET
CHARLOTTE, NC
Site 2 of 2 in cluster T

SHWS **S103718028**
IMD **N/A**
LAST

Relative:
Higher

SHWS:
 Facility ID: NONCD0001211
 Facility Type: Inactive Hazardous Sites and Pollutant-Only Sites
 Lat/Longitude: 35.227777 / -80.840833
 Geolocation Method: UNKNOWN

Actual:
788 ft.

IMD:

Region: MOR
 Facility ID: 19804
 Date Occurred: 11/19/1998
 Submit Date: 3/23/1999
 GW Contam: Yes, Groundwater Contamination has been detected
 Soil Contam: Yes
 Incident Desc: PETROLEUM CONTAMINATED SOIL - LOW LEVEL PETROLEUM AND CHLORINATED SOLVENTS IN GW
 Operator: UNKNOWN,
 Contact Phone: Not reported
 Owner Company: UNKNOWN
 Operator Address: UNKNOWN
 Operator City: UNKNOWN
 Oper City,St,Zip: UNKNOWN
 Ownership: Municipal
 Operation: Agricultural
 Material: GASOLINE
 Qty Lost 1: Not reported
 Qty Recovered 1: Not reported
 Material: TCE
 Qty Lost: Not reported
 Qty Recovered: Not reported
 Source: Unknown
 Type: Gasoline/diesel
 Location: Facility
 Setting: Urban
 Risk Site: Not reported
 Site Priority: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

200 NORTH TRYON STREET (Continued)

S103718028

Priority Code: E
Priority Update: 3/29/1999
Dem Contact: AHP
Wells Affected: No
Num Affected: Not reported
Wells Contam: Not reported
Sampled By: Other
Samples Include: Groundwater Samples
7.5 Min Quad: Not reported
5 Min Quad: R66J
Latitude: Not reported
Longitude: Not reported
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: EST
Agency: DWQ
Facility ID: 19804
Last Modified: 5/9/2001
Incident Phase: Assessment
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LAST:

Facility ID: Not reported
UST Number: MO-19804
Incident Number: 19804
Contamination Type: GW
Source Type: 1
Product Type: B
Date Reported: Not reported
Date Occur: Not reported
Cleanup: Not reported
Closure Request: Not reported
Close Out: Not reported
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Not reported
Of Supply Wells: 0
Commercial/NonCommercial UST Site: Not reported
Risk Classification: U
Risk Class Based On Review: U
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: 45
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

200 NORTH TRYON STREET (Continued)

S103718028

Land Use: IND
MTBE: No
MTBE1: Unknown
Flag: No
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: C
RBCA GW: Not reported
PETOPT: 3
RPL: False
CD Num: 0
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0
Error Code: Not reported
Valid: False
Lat/Long: 35 13 39.96 80 50 26.94
Lat/Long Decimal: 35.227777000000003 80.840833000000003
Testlat: Not reported
Regional Officer Project Mgr: DPB
Region: MOR
Company: UNKNOWN
Contact Person: UNKNOWN
Telephone: Not reported
RP Address: UNKNOWN
RP City,St,Zip: UNKNOWN, NC
RP County: Not reported
Comments: PETROLEUM CONTAMINATED SOIL - LOW LEVEL PETROLEUM AND CHLORINATED SOLVENTS IN GW
5 Min Quad: Not reported

94
SE
1/2-1
0.738 mi.
3897 ft.

DISCOVERY PLACE
301 NORTH TRYON STREET
CHARLOTTE, NC 28202

SHWS 1000781001
IMD N/A
LUST
UST

Relative:
Higher

SHWS:
Facility ID: NONCD0001608
Facility Type: Inactive Hazardous Sites and Pollutant-Only Sites
Lat/Longitude: 35.229166 / -80.841666
Geolocation Method: UNKNOWN

Actual:
788 ft.

IMD:
Region: MOR
Facility ID: 17701
Date Occurred: Not reported
Submit Date: 8/18/1997
GW Contam: No Groundwater Contamination detected
Soil Contam: Yes
Incident Desc: UST CLOSURE
Operator: MICHELLE GREGOR
Contact Phone: 704-336-3654
Owner Company: CITY OF CHARLOTTE
Operator Address: 600 EAST 4TH STREET, 12TH FLR

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DISCOVERY PLACE (Continued)

1000781001

Operator City: CHARLOTTE
Oper City,St,Zip: CHARLOTTE, NC 28202
Ownership: Municipal
Operation: Educational/Religious
Material: Not reported
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Leak-underground
Type: Gasoline/diesel
Location: Facility
Setting: Urban
Risk Site: L
Site Priority: E
Priority Code: L
Priority Update: 5/30/1998
Dem Contact: CGP
Wells Affected: Not reported
Num Affected: 0
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: 35.22944444
Longitude: -80.84138888
Latitude Number: 351346
Longitude Number: 805029
Latitude Decimal: 35.22944444444444
Longitude Decimal: 80.8413888888889
GPS: NOD
Agency: DWM
Facility ID: 17701
Last Modified: 5/3/2001
Incident Phase: Closed Out
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: 7/30/1997

Region: MOR
Facility ID: 5300
Date Occurred: 10/6/1989
Submit Date: 10/23/2002
GW Contam: Yes, Groundwater Contamination has been detected
Soil Contam: Yes
Incident Desc: SOLVENT LOCATION UNKNOWN. THE SITE IS IS DOWNTOWN CHARLOTTE WHERE THERE ARE NUMEROUS SOURCES FOR THIS CONTAMINATION. A WELL USED FOR THE HEATING/COOLING SYSTEM
Operator: UNKNOWN,
Contact Phone: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DISCOVERY PLACE (Continued)

1000781001

Owner Company: UNKNOWN
Operator Address: UNKNOWN
Operator City: Not reported
Oper City,St,Zip: Not reported
Ownership: Municipal
Operation: Agricultural
Material: TCE, TRICHLORAETHYLENE, CHLORO
Qty Lost 1: Not reported
Qty Recovered 1: UNK
Source: Unknown
Type: Other inorganics
Location: Facility
Setting: Urban
Risk Site: Not reported
Site Priority: 60
Priority Code: E
Priority Update: Not reported
Dem Contact: GLD
Wells Affected: No
Num Affected: 0
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: 35.229166
Longitude: -80.841666
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: EST
Agency: DWQ
Facility ID: 5300
Last Modified: 10/23/2002
Incident Phase: Assessment
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

Region: MOR
Facility ID: 8650
Date Occurred: 5/11/1990
Submit Date: 7/23/1992
GW Contam: No Groundwater Contamination detected
Soil Contam: Yes
Incident Desc: CONTAMINATION FOUND DURING UST REMOVAL
Operator: BARRY BLACKWOOD
Contact Phone: 704-536-2291

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DISCOVERY PLACE (Continued)

1000781001

Owner Company: CITY OF CHARLOTTE
Operator Address:600 EAST FOURTH STREET
Operator City: CHARLOTTE
Oper City,St,Zip: CHARLOTTE, NC 282022844
Ownership: Municipal
Operation: Educational/Religious
Material: FUEL OIL
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Leak-underground
Type: Gasoline/diesel
Location: Facility
Setting: Urban
Risk Site: Not reported
Site Priority: Not reported
Priority Code: Not reported
Priority Update: Not reported
Dem Contact: GSB
Wells Affected: Not reported
Num Affected: 0
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: 35.22972222
Longitude: -80.84111111
Latitude Number: 351347
Longitude Number: 805028
Latitude Decimal: 35.2297222222222
Longitude Decimal: 80.8411111111111
GPS: NOD
Agency: DWM
Facility ID: 8650
Last Modified: 8/6/1992
Incident Phase: Closed Out
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: 7/23/1992

LUST:

Facility ID: 0-000617
UST Number: MO-5184
Incident Number: 17701
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 1997-07-30 00:00:00
Date Occur: 1997-07-30 00:00:00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DISCOVERY PLACE (Continued)

1000781001

Cleanup: 1997-08-18 00:00:00
Closure Request: Not reported
Close Out: 1997-07-30 00:00:00
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: L
Risk Class Based On Review: Not reported
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: E
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Not reported
MTBE: Not reported
MTBE1: Unknown
Flag: Yes
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in Archives
RBCA GW: Not reported
PETOPT: Not reported
RPL: False
CD Num: 4
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0
Error Code: Not reported
Valid: False
Lat/Long: 35 13 45.3 80 50 27.24
Lat/Long Decimal: 35.229256999999997 80.840909999999994
Testlat: Not reported
Regional Officer Project Mgr: CGP
Region: Mooresville
Company: CITY OF CHARLOTTE
Contact Person: MICHELLE GREGOR
Telephone: 704-336-3654
RP Address: 600 EAST 4TH STREET, 12TH FLR
RP City,St,Zip: CHARLOTTE, NC 28202
RP County: MECKLENBURG
Comments: Not reported
5 Min Quad: R66J

PIRF:
Facility Id: 17701
Date Occurred: Not reported
Date Reported: 1997-08-18 00:00:00
Description Of Incident: UST CLOSURE
Owner/Operator: MICHELLE GREGOR
Ownership: 1
Operation Type: 4
Type: 3
Location: 1
Site Priority: E

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DISCOVERY PLACE (Continued)

1000781001

Priority Update: 1998-05-30 00:00:00
Wells Affected Y/N: Not reported
Samples Include: 0
7#5 Minute Quad: Not reported
5 Minute Quad: Not reported
Pirf/Min Soil: Not reported
Release Code: Not reported
Source Code: Min_Soil
Err Type: Not reported
Cause: Not reported
Source: Not reported
Ust Number: Not reported

Last Modified: 2001-05-03 00:00:00
Incident Phase: Closed Out
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Signed: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: 1997-07-30 00:00:00

Facility ID: 0-000617
UST Number: MO-3457
Incident Number: 8650
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 1992-07-23 00:00:00
Date Occur: 1990-05-11 00:00:00
Cleanup: 1990-05-11 00:00:00
Closure Request: Not reported
Close Out: 1991-01-09 00:00:00
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Non Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: NON COMMERCIAL
Risk Classification: Not reported
Risk Class Based On Review: Not reported
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: Not reported
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Not reported
MTBE: Not reported
MTBE1: Unknown
Flag: No
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in Archives

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DISCOVERY PLACE (Continued)

1000781001

RBCA GW: Not reported
PETOPT: Not reported
RPL: False
CD Num: 2
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0
Error Code: Not reported
Valid: False
Lat/Long: 35 13 46.98 80 50 27.96
Lat/Long Decimal: 35.22972 80.84111
Testlat: Not reported
Regional Officer Project Mgr: GSB
Region: Mooresville
Company: CITY OF CHARLOTTE
Contact Person: BARRY BLACKWOOD
Telephone: 704-536-2291
RP Address: 600 EAST FOURTH STREET
RP City,St,Zip: CHARLOTTE, NC 282022844
RP County: ME
Comments: Not reported
5 Min Quad: R66D

PIRF:

Facility Id: 8650
Date Occurred: 1990-05-11 00:00:00
Date Reported: 1992-07-23 00:00:00
Description Of Incident: CONTAMINATION FOUND DURING UST REMOVAL
Owner/Operator: BARRY BLACKWOOD
Ownership: 1
Operation Type: 4
Type: 4
Location: 1
Site Priority: Not reported
Priority Update: Not reported
Wells Affected Y/N: Not reported
Samples Include: 0
7#5 Minute Quad: Not reported
5 Minute Quad: Not reported
Pirf/Min Soil: Not reported
Release Code: Not reported
Source Code: Min_Soil
Err Type: Not reported
Cause: Not reported
Source: Not reported
Ust Number: Not reported

Last Modified: 1992-08-06 00:00:00

Incident Phase: Closed Out
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Signed: Not reported
Reclassification Report: Not reported
RS Designation: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DISCOVERY PLACE (Continued)

1000781001

Closure Request Date: Not reported
Close-out Report: 1992-07-23 00:00:00

UST:

Facility ID: 0-000617
Region: 3
Facility Telephone: (704) 336-3602
Last Update: 2007-10-26 00:00:00
Owner Name: CITY OF CHARLOTTE
Owner Address: 600 EAST 4TH ST/DAVID WOLFE
Owner City,St,Zip: CHARLOTTE, NC 28202
Owner Phone: (704) 336-3602
Latitude: 35.22941
Latitude 1: 35 13 45.88
Longitude: 80.84142
Longitude 1: 80 50 29.10
GPS String Confirmed: Yes
Initials of Individual Confirming GPS: MAB

Tank ID: 001
Tank ID Number: Not reported
Tank Capacity: 1000
Status: Permanent Closed
Date installed: 1981-04-30 00:00:00
Date removed: 1997-01-27 00:00:00
Tank Product: Diesel, Diesel Mixture
Product Type: NON
Tank Material: Steel
Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: 199702239O
Date Last Certified: 1996-12-31 00:00:00
Begin Certified Number: 1997-01-01 00:00:00
End Certified Number: Not reported
Interior Protection: None
Exterior Protection: Paint
Piping material: Steel
Certify Type: Not reported
Leak Detection Type: Not reported
Leak Detection Piping 1: Not reported
Corrosn Protec Tank: Not reported
Corrosn Protec Pipe: Not reported
Spill and Overfill: Not reported
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Not reported
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Not reported
Corrosion Protection Tank Date: Not reported
Corrosion Protection Piping Date: Not reported
Spill Overfill Date: Not reported
Piping System Type Code: Not reported
Piping System Type Description: Not reported
Comment: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DISCOVERY PLACE (Continued)

1000781001

Tank ID: 2
Tank ID Number: Not reported
Tank Capacity: 20000
Status: Currently In Use
Date installed: 1978-09-24 00:00:00
Date removed: Not reported
Tank Product: Other, Non-Petroleum
Product Type: EXE
Tank Material: Steel
Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: Not reported
Date Last Certified: Not reported
Begin Certified Number: Not reported
End Certified Number: Not reported
Interior Protection: None
Exterior Protection: Paint
Piping material: Steel
Certify Type: Not reported
Leak Detection Type: Not reported
Leak Detection Piping 1: Not reported
Corrosn Protec Tank: Not reported
Corrosn Protec Pipe: Not reported
Spill and Overfill: Not reported
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Not reported
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Not reported
Corrosion Protection Tank Date: Not reported
Corrosion Protection Piping Date: Not reported
Spill Overfill Date: Not reported
Piping System Type Code: Not reported
Piping System Type Description: Not reported
Comment: WATER

Tank ID: A1
Tank ID Number: Not reported
Tank Capacity: 1000
Status: Currently In Use
Date installed: 1997-09-01 00:00:00
Date removed: Not reported
Tank Product: Diesel, Diesel Mixture
Product Type: GEN
Tank Material: Fiberglass Reinforced Plastic
Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: 2011013120
Date Last Certified: 2010-12-14 00:00:00
Begin Certified Number: 2011-01-01 00:00:00
End Certified Number: Not reported
Interior Protection: FRP

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DISCOVERY PLACE (Continued)

1000781001

Exterior Protection: FRP
Piping material: 12
Certify Type: Installer certified by tank and piping manufacturers
Leak Detection Type: None
Leak Detection Piping 1:None
Corrosn Protec Tank: FRP tank/piping
Corrosn Protec Pipe: Steel/FRP composite
Spill and Overfill: Not reported
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Not reported
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Catchment basins
Corrosion Protection Tank Date: 1997-01-01 00:00:00
Corrosion Protection Piping Date: 1997-01-01 00:00:00
Spill Overfill Date: 1997-01-01 00:00:00
Piping System Type Code: P
Piping System Type Description: Not reported
Comment: Not reported

95
SW
1/2-1
0.748 mi.
3950 ft.

GRINNELL SUPPLY SALES 2
1431 WEST MOREHEAD ST.
CHARLOTTE, NC

SHWS S103040554
IMD N/A

Relative:
Lower

SHWS:
Facility ID: NONCD0001803
Facility Type: Inactive Hazardous Sites and Pollutant-Only Sites
Lat/Longitude: 35.228888 / -80.864444
Geolocation Method: UNKNOWN

Actual:
663 ft.

IMD:
Region: MOR
Facility ID: 18275
Date Occurred: 1/20/1998
Submit Date: 2/9/1998
GW Contam: Yes, Groundwater Contamination has been detected
Soil Contam: Not reported
Incident Desc: PCE FOUND IN GROUNDWATER SAMPLES.
Operator: UNKNOWN
Contact Phone: Not reported
Owner Company: Not reported
Operator Address:Not reported
Operator City: Not reported
Oper City,St,Zip: Not reported
Ownership: Unknown
Operation: Not reported
Material: PCE
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Unknown
Type: Other inorganics
Location: Facility
Setting: Urban

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRINNELL SUPPLY SALES 2 (Continued)

S103040554

Risk Site: Not reported
Site Priority: Not reported
Priority Code: Not reported
Priority Update: Not reported
Dem Contact: Not reported
Wells Affected: No
Num Affected: 0
Wells Contam: Not reported
Sampled By: Other
Samples Include: Groundwater Samples
7.5 Min Quad: Not reported
5 Min Quad: R66G
Latitude: Not reported
Longitude: Not reported
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: NOD
Agency: Not reported
Facility ID: 18275
Last Modified: Not reported
Incident Phase: RE
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

Region: MOR
Facility ID: 86353
Date Occurred: 6/18/1997
Submit Date: 2/28/2006
GW Contam: Yes, Groundwater Contamination has been detected
Soil Contam: Not reported
Incident Desc: PCE >2L DETECTED IN DURING LSA SUSPECT OFFSITE SOURCE. SEE INC #15830
FOR INFO ON UST RELEASE. (same site as 17998)
Operator: MILLS, TOM
Contact Phone: 704/376-4431
Owner Company: TYCO INTERNATIONAL LTD
Operator Address: 1611 S LATHROP AVE
Operator City: HARVEY
Oper City, St, Zip: HARVEY, IL 704/376-4431
Ownership: Federal
Operation: 8
Material: Not reported
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Unknown
Type: Other inorganics
Location: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRINNELL SUPPLY SALES 2 (Continued)

S103040554

Setting: Not reported
Risk Site: Not reported
Site Priority: 0
Priority Code: E
Priority Update: Not reported
Dem Contact: ARL
Wells Affected: No
Num Affected: 0
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: 35.228888
Longitude: -80.864444
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: EST
Agency: DWQ
Facility ID: 86353
Last Modified: 2/28/2006
Incident Phase: Discovery
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

96
SSE
1/2-1
0.766 mi.
4043 ft.

**BRIDGESTONE/FIRESTONE RETAIL S
530 S TRYON STREET
CHARLOTTE, NC**

**SHWS S107405402
IMD N/A**

**Relative:
Higher**

SHWS:
Facility ID: NONCD0001380
Facility Type: Inactive Hazardous Sites and Pollutant-Only Sites
Lat/Longitude: 35.22402 / -80.847953
Geolocation Method: GEOCODING

**Actual:
777 ft.**

IMD:

Region: MOR
Facility ID: 87479
Date Occurred: 9/8/2005
Submit Date: 9/19/2005
GW Contam: Yes, Groundwater Contamination has been detected
Soil Contam: Not reported
Incident Desc: VERY LOW LEVEL OF PCE DETECTED IN 2 MONITORING WELLS ON THE
BRIDGESTONE FIRESTONE PROPOERTY. WELLS ARE UPGRADIENT OF ANY POSSIBLE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BRIDGESTONE/FIRESTONE RETAIL S (Continued)

S107405402

CONTAMINATION SOURCE ON THE PR
Operator: UNKNOWN,
Contact Phone: Not reported
Owner Company: UNKNOWN
Operator Address: Not reported
Operator City: Not reported
Oper City, St, Zip: NC
Ownership: Not Reported
Operation: Not Reported
Material: Not reported
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Unknown
Type: Other inorganics
Location: Not reported
Setting: Not reported
Risk Site: Not reported
Site Priority: Not reported
Priority Code: E
Priority Update: Not reported
Dem Contact: ARL
Wells Affected: No
Num Affected: Not reported
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: Not reported
Longitude: Not reported
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: NOD
Agency: DWQ
Facility ID: 87479
Last Modified: 9/19/2005
Incident Phase: Discovery
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Signed: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

97
SE
1/2-1
0.800 mi.
4225 ft.

CHARLOTTE MGP NO.1
200 SOUTH COLLEGE STREET
CHARLOTTE, NC 28202

Manufactured Gas Plants **1008407277**
N/A

Relative:
Higher

Manufactured Gas Plants:
Alternate Name:CHARLOTTE COAL GAS PLANT NO. 1. No additional information available

Actual:
767 ft.

98
SSE
1/2-1
0.808 mi.
4266 ft.

BROOKWOOD DEVELOPMENT
301 SOUTH COLLEGE STREET
CHARLOTTE, NC

SHWS **S105586558**
IMD **N/A**
LUST

Relative:
Higher

SHWS:
Facility ID: NONCD0001387
Facility Type: Inactive Hazardous Sites and Pollutant-Only Sites
Lat/Longitude: 35.124444 / -80.926388
Geolocation Method: UNKNOWN

Actual:
771 ft.

IMD:

Region: MOR
Facility ID: 15034
Date Occurred: 10/23/1989
Submit Date: 2/14/1996
GW Contam: Yes, Groundwater Contamination has been detected
Soil Contam: Not reported
Incident Desc: LOW LEVELS CHLORINATED HC; DOWNGRADIENT FROM GENERAL TIRE, WAITING WATER WELL SURVEY TO RANK;LETTER RANK BY GLD 6/19/96
Operator: KLEIN PROPERTIES, CHILDRESS
Contact Phone: Not reported
Owner Company: CHILDRESS KLEIN PROPERTIES
Operator Address:2800 ONE FIRST UNION CENTER
Operator City: CHARLOTTE
Oper City,St,Zip: CHARLOTTE, NC
Ownership: Federal
Operation: 8
Material: NAPTHA
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Landfill
Type: Other inorganics
Location: Facility
Setting: Not reported
Risk Site: No
Site Priority: Not reported
Priority Code: E
Priority Update: 5/15/1998
Dem Contact: AHP
Wells Affected: No
Num Affected: 0
Wells Contam: Not reported
Sampled By: Responsible Parties
Samples Include: Groundwater Samples
7.5 Min Quad: Not reported
5 Min Quad: S67K
Latitude: Not reported
Longitude: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BROOKWOOD DEVELOPMENT (Continued)

S105586558

Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: EST
Agency: DWQ
Facility ID: 15034
Last Modified: 4/30/2001
Incident Phase: Assessment
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LUST:

Facility ID: 0-032717
UST Number: MO-7708
Incident Number: 36382
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 2007-10-15 00:00:00
Date Occur: 2007-09-19 00:00:00
Cleanup: Not reported
Closure Request: Not reported
Close Out: Not reported
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: U
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: Not reported
Phase Of LSA Req: 1
Site Risk Reason: Not reported
Land Use: Industrial/commercial
MTBE: No
MTBE1: Unknown
Flag: No
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in House
RBCA GW: Not reported
PETOPT: 3
RPL: False
CD Num: 0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BROOKWOOD DEVELOPMENT (Continued)

S105586558

Reel Num: 0
RPOW: True
RPOP: False
Error Flag: 0
Error Code: N
Valid: False
Lat/Long: 35 13 29.28 80 50 42.6
Lat/Long Decimal: 35.224811000000003 80.845179000000002
Testlat: Not reported
Regional Officer Project Mgr: DPB
Region: Mooresville
Company: CK BROKERAGE COMPANY #2 LP
Contact Person: Not reported
Telephone: Not reported
RP Address: 301 SOUTH COLLEGE STREET
RP City,St,Zip: CHARLOTTE, NC 28202
RP County: Not reported
Comments: 1-1000-GALLON DIESEL UST TO BE ABANDONED INPLACE
5 Min Quad: Not reported

PIRF:

Facility Id: 36382
Date Occurred: 2007-09-19 00:00:00
Date Reported: 2007-10-15 00:00:00
Description Of Incident: Not reported
Owner/Operator: Not reported
Ownership: 4
Operation Type: 6
Type: 3
Location: 1
Site Priority: Not reported
Priority Update: Not reported
Wells Affected Y/N: N
Samples Include: Not reported
7#5 Minute Quad: Y
5 Minute Quad: Not reported
Pirf/Min Soil: Not reported
Release Code: Not reported
Source Code: Not reported
Err Type: 2
Cause: 7
Source: A
Ust Number: P

Last Modified: Not reported
Incident Phase: Not reported
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Signed: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

MAP FINDINGS

Map ID			EDR ID Number
Direction			EPA ID Number
Distance			
Elevation	Site	Database(s)	

99 SW 1/2-1 0.809 mi. 4270 ft.	CHEROKEE OIL 925 SOUTH SUMMIT AVE CHARLOTTE, NC	SHWS	S105488699 N/A
---	--	-------------	---------------------------------

Relative: Lower	SHWS: Facility ID: Facility Type: Lat/Longitude: Geolocation Method:	NCD986190239 Inactive Hazardous Sites and Pollutant-Only Sites 35.2391288469691 / -80.8638490888889 HARD COPY MAP
----------------------------------	---	--

100 SE 1/2-1 0.840 mi. 4434 ft.	EPICENTRE 210 E TRADE ST CHARLOTTE, NC	SHWS	S109136139 N/A
--	---	-------------	---------------------------------

Relative: Higher	SHWS: Facility ID: Facility Type: Lat/Longitude: Geolocation Method:	NONCD0002584 Inactive Hazardous Sites and Pollutant-Only Sites 35.22507 / -80.84168 ON SCREEN PLACEMENT ON GEOREFERENCED MAP
-----------------------------------	---	---

101 WNW 1/2-1 0.862 mi. 4551 ft.	SINCLAIR AND VALENTINE CO. 515 S TURNER AVE CHARLOTTE, NC	SHWS VCP	S103554556 N/A
---	--	---------------------------	---------------------------------

Relative: Lower	SHWS: Facility ID: Facility Type: Lat/Longitude: Geolocation Method:	NCD083678631 Inactive Hazardous Sites and Pollutant-Only Sites 35.2557961796178 / -80.8662466241667 HARD COPY MAP
----------------------------------	---	--

VCP: Facility ID:	NCD083678631
-----------------------------	--------------

102 WNW 1/2-1 0.866 mi. 4572 ft.	CLOROX COMPANY 800 GESCO STREET CHARLOTTE, NC	SHWS IMD LUST	S101572720 N/A
---	--	--	---------------------------------

Relative: Lower	SHWS: Facility ID: Facility Type: Lat/Longitude: Geolocation Method:	NCN000407830 Inactive Hazardous Sites and Pollutant-Only Sites 35.2343972222222 / -80.8707777777778 UNKNOWN
----------------------------------	---	--

IMD: Region: Facility ID: Date Occurred: Submit Date:	MOR 9254 11/5/1990 10/16/1992
--	--

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CLOROX COMPANY (Continued)

S101572720

GW Contam: No Groundwater Contamination detected
Soil Contam: Yes
Incident Desc: CONTAMINATION FOUND UPON REMOVAL OF UST
Operator: MR. MIKE ARATA
Contact Phone: Not reported
Owner Company: THE CLOROX COMPANY
Operator Address: PO BOX 493
Operator City: PLEASANTON
Oper City, St, Zip: PLEASANTON, CA 945660803
Ownership: Private
Operation: Industrial
Material: FUEL OIL
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Leak-underground
Type: Gasoline/diesel
Location: Facility
Setting: Industrial
Risk Site: Not reported
Site Priority: Not reported
Priority Code: Not reported
Priority Update: Not reported
Dem Contact: GSB
Wells Affected: Not reported
Num Affected: 0
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: Not reported
Longitude: Not reported
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: NOD
Agency: DWM
Facility ID: 9254
Last Modified: 7/17/1996
Incident Phase: Closed Out
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: 7/9/1996

LUST:

Facility ID: 0-021015
UST Number: MO-3638
Incident Number: 9254

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

COLORX COMPANY (Continued)

S101572720

Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 1992-09-03 00:00:00
Date Occur: 1990-11-05 00:00:00
Cleanup: 1990-11-05 00:00:00
Closure Request: Not reported
Close Out: 1996-07-09 00:00:00
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Non Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: L
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: Not reported
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Not reported
MTBE: Not reported
MTBE1: Unknown
Flag: Yes
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in Archives
RBCA GW: Not reported
PETOPT: Not reported
RPL: False
CD Num: 3
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0
Error Code: Not reported
Valid: False
Lat/Long: 35 16 40.74 80 52 7.98
Lat/Long Decimal: 35.277996000000002 80.868891000000005
Testlat: Not reported
Regional Officer Project Mgr: GSB
Region: Mooresville
Company: THE CLOROX COMPANY
Contact Person: MR. MIKE ARATA
Telephone: Not reported
RP Address: PO BOX 493
RP City,St,Zip: PLEASANTON, CA 945660803
RP County: Not reported
Comments: Not reported
5 Min Quad: Not reported

PIRF:

Facility Id: 9254
Date Occurred: 1990-11-05 00:00:00
Date Reported: 1992-10-16 00:00:00
Description Of Incident: CONTAMINATION FOUND UPON REMOVAL OF UST
Owner/Operator: Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

COLOROX COMPANY (Continued)

S101572720

Ownership:	4
Operation Type:	5
Type:	4
Location:	1
Site Priority:	Not reported
Priority Update:	Not reported
Wells Affected Y/N:	Not reported
Samples Include:	0
7#5 Minute Quad:	Not reported
5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Min_Soil
Err Type:	Not reported
Cause:	Not reported
Source:	Not reported
Ust Number:	Not reported
Last Modified:	1996-07-17 00:00:00
Incident Phase:	Closed Out
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	1996-07-09 00:00:00

103
 South
 1/2-1
 0.872 mi.
 4603 ft.

WEST MOREHEAD ST PESTICIDE
147 W MOREHEAD ST
CHARLOTTE, NC

SHWS S105488709
N/A

Relative:
Higher

SHWS:	
Facility ID:	NONCD0001091
Facility Type:	SITES REQUIRING NO FURTHER
Lat/Longitude:	Not reported
Geolocation Method:	Not reported

Actual:
765 ft.

104
 West
 1/2-1
 0.894 mi.
 4719 ft.

WORTH CHEMICAL
818 TUCKASEEGEE ROAD
CHARLOTTE, NC 28208

SHWS U003562568
IMD N/A
UST
LAST

Relative:
Lower

SHWS:	
Facility ID:	NONCD0002760
Facility Type:	Inactive Hazardous Sites and Pollutant-Only Sites
Lat/Longitude:	35.237316 / -80.8706
Geolocation Method:	UNKNOWN

Actual:
690 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WORTH CHEMICAL (Continued)

U003562568

IMD:

Region: MOR
Facility ID: 86450
Date Occurred: 12/12/2003
Submit Date: 12/13/2002
GW Contam: Yes, Groundwater Contamination has been detected
Soil Contam: Not reported
Incident Desc: ALSO UST SITE #14076. PHONE REPORT ASSOCIATED W/ MW PERMIT INDICATED
CHLORINATED SOLVENTS FOUND IN SOIL GAS, SOIL & GRAB GW SAMPLES.
INITIAL ASSESSMENT UNDERWAY
Operator: RAMALEY, PETER
Contact Phone: 609-926-6100
Owner Company: BRENNTAG MID-SOUTH
Operator Address: PO BOX 13786
Operator City: READING
Oper City, St, Zip: READING 609-926-6100
Ownership: Federal
Operation: Mining
Material: Not reported
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Dredge Spoil
Type: Other inorganics
Location: Not reported
Setting: Not reported
Risk Site: Not reported
Site Priority: 0
Priority Code: NOD
Priority Update: Not reported
Dem Contact: AHP
Wells Affected: No
Num Affected: 0
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: 35.237316
Longitude: -80.8706
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: GPS
Agency: DWQ
Facility ID: 86450
Last Modified: 12/13/2002
Incident Phase: Discovery
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WORTH CHEMICAL (Continued)

U003562568

Close-out Report: Not reported

UST:

Facility ID: 0-014176
Region: 3
Facility Telephone: (704) 332-7755
Last Update: 1989-07-05 00:00:00
Owner Name: NISBET OIL COMPANY
Owner Address: 1818 BAXTER STREET/PO BOX 35367
Owner City,St,Zip: CHARLOTTE, NC 28204
Owner Phone: (704) 332-7755
Latitude: 0
Latitude 1: Not reported
Longitude: 0
Longitude 1: Not reported
GPS String Confirmed: No
Initials of Individual Confirming GPS: Not reported

Tank ID: 1
Tank ID Number: Not reported
Tank Capacity: 2000
Status: Permanent Closed
Date installed: 1973-03-24 00:00:00
Date removed: 1990-12-30 00:00:00
Tank Product: Gasoline, Gasoline Mixture
Product Type: NON
Tank Material: Steel
Compartment Tank: No
Main Tank: No
Tank Last Used Date: Not reported
Tank Certified Number: Not reported
Date Last Certified: Not reported
Begin Certified Number: Not reported
End Certified Number: Not reported
Interior Protection: None
Exterior Protection: Paint
Piping material: Steel
Certify Type: Not reported
Leak Detection Type: Not reported
Leak Detection Piping 1: Not reported
Corrosn Protec Tank: Not reported
Corrosn Protec Pipe: Not reported
Spill and Overfill: Not reported
Surface Water: Not reported
Water Supply Well: Not reported
Leak Detection Piping 2: Not reported
Leak Detection Type 2: Not reported
Corrosion Protection Tank1: Not reported
Corrosion Piping: Not reported
Overfill: Not reported
Corrosion Protection Tank Date: Not reported
Corrosion Protection Piping Date: Not reported
Spill Overfill Date: Not reported
Piping System Type Code: Not reported
Piping System Type Description: Not reported
Comment: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WORTH CHEMICAL (Continued)

U003562568

LAST:

Facility ID: Not reported
UST Number: MO-86450
Incident Number: 86450
Contamination Type: GW
Source Type: 14
Product Type: B
Date Reported: Not reported
Date Occur: 2002-12-12 00:00:00
Cleanup: Not reported
Closure Request: Not reported
Close Out: Not reported
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Not reported
Of Supply Wells: 0
Commercial/NonCommercial UST Site: Not reported
Risk Classification: U
Risk Class Based On Review: U
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: 0
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: IND
MTBE: No
MTBE1: Unknown
Flag: No
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: C
RBCA GW: Not reported
PETOPT: Not reported
RPL: False
CD Num: 0
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0
Error Code: Not reported
Valid: False
Lat/Long: 35 14 14.28 80 52 14.16
Lat/Long Decimal: 35.237316 80.870599999999996
Testlat: Not reported
Regional Officer Project Mgr: DPB
Region: MOR
Company: BRENNTAG MID-SOUTH
Contact Person: PETER RAMALEY
Telephone: Not reported
RP Address: PO BOX 13786
RP City,St,Zip: READING, NC
RP County: Not reported
Comments: ALSO UST SITE #14076. PHONE REPORT ASSOCIATED W/ MW PERMIT INDICATED
CHLORINATED SOLVENTS FOUND IN SOIL GAS, SOIL & GRAB GW SAMPLES.
INITIAL ASSESSMENT UNDERWAY.
5 Min Quad: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

105
SSW
1/2-1
0.896 mi.
4732 ft.

DIVERSEY WATER TECHNOLOGIES
1201 SOUTH GRAHAM STREET
CHARLOTTE, NC

SHWS **S101525482**
IMD **N/A**

Relative:
Higher

SHWS:
Facility ID: NONCD0001610
Facility Type: Inactive Hazardous Sites and Pollutant-Only Sites
Lat/Longitude: 35.22238 / -80.857426
Geolocation Method: UNKNOWN

Actual:
747 ft.

IMD:
Region: MOR
Facility ID: 12322
Date Occurred: 2/13/1997
Submit Date: 6/29/1994
GW Contam: Yes, Groundwater Contamination has been detected
Soil Contam: Not reported
Incident Desc: METALS + TCE AT THS SITE IN GW MW***GLD REVIEW 2/98 DEXTER NOT RP SENT LETTER AS SUCH; SOURCE APPEARS TO BE ACROSS STREET BASED ON SITE DATA AND ADDTL SITE LOCA

Operator: UNKNOWN,
Contact Phone: Not reported
Owner Company: UNKNOWN
Operator Address: Not reported
Operator City: Not reported
Oper City,St,Zip: Not reported
Ownership: Federal
Operation: 8
Material: TRICHLOROETHENE
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Unknown
Type: Metals
Location: Facility
Setting: Industrial
Risk Site: No
Site Priority: Not reported
Priority Code: D
Priority Update: Not reported
Dem Contact: AHP
Wells Affected: No
Num Affected: 0
Wells Contam: Not reported
Sampled By: Responsible Parties
Samples Include: Groundwater Samples
7.5 Min Quad: Not reported
5 Min Quad: R66I
Latitude: Not reported
Longitude: Not reported
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: GPS
Agency: DWQ
Facility ID: 12322
Last Modified: 2/12/2001

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

DIVERSEY WATER TECHNOLOGIES (Continued)

S101525482

Incident Phase: Follow Up
 NOV Issued: Not reported
 NORR Issued: Not reported
 45 Day Report: Not reported
 Public Meeting Held: Not reported
 Corrective Action Planned: Not reported
 SOC Sighned: Not reported
 Reclassification Report: Not reported
 RS Designation: Not reported
 Closure Request Date: Not reported
 Close-out Report: Not reported

**106
 WNW
 1/2-1
 0.952 mi.
 5026 ft.**

**FORSHAW CHEMICALS
 650 STATE ST
 CHARLOTTE, NC**

**SHWS S107998266
 N/A**

**Relative:
 Lower**

SHWS:
 Facility ID: NCN000409865
 Facility Type: Inactive Hazardous Sites and Pollutant-Only Sites
 Lat/Longitude: 35.2405 / -80.8702
 Geolocation Method: GPS MAPPING GRADE-CORRECTED

**Actual:
 674 ft.**

**107
 SSW
 1/2-1
 0.962 mi.
 5081 ft.**

**INDUSTRIAL & TEXTILE SUPPLY (F
 1300 S. MINT STREET
 CHARLOTTE, NC**

**SHWS S102868648
 IMD N/A
 LAST**

**Relative:
 Higher**

SHWS:
 Facility ID: NONCD0001893
 Facility Type: Inactive Hazardous Sites and Pollutant-Only Sites
 Lat/Longitude: 35.221666 / -80.858333
 Geolocation Method: UNKNOWN

**Actual:
 766 ft.**

IMD:
 Region: MOR
 Facility ID: 18229
 Date Occurred: 7/30/1998
 Submit Date: 2/5/1998
 GW Contam: Yes, Groundwater Contamination has been detected
 Soil Contam: Not reported
 Incident Desc: SOLVENTS ARE PROBABLY NOT SITE RELATED (SEE DIVERSEY FILE) ISSUE IS
 PRIMARILY 1900PPM DRO. ALSO REFER TO UST FILE OF SAME NAME.
 Operator: UNKNOWN,
 Contact Phone: Not reported
 Owner Company: UNKNOWN
 Operator Address: Not reported
 Operator City: Not reported
 Oper City, St, Zip: Not reported
 Ownership: Federal
 Operation: Mining
 Material: Not reported
 Qty Lost 1: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

INDUSTRIAL & TEXTILE SUPPLY (F (Continued))

S102868648

Qty Recovered 1: Not reported
Source: Spill-surface
Type: Gasoline/diesel
Location: Not reported
Setting: Not reported
Risk Site: Not reported
Site Priority: Not reported
Priority Code: E
Priority Update: Not reported
Dem Contact: GLD
Wells Affected: No
Num Affected: 0
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: Not reported
Longitude: Not reported
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: EST
Agency: DWQ
Facility ID: 18229
Last Modified: 4/30/2003
Incident Phase: Assessment
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighed: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LAST:

Facility ID: Not reported
UST Number: MO-18229
Incident Number: 18229
Contamination Type: GW
Source Type: 19
Product Type: B
Date Reported: Not reported
Date Occur: Not reported
Cleanup: Not reported
Closure Request: Not reported
Close Out: Not reported
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Not reported
Of Supply Wells: 0
Commercial/NonCommercial UST Site: Not reported
Risk Classification: U

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

INDUSTRIAL & TEXTILE SUPPLY (F (Continued))

S102868648

Risk Class Based On Review: U
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: 0
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: IND
MTBE: No
MTBE1: Unknown
Flag: No
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: C
RBCA GW: Not reported
PETOPT: 5
RPL: False
CD Num: 0
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0
Error Code: Not reported
Valid: False
Lat/Long: 35 13 17.94 80 51 29.94
Lat/Long Decimal: 35.221665999999999 80.858333000000002
Testlat: Not reported
Regional Officer Project Mgr: DPB
Region: MOR
Company: UNKNOWN
Contact Person: UNKNOWN
Telephone: Not reported
RP Address: Not reported
RP City,St,Zip: NC
RP County: Not reported
Comments: SOLVENTS ARE PROBABLY NOT SITE RELATED (SEE DIVERSEY FILE) ISSUE IS
PRIMARILY 1900PPM DRO. ALSO REFER TO UST FILE OF SAME NAME.
5 Min Quad: Not reported

Count: 20 records.

ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)
CHARLOTTE	1000106575	DOW CHEMICAL CORP/ALLIED	2 WOODLAWN GREEN RD		HWS
CHARLOTTE	1000707747	QUEENS PROPERTY	RESEARCH DRIVE		HWS
CHARLOTTE	1003869451	CHARLOTTE COAL GAS PLANT NO.1	S. COLLEGE STREET, BETWEEN 3RD	28202	CERCLIS-NFRAP
CONCORD	1004744362	RENTAL SERVICE CORP	729 HWY 29 N	28206	FINDS,RCRA-CESQG
CHARLOTTE	1010786889	LOVE AUTO PARTS	11900 US HWY 29	28206	RCRA-NLR
CHARLOTTE	S101525480	ELMWOOD CIRCLE	ELMWOOD CIRCLE		HWS,IMD
CHARLOTTE	S103229259	HWY 49 BATTERY DUMP	NC HIGHWAY 49		HWS,IMD
CHARLOTTE	S105029487	CHARLOTTE CITY DUMP	HWY 49 - YORK ROAD		IMD
CHARLOTTE	S105040811	HENSON'S, INC. MULCH & MORE	OLD LANDCASTER HWY		LF,HIST LF
CHARLOTTE	S105425775	MALLARD CREEK WWTP	12400 HIGHWAY 29 NORTH		IMD,LAST
CHARLOTTE	S106520612	AMOCO TERMINAL-SLOP UST	HIGHWAY 27-PAW CREEK		IMD,LAST,LUST
CHARLOTTE	S109015505	NCDOT ASPHALT SITE #2 (CROWDER CON	CROWDER CONST, HWY 16, 6433 BR		HWS
CHARLOTTE	S109164088	C D SPANGLER CONSTRUCTION CO	U.S. HIGHWAY 29		LF
CHARLOTTE	U001436464	AVIS RENT-A-CAR	NEW DIXIE HIGHWAY & DOUGLAS AV	28208	UST
CHARLOTTE	U001436561	B & G GROCERY	HIGHWAY 115 NORTH	28202	UST
CHARLOTTE	U001436591	DUKE POWER COMPANY	HIGHWAY 21 NORTH	28202	UST
CHARLOTTE	U003144533	WHER. RENA MARINA	HIGHWAY 73	28202	UST
CHERAW	U003557736	BURGESS TRANSPORT INC	US HWY 1 N	29520	UST
BREVARD	U004138816	PERFECT GAS HOUSE - BREVARD	HIGHWAY 64	28203	UST
CHARLOTTE	U004158471	QUIK SHOPPE 2	3005 HWY 152 E	28216	UST

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

To maintain currency of the following federal and state databases, EDR contacts the appropriate governmental agency on a monthly or quarterly basis, as required.

Number of Days to Update: Provides confirmation that EDR is reporting records that have been updated within 90 days from the date the government agency made the information available to the public.

STANDARD ENVIRONMENTAL RECORDS

Federal NPL site list

NPL: National Priority List

National Priorities List (Superfund). The NPL is a subset of CERCLIS and identifies over 1,200 sites for priority cleanup under the Superfund Program. NPL sites may encompass relatively large areas. As such, EDR provides polygon coverage for over 1,000 NPL site boundaries produced by EPA's Environmental Photographic Interpretation Center (EPIC) and regional EPA offices.

Date of Government Version: 12/31/2010	Source: EPA
Date Data Arrived at EDR: 01/13/2011	Telephone: N/A
Date Made Active in Reports: 01/28/2011	Last EDR Contact: 01/13/2011
Number of Days to Update: 15	Next Scheduled EDR Contact: 04/25/2011
	Data Release Frequency: Quarterly

NPL Site Boundaries

Sources:

EPA's Environmental Photographic Interpretation Center (EPIC)
Telephone: 202-564-7333

EPA Region 1
Telephone 617-918-1143

EPA Region 6
Telephone: 214-655-6659

EPA Region 3
Telephone 215-814-5418

EPA Region 7
Telephone: 913-551-7247

EPA Region 4
Telephone 404-562-8033

EPA Region 8
Telephone: 303-312-6774

EPA Region 5
Telephone 312-886-6686

EPA Region 9
Telephone: 415-947-4246

EPA Region 10
Telephone 206-553-8665

Proposed NPL: Proposed National Priority List Sites

A site that has been proposed for listing on the National Priorities List through the issuance of a proposed rule in the Federal Register. EPA then accepts public comments on the site, responds to the comments, and places on the NPL those sites that continue to meet the requirements for listing.

Date of Government Version: 12/31/2010	Source: EPA
Date Data Arrived at EDR: 01/13/2011	Telephone: N/A
Date Made Active in Reports: 01/28/2011	Last EDR Contact: 01/13/2011
Number of Days to Update: 15	Next Scheduled EDR Contact: 04/25/2011
	Data Release Frequency: Quarterly

NPL LIENS: Federal Superfund Liens

Federal Superfund Liens. Under the authority granted the USEPA by CERCLA of 1980, the USEPA has the authority to file liens against real property in order to recover remedial action expenditures or when the property owner received notification of potential liability. USEPA compiles a listing of filed notices of Superfund Liens.

Date of Government Version: 10/15/1991	Source: EPA
Date Data Arrived at EDR: 02/02/1994	Telephone: 202-564-4267
Date Made Active in Reports: 03/30/1994	Last EDR Contact: 02/14/2011
Number of Days to Update: 56	Next Scheduled EDR Contact: 05/30/2011
	Data Release Frequency: No Update Planned

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Federal Delisted NPL site list

DELISTED NPL: National Priority List Deletions

The National Oil and Hazardous Substances Pollution Contingency Plan (NCP) establishes the criteria that the EPA uses to delete sites from the NPL. In accordance with 40 CFR 300.425.(e), sites may be deleted from the NPL where no further response is appropriate.

Date of Government Version: 12/31/2010	Source: EPA
Date Data Arrived at EDR: 01/13/2011	Telephone: N/A
Date Made Active in Reports: 01/28/2011	Last EDR Contact: 01/13/2011
Number of Days to Update: 15	Next Scheduled EDR Contact: 04/25/2011
	Data Release Frequency: Quarterly

Federal CERCLIS list

CERCLIS: Comprehensive Environmental Response, Compensation, and Liability Information System

CERCLIS contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). CERCLIS contains sites which are either proposed to or on the National Priorities List (NPL) and sites which are in the screening and assessment phase for possible inclusion on the NPL.

Date of Government Version: 11/30/2010	Source: EPA
Date Data Arrived at EDR: 12/30/2010	Telephone: 703-412-9810
Date Made Active in Reports: 02/25/2011	Last EDR Contact: 03/01/2011
Number of Days to Update: 57	Next Scheduled EDR Contact: 06/13/2011
	Data Release Frequency: Quarterly

FEDERAL FACILITY: Federal Facility Site Information listing

A listing of National Priority List (NPL) and Base Realignment and Closure (BRAC) sites found in the Comprehensive Environmental Response, Compensation and Liability Information System (CERCLIS) Database where EPA's Federal Facilities Restoration and Reuse Office is involved in cleanup activities.

Date of Government Version: 12/10/2010	Source: Environmental Protection Agency
Date Data Arrived at EDR: 01/11/2011	Telephone: 703-603-8704
Date Made Active in Reports: 02/16/2011	Last EDR Contact: 01/11/2011
Number of Days to Update: 36	Next Scheduled EDR Contact: 04/25/2011
	Data Release Frequency: Varies

Federal CERCLIS NFRAP site List

CERCLIS-NFRAP: CERCLIS No Further Remedial Action Planned

Archived sites are sites that have been removed and archived from the inventory of CERCLIS sites. Archived status indicates that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list this site on the National Priorities List (NPL), unless information indicates this decision was not appropriate or other considerations require a recommendation for listing at a later time. This decision does not necessarily mean that there is no hazard associated with a given site; it only means that, based upon available information, the location is not judged to be a potential NPL site.

Date of Government Version: 10/28/2010	Source: EPA
Date Data Arrived at EDR: 12/01/2010	Telephone: 703-412-9810
Date Made Active in Reports: 02/25/2011	Last EDR Contact: 03/01/2011
Number of Days to Update: 86	Next Scheduled EDR Contact: 06/13/2011
	Data Release Frequency: Quarterly

Federal RCRA CORRACTS facilities list

CORRACTS: Corrective Action Report

CORRACTS identifies hazardous waste handlers with RCRA corrective action activity.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 05/25/2010
Date Data Arrived at EDR: 06/02/2010
Date Made Active in Reports: 10/04/2010
Number of Days to Update: 124

Source: EPA
Telephone: 800-424-9346
Last EDR Contact: 02/14/2011
Next Scheduled EDR Contact: 05/30/2011
Data Release Frequency: Quarterly

Federal RCRA non-CORRACTS TSD facilities list

RCRA-TSDF: RCRA - Treatment, Storage and Disposal

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Transporters are individuals or entities that move hazardous waste from the generator offsite to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste.

Date of Government Version: 02/17/2010
Date Data Arrived at EDR: 02/19/2010
Date Made Active in Reports: 05/17/2010
Number of Days to Update: 87

Source: Environmental Protection Agency
Telephone: (404) 562-8651
Last EDR Contact: 01/06/2011
Next Scheduled EDR Contact: 04/18/2011
Data Release Frequency: Quarterly

Federal RCRA generators list

RCRA-LQG: RCRA - Large Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Large quantity generators (LQGs) generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month.

Date of Government Version: 02/17/2010
Date Data Arrived at EDR: 02/19/2010
Date Made Active in Reports: 05/17/2010
Number of Days to Update: 87

Source: Environmental Protection Agency
Telephone: (404) 562-8651
Last EDR Contact: 01/06/2011
Next Scheduled EDR Contact: 04/18/2011
Data Release Frequency: Quarterly

RCRA-SQG: RCRA - Small Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month.

Date of Government Version: 02/17/2010
Date Data Arrived at EDR: 02/19/2010
Date Made Active in Reports: 05/17/2010
Number of Days to Update: 87

Source: Environmental Protection Agency
Telephone: (404) 562-8651
Last EDR Contact: 01/06/2011
Next Scheduled EDR Contact: 04/18/2011
Data Release Frequency: Quarterly

RCRA-CESQG: RCRA - Conditionally Exempt Small Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally exempt small quantity generators (CESQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month.

Date of Government Version: 02/17/2010
Date Data Arrived at EDR: 02/19/2010
Date Made Active in Reports: 05/17/2010
Number of Days to Update: 87

Source: Environmental Protection Agency
Telephone: (404) 562-8651
Last EDR Contact: 01/06/2011
Next Scheduled EDR Contact: 04/18/2011
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Federal institutional controls / engineering controls registries

US ENG CONTROLS: Engineering Controls Sites List

A listing of sites with engineering controls in place. Engineering controls include various forms of caps, building foundations, liners, and treatment methods to create pathway elimination for regulated substances to enter environmental media or effect human health.

Date of Government Version: 01/05/2011	Source: Environmental Protection Agency
Date Data Arrived at EDR: 01/14/2011	Telephone: 703-603-0695
Date Made Active in Reports: 01/28/2011	Last EDR Contact: 03/14/2011
Number of Days to Update: 14	Next Scheduled EDR Contact: 06/27/2011
	Data Release Frequency: Varies

US INST CONTROL: Sites with Institutional Controls

A listing of sites with institutional controls in place. Institutional controls include administrative measures, such as groundwater use restrictions, construction restrictions, property use restrictions, and post remediation care requirements intended to prevent exposure to contaminants remaining on site. Deed restrictions are generally required as part of the institutional controls.

Date of Government Version: 01/05/2011	Source: Environmental Protection Agency
Date Data Arrived at EDR: 01/14/2011	Telephone: 703-603-0695
Date Made Active in Reports: 01/28/2011	Last EDR Contact: 03/14/2011
Number of Days to Update: 14	Next Scheduled EDR Contact: 06/27/2011
	Data Release Frequency: Varies

Federal ERNS list

ERNS: Emergency Response Notification System

Emergency Response Notification System. ERNS records and stores information on reported releases of oil and hazardous substances.

Date of Government Version: 12/31/2010	Source: National Response Center, United States Coast Guard
Date Data Arrived at EDR: 01/07/2011	Telephone: 202-267-2180
Date Made Active in Reports: 03/21/2011	Last EDR Contact: 01/07/2011
Number of Days to Update: 73	Next Scheduled EDR Contact: 04/18/2011
	Data Release Frequency: Annually

State- and tribal - equivalent NPL

HSDS: Hazardous Substance Disposal Site

Locations of uncontrolled and unregulated hazardous waste sites. The file includes sites on the National Priority List as well as those on the state priority list.

Date of Government Version: 04/06/2006	Source: North Carolina Center for Geographic Information and Analysis
Date Data Arrived at EDR: 02/28/2007	Telephone: 919-754-6580
Date Made Active in Reports: 04/13/2007	Last EDR Contact: 02/09/2011
Number of Days to Update: 44	Next Scheduled EDR Contact: 05/23/2011
	Data Release Frequency: Biennially

State- and tribal - equivalent CERCLIS

SHWS: Inactive Hazardous Sites Inventory

State Hazardous Waste Sites. State hazardous waste site records are the states' equivalent to CERCLIS. These sites may or may not already be listed on the federal CERCLIS list. Priority sites planned for cleanup using state funds (state equivalent of Superfund) are identified along with sites where cleanup will be paid for by potentially responsible parties. Available information varies by state.

Date of Government Version: 01/06/2011	Source: Department of Environment, Health and Natural Resources
Date Data Arrived at EDR: 01/18/2011	Telephone: 919-508-8400
Date Made Active in Reports: 02/18/2011	Last EDR Contact: 03/21/2011
Number of Days to Update: 31	Next Scheduled EDR Contact: 07/04/2011
	Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

State and tribal landfill and/or solid waste disposal site lists

SWF/LF: List of Solid Waste Facilities

Solid Waste Facilities/Landfill Sites. SWF/LF type records typically contain an inventory of solid waste disposal facilities or landfills in a particular state. Depending on the state, these may be active or inactive facilities or open dumps that failed to meet RCRA Subtitle D Section 4004 criteria for solid waste landfills or disposal sites.

Date of Government Version: 01/04/2011	Source: Department of Environment and Natural Resources
Date Data Arrived at EDR: 01/05/2011	Telephone: 919-733-0692
Date Made Active in Reports: 02/11/2011	Last EDR Contact: 10/07/2010
Number of Days to Update: 37	Next Scheduled EDR Contact: 04/18/2011
	Data Release Frequency: Semi-Annually

OLI: Old Landfill Inventory

Old landfill inventory location information. (Does not include no further action sites and other agency lead sites).

Date of Government Version: 01/06/2011	Source: Department of Environment & Natural Resources
Date Data Arrived at EDR: 01/18/2011	Telephone: 919-733-4996
Date Made Active in Reports: 02/11/2011	Last EDR Contact: 01/10/2011
Number of Days to Update: 24	Next Scheduled EDR Contact: 04/18/2011
	Data Release Frequency: Varies

State and tribal leaking storage tank lists

LUST: Regional UST Database

This database contains information obtained from the Regional Offices. It provides a more detailed explanation of current and historic activity for individual sites, as well as what was previously found in the Incident Management Database. Sites in this database with Incident Numbers are considered LUSTs.

Date of Government Version: 02/11/2011	Source: Department of Environment and Natural Resources
Date Data Arrived at EDR: 02/16/2011	Telephone: 919-733-1308
Date Made Active in Reports: 03/14/2011	Last EDR Contact: 02/16/2011
Number of Days to Update: 26	Next Scheduled EDR Contact: 05/30/2011
	Data Release Frequency: Quarterly

LUST TRUST: State Trust Fund Database

This database contains information about claims against the State Trust Funds for reimbursements for expenses incurred while remediating Leaking USTs.

Date of Government Version: 12/17/2010	Source: Department of Environment and Natural Resources
Date Data Arrived at EDR: 01/18/2011	Telephone: 919-733-1315
Date Made Active in Reports: 02/11/2011	Last EDR Contact: 01/18/2011
Number of Days to Update: 24	Next Scheduled EDR Contact: 05/02/2011
	Data Release Frequency: Semi-Annually

LAST: Leaking Aboveground Storage Tanks

A listing of leaking aboveground storage tank site locations.

Date of Government Version: 02/11/2011	Source: Department of Environment & Natural Resources
Date Data Arrived at EDR: 02/16/2011	Telephone: 877-623-6748
Date Made Active in Reports: 03/14/2011	Last EDR Contact: 02/16/2011
Number of Days to Update: 26	Next Scheduled EDR Contact: 05/30/2011
	Data Release Frequency: Quarterly

INDIAN LUST R4: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Florida, Mississippi and North Carolina.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 08/27/2010
Date Data Arrived at EDR: 08/30/2010
Date Made Active in Reports: 10/04/2010
Number of Days to Update: 35

Source: EPA Region 4
Telephone: 404-562-8677
Last EDR Contact: 02/16/2011
Next Scheduled EDR Contact: 05/16/2011
Data Release Frequency: Semi-Annually

INDIAN LUST R9: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Arizona, California, New Mexico and Nevada

Date of Government Version: 01/31/2011
Date Data Arrived at EDR: 02/01/2011
Date Made Active in Reports: 03/21/2011
Number of Days to Update: 48

Source: Environmental Protection Agency
Telephone: 415-972-3372
Last EDR Contact: 01/31/2011
Next Scheduled EDR Contact: 05/16/2011
Data Release Frequency: Quarterly

INDIAN LUST R10: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Alaska, Idaho, Oregon and Washington.

Date of Government Version: 02/03/2011
Date Data Arrived at EDR: 02/04/2011
Date Made Active in Reports: 03/21/2011
Number of Days to Update: 45

Source: EPA Region 10
Telephone: 206-553-2857
Last EDR Contact: 01/31/2011
Next Scheduled EDR Contact: 05/16/2011
Data Release Frequency: Quarterly

INDIAN LUST R1: Leaking Underground Storage Tanks on Indian Land
A listing of leaking underground storage tank locations on Indian Land.

Date of Government Version: 09/01/2010
Date Data Arrived at EDR: 11/05/2010
Date Made Active in Reports: 01/28/2011
Number of Days to Update: 84

Source: EPA Region 1
Telephone: 617-918-1313
Last EDR Contact: 02/03/2011
Next Scheduled EDR Contact: 05/16/2011
Data Release Frequency: Varies

INDIAN LUST R6: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in New Mexico and Oklahoma.

Date of Government Version: 02/03/2011
Date Data Arrived at EDR: 02/04/2011
Date Made Active in Reports: 03/21/2011
Number of Days to Update: 45

Source: EPA Region 6
Telephone: 214-665-6597
Last EDR Contact: 01/31/2011
Next Scheduled EDR Contact: 05/16/2011
Data Release Frequency: Varies

INDIAN LUST R7: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Iowa, Kansas, and Nebraska

Date of Government Version: 11/04/2009
Date Data Arrived at EDR: 05/04/2010
Date Made Active in Reports: 07/07/2010
Number of Days to Update: 64

Source: EPA Region 7
Telephone: 913-551-7003
Last EDR Contact: 05/04/2010
Next Scheduled EDR Contact: 05/16/2011
Data Release Frequency: Varies

INDIAN LUST R8: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Colorado, Montana, North Dakota, South Dakota, Utah and Wyoming.

Date of Government Version: 02/04/2011
Date Data Arrived at EDR: 02/04/2011
Date Made Active in Reports: 03/21/2011
Number of Days to Update: 45

Source: EPA Region 8
Telephone: 303-312-6271
Last EDR Contact: 01/31/2011
Next Scheduled EDR Contact: 05/16/2011
Data Release Frequency: Quarterly

State and tribal registered storage tank lists

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

UST: Petroleum Underground Storage Tank Database

Registered Underground Storage Tanks. UST's are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA) and must be registered with the state department responsible for administering the UST program. Available information varies by state program.

Date of Government Version: 12/21/2010
Date Data Arrived at EDR: 02/16/2011
Date Made Active in Reports: 03/15/2011
Number of Days to Update: 27

Source: Department of Environment and Natural Resources
Telephone: 919-733-1308
Last EDR Contact: 02/16/2011
Next Scheduled EDR Contact: 05/30/2011
Data Release Frequency: Quarterly

AST: AST Database

Facilities with aboveground storage tanks that have a capacity greater than 21,000 gallons.

Date of Government Version: 09/27/2010
Date Data Arrived at EDR: 09/28/2010
Date Made Active in Reports: 11/29/2010
Number of Days to Update: 62

Source: Department of Environment and Natural Resources
Telephone: 919-715-6183
Last EDR Contact: 12/23/2010
Next Scheduled EDR Contact: 04/11/2011
Data Release Frequency: Semi-Annually

INDIAN UST R9: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 9 (Arizona, California, Hawaii, Nevada, the Pacific Islands, and Tribal Nations).

Date of Government Version: 01/31/2011
Date Data Arrived at EDR: 02/01/2011
Date Made Active in Reports: 03/21/2011
Number of Days to Update: 48

Source: EPA Region 9
Telephone: 415-972-3368
Last EDR Contact: 01/31/2011
Next Scheduled EDR Contact: 05/16/2011
Data Release Frequency: Quarterly

INDIAN UST R4: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 4 (Alabama, Florida, Georgia, Kentucky, Mississippi, North Carolina, South Carolina, Tennessee and Tribal Nations)

Date of Government Version: 08/27/2010
Date Data Arrived at EDR: 08/30/2010
Date Made Active in Reports: 10/04/2010
Number of Days to Update: 35

Source: EPA Region 4
Telephone: 404-562-9424
Last EDR Contact: 02/16/2011
Next Scheduled EDR Contact: 05/16/2011
Data Release Frequency: Semi-Annually

INDIAN UST R7: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 7 (Iowa, Kansas, Missouri, Nebraska, and 9 Tribal Nations).

Date of Government Version: 11/01/2010
Date Data Arrived at EDR: 12/02/2010
Date Made Active in Reports: 01/28/2011
Number of Days to Update: 57

Source: EPA Region 7
Telephone: 913-551-7003
Last EDR Contact: 02/03/2011
Next Scheduled EDR Contact: 05/16/2011
Data Release Frequency: Varies

INDIAN UST R6: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 6 (Louisiana, Arkansas, Oklahoma, New Mexico, Texas and 65 Tribes).

Date of Government Version: 02/03/2011
Date Data Arrived at EDR: 02/04/2011
Date Made Active in Reports: 03/21/2011
Number of Days to Update: 45

Source: EPA Region 6
Telephone: 214-665-7591
Last EDR Contact: 01/31/2011
Next Scheduled EDR Contact: 05/16/2011
Data Release Frequency: Semi-Annually

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

INDIAN UST R1: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 1 (Connecticut, Maine, Massachusetts, New Hampshire, Rhode Island, Vermont and ten Tribal Nations).

Date of Government Version: 09/01/2010	Source: EPA, Region 1
Date Data Arrived at EDR: 11/05/2010	Telephone: 617-918-1313
Date Made Active in Reports: 01/28/2011	Last EDR Contact: 02/03/2011
Number of Days to Update: 84	Next Scheduled EDR Contact: 05/16/2011
	Data Release Frequency: Varies

INDIAN UST R8: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 8 (Colorado, Montana, North Dakota, South Dakota, Utah, Wyoming and 27 Tribal Nations).

Date of Government Version: 02/04/2011	Source: EPA Region 8
Date Data Arrived at EDR: 02/04/2011	Telephone: 303-312-6137
Date Made Active in Reports: 03/21/2011	Last EDR Contact: 01/31/2011
Number of Days to Update: 45	Next Scheduled EDR Contact: 05/16/2011
	Data Release Frequency: Quarterly

INDIAN UST R5: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 5 (Michigan, Minnesota and Wisconsin and Tribal Nations).

Date of Government Version: 02/11/2010	Source: EPA Region 5
Date Data Arrived at EDR: 02/11/2010	Telephone: 312-886-6136
Date Made Active in Reports: 04/12/2010	Last EDR Contact: 01/31/2011
Number of Days to Update: 60	Next Scheduled EDR Contact: 05/16/2011
	Data Release Frequency: Varies

INDIAN UST R10: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 10 (Alaska, Idaho, Oregon, Washington, and Tribal Nations).

Date of Government Version: 02/03/2011	Source: EPA Region 10
Date Data Arrived at EDR: 02/04/2011	Telephone: 206-553-2857
Date Made Active in Reports: 03/21/2011	Last EDR Contact: 01/31/2011
Number of Days to Update: 45	Next Scheduled EDR Contact: 05/16/2011
	Data Release Frequency: Quarterly

FEMA UST: Underground Storage Tank Listing

A listing of all FEMA owned underground storage tanks.

Date of Government Version: 01/01/2010	Source: FEMA
Date Data Arrived at EDR: 02/16/2010	Telephone: 202-646-5797
Date Made Active in Reports: 04/12/2010	Last EDR Contact: 01/17/2011
Number of Days to Update: 55	Next Scheduled EDR Contact: 05/02/2011
	Data Release Frequency: Varies

State and tribal institutional control / engineering control registries

INST CONTROL: No Further Action Sites With Land Use Restrictions Monitoring

A land use restricted site is a property where there are limits or requirements on future use of the property due to varying levels of cleanup possible, practical, or necessary at the site.

Date of Government Version: 01/06/2011	Source: Department of Environment, Health and Natural Resources
Date Data Arrived at EDR: 01/07/2011	Telephone: 919-508-8400
Date Made Active in Reports: 02/11/2011	Last EDR Contact: 12/17/2110
Number of Days to Update: 35	Next Scheduled EDR Contact: 07/04/2011
	Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

State and tribal voluntary cleanup sites

INDIAN VCP R1: Voluntary Cleanup Priority Listing

A listing of voluntary cleanup priority sites located on Indian Land located in Region 1.

Date of Government Version: 09/01/2010	Source: EPA, Region 1
Date Data Arrived at EDR: 01/05/2011	Telephone: 617-918-1102
Date Made Active in Reports: 03/21/2011	Last EDR Contact: 01/05/2010
Number of Days to Update: 75	Next Scheduled EDR Contact: 04/18/2011
	Data Release Frequency: Varies

INDIAN VCP R7: Voluntary Cleanup Priority Listing

A listing of voluntary cleanup priority sites located on Indian Land located in Region 7.

Date of Government Version: 03/20/2008	Source: EPA, Region 7
Date Data Arrived at EDR: 04/22/2008	Telephone: 913-551-7365
Date Made Active in Reports: 05/19/2008	Last EDR Contact: 04/20/2009
Number of Days to Update: 27	Next Scheduled EDR Contact: 07/20/2009
	Data Release Frequency: Varies

VCP: Responsible Party Voluntary Action Sites

Responsible Party Voluntary Action site locations.

Date of Government Version: 01/06/2011	Source: Department of Environment and Natural Resources
Date Data Arrived at EDR: 01/07/2011	Telephone: 919-508-8400
Date Made Active in Reports: 02/11/2011	Last EDR Contact: 03/21/2011
Number of Days to Update: 35	Next Scheduled EDR Contact: 07/04/2011
	Data Release Frequency: Semi-Annually

State and tribal Brownfields sites

BROWNFIELDS: Brownfields Projects Inventory

A brownfield site is an abandoned, idled, or underused property where the threat of environmental contamination has hindered its redevelopment. All of the sites in the inventory are working toward a brownfield agreement for cleanup and liability control.

Date of Government Version: 03/31/2010	Source: Department of Environment and Natural Resources
Date Data Arrived at EDR: 10/19/2010	Telephone: 919-733-4996
Date Made Active in Reports: 12/28/2010	Last EDR Contact: 01/14/2011
Number of Days to Update: 70	Next Scheduled EDR Contact: 04/25/2011
	Data Release Frequency: Varies

ADDITIONAL ENVIRONMENTAL RECORDS

Local Brownfield lists

US BROWNFIELDS: A Listing of Brownfields Sites

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Included in the listing are brownfields properties addresses by Cooperative Agreement Recipients and brownfields properties addressed by Targeted Brownfields Assessments. Targeted Brownfields Assessments-EPA's Targeted Brownfields Assessments (TBA) program is designed to help states, tribes, and municipalities--especially those without EPA Brownfields Assessment Demonstration Pilots--minimize the uncertainties of contamination often associated with brownfields. Under the TBA program, EPA provides funding and/or technical assistance for environmental assessments at brownfields sites throughout the country. Targeted Brownfields Assessments supplement and work with other efforts under EPA's Brownfields Initiative to promote cleanup and redevelopment of brownfields. Cooperative Agreement Recipients-States, political subdivisions, territories, and Indian tribes become Brownfields Cleanup Revolving Loan Fund (BCRLF) cooperative agreement recipients when they enter into BCRLF cooperative agreements with the U.S. EPA. EPA selects BCRLF cooperative agreement recipients based on a proposal and application process. BCRLF cooperative agreement recipients must use EPA funds provided through BCRLF cooperative agreement for specified brownfields-related cleanup activities.

Date of Government Version: 12/29/2010	Source: Environmental Protection Agency
Date Data Arrived at EDR: 12/30/2010	Telephone: 202-566-2777
Date Made Active in Reports: 03/21/2011	Last EDR Contact: 12/30/2010
Number of Days to Update: 81	Next Scheduled EDR Contact: 04/11/2011
	Data Release Frequency: Semi-Annually

Local Lists of Landfill / Solid Waste Disposal Sites

ODI: Open Dump Inventory

An open dump is defined as a disposal facility that does not comply with one or more of the Part 257 or Part 258 Subtitle D Criteria.

Date of Government Version: 06/30/1985	Source: Environmental Protection Agency
Date Data Arrived at EDR: 08/09/2004	Telephone: 800-424-9346
Date Made Active in Reports: 09/17/2004	Last EDR Contact: 06/09/2004
Number of Days to Update: 39	Next Scheduled EDR Contact: N/A
	Data Release Frequency: No Update Planned

DEBRIS REGION 9: Torres Martinez Reservation Illegal Dump Site Locations

A listing of illegal dump sites location on the Torres Martinez Indian Reservation located in eastern Riverside County and northern Imperial County, California.

Date of Government Version: 01/12/2009	Source: EPA, Region 9
Date Data Arrived at EDR: 05/07/2009	Telephone: 415-947-4219
Date Made Active in Reports: 09/21/2009	Last EDR Contact: 12/22/2010
Number of Days to Update: 137	Next Scheduled EDR Contact: 04/11/2011
	Data Release Frequency: No Update Planned

HIST LF: Solid Waste Facility Listing

A listing of solid waste facilities.

Date of Government Version: 11/06/2006	Source: Department of Environment & Natural Resources
Date Data Arrived at EDR: 02/13/2007	Telephone: 919-733-0692
Date Made Active in Reports: 03/02/2007	Last EDR Contact: 01/19/2009
Number of Days to Update: 17	Next Scheduled EDR Contact: 04/19/2009
	Data Release Frequency: Quarterly

INDIAN ODI: Report on the Status of Open Dumps on Indian Lands

Location of open dumps on Indian land.

Date of Government Version: 12/31/1998	Source: Environmental Protection Agency
Date Data Arrived at EDR: 12/03/2007	Telephone: 703-308-8245
Date Made Active in Reports: 01/24/2008	Last EDR Contact: 02/08/2011
Number of Days to Update: 52	Next Scheduled EDR Contact: 05/23/2011
	Data Release Frequency: Varies

Local Lists of Hazardous waste / Contaminated Sites

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

US CDL: Clandestine Drug Labs

A listing of clandestine drug lab locations. The U.S. Department of Justice ("the Department") provides this web site as a public service. It contains addresses of some locations where law enforcement agencies reported they found chemicals or other items that indicated the presence of either clandestine drug laboratories or dumpsites. In most cases, the source of the entries is not the Department, and the Department has not verified the entry and does not guarantee its accuracy. Members of the public must verify the accuracy of all entries by, for example, contacting local law enforcement and local health departments.

Date of Government Version: 12/03/2010	Source: Drug Enforcement Administration
Date Data Arrived at EDR: 12/30/2010	Telephone: 202-307-1000
Date Made Active in Reports: 02/16/2011	Last EDR Contact: 03/08/2011
Number of Days to Update: 48	Next Scheduled EDR Contact: 06/20/2011
	Data Release Frequency: Quarterly

US HIST CDL: National Clandestine Laboratory Register

A listing of clandestine drug lab locations. The U.S. Department of Justice ("the Department") provides this web site as a public service. It contains addresses of some locations where law enforcement agencies reported they found chemicals or other items that indicated the presence of either clandestine drug laboratories or dumpsites. In most cases, the source of the entries is not the Department, and the Department has not verified the entry and does not guarantee its accuracy. Members of the public must verify the accuracy of all entries by, for example, contacting local law enforcement and local health departments.

Date of Government Version: 09/01/2007	Source: Drug Enforcement Administration
Date Data Arrived at EDR: 11/19/2008	Telephone: 202-307-1000
Date Made Active in Reports: 03/30/2009	Last EDR Contact: 03/23/2009
Number of Days to Update: 131	Next Scheduled EDR Contact: 06/22/2009
	Data Release Frequency: No Update Planned

Local Land Records

LIENS 2: CERCLA Lien Information

A Federal CERCLA ('Superfund') lien can exist by operation of law at any site or property at which EPA has spent Superfund monies. These monies are spent to investigate and address releases and threatened releases of contamination. CERCLIS provides information as to the identity of these sites and properties.

Date of Government Version: 11/09/2010	Source: Environmental Protection Agency
Date Data Arrived at EDR: 11/16/2010	Telephone: 202-564-6023
Date Made Active in Reports: 02/16/2011	Last EDR Contact: 01/31/2011
Number of Days to Update: 92	Next Scheduled EDR Contact: 05/16/2011
	Data Release Frequency: Varies

LUCIS: Land Use Control Information System

LUCIS contains records of land use control information pertaining to the former Navy Base Realignment and Closure properties.

Date of Government Version: 12/09/2005	Source: Department of the Navy
Date Data Arrived at EDR: 12/11/2006	Telephone: 843-820-7326
Date Made Active in Reports: 01/11/2007	Last EDR Contact: 02/22/2011
Number of Days to Update: 31	Next Scheduled EDR Contact: 06/06/2011
	Data Release Frequency: Varies

Records of Emergency Release Reports

HMIRS: Hazardous Materials Information Reporting System

Hazardous Materials Incident Report System. HMIRS contains hazardous material spill incidents reported to DOT.

Date of Government Version: 12/31/2010	Source: U.S. Department of Transportation
Date Data Arrived at EDR: 01/05/2011	Telephone: 202-366-4555
Date Made Active in Reports: 02/25/2011	Last EDR Contact: 01/05/2011
Number of Days to Update: 51	Next Scheduled EDR Contact: 04/18/2011
	Data Release Frequency: Annually

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Other Ascertainable Records

RCRA-NonGen: RCRA - Non Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste.

Date of Government Version: 02/17/2010	Source: Environmental Protection Agency
Date Data Arrived at EDR: 02/19/2010	Telephone: (404) 562-8651
Date Made Active in Reports: 05/17/2010	Last EDR Contact: 01/06/2011
Number of Days to Update: 87	Next Scheduled EDR Contact: 04/18/2011
	Data Release Frequency: Varies

DOT OPS: Incident and Accident Data

Department of Transportation, Office of Pipeline Safety Incident and Accident data.

Date of Government Version: 10/13/2010	Source: Department of Transportation, Office of Pipeline Safety
Date Data Arrived at EDR: 12/10/2010	Telephone: 202-366-4595
Date Made Active in Reports: 02/25/2011	Last EDR Contact: 02/11/2011
Number of Days to Update: 77	Next Scheduled EDR Contact: 05/23/2011
	Data Release Frequency: Varies

DOD: Department of Defense Sites

This data set consists of federally owned or administered lands, administered by the Department of Defense, that have any area equal to or greater than 640 acres of the United States, Puerto Rico, and the U.S. Virgin Islands.

Date of Government Version: 12/31/2005	Source: USGS
Date Data Arrived at EDR: 11/10/2006	Telephone: 703-692-8801
Date Made Active in Reports: 01/11/2007	Last EDR Contact: 01/21/2011
Number of Days to Update: 62	Next Scheduled EDR Contact: 05/02/2011
	Data Release Frequency: Semi-Annually

FUDS: Formerly Used Defense Sites

The listing includes locations of Formerly Used Defense Sites properties where the US Army Corps of Engineers is actively working or will take necessary cleanup actions.

Date of Government Version: 12/31/2009	Source: U.S. Army Corps of Engineers
Date Data Arrived at EDR: 08/12/2010	Telephone: 202-528-4285
Date Made Active in Reports: 12/02/2010	Last EDR Contact: 03/15/2011
Number of Days to Update: 112	Next Scheduled EDR Contact: 06/27/2011
	Data Release Frequency: Varies

CONSENT: Superfund (CERCLA) Consent Decrees

Major legal settlements that establish responsibility and standards for cleanup at NPL (Superfund) sites. Released periodically by United States District Courts after settlement by parties to litigation matters.

Date of Government Version: 10/01/2010	Source: Department of Justice, Consent Decree Library
Date Data Arrived at EDR: 10/29/2010	Telephone: Varies
Date Made Active in Reports: 01/28/2011	Last EDR Contact: 01/03/2011
Number of Days to Update: 91	Next Scheduled EDR Contact: 04/18/2011
	Data Release Frequency: Varies

ROD: Records Of Decision

Record of Decision. ROD documents mandate a permanent remedy at an NPL (Superfund) site containing technical and health information to aid in the cleanup.

Date of Government Version: 02/25/2011	Source: EPA
Date Data Arrived at EDR: 03/16/2011	Telephone: 703-416-0223
Date Made Active in Reports: 03/21/2011	Last EDR Contact: 03/16/2011
Number of Days to Update: 5	Next Scheduled EDR Contact: 06/27/2011
	Data Release Frequency: Annually

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

UMTRA: Uranium Mill Tailings Sites

Uranium ore was mined by private companies for federal government use in national defense programs. When the mills shut down, large piles of the sand-like material (mill tailings) remain after uranium has been extracted from the ore. Levels of human exposure to radioactive materials from the piles are low; however, in some cases tailings were used as construction materials before the potential health hazards of the tailings were recognized.

Date of Government Version: 09/14/2010	Source: Department of Energy
Date Data Arrived at EDR: 10/21/2010	Telephone: 505-845-0011
Date Made Active in Reports: 01/28/2011	Last EDR Contact: 03/04/2011
Number of Days to Update: 99	Next Scheduled EDR Contact: 06/13/2011
	Data Release Frequency: Varies

MINES: Mines Master Index File

Contains all mine identification numbers issued for mines active or opened since 1971. The data also includes violation information.

Date of Government Version: 08/04/2010	Source: Department of Labor, Mine Safety and Health Administration
Date Data Arrived at EDR: 09/09/2010	Telephone: 303-231-5959
Date Made Active in Reports: 12/02/2010	Last EDR Contact: 03/09/2011
Number of Days to Update: 84	Next Scheduled EDR Contact: 06/20/2011
	Data Release Frequency: Semi-Annually

TRIS: Toxic Chemical Release Inventory System

Toxic Release Inventory System. TRIS identifies facilities which release toxic chemicals to the air, water and land in reportable quantities under SARA Title III Section 313.

Date of Government Version: 12/31/2009	Source: EPA
Date Data Arrived at EDR: 12/17/2010	Telephone: 202-566-0250
Date Made Active in Reports: 03/21/2011	Last EDR Contact: 03/01/2011
Number of Days to Update: 94	Next Scheduled EDR Contact: 06/13/2011
	Data Release Frequency: Annually

TSCA: Toxic Substances Control Act

Toxic Substances Control Act. TSCA identifies manufacturers and importers of chemical substances included on the TSCA Chemical Substance Inventory list. It includes data on the production volume of these substances by plant site.

Date of Government Version: 12/31/2006	Source: EPA
Date Data Arrived at EDR: 09/29/2010	Telephone: 202-260-5521
Date Made Active in Reports: 12/02/2010	Last EDR Contact: 12/29/2010
Number of Days to Update: 64	Next Scheduled EDR Contact: 04/11/2011
	Data Release Frequency: Every 4 Years

FTTS: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)

FTTS tracks administrative cases and pesticide enforcement actions and compliance activities related to FIFRA, TSCA and EPCRA (Emergency Planning and Community Right-to-Know Act). To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 04/09/2009	Source: EPA/Office of Prevention, Pesticides and Toxic Substances
Date Data Arrived at EDR: 04/16/2009	Telephone: 202-566-1667
Date Made Active in Reports: 05/11/2009	Last EDR Contact: 02/28/2011
Number of Days to Update: 25	Next Scheduled EDR Contact: 06/13/2011
	Data Release Frequency: Quarterly

FTTS INSP: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)

A listing of FIFRA/TSCA Tracking System (FTTS) inspections and enforcements.

Date of Government Version: 04/09/2009	Source: EPA
Date Data Arrived at EDR: 04/16/2009	Telephone: 202-566-1667
Date Made Active in Reports: 05/11/2009	Last EDR Contact: 02/28/2011
Number of Days to Update: 25	Next Scheduled EDR Contact: 06/13/2011
	Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

HIST FTTS: FIFRA/TSCA Tracking System Administrative Case Listing

A complete administrative case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

Date of Government Version: 10/19/2006	Source: Environmental Protection Agency
Date Data Arrived at EDR: 03/01/2007	Telephone: 202-564-2501
Date Made Active in Reports: 04/10/2007	Last EDR Contact: 12/17/2007
Number of Days to Update: 40	Next Scheduled EDR Contact: 03/17/2008
	Data Release Frequency: No Update Planned

HIST FTTS INSP: FIFRA/TSCA Tracking System Inspection & Enforcement Case Listing

A complete inspection and enforcement case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

Date of Government Version: 10/19/2006	Source: Environmental Protection Agency
Date Data Arrived at EDR: 03/01/2007	Telephone: 202-564-2501
Date Made Active in Reports: 04/10/2007	Last EDR Contact: 12/17/2008
Number of Days to Update: 40	Next Scheduled EDR Contact: 03/17/2008
	Data Release Frequency: No Update Planned

SSTS: Section 7 Tracking Systems

Section 7 of the Federal Insecticide, Fungicide and Rodenticide Act, as amended (92 Stat. 829) requires all registered pesticide-producing establishments to submit a report to the Environmental Protection Agency by March 1st each year. Each establishment must report the types and amounts of pesticides, active ingredients and devices being produced, and those having been produced and sold or distributed in the past year.

Date of Government Version: 12/31/2009	Source: EPA
Date Data Arrived at EDR: 12/10/2010	Telephone: 202-564-4203
Date Made Active in Reports: 02/25/2011	Last EDR Contact: 01/31/2011
Number of Days to Update: 77	Next Scheduled EDR Contact: 05/16/2011
	Data Release Frequency: Annually

ICIS: Integrated Compliance Information System

The Integrated Compliance Information System (ICIS) supports the information needs of the national enforcement and compliance program as well as the unique needs of the National Pollutant Discharge Elimination System (NPDES) program.

Date of Government Version: 01/07/2011	Source: Environmental Protection Agency
Date Data Arrived at EDR: 01/21/2011	Telephone: 202-564-5088
Date Made Active in Reports: 03/21/2011	Last EDR Contact: 12/23/2010
Number of Days to Update: 59	Next Scheduled EDR Contact: 04/11/2011
	Data Release Frequency: Quarterly

PADS: PCB Activity Database System

PCB Activity Database. PADS Identifies generators, transporters, commercial storers and/or brokers and disposers of PCB's who are required to notify the EPA of such activities.

Date of Government Version: 11/01/2010	Source: EPA
Date Data Arrived at EDR: 11/10/2010	Telephone: 202-566-0500
Date Made Active in Reports: 02/16/2011	Last EDR Contact: 01/21/2011
Number of Days to Update: 98	Next Scheduled EDR Contact: 05/02/2011
	Data Release Frequency: Annually

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

MLTS: Material Licensing Tracking System

MLTS is maintained by the Nuclear Regulatory Commission and contains a list of approximately 8,100 sites which possess or use radioactive materials and which are subject to NRC licensing requirements. To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 03/18/2010	Source: Nuclear Regulatory Commission
Date Data Arrived at EDR: 04/06/2010	Telephone: 301-415-7169
Date Made Active in Reports: 05/27/2010	Last EDR Contact: 03/14/2011
Number of Days to Update: 51	Next Scheduled EDR Contact: 06/27/2011
	Data Release Frequency: Quarterly

RADINFO: Radiation Information Database

The Radiation Information Database (RADINFO) contains information about facilities that are regulated by U.S. Environmental Protection Agency (EPA) regulations for radiation and radioactivity.

Date of Government Version: 01/11/2011	Source: Environmental Protection Agency
Date Data Arrived at EDR: 01/13/2011	Telephone: 202-343-9775
Date Made Active in Reports: 02/16/2011	Last EDR Contact: 01/13/2011
Number of Days to Update: 34	Next Scheduled EDR Contact: 04/25/2011
	Data Release Frequency: Quarterly

FINDS: Facility Index System/Facility Registry System

Facility Index System. FINDS contains both facility information and 'pointers' to other sources that contain more detail. EDR includes the following FINDS databases in this report: PCS (Permit Compliance System), AIRS (Aerometric Information Retrieval System), DOCKET (Enforcement Docket used to manage and track information on civil judicial enforcement cases for all environmental statutes), FURS (Federal Underground Injection Control), C-DOCKET (Criminal Docket System used to track criminal enforcement actions for all environmental statutes), FFIS (Federal Facilities Information System), STATE (State Environmental Laws and Statutes), and PADS (PCB Activity Data System).

Date of Government Version: 04/14/2010	Source: EPA
Date Data Arrived at EDR: 04/16/2010	Telephone: (404) 562-9900
Date Made Active in Reports: 05/27/2010	Last EDR Contact: 03/14/2011
Number of Days to Update: 41	Next Scheduled EDR Contact: 06/27/2011
	Data Release Frequency: Quarterly

RAATS: RCRA Administrative Action Tracking System

RCRA Administration Action Tracking System. RAATS contains records based on enforcement actions issued under RCRA pertaining to major violators and includes administrative and civil actions brought by the EPA. For administration actions after September 30, 1995, data entry in the RAATS database was discontinued. EPA will retain a copy of the database for historical records. It was necessary to terminate RAATS because a decrease in agency resources made it impossible to continue to update the information contained in the database.

Date of Government Version: 04/17/1995	Source: EPA
Date Data Arrived at EDR: 07/03/1995	Telephone: 202-564-4104
Date Made Active in Reports: 08/07/1995	Last EDR Contact: 06/02/2008
Number of Days to Update: 35	Next Scheduled EDR Contact: 09/01/2008
	Data Release Frequency: No Update Planned

BRS: Biennial Reporting System

The Biennial Reporting System is a national system administered by the EPA that collects data on the generation and management of hazardous waste. BRS captures detailed data from two groups: Large Quantity Generators (LQG) and Treatment, Storage, and Disposal Facilities.

Date of Government Version: 12/31/2007	Source: EPA/NTIS
Date Data Arrived at EDR: 02/25/2010	Telephone: 800-424-9346
Date Made Active in Reports: 05/12/2010	Last EDR Contact: 03/01/2011
Number of Days to Update: 76	Next Scheduled EDR Contact: 06/13/2011
	Data Release Frequency: Biennially

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

IMD: Incident Management Database

Groundwater and/or soil contamination incidents

Date of Government Version: 07/21/2006
Date Data Arrived at EDR: 08/01/2006
Date Made Active in Reports: 08/23/2006
Number of Days to Update: 22

Source: Department of Environment and Natural Resources
Telephone: 919-733-3221
Last EDR Contact: 01/04/2011
Next Scheduled EDR Contact: 04/18/2011
Data Release Frequency: Quarterly

UIC: Underground Injection Wells Listing

A listing of uncerground injection wells locations.

Date of Government Version: 02/14/2011
Date Data Arrived at EDR: 02/16/2011
Date Made Active in Reports: 03/14/2011
Number of Days to Update: 26

Source: Department of Environment & Natural Resources
Telephone: 919-733-3221
Last EDR Contact: 02/14/2011
Next Scheduled EDR Contact: 05/30/2011
Data Release Frequency: Varies

DRYCLEANERS: Drycleaning Sites

Potential and known drycleaning sites, active and abandoned, that the Drycleaning Solvent Cleanup Program has knowledge of and entered into this database.

Date of Government Version: 10/08/2010
Date Data Arrived at EDR: 12/30/2010
Date Made Active in Reports: 02/11/2011
Number of Days to Update: 43

Source: Department of Environment & Natural Resources
Telephone: 919-508-8400
Last EDR Contact: 12/30/2010
Next Scheduled EDR Contact: 04/11/2011
Data Release Frequency: Varies

NPDES: NPDES Facility Location Listing

General information regarding NPDES(National Pollutant Discharge Elimination System) permits.

Date of Government Version: 02/23/2011
Date Data Arrived at EDR: 02/24/2011
Date Made Active in Reports: 03/22/2011
Number of Days to Update: 26

Source: Department of Environment & Natural Resources
Telephone: 919-733-7015
Last EDR Contact: 02/22/2011
Next Scheduled EDR Contact: 05/23/2011
Data Release Frequency: Varies

INDIAN RESERV: Indian Reservations

This map layer portrays Indian administered lands of the United States that have any area equal to or greater than 640 acres.

Date of Government Version: 12/31/2005
Date Data Arrived at EDR: 12/08/2006
Date Made Active in Reports: 01/11/2007
Number of Days to Update: 34

Source: USGS
Telephone: 202-208-3710
Last EDR Contact: 01/21/2011
Next Scheduled EDR Contact: 05/02/2011
Data Release Frequency: Semi-Annually

SCRD DRYCLEANERS: State Coalition for Remediation of Drycleaners Listing

The State Coalition for Remediation of Drycleaners was established in 1998, with support from the U.S. EPA Office of Superfund Remediation and Technology Innovation. It is comprised of representatives of states with established drycleaner remediation programs. Currently the member states are Alabama, Connecticut, Florida, Illinois, Kansas, Minnesota, Missouri, North Carolina, Oregon, South Carolina, Tennessee, Texas, and Wisconsin.

Date of Government Version: 08/31/2010
Date Data Arrived at EDR: 09/01/2010
Date Made Active in Reports: 12/02/2010
Number of Days to Update: 92

Source: Environmental Protection Agency
Telephone: 615-532-8599
Last EDR Contact: 02/22/2011
Next Scheduled EDR Contact: 05/09/2011
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

FEDLAND: Federal and Indian Lands

Federally and Indian administrated lands of the United States. Lands included are administrated by: Army Corps of Engineers, Bureau of Reclamation, National Wild and Scenic River, National Wildlife Refuge, Public Domain Land, Wilderness, Wilderness Study Area, Wildlife Management Area, Bureau of Indian Affairs, Bureau of Land Management, Department of Justice, Forest Service, Fish and Wildlife Service, National Park Service.

Date of Government Version: 12/31/2005	Source: U.S. Geological Survey
Date Data Arrived at EDR: 02/06/2006	Telephone: 888-275-8747
Date Made Active in Reports: 01/11/2007	Last EDR Contact: 01/21/2011
Number of Days to Update: 339	Next Scheduled EDR Contact: 05/02/2011
	Data Release Frequency: N/A

PCB TRANSFORMER: PCB Transformer Registration Database

The database of PCB transformer registrations that includes all PCB registration submittals.

Date of Government Version: 01/01/2008	Source: Environmental Protection Agency
Date Data Arrived at EDR: 02/18/2009	Telephone: 202-566-0517
Date Made Active in Reports: 05/29/2009	Last EDR Contact: 02/04/2011
Number of Days to Update: 100	Next Scheduled EDR Contact: 05/16/2011
	Data Release Frequency: Varies

COAL ASH EPA: Coal Combustion Residues Surface Impoundments List

A listing of coal combustion residues surface impoundments with high hazard potential ratings.

Date of Government Version: 08/17/2010	Source: Environmental Protection Agency
Date Data Arrived at EDR: 01/03/2011	Telephone: N/A
Date Made Active in Reports: 03/21/2011	Last EDR Contact: 03/18/2011
Number of Days to Update: 77	Next Scheduled EDR Contact: 06/27/2011
	Data Release Frequency: Varies

COAL ASH DOE: Sleam-Electric Plan Operation Data

A listing of power plants that store ash in surface ponds.

Date of Government Version: 12/31/2005	Source: Department of Energy
Date Data Arrived at EDR: 08/07/2009	Telephone: 202-586-8719
Date Made Active in Reports: 10/22/2009	Last EDR Contact: 01/18/2011
Number of Days to Update: 76	Next Scheduled EDR Contact: 05/02/2011
	Data Release Frequency: Varies

COAL ASH: Coal Ash Disposal Sites

A listing of coal combustion products distribution permits issued by the Division for the treatment, storage, transportation, use and disposal of coal combustion products.

Date of Government Version: 12/31/2007	Source: Department of Environment & Natural Resources
Date Data Arrived at EDR: 08/04/2009	Telephone: 919-807-6359
Date Made Active in Reports: 08/17/2009	Last EDR Contact: 02/23/2011
Number of Days to Update: 13	Next Scheduled EDR Contact: 05/23/2011
	Data Release Frequency: Varies

EDR PROPRIETARY RECORDS

EDR Proprietary Records

Manufactured Gas Plants: EDR Proprietary Manufactured Gas Plants

The EDR Proprietary Manufactured Gas Plant Database includes records of coal gas plants (manufactured gas plants) compiled by EDR's researchers. Manufactured gas sites were used in the United States from the 1800's to 1950's to produce a gas that could be distributed and used as fuel. These plants used whale oil, rosin, coal, or a mixture of coal, oil, and water that also produced a significant amount of waste. Many of the byproducts of the gas production, such as coal tar (oily waste containing volatile and non-volatile chemicals), sludges, oils and other compounds are potentially hazardous to human health and the environment. The byproduct from this process was frequently disposed of directly at the plant site and can remain or spread slowly, serving as a continuous source of soil and groundwater contamination.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

EDR Historical Auto Stations: EDR Proprietary Historic Gas Stations

EDR has searched selected national collections of business directories and has collected listings of potential gas station/filling station/service station sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include gas station/filling station/service station establishments. The categories reviewed included, but were not limited to gas, gas station, gasoline station, filling station, auto, automobile repair, auto service station, service station, etc.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

EDR Historical Cleaners: EDR Proprietary Historic Dry Cleaners

EDR has searched selected national collections of business directories and has collected listings of potential dry cleaner sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include dry cleaning establishments. The categories reviewed included, but were not limited to dry cleaners, cleaners, laundry, laundromat, cleaning/laundry, wash & dry etc.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

OTHER DATABASE(S)

Depending on the geographic area covered by this report, the data provided in these specialty databases may or may not be complete. For example, the existence of wetlands information data in a specific report does not mean that all wetlands in the area covered by the report are included. Moreover, the absence of any reported wetlands information does not necessarily mean that wetlands do not exist in the area covered by the report.

CT MANIFEST: Hazardous Waste Manifest Data

Facility and manifest data. Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a tsd facility.

Date of Government Version: 12/31/2007
Date Data Arrived at EDR: 08/26/2009
Date Made Active in Reports: 09/11/2009
Number of Days to Update: 16

Source: Department of Environmental Protection
Telephone: 860-424-3375
Last EDR Contact: 02/25/2011
Next Scheduled EDR Contact: 06/06/2011
Data Release Frequency: Annually

NJ MANIFEST: Manifest Information

Hazardous waste manifest information.

Date of Government Version: 12/31/2009
Date Data Arrived at EDR: 07/22/2010
Date Made Active in Reports: 08/26/2010
Number of Days to Update: 35

Source: Department of Environmental Protection
Telephone: N/A
Last EDR Contact: 01/21/2011
Next Scheduled EDR Contact: 05/02/2011
Data Release Frequency: Annually

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

NY MANIFEST: Facility and Manifest Data

Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a TSD facility.

Date of Government Version: 12/31/2010
Date Data Arrived at EDR: 02/09/2011
Date Made Active in Reports: 03/04/2011
Number of Days to Update: 23

Source: Department of Environmental Conservation
Telephone: 518-402-8651
Last EDR Contact: 02/09/2011
Next Scheduled EDR Contact: 05/23/2011
Data Release Frequency: Annually

PA MANIFEST: Manifest Information

Hazardous waste manifest information.

Date of Government Version: 12/31/2008
Date Data Arrived at EDR: 12/01/2009
Date Made Active in Reports: 12/14/2009
Number of Days to Update: 13

Source: Department of Environmental Protection
Telephone: 717-783-8990
Last EDR Contact: 02/18/2011
Next Scheduled EDR Contact: 06/06/2011
Data Release Frequency: Annually

RI MANIFEST: Manifest information

Hazardous waste manifest information

Date of Government Version: 12/31/2009
Date Data Arrived at EDR: 07/19/2010
Date Made Active in Reports: 08/26/2010
Number of Days to Update: 38

Source: Department of Environmental Management
Telephone: 401-222-2797
Last EDR Contact: 02/28/2011
Next Scheduled EDR Contact: 06/13/2011
Data Release Frequency: Annually

WI MANIFEST: Manifest Information

Hazardous waste manifest information.

Date of Government Version: 12/31/2009
Date Data Arrived at EDR: 07/06/2010
Date Made Active in Reports: 07/26/2010
Number of Days to Update: 20

Source: Department of Natural Resources
Telephone: N/A
Last EDR Contact: 03/21/2011
Next Scheduled EDR Contact: 07/04/2011
Data Release Frequency: Annually

Oil/Gas Pipelines: This data was obtained by EDR from the USGS in 1994. It is referred to by USGS as GeoData Digital Line Graphs from 1:100,000-Scale Maps. It was extracted from the transportation category including some oil, but primarily gas pipelines.

Electric Power Transmission Line Data

Source: Rextag Strategies Corp.
Telephone: (281) 769-2247

U.S. Electric Transmission and Power Plants Systems Digital GIS Data

Sensitive Receptors: There are individuals deemed sensitive receptors due to their fragile immune systems and special sensitivity to environmental discharges. These sensitive receptors typically include the elderly, the sick, and children. While the location of all sensitive receptors cannot be determined, EDR indicates those buildings and facilities - schools, daycares, hospitals, medical centers, and nursing homes - where individuals who are sensitive receptors are likely to be located.

AHA Hospitals:

Source: American Hospital Association, Inc.
Telephone: 312-280-5991

The database includes a listing of hospitals based on the American Hospital Association's annual survey of hospitals.

Medical Centers: Provider of Services Listing

Source: Centers for Medicare & Medicaid Services
Telephone: 410-786-3000

A listing of hospitals with Medicare provider number, produced by Centers of Medicare & Medicaid Services, a federal agency within the U.S. Department of Health and Human Services.

Nursing Homes

Source: National Institutes of Health
Telephone: 301-594-6248

Information on Medicare and Medicaid certified nursing homes in the United States.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Public Schools

Source: National Center for Education Statistics

Telephone: 202-502-7300

The National Center for Education Statistics' primary database on elementary and secondary public education in the United States. It is a comprehensive, annual, national statistical database of all public elementary and secondary schools and school districts, which contains data that are comparable across all states.

Private Schools

Source: National Center for Education Statistics

Telephone: 202-502-7300

The National Center for Education Statistics' primary database on private school locations in the United States.

Daycare Centers: Child Care Facility List

Source: Department of Health & Human Services

Telephone: 919-662-4499

Flood Zone Data: This data, available in select counties across the country, was obtained by EDR in 2003 & 2009 from the Federal Emergency Management Agency (FEMA). Data depicts 100-year and 500-year flood zones as defined by FEMA.

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002 and 2005 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Wetlands Inventory

Source: Department of Environment & Natural Resources

Telephone: 919-733-2090

STREET AND ADDRESS INFORMATION

© 2010 Tele Atlas North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

GEOCHECK[®] - PHYSICAL SETTING SOURCE ADDENDUM

TARGET PROPERTY ADDRESS

NCW-481
950-1000 W TRADE STREET
CHARLOTTE, NC 28202

TARGET PROPERTY COORDINATES

Latitude (North):	35.23550 - 35° 14' 7.8"
Longitude (West):	80.8522 - 80° 51' 7.9"
Universal Transverse Mercator:	Zone 17
UTM X (Meters):	513448.6
UTM Y (Meters):	3898971.2
Elevation:	698 ft. above sea level

USGS TOPOGRAPHIC MAP

Target Property Map:	35080-B7 CHARLOTTE EAST, NC
Most Recent Revision:	1988
West Map:	35080-B8 CHARLOTTE WEST, NC
Most Recent Revision:	1996

EDR's GeoCheck Physical Setting Source Addendum is provided to assist the environmental professional in forming an opinion about the impact of potential contaminant migration.

Assessment of the impact of contaminant migration generally has two principle investigative components:

1. Groundwater flow direction, and
2. Groundwater flow velocity.

Groundwater flow direction may be impacted by surface topography, hydrology, hydrogeology, characteristics of the soil, and nearby wells. Groundwater flow velocity is generally impacted by the nature of the geologic strata.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

GROUNDWATER FLOW DIRECTION INFORMATION

Groundwater flow direction for a particular site is best determined by a qualified environmental professional using site-specific well data. If such data is not reasonably ascertainable, it may be necessary to rely on other sources of information, such as surface topographic information, hydrologic information, hydrogeologic data collected on nearby properties, and regional groundwater flow information (from deep aquifers).


TOPOGRAPHIC INFORMATION

Surface topography may be indicative of the direction of surficial groundwater flow. This information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

TARGET PROPERTY TOPOGRAPHY

General Topographic Gradient: General NW

SURROUNDING TOPOGRAPHY: ELEVATION PROFILES

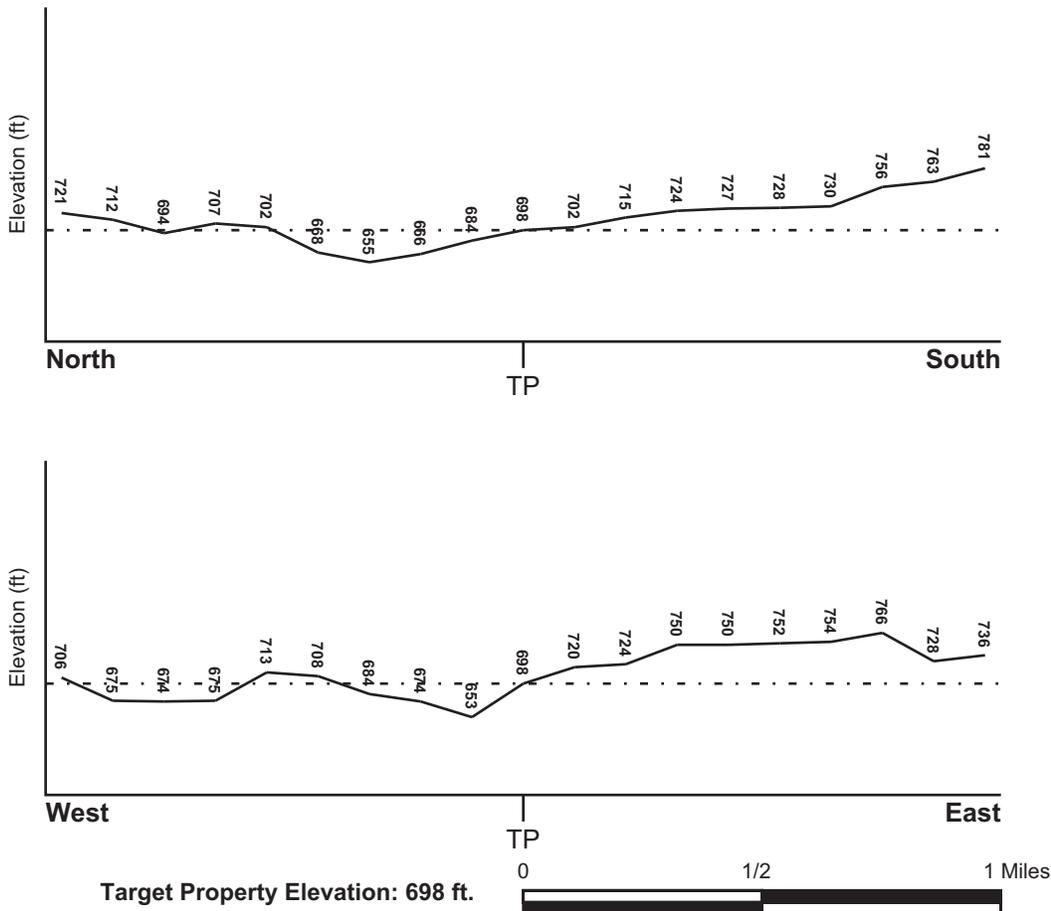

Source: Topography has been determined from the USGS 7.5' Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

HYDROLOGIC INFORMATION

Surface water can act as a hydrologic barrier to groundwater flow. Such hydrologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Refer to the Physical Setting Source Map following this summary for hydrologic information (major waterways and bodies of water).

FEMA FLOOD ZONE

<u>Target Property County</u>	FEMA Flood
MECKLENBURG, NC	<u>Electronic Data</u>
	YES - refer to the Overview Map and Detail Map

Flood Plain Panel at Target Property: 37119C - FEMA DFIRM Flood data

Additional Panels in search area: Not Reported

NATIONAL WETLAND INVENTORY

<u>NWI Quad at Target Property</u>	NWI Electronic
CHARLOTTE EAST	<u>Data Coverage</u>
	YES - refer to the Overview Map and Detail Map

HYDROGEOLOGIC INFORMATION

Hydrogeologic information obtained by installation of wells on a specific site can often be an indicator of groundwater flow direction in the immediate area. Such hydrogeologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

AQUIFLOW®

Search Radius: 1.000 Mile.

EDR has developed the AQUIFLOW Information System to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted by environmental professionals to regulatory authorities at select sites and has extracted the date of the report, groundwater flow direction as determined hydrogeologically, and the depth to water table.

<u>MAP ID</u>	<u>LOCATION FROM TP</u>	<u>GENERAL DIRECTION GROUNDWATER FLOW</u>
1	1/4 - 1/2 Mile ESE	W
2	1/4 - 1/2 Mile SE	E & S
3	1/4 - 1/2 Mile WNW	Not Reported
4	1/4 - 1/2 Mile ESE	Not Reported
A5	1/2 - 1 Mile SSW	W
A6	1/2 - 1 Mile SSW	W
7	1/2 - 1 Mile East	Not Reported
9	1/2 - 1 Mile SW	Not Reported
11	1/2 - 1 Mile SSW	Not Reported
B12	1/2 - 1 Mile SSE	WNW
B13	1/2 - 1 Mile SSE	Not Reported
C15	1/2 - 1 Mile SE	Not Reported
C16	1/2 - 1 Mile SE	Not Reported
17	1/2 - 1 Mile East	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

<u>MAP ID</u>	<u>LOCATION FROM TP</u>	<u>GENERAL DIRECTION GROUNDWATER FLOW</u>
18	1/2 - 1 Mile SE	Not Reported
19	1/2 - 1 Mile SSE	SSE
20	1/2 - 1 Mile WSW	Not Reported
21	1/2 - 1 Mile SSE	Not Reported
D23	1/2 - 1 Mile South	Not Reported
E24	1/2 - 1 Mile SW	W
E25	1/2 - 1 Mile SW	Not Reported
E26	1/2 - 1 Mile SW	N
27	1/2 - 1 Mile WNW	Not Reported
29	1/2 - 1 Mile North	SE
31	1/2 - 1 Mile ENE	Not Reported
D32	1/2 - 1 Mile South	Not Reported
33	1/2 - 1 Mile ESE	SE
34	1/2 - 1 Mile ENE	NW

For additional site information, refer to Physical Setting Source Map Findings.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

GROUNDWATER FLOW VELOCITY INFORMATION

Groundwater flow velocity information for a particular site is best determined by a qualified environmental professional using site specific geologic and soil strata data. If such data are not reasonably ascertainable, it may be necessary to rely on other sources of information, including geologic age identification, rock stratigraphic unit and soil characteristics data collected on nearby properties and regional soil information. In general, contaminant plumes move more quickly through sandy-gravelly types of soils than silty-clayey types of soils.

GEOLOGIC INFORMATION IN GENERAL AREA OF TARGET PROPERTY

Geologic information can be used by the environmental professional in forming an opinion about the relative speed at which contaminant migration may be occurring.

ROCK STRATIGRAPHIC UNIT


Era: Paleozoic
System: Ordovian
Series: Lower Paleozoic granitic rocks
Code: Pzg1 (*decoded above as Era, System & Series*)

GEOLOGIC AGE IDENTIFICATION


Category: Plutonic and Intrusive Rocks

Geologic Age and Rock Stratigraphic Unit Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - a digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

SSURGO SOIL MAP - 3023111.1s

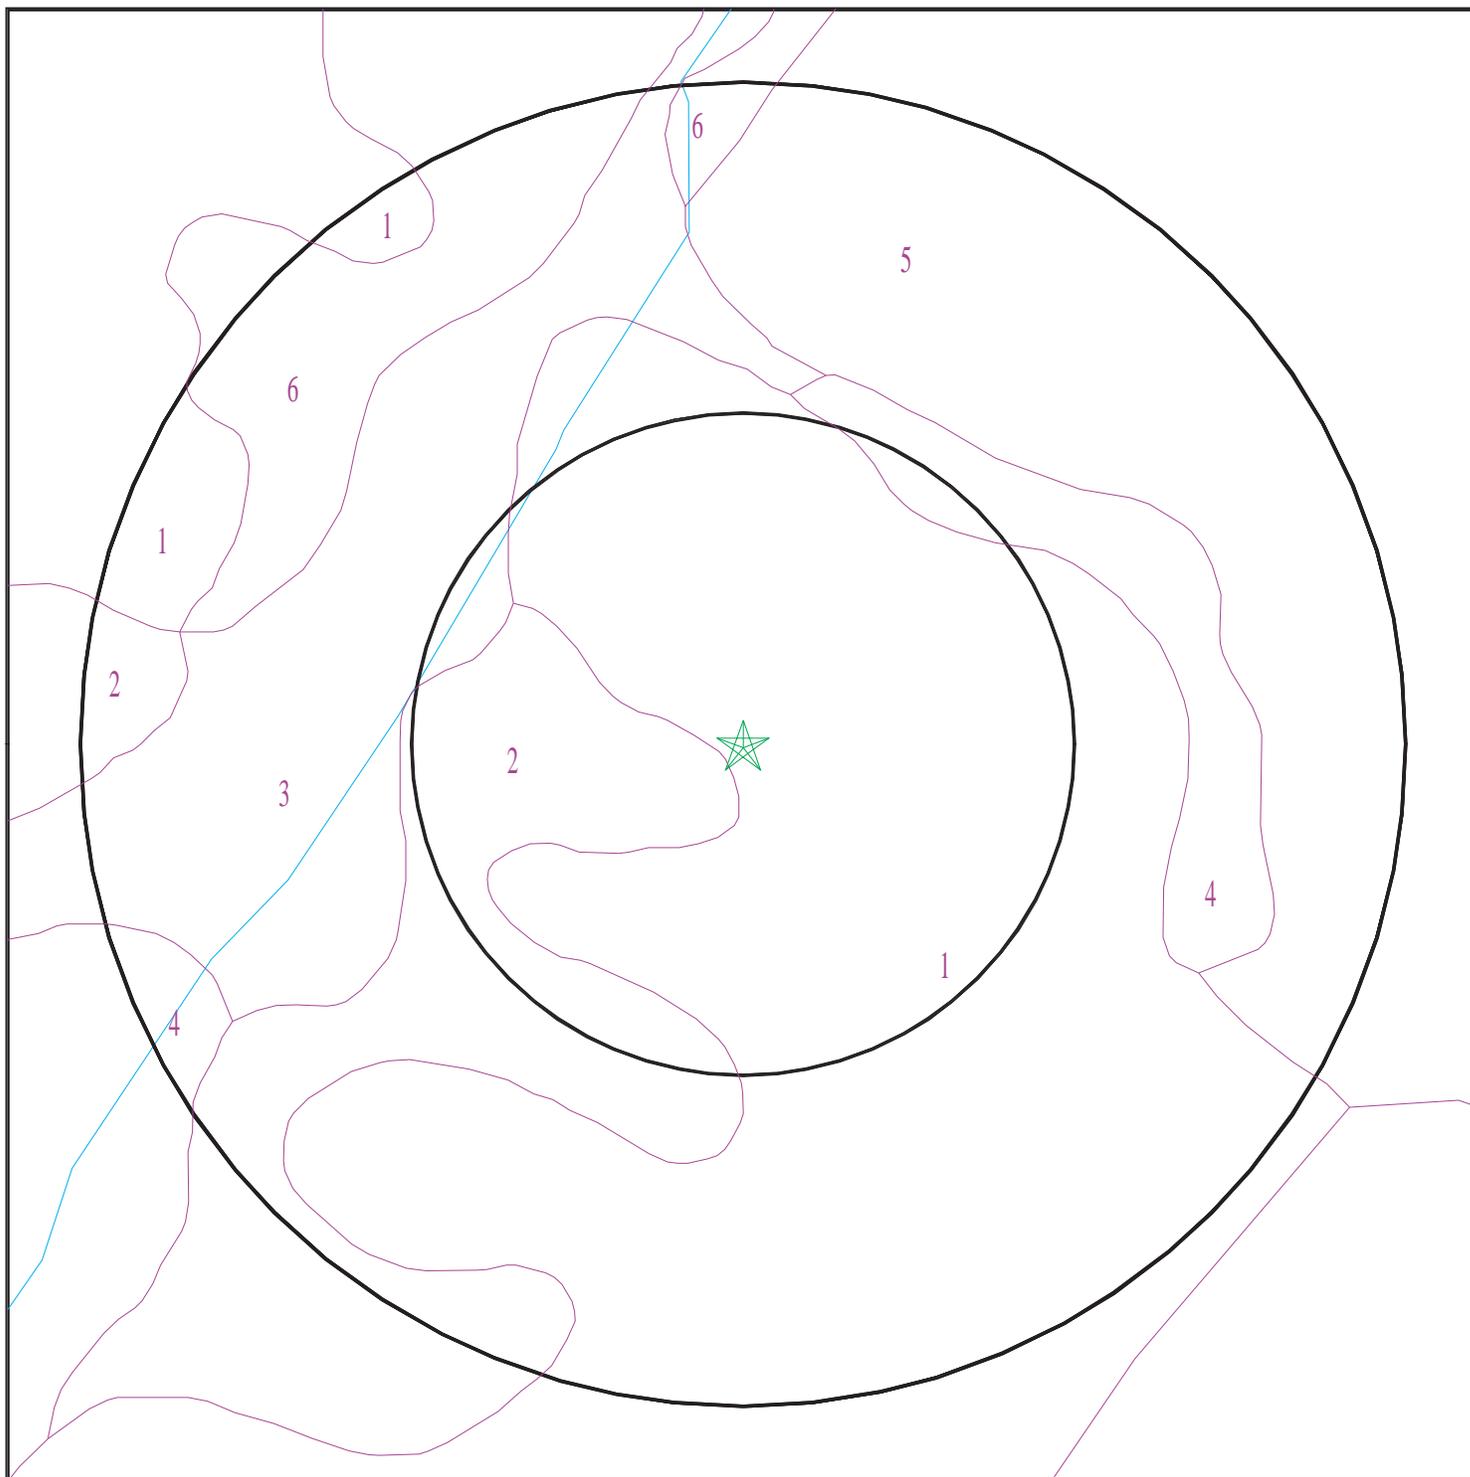

- ★ Target Property
- ∩ SSURGO Soil
- ∩ Water



SITE NAME: NCW-481
ADDRESS: 950-1000 W Trade Street
Charlotte NC 28202
LAT/LONG: 35.2355 / 80.8522

CLIENT: ARCADIS U.S., Inc.
CONTACT: Sean Drain
INQUIRY #: 3023111.1s
DATE: March 25, 2011 9:14 am

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

DOMINANT SOIL COMPOSITION IN GENERAL AREA OF TARGET PROPERTY

The U.S. Department of Agriculture's (USDA) Soil Conservation Service (SCS) leads the National Cooperative Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. The following information is based on Soil Conservation Service SSURGO data.

Soil Map ID: 1

Soil Component Name: Cecil

Soil Surface Texture: sandy clay loam

Hydrologic Group: Class B - Moderate infiltration rates. Deep and moderately deep, moderately well and well drained soils with moderately coarse textures.

Soil Drainage Class: Well drained

Hydric Status: Not hydric

Corrosion Potential - Uncoated Steel: High

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 0 inches

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
1	0 inches	5 inches	sandy clay loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Clayey sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 14 Min: 4	Max: 5.5 Min: 4.5
2	5 inches	51 inches	clay	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Clayey sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 14 Min: 4	Max: 5.5 Min: 4.5
3	51 inches	85 inches	loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Clayey sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 14 Min: 4	Max: 5.5 Min: 4.5

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Soil Map ID: 2

Soil Component Name: Cecil

Soil Surface Texture: sandy clay loam

Hydrologic Group: Class B - Moderate infiltration rates. Deep and moderately deep, moderately well and well drained soils with moderately coarse textures.

Soil Drainage Class: Well drained

Hydric Status: Not hydric

Corrosion Potential - Uncoated Steel: Moderate

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 0 inches

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
1	0 inches	5 inches	sandy clay loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Clayey sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 14 Min: 4	Max: 5.5 Min: 4.5
2	5 inches	51 inches		Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Clayey sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 14 Min: 4	Max: 5.5 Min: 4.5
3	51 inches	85 inches	loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Clayey sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 14 Min: 4	Max: 5.5 Min: 4.5

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Soil Map ID: 3

Soil Component Name: Monacan

Soil Surface Texture: loam

Hydrologic Group: Class C - Slow infiltration rates. Soils with layers impeding downward movement of water, or soils with moderately fine or fine textures.

Soil Drainage Class: Somewhat poorly drained

Hydric Status: Not hydric

Corrosion Potential - Uncoated Steel: Moderate

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 38 inches

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
1	0 inches	14 inches	loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Clayey sand.	Max: 141 Min: 0.42	Max: 7.3 Min: 5.1
2	14 inches	25 inches	silty clay loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Clayey sand.	Max: 141 Min: 0.42	Max: 7.3 Min: 5.1
3	25 inches	64 inches	sandy clay loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Clayey sand.	Max: 141 Min: 0.42	Max: 7.3 Min: 5.1
4	64 inches	79 inches	stratified sand to clay	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Clayey sand.	Max: 141 Min: 0.42	Max: 7.3 Min: 5.1

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Soil Map ID: 4

Soil Component Name: Monacan

Soil Surface Texture: loam

Hydrologic Group: Class C - Slow infiltration rates. Soils with layers impeding downward movement of water, or soils with moderately fine or fine textures.

Soil Drainage Class: Somewhat poorly drained

Hydric Status: Partially hydric

Corrosion Potential - Uncoated Steel: Moderate

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 38 inches

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
1	0 inches	14 inches	loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay	Max: 14 Min: 4	Max: 7.3 Min: 5.1
2	14 inches	25 inches	silty clay loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay	Max: 14 Min: 4	Max: 7.3 Min: 5.1
3	64 inches	79 inches	stratified sand to clay	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay	Max: 14 Min: 4	Max: 7.3 Min: 5.1
4	25 inches	64 inches	sandy clay loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay	Max: 14 Min: 4	Max: 7.3 Min: 5.1

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Soil Map ID: 5

Soil Component Name: Cecil

Soil Surface Texture: sandy clay loam

Hydrologic Group: Class B - Moderate infiltration rates. Deep and moderately deep, moderately well and well drained soils with moderately coarse textures.

Soil Drainage Class: Well drained

Hydric Status: Not hydric

Corrosion Potential - Uncoated Steel: High

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 0 inches

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
1	0 inches	5 inches	sandy clay loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Clayey sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 14 Min: 4	Max: 6 Min: 4.5
2	5 inches	48 inches	clay	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Clayey sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 14 Min: 4	Max: 6 Min: 4.5
3	48 inches	61 inches	loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Clayey sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 14 Min: 4	Max: 6 Min: 4.5

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Soil Map ID: 6

Soil Component Name: Cecil

Soil Surface Texture: sandy clay loam

Hydrologic Group: Class B - Moderate infiltration rates. Deep and moderately deep, moderately well and well drained soils with moderately coarse textures.

Soil Drainage Class: Well drained

Hydric Status: Not hydric

Corrosion Potential - Uncoated Steel: High

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 0 inches

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
1	0 inches	5 inches	sandy clay loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Clayey sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 14 Min: 4	Max: 6 Min: 4.5
2	5 inches	48 inches	clay	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Clayey sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 14 Min: 4	Max: 6 Min: 4.5
3	48 inches	61 inches	loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Clayey sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 14 Min: 4	Max: 6 Min: 4.5

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

LOCAL / REGIONAL WATER AGENCY RECORDS

EDR Local/Regional Water Agency records provide water well information to assist the environmental professional in assessing sources that may impact ground water flow direction, and in forming an opinion about the impact of contaminant migration on nearby drinking water wells.

WELL SEARCH DISTANCE INFORMATION

<u>DATABASE</u>	<u>SEARCH DISTANCE (miles)</u>
Federal USGS	1.000
Federal FRDS PWS	Nearest PWS within 1 mile
State Database	1.000

FEDERAL USGS WELL INFORMATION

<u>MAP ID</u>	<u>WELL ID</u>	<u>LOCATION FROM TP</u>
8	USGS2260281	1/2 - 1 Mile WNW
14	USGS2260447	1/2 - 1 Mile SSW
28	USGS2260419	1/2 - 1 Mile SSW

FEDERAL FRDS PUBLIC WATER SUPPLY SYSTEM INFORMATION

<u>MAP ID</u>	<u>WELL ID</u>	<u>LOCATION FROM TP</u>
10	NC0160160	1/2 - 1 Mile ENE

Note: PWS System location is not always the same as well location.

STATE DATABASE WELL INFORMATION

<u>MAP ID</u>	<u>WELL ID</u>	<u>LOCATION FROM TP</u>
30	NC2000000002564	1/2 - 1 Mile ESE

PHYSICAL SETTING SOURCE MAP - 3023111.1s



- | | | |
|--|--|---------------------------|
| County Boundary | Groundwater Flow Direction | Wildlife Areas |
| Major Roads | Indeterminate Groundwater Flow at Location | Natural Areas |
| Contour Lines | Groundwater Flow Varies at Location | Rare & Endangered Species |
| Airports | | |
| Earthquake epicenter, Richter 5 or greater | | |
| Water Wells | | |
| Public Water Supply Wells | | |
| Cluster of Multiple Icons | | |

SITE NAME: NCW-481
 ADDRESS: 950-1000 W Trade Street
 Charlotte NC 28202
 LAT/LONG: 35.2355 / 80.8522

CLIENT: ARCADIS U.S., Inc.
 CONTACT: Sean Drain
 INQUIRY #: 3023111.1s
 DATE: March 25, 2011 9:14 am

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

1	Site ID:	10712		
ESE	Groundwater Flow:	W	AQUIFLOW	41071
1/4 - 1/2 Mile	Shallowest Water Table Depth:	Not Reported		
Higher	Deepest Water Table Depth:	Not Reported		
	Average Water Table Depth:	6		
	Depth to rock - shallowest:	Not Reported		
	Depth to rock - deepest:	Not Reported		
	Depth to rock - average:	Not Reported		
	Date:	05/06/1994		

2	Site ID:	14771		
SE	Groundwater Flow:	E & S	AQUIFLOW	40881
1/4 - 1/2 Mile	Shallowest Water Table Depth:	Not Reported		
Higher	Deepest Water Table Depth:	Not Reported		
	Average Water Table Depth:	16		
	Depth to rock - shallowest:	Not Reported		
	Depth to rock - deepest:	Not Reported		
	Depth to rock - average:	Not Reported		
	Date:	02/06/1996		

3	Site ID:	14222		
WNW	Groundwater Flow:	Not Reported	AQUIFLOW	40880
1/4 - 1/2 Mile	Shallowest Water Table Depth:	Not Reported		
Higher	Deepest Water Table Depth:	Not Reported		
	Average Water Table Depth:	Not Reported		
	Depth to rock - shallowest:	Not Reported		
	Depth to rock - deepest:	Not Reported		
	Depth to rock - average:	30		
	Date:	01/14/1994		

4	Site ID:	16923		
ESE	Groundwater Flow:	Not Reported	AQUIFLOW	36936
1/4 - 1/2 Mile	Shallowest Water Table Depth:	13		
Higher	Deepest Water Table Depth:	15		
	Average Water Table Depth:	Not Reported		
	Depth to rock - shallowest:	Not Reported		
	Depth to rock - deepest:	Not Reported		
	Depth to rock - average:	Not Reported		
	Date:	12/1998		

A5	Site ID:	7152		
SSW	Groundwater Flow:	W	AQUIFLOW	40826
1/2 - 1 Mile	Shallowest Water Table Depth:	3.51		
Lower	Deepest Water Table Depth:	16.85		
	Average Water Table Depth:	Not Reported		
	Depth to rock - shallowest:	7		
	Depth to rock - deepest:	23		
	Depth to rock - average:	Not Reported		
	Date:	07/1996		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

A6 SSW 1/2 - 1 Mile Lower	Site ID: 18556		
	Groundwater Flow: W	AQUIFLOW	40836
	Shallowest Water Table Depth: 3.51		
	Deepest Water Table Depth: 16.85		
	Average Water Table Depth: Not Reported		
	Depth to rock - shallowest: 7		
	Depth to rock - deepest: 23		
	Depth to rock - average: Not Reported		
	Date: 07/1996		

7 East 1/2 - 1 Mile Higher	Site ID: 5487		
	Groundwater Flow: Not Reported	AQUIFLOW	40916
	Shallowest Water Table Depth: 8.2		
	Deepest Water Table Depth: 9.3		
	Average Water Table Depth: Not Reported		
	Depth to rock - shallowest: Not Reported		
	Depth to rock - deepest: Not Reported		
	Depth to rock - average: Not Reported		
	Date: 10/19/1990		

8 WNW 1/2 - 1 Mile Lower		FED USGS	USGS2260281
---	--	-----------------	--------------------

Agency cd: USGS	Site no: 351415080514801
Site name: ME-134	
Latitude: 351415	EDR Site id: USGS2260281
Longitude: 0805148	Dec lat: 35.237642
Dec lon: -80.86312711	Coor meth: M
Coor accr: S	Latlong datum: NAD27
Dec latlong datum: NAD83	District: 37
State: 37	County: 119
Country: US	Land net: Not Reported
Location map: Not Reported	Map scale: Not Reported
Altitude: Not Reported	
Altitude method: Not Reported	
Altitude accuracy: Not Reported	
Altitude datum: Not Reported	
Hydrologic: Not Reported	
Topographic: Upland draw	
Site type: Ground-water other than Spring	Date construction: Not Reported
Date inventoried: Not Reported	Mean greenwich time offset: EST
Local standard time flag: Y	
Type of ground water site: Single well, other than collector or Ranney type	
Aquifer Type: Not Reported	
Aquifer: FELSIC METAIGNEOUS ROCK	
Well depth: 150.0	Hole depth: Not Reported
Source of depth data: reporting agency (generally USGS)	
Project number: 453709900	
Real time data flag: Not Reported	Daily flow data begin date: Not Reported
Daily flow data end date: Not Reported	Daily flow data count: Not Reported
Peak flow data begin date: Not Reported	Peak flow data end date: Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Peak flow data count: Not Reported
 Water quality data end date: Not Reported
 Ground water data begin date: Not Reported
 Ground water data count: Not Reported

Water quality data begin date: Not Reported
 Water quality data count: Not Reported
 Ground water data end date: Not Reported

Ground-water levels, Number of Measurements: 0

**9
SW
1/2 - 1 Mile
Lower**

Site ID: 9609
 Groundwater Flow: Not Reported
 Shallowest Water Table Depth: 11.55
 Deepest Water Table Depth: 18.0
 Average Water Table Depth: Not Reported
 Depth to rock - shallowest: Not Reported
 Depth to rock - deepest: Not Reported
 Depth to rock - average: Not Reported
 Date: 10/12/1998

AQUIFLOW 40319

**10
ENE
1/2 - 1 Mile
Higher**

FRDS PWS NC0160160

PWS ID: NC0160160
 Date Initiated: 7706 Date Deactivated: Not Reported
 PWS Name: MINERAL SPRINGS MHP
 CHARLOTTE, NC 28262

Addressee / Facility: System Owner/Responsible Party
 MILTON CHIDESTER OR MANAGER
 7501 NEAL RD
 CHARLOTTE, NC 28262

Addressee / Facility: System Owner/Responsible Party
 MILTON CHIDESTER
 7501 NEAL RD
 CHARLOTTE, NC 28262

Facility Latitude: 35 14 19 Facility Longitude: 080 50 28
 City Served: CHARLOTTE
 Treatment Class: Untreated Population: 00000108

PWS currently has or had major violation(s) or enforcement: YES

VIOLATIONS INFORMATION:

Violation ID:	9300511	Source ID:	Not Reported	PWS Phone:	Not Reported
Vio. beginning Date:	03/01/93	Vio. end Date:	03/31/93	Vio. Period:	001 Months
Num required Samples:	Not Reported	Number of Samples Taken:	Not Reported		
Analysis Result:	Not Reported	Maximum Contaminant Level:	Not Reported		
Analysis Method:	Not Reported				
Violation Type:	Monitoring, Routine Major (TCR)				
Contaminant:	COLIFORM (TCR)				
Vio. Awareness Date:	042493				

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Violation ID:	9300510	Source ID:	Not Reported	PWS Phone:	Not Reported
Vio. beginning Date:	02/01/93	Vio. end Date:	02/28/93	Vio. Period:	001 Months
Num required Samples:	Not Reported	Number of Samples Taken:	Not Reported		
Analysis Result:	Not Reported	Maximum Contaminant Level:	Not Reported		
Analysis Method:	Not Reported				
Violation Type:	Monitoring, Routine Major (TCR)				
Contaminant:	COLIFORM (TCR)				
Vio. Awareness Date:	032493				
Violation ID:	9300509	Source ID:	Not Reported	PWS Phone:	Not Reported
Vio. beginning Date:	01/01/93	Vio. end Date:	01/31/93	Vio. Period:	001 Months
Num required Samples:	Not Reported	Number of Samples Taken:	Not Reported		
Analysis Result:	Not Reported	Maximum Contaminant Level:	Not Reported		
Analysis Method:	Not Reported				
Violation Type:	Monitoring, Routine Major (TCR)				
Contaminant:	COLIFORM (TCR)				
Vio. Awareness Date:	022193				
Violation ID:	9413069	Source ID:	Not Reported	PWS Phone:	Not Reported
Vio. beginning Date:	07/01/93	Vio. end Date:	12/31/93	Vio. Period:	006 Months
Num required Samples:	Not Reported	Number of Samples Taken:	Not Reported		
Analysis Result:	Not Reported	Maximum Contaminant Level:	Not Reported		
Analysis Method:	Not Reported				
Violation Type:	Initial Tap Sampling for Pb and Cu				
Contaminant:	LEAD & COPPER RULE				
Vio. Awareness Date:	Not Reported				
Violation ID:	9406908	Source ID:	Not Reported	PWS Phone:	Not Reported
Vio. beginning Date:	01/01/91	Vio. end Date:	12/31/93	Vio. Period:	036 Months
Num required Samples:	000	Number of Samples Taken:	000		
Analysis Result:	Not Reported	Maximum Contaminant Level:	Not Reported		
Analysis Method:	Not Reported				
Violation Type:	Monitoring, Regular				
Contaminant:	PH				
Vio. Awareness Date:	060194				
Violation ID:	9406907	Source ID:	Not Reported	PWS Phone:	Not Reported
Vio. beginning Date:	01/01/91	Vio. end Date:	12/31/93	Vio. Period:	036 Months
Num required Samples:	000	Number of Samples Taken:	000		
Analysis Result:	Not Reported	Maximum Contaminant Level:	Not Reported		
Analysis Method:	Not Reported				
Violation Type:	Monitoring, Regular				
Contaminant:	THALLIUM, TOTAL				
Vio. Awareness Date:	060194				
Violation ID:	9406906	Source ID:	Not Reported	PWS Phone:	Not Reported
Vio. beginning Date:	01/01/91	Vio. end Date:	12/31/93	Vio. Period:	036 Months
Num required Samples:	000	Number of Samples Taken:	000		
Analysis Result:	Not Reported	Maximum Contaminant Level:	Not Reported		
Analysis Method:	Not Reported				
Violation Type:	Monitoring, Regular				
Contaminant:	BERYLLIUM, TOTAL				
Vio. Awareness Date:	060194				

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Violation ID:	9406905	Source ID:	Not Reported	PWS Phone:	Not Reported
Vio. beginning Date:	01/01/91	Vio. end Date:	12/31/93	Vio. Period:	036 Months
Num required Samples:	000	Number of Samples Taken:	000		
Analysis Result:	Not Reported	Maximum Contaminant Level:	Not Reported		
Analysis Method:	Not Reported				
Violation Type:	Monitoring, Regular				
Contaminant:	ANTIMONY, TOTAL				
Vio. Awareness Date:	060194				
Violation ID:	9406904	Source ID:	Not Reported	PWS Phone:	Not Reported
Vio. beginning Date:	01/01/91	Vio. end Date:	12/31/93	Vio. Period:	036 Months
Num required Samples:	000	Number of Samples Taken:	000		
Analysis Result:	Not Reported	Maximum Contaminant Level:	Not Reported		
Analysis Method:	Not Reported				
Violation Type:	Monitoring, Regular				
Contaminant:	SULFATE				
Vio. Awareness Date:	060194				
Violation ID:	9406903	Source ID:	Not Reported	PWS Phone:	Not Reported
Vio. beginning Date:	01/01/91	Vio. end Date:	12/31/93	Vio. Period:	036 Months
Num required Samples:	000	Number of Samples Taken:	000		
Analysis Result:	Not Reported	Maximum Contaminant Level:	Not Reported		
Analysis Method:	Not Reported				
Violation Type:	Monitoring, Regular				
Contaminant:	SODIUM				
Vio. Awareness Date:	060194				
Violation ID:	9406902	Source ID:	Not Reported	PWS Phone:	Not Reported
Vio. beginning Date:	01/01/91	Vio. end Date:	12/31/93	Vio. Period:	036 Months
Num required Samples:	000	Number of Samples Taken:	000		
Analysis Result:	Not Reported	Maximum Contaminant Level:	Not Reported		
Analysis Method:	Not Reported				
Violation Type:	Monitoring, Regular				
Contaminant:	SELENIUM				
Vio. Awareness Date:	060194				
Violation ID:	9406901	Source ID:	Not Reported	PWS Phone:	Not Reported
Vio. beginning Date:	01/01/91	Vio. end Date:	12/31/93	Vio. Period:	036 Months
Num required Samples:	000	Number of Samples Taken:	000		
Analysis Result:	Not Reported	Maximum Contaminant Level:	Not Reported		
Analysis Method:	Not Reported				
Violation Type:	Monitoring, Regular				
Contaminant:	NICKEL				
Vio. Awareness Date:	060194				
Violation ID:	9406900	Source ID:	Not Reported	PWS Phone:	Not Reported
Vio. beginning Date:	01/01/91	Vio. end Date:	12/31/93	Vio. Period:	036 Months
Num required Samples:	000	Number of Samples Taken:	000		
Analysis Result:	Not Reported	Maximum Contaminant Level:	Not Reported		
Analysis Method:	Not Reported				
Violation Type:	Monitoring, Regular				
Contaminant:	MERCURY				
Vio. Awareness Date:	060194				

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Violation ID:	9406899	Source ID:	Not Reported	PWS Phone:	Not Reported
Vio. beginning Date:	01/01/91	Vio. end Date:	12/31/93	Vio. Period:	036 Months
Num required Samples:	000	Number of Samples Taken:	000		
Analysis Result:	Not Reported	Maximum Contaminant Level:	Not Reported		
Analysis Method:	Not Reported				
Violation Type:	Monitoring, Regular				
Contaminant:	MANGANESE				
Vio. Awareness Date:	060194				
Violation ID:	9406898	Source ID:	Not Reported	PWS Phone:	Not Reported
Vio. beginning Date:	01/01/91	Vio. end Date:	12/31/93	Vio. Period:	036 Months
Num required Samples:	000	Number of Samples Taken:	000		
Analysis Result:	Not Reported	Maximum Contaminant Level:	Not Reported		
Analysis Method:	Not Reported				
Violation Type:	Monitoring, Regular				
Contaminant:	IRON				
Vio. Awareness Date:	060194				
Violation ID:	9406897	Source ID:	Not Reported	PWS Phone:	Not Reported
Vio. beginning Date:	01/01/91	Vio. end Date:	12/31/93	Vio. Period:	036 Months
Num required Samples:	000	Number of Samples Taken:	000		
Analysis Result:	Not Reported	Maximum Contaminant Level:	Not Reported		
Analysis Method:	Not Reported				
Violation Type:	Monitoring, Regular				
Contaminant:	FLUORIDE				
Vio. Awareness Date:	060194				
Violation ID:	9406896	Source ID:	Not Reported	PWS Phone:	Not Reported
Vio. beginning Date:	01/01/91	Vio. end Date:	12/31/93	Vio. Period:	036 Months
Num required Samples:	000	Number of Samples Taken:	000		
Analysis Result:	Not Reported	Maximum Contaminant Level:	Not Reported		
Analysis Method:	Not Reported				
Violation Type:	Monitoring, Regular				
Contaminant:	CYANIDE				
Vio. Awareness Date:	060194				
Violation ID:	9406895	Source ID:	Not Reported	PWS Phone:	Not Reported
Vio. beginning Date:	01/01/91	Vio. end Date:	12/31/93	Vio. Period:	036 Months
Num required Samples:	000	Number of Samples Taken:	000		
Analysis Result:	Not Reported	Maximum Contaminant Level:	Not Reported		
Analysis Method:	Not Reported				
Violation Type:	Monitoring, Regular				
Contaminant:	CHROMIUM				
Vio. Awareness Date:	060194				
Violation ID:	9406894	Source ID:	Not Reported	PWS Phone:	Not Reported
Vio. beginning Date:	01/01/91	Vio. end Date:	12/31/93	Vio. Period:	036 Months
Num required Samples:	000	Number of Samples Taken:	000		
Analysis Result:	Not Reported	Maximum Contaminant Level:	Not Reported		
Analysis Method:	Not Reported				
Violation Type:	Monitoring, Regular				
Contaminant:	CADMIUM				
Vio. Awareness Date:	060194				

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Violation ID:	9406893	Source ID:	Not Reported	PWS Phone:	Not Reported
Vio. beginning Date:	01/01/91	Vio. end Date:	12/31/93	Vio. Period:	036 Months
Num required Samples:	000	Number of Samples Taken:	000		
Analysis Result:	Not Reported	Maximum Contaminant Level:	Not Reported		
Analysis Method:	Not Reported				
Violation Type:	Monitoring, Regular				
Contaminant:	BARIUM				
Vio. Awareness Date:	060194				

Violation ID:	9406892	Source ID:	Not Reported	PWS Phone:	Not Reported
Vio. beginning Date:	01/01/91	Vio. end Date:	12/31/93	Vio. Period:	036 Months
Num required Samples:	000	Number of Samples Taken:	000		
Analysis Result:	Not Reported	Maximum Contaminant Level:	Not Reported		
Analysis Method:	Not Reported				
Violation Type:	Monitoring, Regular				
Contaminant:	ARSENIC				
Vio. Awareness Date:	060194				

Violation ID:	9406891	Source ID:	Not Reported	PWS Phone:	Not Reported
Vio. beginning Date:	01/01/93	Vio. end Date:	12/31/93	Vio. Period:	012 Months
Num required Samples:	000	Number of Samples Taken:	000		
Analysis Result:	Not Reported	Maximum Contaminant Level:	Not Reported		
Analysis Method:	Not Reported				
Violation Type:	Monitoring, Regular				
Contaminant:	NITRATE				
Vio. Awareness Date:	060194				

ENFORCEMENT INFORMATION:

System Name:	MINERAL SPRINGS MHP			
Violation Type:	Initial Tap Sampling for Pb and Cu			
Contaminant:	LEAD & COPPER RULE			
Compliance Period:	1994-01-01 - 1994-06-30			
Violation ID:	9400001V			
Enforcement Date:	Not Reported	Enf. Action:	Not Reported	

System Name:	MINERAL SPRINGS MHP			
Violation Type:	Initial Tap Sampling for Pb and Cu			
Contaminant:	LEAD & COPPER RULE			
Compliance Period:	1993-07-01 - 2015-12-31			
Violation ID:	9413069			
Enforcement Date:	1994-08-22	Enf. Action:	Fed Public Notif Requested	

System Name:	MINERAL SPRINGS MHP			
Violation Type:	Initial Tap Sampling for Pb and Cu			
Contaminant:	LEAD & COPPER RULE			
Compliance Period:	1993-07-01 - 2015-12-31			
Violation ID:	9413069			
Enforcement Date:	1994-08-22	Enf. Action:	Fed Formal NOV Issued	

System Name:	MINERAL SPRINGS MHP			
Violation Type:	Initial Tap Sampling for Pb and Cu			
Contaminant:	LEAD & COPPER RULE			
Compliance Period:	1993-07-01 - 2015-12-31			
Violation ID:	9413069			
Enforcement Date:	1995-03-14	Enf. Action:	Fed PAO Issued	

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

ENFORCEMENT INFORMATION:

System Name:	MINERAL SPRINGS MHP		
Violation Type:	Initial Tap Sampling for Pb and Cu		
Contaminant:	LEAD & COPPER RULE		
Compliance Period:	1993-07-01 - 2015-12-31		
Violation ID:	9413069		
Enforcement Date:	1995-03-14	Enf. Action:	Fed Public Notif Requested
System Name:	MINERAL SPRINGS MHP		
Violation Type:	Initial Tap Sampling for Pb and Cu		
Contaminant:	LEAD & COPPER RULE		
Compliance Period:	1993-07-01 - 2015-12-31		
Violation ID:	9413069		
Enforcement Date:	1995-05-25	Enf. Action:	Fed FAO Issued
System Name:	MINERAL SPRINGS MHP		
Violation Type:	Initial Tap Sampling for Pb and Cu		
Contaminant:	LEAD & COPPER RULE		
Compliance Period:	1993-07-01 - 2015-12-31		
Violation ID:	9413069		
Enforcement Date:	1995-05-25	Enf. Action:	Fed Public Notif Requested
System Name:	MINERAL SPRINGS MHP		
Violation Type:	Initial Tap Sampling for Pb and Cu		
Contaminant:	LEAD & COPPER RULE		
Compliance Period:	1993-07-01 - 2015-12-31		
Violation ID:	94V0001		
Enforcement Date:	1994-08-22	Enf. Action:	Fed Public Notif Requested
System Name:	MINERAL SPRINGS MHP		
Violation Type:	Initial Tap Sampling for Pb and Cu		
Contaminant:	LEAD & COPPER RULE		
Compliance Period:	1993-07-01 - 2015-12-31		
Violation ID:	94V0001		
Enforcement Date:	1994-08-22	Enf. Action:	Fed Formal NOV Issued
System Name:	MINERAL SPRINGS MHP		
Violation Type:	Monitoring, Repeat Minor (TCR)		
Contaminant:	COLIFORM (TCR)		
Compliance Period:	1995-02-01 - 1995-02-28		
Violation ID:	9541181		
Enforcement Date:	1995-04-26	Enf. Action:	State Formal NOV Issued
System Name:	MINERAL SPRINGS MHP		
Violation Type:	Monitoring, Repeat Minor (TCR)		
Contaminant:	COLIFORM (TCR)		
Compliance Period:	1995-02-01 - 1995-02-28		
Violation ID:	9541181		
Enforcement Date:	1995-04-26	Enf. Action:	State Public Notif Requested
System Name:	MINERAL SPRINGS MHP		
Violation Type:	Monitoring, Regular		
Contaminant:	NITRATE		
Compliance Period:	1994-01-01 - 1994-12-31		
Violation ID:	9543492		
Enforcement Date:	1995-09-15	Enf. Action:	State Formal NOV Issued
System Name:	MINERAL SPRINGS MHP		
Violation Type:	Monitoring, Regular		
Contaminant:	NITRATE		
Compliance Period:	1994-01-01 - 1994-12-31		
Violation ID:	9543492		
Enforcement Date:	1995-09-15	Enf. Action:	State Public Notif Requested

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

ENFORCEMENT INFORMATION:

System Name:	MINERAL SPRINGS MHP		
Violation Type:	Monitoring, Regular		
Contaminant:	GROSS ALPHA, EXCL. RADON & U		
Compliance Period:	1994-10-01 - 1994-12-31		
Violation ID:	9543510		
Enforcement Date:	1995-07-14	Enf. Action:	State Formal NOV Issued
System Name:	MINERAL SPRINGS MHP		
Violation Type:	Monitoring, Regular		
Contaminant:	GROSS ALPHA, EXCL. RADON & U		
Compliance Period:	1994-10-01 - 1994-12-31		
Violation ID:	9543510		
Enforcement Date:	1995-07-14	Enf. Action:	State Public Notif Requested
System Name:	MINERAL SPRINGS MHP		
Violation Type:	Monitoring, Regular		
Contaminant:	GROSS ALPHA, EXCL. RADON & U		
Compliance Period:	1995-01-01 - 1995-03-31		
Violation ID:	9543511		
Enforcement Date:	1995-07-14	Enf. Action:	State Formal NOV Issued
System Name:	MINERAL SPRINGS MHP		
Violation Type:	Monitoring, Regular		
Contaminant:	GROSS ALPHA, EXCL. RADON & U		
Compliance Period:	1995-01-01 - 1995-03-31		
Violation ID:	9543511		
Enforcement Date:	1995-07-14	Enf. Action:	State Public Notif Requested
System Name:	MINERAL SPRINGS MHP		
Violation Type:	Monitoring, Regular		
Contaminant:	NITRATE		
Compliance Period:	1995-01-01 - 1995-12-31		
Violation ID:	9721524		
Enforcement Date:	Not Reported	Enf. Action:	Not Reported

11 SSW 1/2 - 1 Mile Higher	Site ID:	15506		
	Groundwater Flow:	Not Reported	AQUIFLOW	41044
	Shallowest Water Table Depth:	Not Reported		
	Deepest Water Table Depth:	Not Reported		
	Average Water Table Depth:	Not Reported		
	Depth to rock - shallowest:	Not Reported		
	Depth to rock - deepest:	Not Reported		
	Depth to rock - average:	8		
	Date:	06/1996		

B12 SSE 1/2 - 1 Mile Higher	Site ID:	17176		
	Groundwater Flow:	WNW	AQUIFLOW	36854
	Shallowest Water Table Depth:	Not Reported		
	Deepest Water Table Depth:	Not Reported		
	Average Water Table Depth:	16		
	Depth to rock - shallowest:	Not Reported		
	Depth to rock - deepest:	Not Reported		
	Depth to rock - average:	Not Reported		
	Date:	11/05/1996		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

B13 SSE 1/2 - 1 Mile Higher	Site ID: 3222 Groundwater Flow: Not Reported Shallowest Water Table Depth: 11.45 Deepest Water Table Depth: 17.50 Average Water Table Depth: Not Reported Depth to rock - shallowest: 16.5 Depth to rock - deepest: 24.5 Depth to rock - average: Not Reported Date: 06/28/1988	AQUIFLOW 41059
--	---	----------------------------

14 SSW 1/2 - 1 Mile Higher	Agency cd: USGS Site name: ME-133 Latitude: 351332 Longitude: 0805129 Dec lon: -80.85784932 Coor accr: S Dec latlong datum: NAD83 State: 37 Country: US Location map: Not Reported Altitude: Not Reported Altitude method: Not Reported Altitude accuracy: Not Reported Altitude datum: Not Reported Hydrologic: Not Reported Topographic: Upland draw Site type: Ground-water other than Spring Date inventoried: Not Reported Local standard time flag: Y Type of ground water site: Single well, other than collector or Ranney type Aquifer Type: Not Reported Aquifer: FELSIC METAIGNEOUS ROCK Well depth: 200.0 Source of depth data: reporting agency (generally USGS) Project number: 453709900 Real time data flag: Not Reported Daily flow data end date: Not Reported Peak flow data begin date: Not Reported Peak flow data count: Not Reported Water quality data end date: Not Reported Ground water data begin date: Not Reported Ground water data count: Not Reported	Site no: 351332080512901 EDR Site id: USGS2260447 Dec lat: 35.22569794 Coor meth: M Latlong datum: NAD27 District: 37 County: 119 Land net: Not Reported Map scale: Not Reported Date construction: Not Reported Mean greenwich time offset: EST Hole depth: Not Reported Daily flow data begin date: Not Reported Daily flow data count: Not Reported Peak flow data end date: Not Reported Water quality data begin date: Not Reported Water quality data count: Not Reported Ground water data end date: Not Reported	FED USGS USGS2260447
---	---	---	----------------------------------

Ground-water levels, Number of Measurements: 0

C15 SE 1/2 - 1 Mile Higher	Site ID: 6921 Groundwater Flow: Not Reported Shallowest Water Table Depth: 26 Deepest Water Table Depth: 30 Average Water Table Depth: Not Reported Depth to rock - shallowest: Not Reported Depth to rock - deepest: Not Reported Depth to rock - average: Not Reported Date: 09/14/1989	AQUIFLOW 40974
---	---	----------------------------

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

C16 SE 1/2 - 1 Mile Higher	Site ID:	11476		
	Groundwater Flow:	Not Reported	AQUIFLOW	40320
	Shallowest Water Table Depth:	Not Reported		
	Deepest Water Table Depth:	Not Reported		
	Average Water Table Depth:	38		
	Depth to rock - shallowest:	Not Reported		
	Depth to rock - deepest:	Not Reported		
	Depth to rock - average:	Not Reported		
Date:	02/12/1992			
<hr/>				
17 East 1/2 - 1 Mile Higher	Site ID:	8773		
	Groundwater Flow:	Not Reported	AQUIFLOW	40901
	Shallowest Water Table Depth:	Not Reported		
	Deepest Water Table Depth:	Not Reported		
	Average Water Table Depth:	35		
	Depth to rock - shallowest:	Not Reported		
	Depth to rock - deepest:	Not Reported		
	Depth to rock - average:	Not Reported		
Date:	11/29/1990			
<hr/>				
18 SE 1/2 - 1 Mile Higher	Site ID:	8650		
	Groundwater Flow:	Not Reported	AQUIFLOW	36844
	Shallowest Water Table Depth:	Not Reported		
	Deepest Water Table Depth:	Not Reported		
	Average Water Table Depth:	28		
	Depth to rock - shallowest:	Not Reported		
	Depth to rock - deepest:	Not Reported		
	Depth to rock - average:	Not Reported		
Date:	07/11/1990			
<hr/>				
19 SSE 1/2 - 1 Mile Higher	Site ID:	9513		
	Groundwater Flow:	SSE	AQUIFLOW	40855
	Shallowest Water Table Depth:	Not Reported		
	Deepest Water Table Depth:	Not Reported		
	Average Water Table Depth:	15		
	Depth to rock - shallowest:	Not Reported		
	Depth to rock - deepest:	Not Reported		
	Depth to rock - average:	Not Reported		
Date:	02/1993			
<hr/>				
20 WSW 1/2 - 1 Mile Lower	Site ID:	15830		
	Groundwater Flow:	Not Reported	AQUIFLOW	40876
	Shallowest Water Table Depth:	Not Reported		
	Deepest Water Table Depth:	Not Reported		
	Average Water Table Depth:	10		
	Depth to rock - shallowest:	Not Reported		
	Depth to rock - deepest:	Not Reported		
	Depth to rock - average:	Not Reported		
Date:	12/16/1996			

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

21 SSE 1/2 - 1 Mile Higher	Site ID: 7745 Groundwater Flow: Not Reported Shallowest Water Table Depth: Not Reported Deepest Water Table Depth: Not Reported Average Water Table Depth: 14.58 Depth to rock - shallowest: Not Reported Depth to rock - deepest: Not Reported Depth to rock - average: Not Reported Date: 12/17/1993	AQUIFLOW	36887
---	--	-----------------	--------------

22 SSE 1/2 - 1 Mile Higher	Site ID: 10374 Groundwater Flow: Not Reported Shallowest Water Table Depth: 5.24 Deepest Water Table Depth: 8.84 Average Water Table Depth: Not Reported Depth to rock - shallowest: 12 Depth to rock - deepest: 15 Depth to rock - average: Not Reported Date: 12/01/1989	AQUIFLOW	40557
---	--	-----------------	--------------

D23 South 1/2 - 1 Mile Higher	Site ID: 8634 Groundwater Flow: Not Reported Shallowest Water Table Depth: 12.51 Deepest Water Table Depth: 21.73 Average Water Table Depth: Not Reported Depth to rock - shallowest: 17 Depth to rock - deepest: 31 Depth to rock - average: Not Reported Date: 12/1994	AQUIFLOW	40263
--	--	-----------------	--------------

E24 SW 1/2 - 1 Mile Lower	Site ID: 14068 Groundwater Flow: W Shallowest Water Table Depth: Not Reported Deepest Water Table Depth: Not Reported Average Water Table Depth: Not Reported Depth to rock - shallowest: Not Reported Depth to rock - deepest: Not Reported Depth to rock - average: 12 Date: 08/1995	AQUIFLOW	36803
--	--	-----------------	--------------

E25 SW 1/2 - 1 Mile Lower	Site ID: 12563 Groundwater Flow: Not Reported Shallowest Water Table Depth: 14 Deepest Water Table Depth: 19 Average Water Table Depth: Not Reported Depth to rock - shallowest: 16 Depth to rock - deepest: 28 Depth to rock - average: Not Reported Date: 06/1995	AQUIFLOW	40966
--	---	-----------------	--------------

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

E26 SW 1/2 - 1 Mile Lower	Site ID: 15652 Groundwater Flow: N Shallowest Water Table Depth: 13.03 Deepest Water Table Depth: 25.24 Average Water Table Depth: Not Reported Depth to rock - shallowest: Not Reported Depth to rock - deepest: Not Reported Depth to rock - average: 24 Date: 05/31/1996	AQUIFLOW	40968
--	---	-----------------	--------------

27 WNW 1/2 - 1 Mile Lower	Site ID: 9254 Groundwater Flow: Not Reported Shallowest Water Table Depth: Not Reported Deepest Water Table Depth: Not Reported Average Water Table Depth: Not Reported Depth to rock - shallowest: Not Reported Depth to rock - deepest: Not Reported Depth to rock - average: 15 Date: 02/01/1991	AQUIFLOW	36823
--	---	-----------------	--------------

28 SSW 1/2 - 1 Mile Higher		FED USGS	USGS2260419
---	--	-----------------	--------------------

Agency cd: USGS Site name: ME-132 Latitude: 351322 Longitude: 0805134 Dec lon: -80.85923826 Coor accr: S Dec latlong datum: NAD83 State: 37 Country: US Location map: Not Reported Altitude: Not Reported Altitude method: Not Reported Altitude accuracy: Not Reported Altitude datum: Not Reported Hydrologic: Not Reported Topographic: Hillside (slope) Site type: Ground-water other than Spring Date inventoried: Not Reported Local standard time flag: Y Type of ground water site: Single well, other than collector or Ranney type Aquifer Type: Not Reported Aquifer: FELSIC METAIGNEOUS ROCK Well depth: 196.0 Source of depth data: reporting agency (generally USGS) Project number: 453709900 Real time data flag: 0 Daily flow data end date: 0000-00-00 Peak flow data begin date: 0000-00-00	Site no: 351322080513401 EDR Site id: USGS2260419 Dec lat: 35.22292022 Coor meth: M Latlong datum: NAD27 District: 37 County: 119 Land net: Not Reported Map scale: Not Reported Date construction: Not Reported Mean greenwich time offset: EST Hole depth: Not Reported Daily flow data begin date: 0000-00-00 Daily flow data count: 0 Peak flow data end date: 0000-00-00
---	---

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Peak flow data count: 0
 Water quality data end date: 0000-00-00
 Ground water data begin date: 1952-00-00
 Ground water data count: 1

Water quality data begin date: 0000-00-00
 Water quality data count: 0
 Ground water data end date: 1952-00-00

Ground-water levels, Number of Measurements: 1

Date	Feet below	
	Surface	Sealevel
1952	20	

29
North
1/2 - 1 Mile
Higher

Site ID: 10754
 Groundwater Flow: SE
 Shallowest Water Table Depth: 20
 Deepest Water Table Depth: 25
 Average Water Table Depth: Not Reported
 Depth to rock - shallowest: Not Reported
 Depth to rock - deepest: Not Reported
 Depth to rock - average: Not Reported
 Date: 01/29/1997

AQUIFLOW 36824

30
ESE
1/2 - 1 Mile
Higher

Pwsidentif: NC0160901
 System nam: COVENANT BAPTIST CHURCH
 Pws type: NC
 County: MECKLENBURG
 City: CHARLOTTE
 Primary so: GW
 Water type: GW
 Facility n: WELL #1
 Facility a: S01
 Latitude m: 35.231189
 Longitude : -80.83596
 Availavili: A
 Well depth: 0
 Well dep 1: Not Reported
 Owner name: COVENANT BAPTIST CHURCH
 Site id: NC200000002564

NC WELLS NC200000002564

31
ENE
1/2 - 1 Mile
Higher

Site ID: 5967
 Groundwater Flow: Not Reported
 Shallowest Water Table Depth: 7.58
 Deepest Water Table Depth: 7.76
 Average Water Table Depth: Not Reported
 Depth to rock - shallowest: Not Reported
 Depth to rock - deepest: Not Reported
 Depth to rock - average: Not Reported
 Date: 01/1991

AQUIFLOW 40224

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

D32 South 1/2 - 1 Mile Higher	Site ID: 18627 Groundwater Flow: Not Reported Shallowest Water Table Depth: 19.47 Deepest Water Table Depth: 22.86 Average Water Table Depth: Not Reported Depth to rock - shallowest: Not Reported Depth to rock - deepest: Not Reported Depth to rock - average: 39 Date: 05/13/1998	AQUIFLOW	40289
--	--	-----------------	--------------

33 ESE 1/2 - 1 Mile Higher	Site ID: 17138 Groundwater Flow: SE Shallowest Water Table Depth: Not Reported Deepest Water Table Depth: Not Reported Average Water Table Depth: Not Reported Depth to rock - shallowest: Not Reported Depth to rock - deepest: Not Reported Depth to rock - average: Not Reported Date: 08/01/1996	AQUIFLOW	40853
---	--	-----------------	--------------

34 ENE 1/2 - 1 Mile Higher	Site ID: 11043 Groundwater Flow: NW Shallowest Water Table Depth: 6 Deepest Water Table Depth: 8 Average Water Table Depth: Not Reported Depth to rock - shallowest: Not Reported Depth to rock - deepest: Not Reported Depth to rock - average: Not Reported Date: 06/12/1998	AQUIFLOW	40311
---	--	-----------------	--------------

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS RADON

AREA RADON INFORMATION

State Database: NC Radon

Radon Test Results

Num Results	Avg pCi/L	Min pCi/L	Max pCi/L
1	5.70	5.7	5.7

Federal EPA Radon Zone for MECKLENBURG County: 3

- Note: Zone 1 indoor average level > 4 pCi/L.
 : Zone 2 indoor average level >= 2 pCi/L and <= 4 pCi/L.
 : Zone 3 indoor average level < 2 pCi/L.

Federal Area Radon Information for Zip Code: 28202

Number of sites tested: 1

Area	Average Activity	% <4 pCi/L	% 4-20 pCi/L	% >20 pCi/L
Living Area - 1st Floor	-0.100 pCi/L	100%	0%	0%
Living Area - 2nd Floor	Not Reported	Not Reported	Not Reported	Not Reported
Basement	Not Reported	Not Reported	Not Reported	Not Reported

PHYSICAL SETTING SOURCE RECORDS SEARCHED

TOPOGRAPHIC INFORMATION

USGS 7.5' Digital Elevation Model (DEM)

Source: United States Geologic Survey

EDR acquired the USGS 7.5' Digital Elevation Model in 2002 and updated it in 2006. The 7.5 minute DEM corresponds to the USGS 1:24,000- and 1:25,000-scale topographic quadrangle maps. The DEM provides elevation data with consistent elevation units and projection.

HYDROLOGIC INFORMATION

Flood Zone Data: This data, available in select counties across the country, was obtained by EDR in 2003 & 2009 from the Federal Emergency Management Agency (FEMA). Data depicts 100-year and 500-year flood zones as defined by FEMA.

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002 and 2005 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Wetlands Inventory

Source: Department of Environment & Natural Resources

Telephone: 919-733-2090

HYDROGEOLOGIC INFORMATION

AQUIFLOW^R Information System

Source: EDR proprietary database of groundwater flow information

EDR has developed the AQUIFLOW Information System (AIS) to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted to regulatory authorities at select sites and has extracted the date of the report, hydrogeologically determined groundwater flow direction and depth to water table information.

GEOLOGIC INFORMATION

Geologic Age and Rock Stratigraphic Unit

Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - A digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

STATSGO: State Soil Geographic Database

Source: Department of Agriculture, Natural Resources Conservation Services

The U.S. Department of Agriculture's (USDA) Natural Resources Conservation Service (NRCS) leads the national Conservation Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. Soil maps for STATSGO are compiled by generalizing more detailed (SSURGO) soil survey maps.

SSURGO: Soil Survey Geographic Database

Source: Department of Agriculture, Natural Resources Conservation Services (NRCS)

Telephone: 800-672-5559

SSURGO is the most detailed level of mapping done by the Natural Resources Conservation Services, mapping scales generally range from 1:12,000 to 1:63,360. Field mapping methods using national standards are used to construct the soil maps in the Soil Survey Geographic (SSURGO) database. SSURGO digitizing duplicates the original soil survey maps. This level of mapping is designed for use by landowners, townships and county natural resource planning and management.

PHYSICAL SETTING SOURCE RECORDS SEARCHED

LOCAL / REGIONAL WATER AGENCY RECORDS

FEDERAL WATER WELLS

PWS: Public Water Systems

Source: EPA/Office of Drinking Water

Telephone: 202-564-3750

Public Water System data from the Federal Reporting Data System. A PWS is any water system which provides water to at least 25 people for at least 60 days annually. PWSs provide water from wells, rivers and other sources.

PWS ENF: Public Water Systems Violation and Enforcement Data

Source: EPA/Office of Drinking Water

Telephone: 202-564-3750

Violation and Enforcement data for Public Water Systems from the Safe Drinking Water Information System (SDWIS) after August 1995. Prior to August 1995, the data came from the Federal Reporting Data System (FRDS).

USGS Water Wells: USGS National Water Inventory System (NWIS)

This database contains descriptive information on sites where the USGS collects or has collected data on surface water and/or groundwater. The groundwater data includes information on wells, springs, and other sources of groundwater.

STATE RECORDS

North Carolina Public Water Supply Wells

Source: Department of Environmental Health

Telephone: 919-715-3243

OTHER STATE DATABASE INFORMATION

NC Natural Areas: Significant Natural Heritage Areas

Source: Center for Geographic Information and Analysis

Telephone: 919-733-2090

A polygon coverage identifying sites (terrestrial or aquatic that have particular biodiversity significance.

A site's significance may be due to the presence of rare species, rare or high quality natural communities, or other important ecological features.

NC Game Lands: Wildlife Resources Commission Game Lands

Source: Center for Geographic Information and Analysis

Telephone: 919-733-2090

All publicly owned game lands managed by the North Carolina Wildlife Resources Commission and as listed in Hunting and Fishing Maps.

NC Natural Heritage Sites: Natural Heritage Element Occurrence Sites

Source: Center for Geographic Information and Analysis

Telephone: 919-733-2090

A point coverage identifying locations of rare and endangered species, occurrences of exemplary or unique natural ecosystems (terrestrial or aquatic), and special animal habitats (e.g., colonial waterbird nesting sites).

RADON

State Database: NC Radon

Source: Department of Environment & Natural Resources

Telephone: 919-733-4984

Radon Statistical and Non Statistical Data

Area Radon Information

Source: USGS

Telephone: 703-356-4020

The National Radon Database has been developed by the U.S. Environmental Protection Agency (USEPA) and is a compilation of the EPA/State Residential Radon Survey and the National Residential Radon Survey. The study covers the years 1986 - 1992. Where necessary data has been supplemented by information collected at private sources such as universities and research institutions.

PHYSICAL SETTING SOURCE RECORDS SEARCHED

EPA Radon Zones

Source: EPA

Telephone: 703-356-4020

Sections 307 & 309 of IRAA directed EPA to list and identify areas of U.S. with the potential for elevated indoor radon levels.

OTHER

Airport Landing Facilities: Private and public use landing facilities

Source: Federal Aviation Administration, 800-457-6656

Epicenters: World earthquake epicenters, Richter 5 or greater

Source: Department of Commerce, National Oceanic and Atmospheric Administration

STREET AND ADDRESS INFORMATION

© 2010 Tele Atlas North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

ARCADIS

Appendix C

Historical Resources

ARCADIS

Aerial Photographs



Gateway Area

1100 W. Trade Street
Charlotte, NC 28202

Inquiry Number: 2999896.5
February 25, 2011

The EDR Aerial Photo Decade Package

EDR Aerial Photo Decade Package

Environmental Data Resources, Inc. (EDR) Aerial Photo Decade Package is a screening tool designed to assist environmental professionals in evaluating potential liability on a target property resulting from past activities. EDR's professional researchers provide digitally reproduced historical aerial photographs, and when available, provide one photo per decade.

When delivered electronically by EDR, the aerial photo images included with this report are for ONE TIME USE ONLY. Further reproduction of these aerial photo images is prohibited without permission from EDR. For more information contact your EDR Account Executive.

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report AS IS. Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2011 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

Date EDR Searched Historical Sources:

Aerial Photography February 25, 2011

Target Property:

1100 W. Trade Street


Charlotte, NC 28202

<u>Year</u>	<u>Scale</u>	<u>Details</u>	<u>Source</u>
1950	Aerial Photograph. Scale: 1"=500'	Panel #: 35080-B7, Charlotte East, NC;/Flight Date: March 09, 1950	EDR
1968	Aerial Photograph. Scale: 1"=500'	Panel #: 35080-B7, Charlotte East, NC;/Flight Date: February 25, 1968	EDR
1973	Aerial Photograph. Scale: 1"=750'	Panel #: 35080-B7, Charlotte East, NC;/Flight Date: November 19, 1973	EDR
1983	Aerial Photograph. Scale: 1"=1000'	Panel #: 35080-B7, Charlotte East, NC;/Flight Date: March 03, 1983	EDR
1988	Aerial Photograph. Scale: 1"=750'	Panel #: 35080-B7, Charlotte East, NC;/Flight Date: October 12, 1988	EDR
1996	Aerial Photograph. Scale: 1"=750'	Panel #: 35080-B7, Charlotte East, NC;/Flight Date: April 25, 1996	EDR
2006	Aerial Photograph. Scale: 1"=604'	Panel #: 35080-B7, Charlotte East, NC;/Flight Date: January 01, 2006	EDR



INQUIRY #: 2999896.5

YEAR: 1950

 = 500'



808,288

ACO - 3 JJ - 128



INQUIRY #: 2999896.5

YEAR: 1968

| = 500'





INQUIRY #: 2999896.5

YEAR: 1973

|—————| = 750'





INQUIRY #: 2999896.5
YEAR: 1983
|—————| = 1000'





INQUIRY #: 2999896.5

YEAR: 1988

| = 750'





INQUIRY #: 2999896.5

YEAR: 1996

| = 750'





INQUIRY #: 2999896.5

YEAR: 2006

|—————| = 604'



ARCADIS

Sanborn Maps



Gateway Area

1100 W. Trade Street
Charlotte, NC 28202

Inquiry Number: 2999896.3
February 25, 2011

Certified Sanborn® Map Report

Certified Sanborn® Map Report

2/25/11

Site Name:

Gateway Area
1100 W. Trade Street
Charlotte, NC 28202

Client Name:

ARCADIS U.S., Inc.
194 Forbes Road
Braintree, MA 02184

EDR Inquiry # 2999896.3

Contact: Sean Drain



The complete Sanborn Library collection has been searched by EDR, and fire insurance maps covering the target property location provided by ARCADIS U.S., Inc. were identified for the years listed below. The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by Sanborn Library LLC, the copyright holder for the collection.

Certified Sanborn Results:

Site Name: Gateway Area
Address: 1100 W. Trade Street
City, State, Zip: Charlotte, NC 28202
Cross Street:
P.O. # NA
Project: NA
Certification # CE77-4187-B560



Sanborn® Library search results
Certification # CE77-4187-B560

Maps Provided:

1963
1953
1950
1929

The Sanborn Library includes more than 1.2 million Sanborn fire insurance maps, which track historical property usage in approximately 12,000 American cities and towns. Collections searched:

- Library of Congress
- University Publications of America
- EDR Private Collection

The Sanborn Library LLC Since 1866™

Limited Permission To Make Copies

ARCADIS U.S., Inc. (the client) is permitted to make up to THREE photocopies of this Sanborn Map transmittal and each fire insurance map accompanying this report solely for the limited use of its customer. No one other than the client is authorized to make copies. Upon request made directly to an EDR Account Executive, the client may be permitted to make a limited number of additional photocopies. This permission is conditioned upon compliance by the client, its customer and their agents with EDR's copyright policy; a copy of which is available upon request.

Disclaimer - Copyright and Trademark notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2011 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

Sanborn Sheet Thumbnails

This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.



1963 Source Sheets



Volume 3, Sheet 317




Volume 3, Sheet 313

1953 Source Sheets



Volume 3, Sheet 313

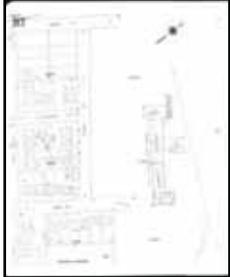


Volume 3, Sheet 317

1950 Source Sheets



Volume 3, Sheet 313

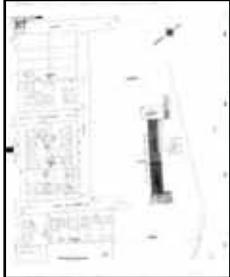

Volume 3, Sheet 317

1929 Source Sheets



Volume 2, Sheet 313



Volume 2, Sheet 317

1963 Certified Sanborn Map


The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # CE77-4187-B560


Site Name: Gateway Area
 Address: 1100 W. Trade Street
 City, ST, ZIP: Charlotte NC 28202
 Client: ARCADIS U.S., Inc.
 EDR Inquiry: 2999896.3
 Order Date: 2/25/2011 11:48:01 AM
 Certification #: CE77-4187-B560
 Copyright: 1963



This Certified Sanborn Map combines the following sheets. Outlined areas indicate map sheets within the collection.

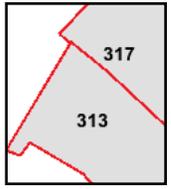

Volume 3, Sheet 317
 Volume 3, Sheet 313



1953 Certified Sanborn Map


The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # CE77-4187-B560


Site Name: Gateway Area
 Address: 1100 W. Trade Street
 City, ST, ZIP: Charlotte NC 28202
 Client: ARCADIS U.S., Inc.
 EDR Inquiry: 2999896.3
 Order Date: 2/25/2011 11:48:01 AM
 Certification #: CE77-4187-B560
 Copyright: 1953



This Certified Sanborn Map combines the following sheets. Outlined areas indicate map sheets within the collection.

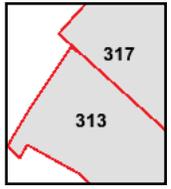

Volume 3, Sheet 313
 Volume 3, Sheet 317



1950 Certified Sanborn Map



The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # CE77-4187-B560

Site Name: Gateway Area
 Address: 1100 W. Trade Street
 City, ST, ZIP: Charlotte NC 28202
 Client: ARCADIS U.S., Inc.
 EDR Inquiry: 2999896.3
 Order Date: 2/25/2011 11:48:01 AM
 Certification #: CE77-4187-B560
 Copyright: 1950



This Certified Sanborn Map combines the following sheets. Outlined areas indicate map sheets within the collection.

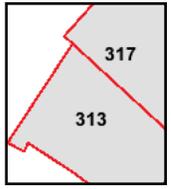

Volume 3, Sheet 313
 Volume 3, Sheet 317



1929 Certified Sanborn Map


The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # CE77-4187-B560


Site Name: Gateway Area
 Address: 1100 W. Trade Street
 City, ST, ZIP: Charlotte NC 28202
 Client: ARCADIS U.S., Inc.
 EDR Inquiry: 2999896.3
 Order Date: 2/25/2011 11:48:01 AM
 Certification #: CE77-4187-B560
 Copyright: 1929



This Certified Sanborn Map combines the following sheets. Outlined areas indicate map sheets within the collection.

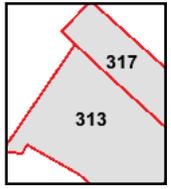

Volume 2, Sheet 313
 Volume 2, Sheet 317



ARCADIS

City Directory Abstract

Gateway Area

1100 W. Trade Street
Charlotte, NC 28202

Inquiry Number: 2999896.6
March 22, 2011

The EDR-City Directory Abstract



Environmental Data Resources Inc

440 Wheelers Farms Road
Milford, CT 06461
800.352.0050
www.edrnet.com

TABLE OF CONTENTS

SECTION

Executive Summary

Findings

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OR DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2009 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc. or its affiliates is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

EXECUTIVE SUMMARY

DESCRIPTION

Environmental Data Resources, Inc.'s (EDR) City Directory Abstract is a screening tool designed to assist environmental professionals in evaluating potential liability on a target property resulting from past activities. EDR's City Directory Abstract includes a search and abstract of available city directory data. For each address, the directory lists the name of the corresponding occupant at five year intervals.

Business directories including city, cross reference and telephone directories were reviewed, if available, at approximately five year intervals for the years spanning 1921 through 2005. This report compiles information gathered in this review by geocoding the latitude and longitude of properties identified and gathering information about properties within 660 feet of the target property.

A summary of the information obtained is provided in the text of this report.

RESEARCH SUMMARY

The following research sources were consulted in the preparation of this report. An "X" indicates where information was identified in the source and provided in this report.

<u>Year</u>	<u>Source</u>	<u>TP</u>	<u>Adjoining</u>	<u>Text Abstract</u>	<u>Source Image</u>
2005	Hill-Donnelly Information Services	-	X	X	-
1999	City Publishing Company Inc.	-	X	X	-
1994	R. L. Polk & Co.	X	X	X	-
1991	R. L. Polk & Co.	-	-	-	-
1989	R. L. Polk & Co.	X	X	X	-
1984	R. L. Polk & Co.	X	X	X	-
1979	Hill's City Directory	X	X	X	-
1975	Hills City Directory	-	-	-	-
1974	Hill's City Directory	X	X	X	-
1969	Hill's City Directory	X	X	X	-
1964	Hill's City Directory	X	X	X	-
1959	Hill's City Directory	X	X	X	-
1953	Hill's City Directory	X	X	X	-
1949	Hill's City Directory	X	X	X	-
1944	Hill's City Directory	X	X	X	-
1937	Hill's City Directory	X	X	X	-
1931	Piedmont Directory Company	-	X	X	-
1925	Commercial Service Co.	-	X	X	-
1921	Commercial Service Co.	-	X	X	-

FINDINGS

TARGET PROPERTY INFORMATION

ADDRESS

1100 W. Trade Street
Charlotte, NC 28202

FINDINGS DETAIL

Target Property research detail.

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1994	ELMERS AUTO SERVICE auto repr	R. L. Polk & Co.
	INTERSTATE JOHNSON LANE UPTOWN BRANCH	R. L. Polk & Co.
1989	Elmers Auto Service gas sta	R. L. Polk & Co.
1984	Elmers Auto Service gas sta	R. L. Polk & Co.
1979	Elmers Auto Service gas sta	Hill's City Directory
1974	Elmers Auto Service gas sta	Hill's City Directory
1969	PUCKETTS TEXACO SERVICE GAS STA	Hill's City Directory
1964	Babcock & Wilcox Co The boilers sls ofc	Hill's City Directory
	Puckett Bros Inc fuel oil	Hill's City Directory
	Pucketts Fuel Oil Serv	Hill's City Directory
	Pucketts Texaco Serv gas sta	Hill's City Directory
	Vacant	Hill's City Directory
1959	Babcock & Wilcox Co The blrs ED	Hill's City Directory
	Puckett Fuel Oil Serv fuel oil FR	Hill's City Directory
	Pucketts Texaco Serv FR	Hill's City Directory
	Vacant	Hill's City Directory
1953	Gaddy R Bennett dentist	Hill's City Directory
	Lowerys Texaco Serv	Hill's City Directory
1949	Hosp Savings Assn of N C Inc	Hill's City Directory
	Lowerys Texaco Service fill sta	Hill's City Directory
	Sycamore intersects	Hill's City Directory
1944	Hosp Saving Asn of N C Inc	Hill's City Directory
1937	Chapman & Strand acct	Hill's City Directory
	Puckett Robt L filling sta	Hill's City Directory

FINDINGS

ADJOINING PROPERTY DETAIL

The following Adjoining Property addresses were researched for this report. Detailed findings are provided for each address.

5TH ST

1000 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1925	new Lyde Jas	Commercial Service Co.
1921	new Foster Mattie	Commercial Service Co.

1001 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1925	Vacant	Commercial Service Co.

1002 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1925	new Floster Mack	Commercial Service Co.
	Wilkie J B	Commercial Service Co.

1003 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1925	Lawrence J A	Commercial Service Co.
1921	Lawrence J A	Commercial Service Co.

1004 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1925	Hummel Geo K	Commercial Service Co.
	new Mooro Eliza	Commercial Service Co.
1921	Hummel G K	Commercial Service Co.

1005 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1925	B Byrum F K	Commercial Service Co.
	A Ford W B	Commercial Service Co.

1006 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1004 Imes John c	Piedmont Directory Company
1925	new Williams Elizabeth	Commercial Service Co.
	Perry E L	Commercial Service Co.

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1921	new Patterson Horace	Commercial Service Co.

1007 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1925	Henderson J R	Commercial Service Co.
1921	Henderson Jas R	Commercial Service Co.

1008 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1006 Edwards Mable c	Piedmont Directory Company
1925	Scholl W P	Commercial Service Co.
1921	Cresswell T D	Commercial Service Co.
	Morton Jno J marble	Commercial Service Co.

1009 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1925	r new Alexandor Willie Mae	Commercial Service Co.
	r new Yonng Marie	Commercial Service Co.
1921	new Carothers Jas	Commercial Service Co.

1010 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1925	new Ross Wm	Commercial Service Co.
	Anderson C C Rev	Commercial Service Co.
	Sycamore intersects	Commercial Service Co.
1921	new Alexander Edwd	Commercial Service Co.

1011 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1925	new Robinson Henry	Commercial Service Co.
1921	new Ramiseus Chas	Commercial Service Co.

1012 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1002 Wilkie J B	Piedmont Directory Company
	1008 Pride Carrie c	Piedmont Directory Company
1925	new Potts Isaac	Commercial Service Co.
1921	new Potts Isaac	Commercial Service Co.

FINDINGS

1013 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	Shuping S L	Piedmont Directory Company
	1001 Revels Sophia Mrs	Piedmont Directory Company
	1009 Scott Daisy c	Piedmont Directory Company
1925	new Connor Jas	Commercial Service Co.
1921	new Connor Jas	Commercial Service Co.

1014 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1010 Vacant	Piedmont Directory Company
1925	new Potts Lee	Commercial Service Co.
1921	new Potts Lee	Commercial Service Co.

1015 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1001 Pender H J Mrs	Piedmont Directory Company
	1011 Massey Saml c	Piedmont Directory Company
1921	new Mills R F	Commercial Service Co.

1016 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1004 Akers W W Rev	Piedmont Directory Company
1925	new Alexander Saml	Commercial Service Co.
	new Jones Henry	Commercial Service Co.
1921	new Goforth Lina	Commercial Service Co.

1017 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1003 Privette H L	Piedmont Directory Company
	1013 White Chas c	Piedmont Directory Company
1925	new Mc Dowell Robt	Commercial Service Co.
1921	new Medlin Arthur	Commercial Service Co.

1018 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	Barbours Court begins	Piedmont Directory Company
1925	new Able David	Commercial Service Co.
1921	new Cole Jennie	Commercial Service Co.

FINDINGS

1019 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1925	new Walker Lee	Commercial Service Co.
1921	new Mc Dowell Katie	Commercial Service Co.

1020 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1006 Peterson J E	Piedmont Directory Company
1925	new Graham Lee	Commercial Service Co.
1921	new Graham Lee	Commercial Service Co.

1021 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1005 Vacant	Piedmont Directory Company
	1015 Springs Alex c	Piedmont Directory Company
1925	new Trussell Hattie	Commercial Service Co.
1921	new Truesdale Hattie	Commercial Service Co.

1022 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1016 Fisher Cora c	Piedmont Directory Company
	1008 Humphrey P V	Piedmont Directory Company
1925	new Black Sallie	Commercial Service Co.
1921	new Black Sallie	Commercial Service Co.

1023 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1005 1/2 OConnor J M	Piedmont Directory Company
	1017 Weaver Conley c	Piedmont Directory Company

1024 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1018 Able David c	Piedmont Directory Company

1025 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	A 1021 Odom Minyard c	Piedmont Directory Company
	1019 Smith Benj c	Piedmont Directory Company
1925	Charlotte Ice Co The	Commercial Service Co.
	Morrow intersects	Commercial Service Co.

FINDINGS

1026 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1020 Knox Bessie c	Piedmont Directory Company
	1010 Stephens W F	Piedmont Directory Company

1027 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	Sycamore intersects	Piedmont Directory Company
	1007 Vacant	Piedmont Directory Company
	1025 Jacobs Wm c	Piedmont Directory Company

1028 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1022 Hill John c	Piedmont Directory Company
	Morow intersects	Piedmont Directory Company

1103 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1925	Taylor W C	Commercial Service Co.
	Collins Benj	Commercial Service Co.
	Andrill Terrace intersects	Commercial Service Co.

1105 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1035 Mc Corkle Lizzie c	Piedmont Directory Company

1107 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1037 Johnson Harrison c	Piedmont Directory Company
	Sugaw Creek crosses Cecil intersects	Piedmont Directory Company

1108 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1100 Bland J A	Piedmont Directory Company
	1/2 1102 Cochrane W F	Piedmont Directory Company

1114 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1104 Henley C A	Piedmont Directory Company

FINDINGS

1115 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	Andrill Terrace intersects	Piedmont Directory Company
	1103 Collins Benj	Piedmont Directory Company

1200 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1925	Cecil intersects	Commercial Service Co.
	Open Air School	Commercial Service Co.
1921	Mayhew M S	Commercial Service Co.

1201 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1401 Green K S	Piedmont Directory Company

1207 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1403 Wilson J W	Piedmont Directory Company

1208 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1302 Dean L P	Piedmont Directory Company

1211 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1405 Abercrombie A B	Piedmont Directory Company
1925	Gallagher E F	Commercial Service Co.

1212 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1304 Brady H J	Piedmont Directory Company

1213 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1925	Vacant	Commercial Service Co.

1215 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	Groover B L	Piedmont Directory Company
	1407 Seegers A F	Piedmont Directory Company

FINDINGS

1218 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1306 Russell Luna Miss	Piedmont Directory Company

1219 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1409 Iseley L H Mrs	Piedmont Directory Company

1222 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1308 Wood J C bldg contr	Piedmont Directory Company

1223 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1411 Gilbert R C	Piedmont Directory Company

1224 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1310 Foures J M	Piedmont Directory Company

1230 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1312 Reid C Y	Piedmont Directory Company

1231 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1415 Fowler Lou Mrs	Piedmont Directory Company

1234 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1314 Wilson G H	Piedmont Directory Company

1235 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1417 Kumpe J E	Piedmont Directory Company

1236 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1400 Houston J W	Piedmont Directory Company

1239 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1419 Morse S L	Piedmont Directory Company

FINDINGS

E 5TH ST

1000 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1944	Brown Ella c	Hill's City Directory
1937	Patterson Robt H c	Hill's City Directory

1006 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1944	Hinton Walter c	Hill's City Directory
1937	Davis Dalsy c	Hill's City Directory

1008 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1944	Lewis Robt c	Hill's City Directory
1937	Weaver Conley c	Hill's City Directory

1012 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1944	Moore Janie c	Hill's City Directory
1937	Bowman Sarah c	Hill's City Directory

1013 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	White Janie Mrs	Hill's City Directory
1959	Steele Dorothy G Mrs	Hill's City Directory
1953	Pauling Abr P	Hill's City Directory
1944	Paul Abr P c	Hill's City Directory
1937	Massey Walter c	Hill's City Directory

1014 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Baldwin Jas W	Hill's City Directory
1959	Harrison Jas	Hill's City Directory
1953	Watkins Erasmus K Rev res	Hill's City Directory
1949	Watkins E K Rev c	Hill's City Directory

1015 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Martin Essie Mrs	Hill's City Directory
1959	White Janie B Mrs	Hill's City Directory

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1953	White Janie B Mrs	Hill's City Directory
1949	White Janie c	Hill's City Directory
1944	White Janie c	Hill's City Directory
1937	Wiley Stein c	Hill's City Directory

1016 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Carter Matthew res	Hill's City Directory
1959	Carter Matthew res ED	Hill's City Directory
1953	Carter Matthew	Hill's City Directory
1949	Spears Wm c res	Hill's City Directory

1017 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Barbours ct begins	Hill's City Directory
	Melton Odessa Mrs	Hill's City Directory
1959	Barbours ct begins	Hill's City Directory
	Vacant	Hill's City Directory
1953	Barbours ct begins	Hill's City Directory
	Sims Annie L Mrs	Hill's City Directory
1949	Barbours ct begins	Hill's City Directory
	Sims Annie L c	Hill's City Directory
1944	Barbours ct begins	Hill's City Directory
	Slms John c	Hill's City Directory
1937	Harris John c	Hill's City Directory

1018 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Robinson Dewey	Hill's City Directory
1959	Stack Annie L Mrs	Hill's City Directory
1953	Mc Gill Jas	Hill's City Directory
1949	Mc Gill Jas c	Hill's City Directory
1944	Potts Annie M c	Hill's City Directory
1937	Potts Issac E c	Hill's City Directory
	Barbours to begins	Hill's City Directory

1020 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Vacant	Hill's City Directory
1959	Potts Annie M Mrs res ED	Hill's City Directory

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1953	Potts Annie M Mrs	Hill's City Directory
1949	Potts Annie M Mrs c res	Hill's City Directory
1944	Reid Chas c	Hill's City Directory

1021 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Alexander Lomar Mrs	Hill's City Directory
1959	Patterson Selina H Mrs	Hill's City Directory
1953	Patterson Robt	Hill's City Directory
1949	Petterson Robt c	Hill's City Directory
1944	Patterson Robt c	Hill's City Directory
1937	Spring Alex c	Hill's City Directory

1022 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Mozee Jas	Hill's City Directory
1959	Mozee Jas	Hill's City Directory
1953	Strong Walter jr res	Hill's City Directory
1949	Kelley Leroy c res	Hill's City Directory
1944	Carson Fannie c	Hill's City Directory
	Fisher Cora c	Hill's City Directory
1937	Fisher Cora c	Hill's City Directory

1023 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Carson Fannie R	Hill's City Directory
1959	Carson Fannie R drsmkr	Hill's City Directory
1953	Carson Fannie Mrs	Hill's City Directory
1949	Carson Fannie c	Hill's City Directory
1937	Whitin Lewis c	Hill's City Directory

1024 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1937	Able Davis c	Hill's City Directory

1025 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Vacant	Hill's City Directory
1959	Caldwell Albert ED	Hill's City Directory
1953	Caldwell Albert	Hill's City Directory

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1949	Caldwell Albert c	Hill's City Directory
1944	Caldwell Albert c	Hill's City Directory
1937	Wright Jas c	Hill's City Directory

1026 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Cooper James	Hill's City Directory
1959	Wilson Melvin FR	Hill's City Directory
1953	Wilson Melvin	Hill's City Directory
1949	Wilson Melvin c res	Hill's City Directory
1944	Mc Dowell Randolph c	Hill's City Directory
1937	Russell Annie c	Hill's City Directory

1027 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1953	Carson Wm H	Hill's City Directory
1949	Johnson Annie c	Hill's City Directory
1944	Johnson Annie c	Hill's City Directory
1937	Vacant	Hill's City Directory

1028 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	reeder Marcus res	Hill's City Directory
1959	reeder Marcus res ED	Hill's City Directory
1953	Reeder Marcus res	Hill's City Directory
1949	reeder Marcus c res	Hill's City Directory
1944	Lacy Geo c	Hill's City Directory
1937	Imes John c	Hill's City Directory

1029 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1937	Morrow ends	Hill's City Directory
	Barnes Annabelle c	Hill's City Directory

1031 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Apostolic Ch of God The	Hill's City Directory
	N Morrow ends	Hill's City Directory
1959	Apostolic Ch of God The	Hill's City Directory
	N Morrow ends	Hill's City Directory

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1953	N Morrow ends	Hill's City Directory
	Irwin Mission Hall	Hill's City Directory
1949	N Morrow ends	Hill's City Directory
	Irwin Mission Hall c	Hill's City Directory
1944	N Morrow ends	Hill's City Directory
	Irwin Mission Hall c	Hill's City Directory

1101 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Goss Willie S	Hill's City Directory
1959	Green Jas W	Hill's City Directory
1953	Waiters Jas	Hill's City Directory

1103 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Jackson Charlie	Hill's City Directory
1959	Gore Thelma	Hill's City Directory
1953	Miller Freddie L	Hill's City Directory

1105 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Moore John	Hill's City Directory
1959	White Janie M	Hill's City Directory
1953	Bellamy Claude	Hill's City Directory
1949	Young L Wm c res	Hill's City Directory
1944	Young Wm C res	Hill's City Directory
1937	Young Wm c	Hill's City Directory

1106 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1949	Hunter John H c	Hill's City Directory

1107 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Raiford John	Hill's City Directory
	Sugaw Creek no bridge Not open bet Sugaw Creek and N Cecil	Hill's City Directory
	Kings dr intersects	Hill's City Directory
1959	Staton Hoyt	Hill's City Directory
	Sugar Creek no bridge	Hill's City Directory

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1959	Not open bet Sugar Creek and N Cecil	Hill's City Directory
	N Cecil intersects	Hill's City Directory
1953	N Cecil intersects	Hill's City Directory
	Sugar Creek no bridge Not open bet Sugar Creek and N Cecil	Hill's City Directory
	Vacant	Hill's City Directory
1949	Robert Lonnie c	Hill's City Directory
	Sugar Creek no bridge	Hill's City Directory
	Not open bet Sugar Creek and N Cecil	Hill's City Directory
	N Cecil intersects	Hill's City Directory
1944	Roberts Lonzie c	Hill's City Directory
	Sugar Crook no bridge Not open between Sugar Crook and N Ceel	Hill's City Directory
1937	Massey Saml c	Hill's City Directory
	Sugar Creek crosses	Hill's City Directory
	Cecil intersects	Hill's City Directory

1201 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Vacant	Hill's City Directory
1959	Caldwell Charlotte Mrs FR 11 G 6973	Hill's City Directory
1953	Caldwell Lottie R Mrs res	Hill's City Directory
1949	Caldwell Lottie r Mrs res	Hill's City Directory
1944	Caldwell Lottie r Mrs res	Hill's City Directory
1937	5TH E Contd	Hill's City Directory
	Caldwell Lottie R Mrs	Hill's City Directory

1207 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Vacant	Hill's City Directory
1959	Beacham Cleveland jr res ED	Hill's City Directory
1953	Beacham Cleveland jr res	Hill's City Directory
1949	Beacham Cleveland jr res	Hill's City Directory
1944	Wilson John W res	Hill's City Directory

1208 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Ward Pauline C Mrs mint dec	Hill's City Directory
	Ward Marvin S res	Hill's City Directory
1959	Ward Pauline C Mrs int dec	Hill's City Directory

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1959	Ward Marvin S res ED	Hill's City Directory
1953	Ward Marvin S res	Hill's City Directory
1949	Ward Marvin S res	Hill's City Directory
1944	Ward Marvin S res	Hill's City Directory
1937	Dean Lemuel P	Hill's City Directory

1211 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Greene I Devona res	Hill's City Directory
1959	Greene I Devona res ED	Hill's City Directory
1953	Greene I Devona res	Hill's City Directory
1949	Greene I Devona res	Hill's City Directory
1944	Greene I Devona res	Hill's City Directory
1937	Wagner Wm W	Hill's City Directory

1212 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Cornell Jas F res	Hill's City Directory
1959	Cornell Jas F res ED	Hill's City Directory
1953	Cornell Jas F res	Hill's City Directory
1949	Burnette Arth L res	Hill's City Directory
1944	Burnette Arth res	Hill's City Directory
1937	Odem L Garfield	Hill's City Directory

1215 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Mc Kenzie Margt B Mrs res	Hill's City Directory
1959	Mc Kenzie Gaston S res Fr G 7186	Hill's City Directory
1953	Leaird Cornelia B res	Hill's City Directory
1949	Mc Kenzie G Shelton res	Hill's City Directory
1944	Mc Kenzie G Shelton res	Hill's City Directory
1937	Mc Kenzie G Shelton	Hill's City Directory

1218 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Spurlin Ned W res	Hill's City Directory
1959	Spurlin Ned W FR	Hill's City Directory
1953	Spurlin Ned W	Hill's City Directory
1949	Dunlap Nona r Mrs res	Hill's City Directory
1944	russell Luna F res	Hill's City Directory

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1937	Russell Luna F	Hill's City Directory

1221 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Vacant	Hill's City Directory
1959	Dodd John P FR	Hill's City Directory
1953	Fuckenworth Ralph E	Hill's City Directory
1949	Mc Kenzie David A res	Hill's City Directory
1944	Vacant	Hill's City Directory
1937	Iseley Lena H Mrs	Hill's City Directory

1222 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Wood John C res	Hill's City Directory
1959	Wood John C res ED	Hill's City Directory
1953	Wood John C res	Hill's City Directory
1949	Wood John C res bldg contr	Hill's City Directory
1944	Wood John C res bldg contr	Hill's City Directory
1937	Wood John C	Hill's City Directory

1223 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Vacant	Hill's City Directory
1959	Vacant	Hill's City Directory
1953	Keever Danl W res	Hill's City Directory
1949	Morris Edna Mrs	Hill's City Directory
1944	Morris Harris W	Hill's City Directory
1937	Carter Harry L	Hill's City Directory

1224 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Winecaff Walter R	Hill's City Directory
1959	Vacant	Hill's City Directory
1953	Stallings Ulysses E	Hill's City Directory
1949	Hutchins Guy S res	Hill's City Directory
1944	Wilson Augustus II	Hill's City Directory
1937	Wilson Augustus H	Hill's City Directory

FINDINGS

1227 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Apartments	Hill's City Directory
	Cannon Eunice Mrs	Hill's City Directory
	Vaughn Annie M Mrs nurse	Hill's City Directory
	Vacant	Hill's City Directory
	Tiffany Russell	Hill's City Directory
	Street continued	Hill's City Directory
1959	Vaughn Annie M Mrs FR	Hill's City Directory
	Bolinger Guy	Hill's City Directory
	Vacant	Hill's City Directory
	Street continued	Hill's City Directory
	Apartments	Hill's City Directory
	Vacant	Hill's City Directory
1953	Street continued	Hill's City Directory
	Apartments	Hill's City Directory
	Reece Ernest V	Hill's City Directory
	Carter Charlie E	Hill's City Directory
	Calebro Mary B Mrs	Hill's City Directory
	Vaughan Annie N Mrs baby sitter	Hill's City Directory
1949	Apartments	Hill's City Directory
	Honeycutt Jas F	Hill's City Directory
	Anderson Mirtie A Mrs	Hill's City Directory
	Sanford Chas F	Hill's City Directory
	Dodson Nancy A Mrs	Hill's City Directory
	Street continued	Hill's City Directory
1944	Apartments	Hill's City Directory
	Wilson J Calvin	Hill's City Directory
	Mc Call Lloyd C	Hill's City Directory
	Barkley Jas A	Hill's City Directory
	Barker J A	Hill's City Directory
	Street continued	Hill's City Directory
1937	Apartments	Hill's City Directory
	Ross Walter D	Hill's City Directory
	Williams Jennie J Mrs	Hill's City Directory
	Weddine Irene Mrs	Hill's City Directory
	Keevar Danl W	Hill's City Directory
	Street continued	Hill's City Directory

FINDINGS

1230 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Rountree A C Co ins adj	Hill's City Directory
1959	Waller Guy E res Fr	Hill's City Directory
1953	Waller Guy E res	Hill's City Directory
1949	Cram Maynard U	Hill's City Directory
1944	reid Mary J Mrs res	Hill's City Directory
1937	Reid Clarence Y	Hill's City Directory

1231 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Vacant	Hill's City Directory
1959	Vacant	Hill's City Directory
1953	Hoover Daisy C Mrs	Hill's City Directory
1949	Vacant	Hill's City Directory
1944	Richardson Harry E	Hill's City Directory
1937	Moore John C	Hill's City Directory

1232 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Vacant	Hill's City Directory
1959	Vacant	Hill's City Directory
1953	Oakley Charlotte Mrs	Hill's City Directory

1234 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Alford Roy N	Hill's City Directory
1959	Carithers Eme H res ED	Hill's City Directory
1953	Carithers Eme H res	Hill's City Directory
1949	reese Sallie E Mrs res	Hill's City Directory
1944	Reese Sallie M Mrs	Hill's City Directory
1937	Smith Wm M	Hill's City Directory

1235 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Baker Goldie I Mrs res	Hill's City Directory
1959	Baker Henry L ED	Hill's City Directory
1953	Baker Harry L	Hill's City Directory
1949	Baker Harry L	Hill's City Directory
1944	Baker Harry L	Hill's City Directory
1937	Claiborne Minnie Mrs	Hill's City Directory

FINDINGS

1236 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Houston Jas W res	Hill's City Directory
1959	Houston Jas W res ED	Hill's City Directory
1953	Houston Jas W res	Hill's City Directory
1949	Houston Jas W res	Hill's City Directory
	Porter Robt M	Hill's City Directory
1944	Houston Jas W res	Hill's City Directory
	Porter Robt M	Hill's City Directory
1937	Houston J Walter	Hill's City Directory

1239 E 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Miller D Moore res	Hill's City Directory
1959	Miller D Moore res ED	Hill's City Directory
1953	Miller D Moore	Hill's City Directory
1949	Miller D Moore res	Hill's City Directory
1944	Miller D Moore	Hill's City Directory
1937	Hoyle Robt D	Hill's City Directory

E TRADE ST

1000 E TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1989	Jones Hewson & Woolard lwyrs	R. L. Polk & Co.
1984	Jones Hewson & Woolard lwyrs	R. L. Polk & Co.
1979	Jones Hewson & Woolard lwyrs	Hill's City Directory
1974	Jones Hewson & Woolard lwyrs	Hill's City Directory
1969	JONES HEWSON & WOOLARO LWYRS	Hill's City Directory
1964	Craig Edw	Hill's City Directory
1959	Craig Edw	Hill's City Directory
1953	Mullis Bertha M Mrs	Hill's City Directory
1949	Vacant	Hill's City Directory
1944	Moore Martin H	Hill's City Directory
1937	Barkley Claude C	Hill's City Directory

1001 E TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1944	Pierce H Alice Mrs	Hill's City Directory

FINDINGS

1006 E TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Transients	Hill's City Directory
1959	Phifer Thos FR	Hill's City Directory
1953	Malphurs Mary JMrs	Hill's City Directory
1949	Proctor Jas P res	Hill's City Directory
1944	Ingram Iva Mrs	Hill's City Directory
	Ford Wm B	Hill's City Directory
1937	Lawhorn Drane	Hill's City Directory

1008 E TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Coleman Jethro Mrs	Hill's City Directory
1959	Mc Mullen Julius FR	Hill's City Directory
1953	Vacant	Hill's City Directory
1949	Baker Ella R Mrs	Hill's City Directory
1944	Cain Ernest E	Hill's City Directory
1937	Byers Le Roy	Hill's City Directory

1009 E TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1984	Vacant	R. L. Polk & Co.
1979	Downs Kenneth R lwyr	Hill's City Directory

1010 E TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Rogers Louise	Hill's City Directory
1959	Burke Chester FR	Hill's City Directory
1953	Minor Alex D	Hill's City Directory
1949	Minor Alex D	Hill's City Directory
1944	Minor Alex D	Hill's City Directory

1012 E TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Whitmore Willie P Mrs	Hill's City Directory
1959	Howie Robt L ED	Hill's City Directory
1953	Austin S Garland	Hill's City Directory
1949	Penegar L May	Hill's City Directory
1944	Penegar Bessie A Mrs	Hill's City Directory
1937	Lowery Leon	Hill's City Directory

FINDINGS

1014 E TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1989	Kusester Companies The Overflow	R. L. Polk & Co.
1984	Fairley Hamrick Monteith & Cobb Iwys	R. L. Polk & Co.
1979	Fairley Hamrick Monteith & Cobb	Hill's City Directory
1974	Grier Parker Poe Thompson Bernstein Gage & Preston Iwys	Hill's City Directory
1969	GRIER PARKER POE THOMPSON BERNSTEIN GAGE & PRESTON LWYRS	Hill's City Directory
1964	Bridges Wm	Hill's City Directory
1959	Bridges John	Hill's City Directory
1953	Vacant	Hill's City Directory
1949	Smith Blanche E nurse	Hill's City Directory
1944	Mecklin Stella Mrs	Hill's City Directory
1937	Fisher J Wm	Hill's City Directory

1018 E TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Gilliam Willie A	Hill's City Directory
1959	Vacant	Hill's City Directory
1953	Rape Arth D	Hill's City Directory
1949	Ressel Saml J	Hill's City Directory
1944	Ressel Saml J	Hill's City Directory
1937	Barefoot Miles M	Hill's City Directory

1020 E TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1989	Council On Health Costs Inc	R. L. Polk & Co.
1964	Brown Maeola Mrs	Hill's City Directory
1959	Vacant	Hill's City Directory
1953	Austin WMarvin	Hill's City Directory
1949	Austin W Marvin	Hill's City Directory
1944	Austin W Marvin	Hill's City Directory

1021 E TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1953	Char Hudson Co Inc rear	Hill's City Directory

1024 E TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Beach begins	Hill's City Directory

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Morrow intersects	Hill's City Directory
	Stevenson Will	Hill's City Directory
1959	Beach begins	Hill's City Directory
	Stevenson Will ED	Hill's City Directory
	Morrow intersects	Hill's City Directory
1953	Spaulding Euell D	Hill's City Directory
	Morrow intersects	Hill's City Directory
	Beach begins	Hill's City Directory
1949	Beach begins	Hill's City Directory
	Morrow intersects	Hill's City Directory
	Cofer Everott	Hill's City Directory
1944	Morrow intersects	Hill's City Directory
	Cofer Everett	Hill's City Directory
	Beach begins	Hill's City Directory
1937	Hovis Lloyd T	Hill's City Directory

1026 E TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1937	Vacant	Hill's City Directory

1101 E TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Electrical Distrs Inc	Hill's City Directory
1959	Electrical Distrs Inc ED	Hill's City Directory
1953	Sou Piping & Eng Co Inc	Hill's City Directory
1949	Storkline Dy dee Wash	Hill's City Directory

1105 E TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	E 4th intersects	Hill's City Directory
	Daughtry Sht Mtl Co	Hill's City Directory
1959	E 4th intersects	Hill's City Directory
	Daughtry Sht Mtl Co ED	Hill's City Directory
1953	E 4th intersects	Hill's City Directory
	Daughtry Sht Mtl Co	Hill's City Directory
1949	E 4th intersects	Hill's City Directory
	Daughtry Sheet Metal Co	Hill's City Directory

FINDINGS

1109 E TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1944	Daughtry Sheet Metal Co	Hill's City Directory
	E 4th intersects	Hill's City Directory
1937	Daughtry Sheet Meta I Co	Hill's City Directory

IRWIN AVE

108 IRWIN AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1959	Polk Jane A Mrs res ED	Hill's City Directory
1953	Allison Nell L Mrs res	Hill's City Directory
1949	Allison Neil L Mrs res	Hill's City Directory
	Nell L Mrs res	Hill's City Directory
1944	Allison Nell L Mrs res	Hill's City Directory
1937	Allison Nell L Mrs	Hill's City Directory
1931	2 Squire J C	Piedmont Directory Company

109 IRWIN AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1959	Warwick Ronald	Hill's City Directory
	1/2 Vacant	Hill's City Directory
	Contd	Hill's City Directory
	IRWIN AV Contd	Hill's City Directory
	Vacant	Hill's City Directory
	Vacant	Hill's City Directory
	Smith Roy K	Hill's City Directory
	Vacant	Hill's City Directory
	Apartments	Hill's City Directory
	bsmt Vacant	Hill's City Directory
	Goode Esther Mrs	Hill's City Directory
	Vacant	Hill's City Directory
	Nolan Wm R	Hill's City Directory
1953	1/2 West Donald L	Hill's City Directory
	Hart Evelyn	Hill's City Directory
1949	1/2 Krolik Robt	Hill's City Directory
	Dillashaw Wm J	Hill's City Directory
1944	1/2 Chayka Anthony	Hill's City Directory
	Woods Roy W	Hill's City Directory
	ALee Cath T Mrs res	Hill's City Directory

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1937	Lee Cath T Mrs	Hill's City Directory

110 IRWIN AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1959	Walsh Wm A ED	Hill's City Directory
1953	Hatley Timothy	Hill's City Directory
1949	Turbyfill Elma R	Hill's City Directory
1944	Turbyfill Elam R	Hill's City Directory
1937	Babb S Pryor	Hill's City Directory
1931	4 Atwell H S	Piedmont Directory Company

112 IRWIN AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1959	Privette Alice J Mrs res ED	Hill's City Directory
1953	Privette Henry L res	Hill's City Directory
1949	Privette Henry L res	Hill's City Directory
1944	Privette Henry Lres	Hill's City Directory
1937	Privette Henry L	Hill's City Directory
1931	8 Sharpe T E	Piedmont Directory Company

115 IRWIN AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1959	Tartce Martha I Mrs ED	Hill's City Directory
1953	Griffith Alice M nurse	Hill's City Directory
	Washam Potts A	Hill's City Directory
1949	Washam Potts A	Hill's City Directory
1944	Washam Potta A	Hill's City Directory
1937	Washam Potts A	Hill's City Directory

116 IRWIN AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1959	Acorn Snack Shop The conly ED	Hill's City Directory

119 IRWIN AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1959	Davis Jas T FR	Hill's City Directory
1953	Maultsby Frank S	Hill's City Directory
1949	Tolbert Ruth Mrs	Hill's City Directory
1944	Arnall Melvin L	Hill's City Directory
	Rainwater David B	Hill's City Directory

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1944	Cobb Edw	Hill's City Directory
1937	Brickhouse Nettie M Mrs	Hill's City Directory
1931	3 Davis C L	Piedmont Directory Company

122 IRWIN AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1959	Street continued	Hill's City Directory
	Stokes Robt L	Hill's City Directory
	Vacant	Hill's City Directory
	Flowers Ann M ED	Hill's City Directory
	Gallant Ruby B Mrs FR 6 G	Hill's City Directory
	Apartments	Hill's City Directory
1953	Street continued	Hill's City Directory
	Apartments	Hill's City Directory
	Burns Peter F	Hill's City Directory
	Pender Shaw E	Hill's City Directory
	Harper John C	Hill's City Directory
	Eudy Jay T	Hill's City Directory
	1949	Apartments
Harper J Clifton		Hill's City Directory
Pender Shaw E		Hill's City Directory
Holland Max W		Hill's City Directory
Eudy Jay T		Hill's City Directory
Street continued		Hill's City Directory
1944	Mac Kinnon Wm F	Hill's City Directory
	Harper J Clifton	Hill's City Directory
	Apartments	Hill's City Directory
	Joy A Withrow	Hill's City Directory
1937	street continued	Hill's City Directory
	Little Harold D	Hill's City Directory
	Joy A Withrow	Hill's City Directory
	IRWIN AV Contd	Hill's City Directory
	Hayes John E	Hill's City Directory
	Apartments	Hill's City Directory
1931	Fifth intersects	Piedmont Directory Company
	5 Redfern A D Mrs	Piedmont Directory Company
	118 4 Vacant	Piedmont Directory Company
	116 3 Little H D	Piedmont Directory Company
	120 2 Setzler E B	Piedmont Directory Company

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	114 1 Piland C A	Piedmont Directory Company
	114 120 Apartments	Piedmont Directory Company

125 IRWIN AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1959	Morris Ila W Mrs res	Hill's City Directory
	W 5th intersects	Hill's City Directory
1953	W 5th intersects	Hill's City Directory
	Morris Mark W res	Hill's City Directory
1949	W 5th intersects	Hill's City Directory
	Morris Mark N res	Hill's City Directory
1944	W 5th intersects	Hill's City Directory
	Morris Mark N res	Hill's City Directory
1937	Redfern Annie D Mrs	Hill's City Directory

151 IRWIN AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1 Steadham L E	Piedmont Directory Company

201 IRWIN AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1959	Ratchford Jas E Rev ED	Hill's City Directory
1953	Waters G Dana Rev	Hill's City Directory
1949	Rolston Holmes Rev	Hill's City Directory
1944	Rolston Holmes Rev	Hill's City Directory
1937	Akers Wm W Rev	Hill's City Directory
1931	Anthony H J	Piedmont Directory Company
1925	Anthony J T Col	Commercial Service Co.
1921	Anthony J T	Commercial Service Co.

N IRWIN AVE

108 N IRWIN AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1974	Bell Henry J	Hill's City Directory
1969	BELL HENRY J	Hill's City Directory
1964	Polk Jane A Mrs res	Hill's City Directory

FINDINGS

109 N IRWIN AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	1/2 Perkins Dolph	Hill's City Directory
	Whitworth Bobbie B	Hill's City Directory

110 N IRWIN AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1974	Ivey Annie C Mrs	Hill's City Directory
1969	IVEY ANNIE C MRS	Hill's City Directory
1964	Walsh Wm	Hill's City Directory

112 N IRWIN AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1999	Alexander Ins Co	City Publishing Company Inc.
	Alexander Funeral Hm	City Publishing Company Inc.
	Alexander Limousine Service	City Publishing Company Inc.
1989	National Assn For Advancement Colored People	R. L. Polk & Co.
	Alexander Mutual Burial Assn Inc	R. L. Polk & Co.
	Alexander Funeral Home Inc	R. L. Polk & Co.
1984	Alexander Mutual Burial Assan Inc	R. L. Polk & Co.
	National Assn For Advancement Colored People	R. L. Polk & Co.
	Alexander Funeral Home Inc	R. L. Polk & Co.
1979	Alexander Funeral Home Inc	Hill's City Directory
	Alexander Mutual Burial Assn Inc	Hill's City Directory
1974	Alexander Mutual Burial Assn Inc	Hill's City Directory
	Alexander Funeral Home Inc	Hill's City Directory
1969	ALEXANDER MUTUAL BURIAL ASSN INC	Hill's City Directory
	ALEXANDER FUNERAL HOME INC	Hill's City Directory
1964	Alexander Funeral Home Inc	Hill's City Directory
	Alexander Mut ural Assn Inc	Hill's City Directory
	N C State Conference of Brs NAACP	Hill's City Directory

115 N IRWIN AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1979	Vacant	Hill's City Directory
1974	Reid Mattie L	Hill's City Directory
1969	WILLIAMS FURNISHED ROOMS WILLIAMS JOE	Hill's City Directory
1964	Merchant Suddath L	Hill's City Directory

FINDINGS

116 N IRWIN AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1979	Vacant	Hill's City Directory
1974	Vacant	Hill's City Directory
1969	VACANT	Hill's City Directory
1964	Vacant	Hill's City Directory

119 N IRWIN AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Bynum Sol	Hill's City Directory

122 N IRWIN AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1989	Glenn James	R. L. Polk & Co.
	Harris Jas	R. L. Polk & Co.
	Hayes Robt	R. L. Polk & Co.
	Vacant	R. L. Polk & Co.
1984	Apartments	R. L. Polk & Co.
	Glenn James	R. L. Polk & Co.
	Mackey Franklin	R. L. Polk & Co.
	Hayes Robt	R. L. Polk & Co.
1979	Logan Luvenia	R. L. Polk & Co.
	Apartments	R. L. Polk & Co.
	Glenn Charles	Hill's City Directory
	Mc Donald Clayton	Hill's City Directory
1974	Jennings Billie L Mrs	Hill's City Directory
	Logan Luvenia	Hill's City Directory
	Apartments	Hill's City Directory
	Jennings Billie L Mrs	Hill's City Directory
1969	Hammonds Sammie L Mrs	Hill's City Directory
	Apartments	Hill's City Directory
	Hill Louise Mrs	Hill's City Directory
	Bratton Florence	Hill's City Directory
1964	HILL LOUISE MRS	Hill's City Directory
	BRATTON FLORENCE	Hill's City Directory
	JENNINGS BILLIE W MRS	Hill's City Directory
	HAMMONS SAMMIE L MRS	Hill's City Directory
1964	APARTMENTS	Hill's City Directory
	Street continued	Hill's City Directory
	Bracken Florence	Hill's City Directory

FINDINGS

125 N IRWIN AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2005	Minority Business Dev Ctr	Hill-Donnelly Information Services
	Minority Resource Contr Ctr	Hill-Donnelly Information Services
	Mark Technical Svc	Hill-Donnelly Information Services
1999	Big Beans Meat Market & Grocery	City Publishing Company Inc.
1989	5TH ST INTERSECTS	R. L. Polk & Co.
	Big Ben Meat & Grocery	R. L. Polk & Co.
1984	5TH ST INTERSECTS	R. L. Polk & Co.
	Big Ben Meat Market	R. L. Polk & Co.
1979	5TH ST INTERSECTS	Hill's City Directory
	Lunsford Grocery	Hill's City Directory
1974	5TH ST INTERSECTS	Hill's City Directory
	Lunsford Grocery	Hill's City Directory
1969	5TH ST INTERSECTS	Hill's City Directory
	LUNSFORD GROCERY	Hill's City Directory
1964	No Return	Hill's City Directory
	W 5th intersects	Hill's City Directory

201 N IRWIN AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1969	GOVAN FREIDA MRS	Hill's City Directory
1964	Edwards Leonard	Hill's City Directory
	a Coleman Toy	Hill's City Directory

N SYCAMORE ST

106 N SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1959	Mc Call Walter C	Hill's City Directory
1953	Greene Zeb	Hill's City Directory
1949	Bowen Norman H	Hill's City Directory
1944	Galdwell Jas A	Hill's City Directory
1937	Solomon Jas O	Hill's City Directory

107 N SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1984	Vacant	R. L. Polk & Co.
1979	Thompson Marion	Hill's City Directory
1974	Thompson M	Hill's City Directory

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1969	THOMPSON MARION	Hill's City Directory
1964	Mar Jo Beauty Salon ridley Nell C Mrs res	Hill's City Directory
1959	Sycamore House The furn rms ED	Hill's City Directory
	Ridley Nell C Mrs beauty shop ED	Hill's City Directory
1953	Thomason Ruby Mrs	Hill's City Directory
1949	Cole Wm H	Hill's City Directory
1944	Gay Wm A	Hill's City Directory
1937	Gerber John H	Hill's City Directory

109 N SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1984	Rear Vacant	R. L. Polk & Co.
	Vacant	R. L. Polk & Co.
1979	Rear Vacant	Hill's City Directory
	Anthony Aizle	Hill's City Directory
1974	Williams Mary E Mrs	Hill's City Directory
	Rear Vacant	Hill's City Directory
1969	REAR VACANT	Hill's City Directory
	WILLIAMS MARY E MRS	Hill's City Directory
1964	Puckett Ralph M	Hill's City Directory
	Huffman Martha F Mrs	Hill's City Directory
1953	Davis Ellis R	Hill's City Directory
1949	ridley Nell C Mrs res	Hill's City Directory
1944	Ridley Nell Mrs	Hill's City Directory
1937	Jenkins Vivian B nurse	Hill's City Directory
	Martin Fred H	Hill's City Directory

111 N SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1984	Vacant	R. L. Polk & Co.
1979	No Return	Hill's City Directory
1974	Jackson Ruby	Hill's City Directory
1969	MOORE JAMES	Hill's City Directory
1964	Lampkin Willie J	Hill's City Directory
1959	Braswell Jas W FR	Hill's City Directory
1953	Riley Wm E	Hill's City Directory
1949	Hemby W Clyde res	Hill's City Directory
1944	Thompson Hazel I	Hill's City Directory
1937	Basinger Richd G	Hill's City Directory

FINDINGS

112 N SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1984	Vacant	R. L. Polk & Co.
	1/2 Vacant	R. L. Polk & Co.
1979	1/2 Vacant	Hill's City Directory
	Vacant	Hill's City Directory
1974	1/2 new Benny Ernest	Hill's City Directory
	new Hall Bailey	Hill's City Directory
1969	MILLER AMELIA V	Hill's City Directory
	1/2 BENNY ELWOOD	Hill's City Directory
1964	Burt James	Hill's City Directory
1959	Cathey Sinclair M ED	Hill's City Directory
	1/2 Latham M Otis FR	Hill's City Directory
1953	1/2 Latham M Otis	Hill's City Directory
	Cathey Sinclair M	Hill's City Directory
1949	Bell W Franklin	Hill's City Directory
	1/2 Byrd Clarence T	Hill's City Directory
1944	Bell W Frank	Hill's City Directory
	1/2 Vacant	Hill's City Directory
1937	Watterson Chas K	Hill's City Directory
	1/2 Faulconer Jos F	Hill's City Directory

113 N SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1984	Vacant	R. L. Polk & Co.
1979	Jackson Reesa Mrs	Hill's City Directory
1974	Jackson Ressa Mrs	Hill's City Directory
1969	JACKSON REESA MRS	Hill's City Directory
1964	Thomas Susie R Mrs	Hill's City Directory
1959	Elliott J Flynn res ED	Hill's City Directory
1953	Elliott J Flynn res	Hill's City Directory
1949	Mcrae John A jr res	Hill's City Directory
1944	Mc Gloughlin Wm M	Hill's City Directory
1937	Wray Howard F	Hill's City Directory

115 N SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1984	Vacant	R. L. Polk & Co.
1979	rivers Leroy res	Hill's City Directory
1974	Williams Annie M Mrs res	Hill's City Directory

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1969	WILLIAMS ANNIE M res	Hill's City Directory
1964	Beatty Rosa M Mrs	Hill's City Directory
1959	Kleckley Alvin L res ED	Hill's City Directory
1953	Kleckley Alvin L res	Hill's City Directory
1949	Kleckley Albert L res	Hill's City Directory
1944	Kleckley Albert L res	Hill's City Directory
1937	Kleckley Alvin L	Hill's City Directory

118 N SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1974	Sterling Saml	Hill's City Directory
1969	STERLING SAML	Hill's City Directory
1964	Johnson Eddie	Hill's City Directory
1959	Thompson Hazel Q FR	Hill's City Directory
1953	Thompson Hazel Q	Hill's City Directory
1949	Thompson Hazel Q	Hill's City Directory
	Thompson Margt G Mrs res	Hill's City Directory
1944	Thompson Wm M res	Hill's City Directory
1937	Tompson Wm M	Hill's City Directory

119 N SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1984	Fuller Richd	R. L. Polk & Co.
1979	Fuller	Hill's City Directory
1974	Taylor Johnny J	Hill's City Directory
1969	TAYLOR JOHNNY J	Hill's City Directory
1964	Payne Chas jr	Hill's City Directory
1959	Kistler Sallie H Mrs ED	Hill's City Directory
1953	Kistler Sallie Mrs	Hill's City Directory
1949	Edwards Durant C	Hill's City Directory
	Kistler Sallie Mrs	Hill's City Directory
1944	Kistler Sallie B Mrs	Hill's City Directory
	Edwards Ducant C	Hill's City Directory
1937	Kistler Sallie B Mrs	Hill's City Directory

120 N SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1984	Vacant	R. L. Polk & Co.
1979	Vacant	Hill's City Directory

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1974	White Sally	Hill's City Directory
1969	MC OONALDSON SAMELLA MRS	Hill's City Directory
1964	Merritt Vonnie K Mrs	Hill's City Directory
1959	Fullerton Eug E ED	Hill's City Directory
1953	Glasscock Howard R Fullerton Edw E	Hill's City Directory
1949	Marlowe Boyce S	Hill's City Directory
1944	Marlowe Boyce S	Hill's City Directory

121 N SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1984	Byrum Maggie	R. L. Polk & Co.
1979	Bydum Maggie	Hill's City Directory
1974	Williamson Lucy J	Hill's City Directory
1969	WILLIAMSON LUCY	Hill's City Directory
1964	De Minds Clarence	Hill's City Directory
1959	Kelley Chas W ED	Hill's City Directory
1953	Ellis John W	Hill's City Directory
1949	Ellis John W	Hill's City Directory
1944	Eills John W	Hill's City Directory
1937	Knox Wm E	Hill's City Directory

122 N SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2005	Merchant Jean B	Hill-Donnelly Information Services
	Underwood C B	Hill-Donnelly Information Services
1984	new Jones Michl	R. L. Polk & Co.
1979	Vacant	Hill's City Directory
1974	Black Marie	Hill's City Directory
1969	BING ELOISE MRS	Hill's City Directory
1964	Bing Tony	Hill's City Directory
1959	Elliott Odus E FR	Hill's City Directory
	W 5th intersects	Hill's City Directory
1953	Kollar Ernest	Hill's City Directory
	W 5th intersects	Hill's City Directory
1949	Glasscock Howard R	Hill's City Directory
	W 5th intersects	Hill's City Directory
1944	Glasscock Howard It	Hill's City Directory
1937	Glasscock Howard R	Hill's City Directory

FINDINGS

125 N SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2005	Combs Mable	Hill-Donnelly Information Services

127 N SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1984	Apartments	R. L. Polk & Co.
	Cowan Mitchell	R. L. Polk & Co.
	Reid Odessa	R. L. Polk & Co.
	Herndon Arth L	R. L. Polk & Co.
	Hyde Mitchell	R. L. Polk & Co.
	new Mc Nair Henry	R. L. Polk & Co.
1979	Apartments	Hill's City Directory
	new Evans Larry	Hill's City Directory
	new Reid Odesa	Hill's City Directory
	Herndon Arth L	Hill's City Directory
	Baker Santee	Hill's City Directory
	new Belk Patricia	Hill's City Directory
1974	Apartments A Cowan Mitchell M Mrs	Hill's City Directory
	B Mc Corkle Willth	Hill's City Directory
	C Vacant D Baker S	Hill's City Directory
	E Mc Clinton John	Hill's City Directory
1969	APARTMENTS A COWAN MITCHELL M	Hill's City Directory
	B MOORE ROBT C AUSTIN RUBY C MRS	Hill's City Directory
	D BAKER SANTEE	Hill's City Directory
	E HC CLINTON JOHN	Hill's City Directory
1964	Apartments	Hill's City Directory
	A Hyde Mitchell M Mrs	Hill's City Directory
	B Martin Frances C Austin Calvin jr	Hill's City Directory
	D Seegers Farmer	Hill's City Directory
	E Witherspoon Wm	Hill's City Directory

129 N SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1984	Apartments	R. L. Polk & Co.
	A Benjamin Patricia B Dunn Annie Mrs	R. L. Polk & Co.
	C Clyburn Mary L	R. L. Polk & Co.
	D Coleman Gertrude W	R. L. Polk & Co.
	E Evans Johnny F Bell Johnny W	R. L. Polk & Co.

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1979	Apartments	Hill's City Directory
	A new Chisholm Sam	Hill's City Directory
	B Dunn Annie Mrs	Hill's City Directory
	C Ervin John G	Hill's City Directory
	D new Coleman Gertrude W	Hill's City Directory
	E Evans Johnny F Bell Johnny W	Hill's City Directory
1974	Stadford Martha	Hill's City Directory
	Apartments	Hill's City Directory
	A Chisholm Sam B Dunn Annie Mrs	Hill's City Directory
	C Sturdivant Cecil G	Hill's City Directory
	D Stadford Louise	Hill's City Directory
	E new Witherspoon Vina	Hill's City Directory
	F No Return	Hill's City Directory
1969	APARTMENTS	Hill's City Directory
	A CHISHOLM SAM B DUNN HENRY	Hill's City Directory
	C WILMORE ROBT J	Hill's City Directory
	D WEAVER FARRELL	Hill's City Directory
	SYCAMORE ST N Contd	Hill's City Directory
	Apts Contd	Hill's City Directory
	F LEACH MARY MRS	Hill's City Directory
1964	Apartments	Hill's City Directory
	D No Return E Sowell Nathi jr	Hill's City Directory
	A Chisholm Sam	Hill's City Directory
	B Dunn Henry	Hill's City Directory
	C Mc Kinney Willie	Hill's City Directory
	F Patton Wm	Hill's City Directory

131 N SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2005	Jla Svc	Hill-Donnelly Information Services
1984	Apartments	R. L. Polk & Co.
	A Grier Phyllis B Ford Sammie L	R. L. Polk & Co.
	C Mc Kinney Ementras W	R. L. Polk & Co.
	D Brown Fannie F Mrs	R. L. Polk & Co.
	E Collins Christine	R. L. Polk & Co.
	5TH ST INTERSECTS	R. L. Polk & Co.
1979	5TH ST INTERSECTS	Hill's City Directory
	Apartments	Hill's City Directory
	A Vacant B Ford Sammie L	Hill's City Directory

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1979	C Mc Kinney Ementras W	Hill's City Directory
	D Brown Fannie F Mrs	Hill's City Directory
	E No Return	Hill's City Directory
1974	Apartments	Hill's City Directory
	N SYCAMORE ST Contd	Hill's City Directory
	B Ford Sammie L	Hill's City Directory
	C Mc Crimmon W D Brown Fannie F Mrs	Hill's City Directory
1969	5TH ST INTERSECTS	Hill's City Directory
	APARTMENTS A PHARR JOHNNIE M MRS	Hill's City Directory
	B FORD SAML L	Hill's City Directory
	C LONG LEROY D BROWN FANNIE MRS	Hill's City Directory
1964	5TH ST INTERSECTS	Hill's City Directory
	Apartments	Hill's City Directory
	A C No Return	Hill's City Directory
	B Melton Mildred D Caraway James F	Hill's City Directory
	E Patterson John H	Hill's City Directory
	W 5th intersects	Hill's City Directory

205 N SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Cochrane Margt E Mrs res	Hill's City Directory
1959	Cochrane Margt E Mrs res Fr	Hill's City Directory
1953	Clanton J Newton	Hill's City Directory
1949	Clanton J Newton	Hill's City Directory
1944	clanton J Newton	Hill's City Directory
1937	Clanton Jasper N	Hill's City Directory

207 N SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1984	a Hemlin Stewart	R. L. Polk & Co.
	b new Hunter Phyllis J	R. L. Polk & Co.
1979	a Hemlin Stewart	Hill's City Directory
	b Whitaker Moses C	Hill's City Directory
1974	Whitaker Moses C	Hill's City Directory
1969	KENNEDY ANNA C MRS	Hill's City Directory
1964	Birmingham Voidia S Mrs res	Hill's City Directory
	Mathis Fredk R	Hill's City Directory
1959	Birmingham Viola S Mrs res ED	Hill's City Directory

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1959	Lowe Opal M ED	Hill's City Directory
	Somers Rosa L FR	Hill's City Directory
1953	Birmingham Boida Mrs res	Hill's City Directory
1949	Birmingham Voida S Mrs res	Hill's City Directory
	Miller Jas W	Hill's City Directory
1944	Miller Jas W	Hill's City Directory
	Miller Maude H Mrs nurse	Hill's City Directory
	Myers Relta Mrs	Hill's City Directory
	Birmingham Voida S Mrs res	Hill's City Directory
1937	Birmingham Voida Mrs	Hill's City Directory

208 N SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1969	VACANT	Hill's City Directory
1964	Suther Cath Mrs	Hill's City Directory
1959	Brown John M	Hill's City Directory
1953	Huffman Jas	Hill's City Directory
1949	Morrison Carl C	Hill's City Directory
1944	Green Wm II	Hill's City Directory
1937	Day Jas C	Hill's City Directory

210 N SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1969	VACANT	Hill's City Directory
1964	Mc Cullough Joe D res	Hill's City Directory
1959	Paschal Fred C res Fr	Hill's City Directory
1953	Paschal Fred C res	Hill's City Directory
1949	Paschal Fred C res	Hill's City Directory
1944	Paschal Fred C res	Hill's City Directory
1937	Drewes Fred H	Hill's City Directory

211 N SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1989	Vacant	R. L. Polk & Co.
	5TH ST INTERSECTS	R. L. Polk & Co.
1984	Littlejohn Larry	R. L. Polk & Co.
1979	Littlejohn Laura C Mrs res	Hill's City Directory
1974	Littlejohnm Laura C Mrs res	Hill's City Directory
1969	LITTLEJOHN LAURA C MRS res	Hill's City Directory

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Blake Clinton L res	Hill's City Directory
1959	Booker Belle r Mrs res ED	Hill's City Directory
1953	Booker Belle r Mrs res	Hill's City Directory
1949	Booker Jas C res	Hill's City Directory
1944	Booker Jas C res	Hill's City Directory
1937	Booker Jas C	Hill's City Directory

212 N SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1949	W 6th intersects	Hill's City Directory
	Godfrey Jessie Mrs res	Hill's City Directory

221 N SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1959	W 6th intersects	Hill's City Directory
	Godfrey Jessie C Mrs res ED	Hill's City Directory
1953	W 6th intersects	Hill's City Directory
	Godfrey Jessie C Mrs res	Hill's City Directory
1944	Godfrey Saml	Hill's City Directory
1937	Harrison Wm R bldg contr	Hill's City Directory

S IRWIN AVE

108 S IRWIN AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1974	Westbrooks Willie	Hill's City Directory
1969	WESTBROOKS WILLIE	Hill's City Directory
1964	Westbrook Willie	Hill's City Directory

111 S IRWIN AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1974	Vacant	Hill's City Directory
1969	ERWIN ROBT L	Hill's City Directory
1964	Robinson Macabe B	Hill's City Directory

112 S IRWIN AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1974	Bell & King lwyr	Hill's City Directory
	Bell Peter H lwyr	Hill's City Directory
1969	BELL CHARLES V LWYR	Hill's City Directory

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1969	BELL PETER H LWYR	Hill's City Directory
1964	Bell Chas Vlwy	Hill's City Directory

115 S IRWIN AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1974	4TH ST INTERSECTS	Hill's City Directory
	Hall Percy res	Hill's City Directory
1969	HALL PERCY res	Hill's City Directory
1964	Hall Percy res	Hill's City Directory

119 S IRWIN AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1969	4TH ST INTERSECTS	Hill's City Directory
	JONES WILLIE L JUNK DLR	Hill's City Directory
1964	Vacant	Hill's City Directory
	W 4th intersects	Hill's City Directory

127 S IRWIN AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1974	Jarrett Christine	Hill's City Directory
1969	SMITH DAVID L	Hill's City Directory
1964	Ross Etta Mrs	Hill's City Directory

129 S IRWIN AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1979	Vacant	Hill's City Directory
1969	RICHE MARVIN	Hill's City Directory
1964	Vacant	Hill's City Directory

131 S IRWIN AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1979	Vacant	Hill's City Directory
1974	Brannon Willie J	Hill's City Directory
1969	PAIGE GEO	Hill's City Directory
1964	IRWIN AV S Contd	Hill's City Directory
	Crawford Earl	Hill's City Directory

137 S IRWIN AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1994	Not Verified	R. L. Polk & Co.

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1994	WOODLAWN TERRACE APARTMENTS N	R. L. Polk & Co.
	Vacant	R. L. Polk & Co.
1989	Woodlawn Terrace Apartments	R. L. Polk & Co.
	new Roach nann	R. L. Polk & Co.
	Moore Etheline B	R. L. Polk & Co.
	Mc Ilwain Mary	R. L. Polk & Co.
	Dant Joseph A	R. L. Polk & Co.
1984	Woodlawn Terrace Apartments	R. L. Polk & Co.
1979	Woodlawn Terrace Apartments	Hill's City Directory
	Johnson Harvey	Hill's City Directory
	Williams Sammie	Hill's City Directory
	Singletree Fannie	Hill's City Directory
	Vacant	Hill's City Directory
1974	Woodlawn Terrace Apartments	Hill's City Directory
	Vacant	Hill's City Directory
	new Harris Beulah	Hill's City Directory
	Johnson L	Hill's City Directory
	new Williams Sammie	Hill's City Directory
1969	WOODLAWN TERRACE APARTMENTS	Hill's City Directory
	BARNES JAMES W	Hill's City Directory
	VACANT	Hill's City Directory
	BARNES ROSE L	Hill's City Directory
1964	Woodlawn Ter Apts	Hill's City Directory
	Hood Clarence	Hill's City Directory
	Witherspoon Isaac	Hill's City Directory
	Taylor John H	Hill's City Directory
	Lamb Carrie Mrs	Hill's City Directory
	Street continued	Hill's City Directory

143 S IRWIN AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1994	4TH ST INTERSECTS	R. L. Polk & Co.
	Alexander J L	R. L. Polk & Co.
1989	Alexander J L	R. L. Polk & Co.
	4TH ST INTERSECTS	R. L. Polk & Co.
1984	Moore Thos R	R. L. Polk & Co.
	new Behney	R. L. Polk & Co.
	4TH ST INTERSECTS	R. L. Polk & Co.

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1979	Vacant	Hill's City Directory
	4TH ST INTERSECTS	Hill's City Directory
1974	Vacant	Hill's City Directory
1969	LEWIS WM E	Hill's City Directory
	A HOLMES JOHN 375 a	Hill's City Directory
1964	Lewis Wm E	Hill's City Directory

200 S IRWIN AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1994	Vacant 3 Hses N	R. L. Polk & Co.
1989	Copeland Myrtle	R. L. Polk & Co.
1984	Hill Montess	R. L. Polk & Co.
1979	Hill Montess	Hill's City Directory
1974	Hill Montez	Hill's City Directory
1969	NO RETURN	Hill's City Directory
1964	Macon Richd A Rev	Hill's City Directory

201 S IRWIN AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1974	Belk Maggie	Hill's City Directory
1969	BELK MAGGIE G MRS	Hill's City Directory
1964	Parks John	Hill's City Directory
	Johnston Richd S	Hill's City Directory

202 S IRWIN AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1989	Vacant	R. L. Polk & Co.
1984	Vacant	R. L. Polk & Co.
1979	Smith Stella	Hill's City Directory
1974	Vacant	Hill's City Directory
1969	BRISOM JAMES S	Hill's City Directory
1964	Kirkpatrick James	Hill's City Directory

204 S IRWIN AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1989	No Return	R. L. Polk & Co.
1984	Johnson Betty	R. L. Polk & Co.
1979	Vacant	Hill's City Directory
1969	VACANT	Hill's City Directory
1964	Taylor John J	Hill's City Directory

FINDINGS

205 S IRWIN AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1999	Mc Entire W H Mrs	City Publishing Company Inc.
1994	Mc Entire Mary Louise A res	R. L. Polk & Co.
1989	Mc Entire Wm H res	R. L. Polk & Co.
1984	Mc Entire Wm H res	R. L. Polk & Co.
1979	Mc Entire Wm H res	Hill's City Directory
1974	Mc Entire Wm res	Hill's City Directory
1969	ALEXANDER MARY L	Hill's City Directory
1964	Houston Frank	Hill's City Directory

206 S IRWIN AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1994	Copeland Ophelia N	R. L. Polk & Co.
1989	Sanders Vashti Mrs	R. L. Polk & Co.
1979	Everette Leolz G	Hill's City Directory
1974	Vacant	Hill's City Directory
1969	LEWIS MARY P MRS	Hill's City Directory
1964	No Return	Hill's City Directory

208 S IRWIN AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1984	Sanders Vashti Mrs	R. L. Polk & Co.
1979	Vacant	Hill's City Directory
1974	Boyd Martha E Mrs	Hill's City Directory
1969	BOYD MARTHA E MRS	Hill's City Directory
1964	No Return	Hill's City Directory

209 S IRWIN AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1974	Vacant	Hill's City Directory
1969	MASSEY FLOODDIE MRS	Hill's City Directory
1964	Johnson Eliz	Hill's City Directory

210 S IRWIN AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1979	Sander Vashtie	Hill's City Directory
1974	new Graham Louetta A	Hill's City Directory
1969	JOHNSON JAMES U	Hill's City Directory
1964	Price Annie	Hill's City Directory

FINDINGS

215 S IRWIN AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1994	Crawford Jas	R. L. Polk & Co.
	Davis Julia C	R. L. Polk & Co.
	Greene Willie Jr	R. L. Polk & Co.
	Clark Hattie L res	R. L. Polk & Co.
1989	Clark Hattie L res	R. L. Polk & Co.
1984	Clark Hattie L res	R. L. Polk & Co.
1979	Clark Hattie L res	Hill's City Directory
1974	Clark Hattie L	Hill's City Directory
1969	NEAL ROBT L	Hill's City Directory
1964	No Return	Hill's City Directory

217 S IRWIN AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Blackmon Rayford	Hill's City Directory

221 S IRWIN AVE

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Allen Alf E res	Hill's City Directory
	Grove intersects	Hill's City Directory

S SYCAMORE ST

105 S SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2005	Multi Unit Address	Hill-Donnelly Information Services
	AUB v	Hill-Donnelly Information Services
	Betterton L vt	Hill-Donnelly Information Services
	Marsh Leola v	Hill-Donnelly Information Services
	Burris Mary Jayne t	Hill-Donnelly Information Services
	Harris Latnclia v	Hill-Donnelly Information Services
	Kearns Jason v	Hill-Donnelly Information Services
	Brophy Heather S v	Hill-Donnelly Information Services

108 S SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1979	Sheets Auto Service Overflow	Hill's City Directory
1974	Wilson Glass Service	Hill's City Directory
1969	WILSON GLASS SERVICE	Hill's City Directory
1964	Wilson Glass Serv	Hill's City Directory

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1959	Wilson Glass Serv ED	Hill's City Directory
1953	Wilson Glass Serv	Hill's City Directory
1949	Wilson Glass Service	Hill's City Directory

113 S SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2005	Sycamore Green Townhomes	Hill-Donnelly Information Services

114 S SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1979	Sheets Auto Service	Hill's City Directory
1974	Sheets Auto Service Inc body reprs	Hill's City Directory
1969	SHEETS AUTO SERVICE INC BODY REPRS	Hill's City Directory
1964	SheetsAuto Serv body reprs	Hill's City Directory
1959	Sheets Auto Serv reprs ED	Hill's City Directory
1953	Sheets Auto Serv reprs	Hill's City Directory
1949	Sheets Auto Serv reprs	Hill's City Directory

115 S SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2005	Bohm Ilse A	Hill-Donnelly Information Services

118 S SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2005	Archie Pauline	Hill-Donnelly Information Services

122 S SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1979	Macks Auto Upholstery	Hill's City Directory
1974	Macks Auto Upholstery	Hill's City Directory
1969	MACKS AUTO UPHOLSTERY	Hill's City Directory
1964	Macks Auto Uphol	Hill's City Directory
1959	Exzac Co Inc pnt distr ED	Hill's City Directory
1953	Braswell M P & Son stge	Hill's City Directory
1949	West End Auto Service	Hill's City Directory
1944	Massey Martin L Blksmith	Hill's City Directory
	West Eml Service	Hill's City Directory

FINDINGS

123 S SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2005	Ikall J A Jr	Hill-Donnelly Information Services

124 S SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2005	King Wendy	Hill-Donnelly Information Services
1974	Vacant	Hill's City Directory
1969	VACANT	Hill's City Directory
1964	Vacant	Hill's City Directory
1953	W 4th intersects ws not open	Hill's City Directory
	Vacant	Hill's City Directory
1949	Braswell M P & Son	Hill's City Directory
	W 4th intersects ws not open	Hill's City Directory

131 S SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2005	Younts Amy V	Hill-Donnelly Information Services

134 S SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2005	Everhardt D G	Hill-Donnelly Information Services

135 S SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2005	Curey Theodore E t	Hill-Donnelly Information Services
	Williams C C	Hill-Donnelly Information Services

146 S SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2005	Pardue Dianne	Hill-Donnelly Information Services

149 S SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2005	Petri E F	Hill-Donnelly Information Services

150 S SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2005	Knox B	Hill-Donnelly Information Services

FINDINGS

156 S SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2005	Steward Chuck	Hill-Donnelly Information Services

162 S SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2005	Roger Beatty L	Hill-Donnelly Information Services

204 S SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2005	Mccall Mary	Hill-Donnelly Information Services

205 S SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2005	Adams Ted	Hill-Donnelly Information Services

208 S SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1979	4TH ST INTERSECTS	Hill's City Directory
	Vacant	Hill's City Directory
1974	4TH ST INTERSECTS	Hill's City Directory
	Standard Transport Stge	Hill's City Directory
1969	4TH ST INTERSECTS	Hill's City Directory
	STANDARD TRANSPORT STGE	Hill's City Directory
1964	Standard Transport stge	Hill's City Directory
	W 4th intersects not open	Hill's City Directory
1959	Standard Transport stge	Hill's City Directory
	W 4th intersects ws not open	Hill's City Directory
1949	Mc Clung Corp bldg matertals	Hill's City Directory
1944	Vacant	Hill's City Directory
1937	Mc Clung Corp bldg materials	Hill's City Directory
	Mc Clung John W jr genl contr	Hill's City Directory

214 S SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1984	Vacant	R. L. Polk & Co.
1979	Springs Henry B	Hill's City Directory
1974	Springs Henry B	Hill's City Directory
1969	SPRINGS HENRY B	Hill's City Directory
1964	Norment Ernest A	Hill's City Directory
1959	Vacant	Hill's City Directory

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1953	Standard Transport stge	Hill's City Directory
1949	Woodbury E Russ	Hill's City Directory
1944	Vacant	Hill's City Directory

216 S SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2005	Owens Rachel	Hill-Donnelly Information Services
1984	Vacant	R. L. Polk & Co.
1979	Brown Melvin	Hill's City Directory
1974	Torrence Josephine A Mrs	Hill's City Directory
1969	TORRENCE ALEX	Hill's City Directory
1964	Vacant	Hill's City Directory
1959	Herion Louis H res ED	Hill's City Directory
1953	Herion Louis H res	Hill's City Directory
1949	Lipford Sallie Mrs	Hill's City Directory
1944	Herion Louis II res	Hill's City Directory

218 S SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1979	Faust Katie	Hill's City Directory
1974	Cunningham Albert M Jr	Hill's City Directory
1969	CUNNINGHAM ALBERT M JR	Hill's City Directory
1964	Lee John	Hill's City Directory
1959	Vacant	Hill's City Directory
1953	Mc Gloughlin Bill	Hill's City Directory
1949	Vacant	Hill's City Directory
1944	Garmon Ney M	Hill's City Directory

220 S SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1979	Vacant	Hill's City Directory
1969	VACANT	Hill's City Directory
1964	Alexander Mabel	Hill's City Directory
1959	Vacant	Hill's City Directory
1953	OBriant Glenn H	Hill's City Directory
1944	Gibson Lonls A	Hill's City Directory

221 S SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1949	Herion Louis H res	Hill's City Directory

FINDINGS

225 S SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2005	Harris Teresa	Hill-Donnelly Information Services

226 S SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1984	Vacant	R. L. Polk & Co.
1974	Jones Charles L	Hill's City Directory
1969	WELCH COLDELL	Hill's City Directory
1964	Grove intersects	Hill's City Directory
	Wetzel Wm H	Hill's City Directory
1959	Grove intersects	Hill's City Directory
	Mc Farland Marian B Mrs res ED	Hill's City Directory
1953	Mc Farland Marian B Mrs res	Hill's City Directory
	Grove intersects	Hill's City Directory
1949	Mc Farland Marian B Mrs	Hill's City Directory
	Grove intersects	Hill's City Directory

SYCAMORE ST

106 SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	2 Vacant	Piedmont Directory Company

107 SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	7 Walker C P	Piedmont Directory Company

109 SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	9 Love T J	Piedmont Directory Company

111 SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	11 Riggs W T	Piedmont Directory Company

112 SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	4 Kiser J A	Piedmont Directory Company

FINDINGS

113 SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	13 Maultsby G E	Piedmont Directory Company

115 SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	15 Kleckley A L	Piedmont Directory Company

118 SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	10 Thompson W M	Piedmont Directory Company

119 SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	19 Mc Coy Pearl Mrs	Piedmont Directory Company

120 SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	12 Blanton P K	Piedmont Directory Company

121 SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	21 Lindsay L T	Piedmont Directory Company

122 SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	14 Martin R V	Piedmont Directory Company
	Fifth intersects	Piedmont Directory Company

201 SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	Hartmann A B Mrs	Piedmont Directory Company
1925	Cochrane W F	Commercial Service Co.
1921	Cochrane W F	Commercial Service Co.

203 SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1925	Henley C A	Commercial Service Co.
	Birmingham J M	Commercial Service Co.

FINDINGS

205 SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1925	Booker J C	Commercial Service Co.
1921	Booker Jas C	Commercial Service Co.

207 SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	203 Birmingham J M	Piedmont Directory Company

208 SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	202 May J H	Piedmont Directory Company

209 SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1925	Mc Mamus R C	Commercial Service Co.

210 SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	204 Barksdale J A	Piedmont Directory Company

211 SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	205 Booker J C	Piedmont Directory Company

221 SYCAMORE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	209 Mc Manus H C	Piedmont Directory Company
	Going South	Piedmont Directory Company

TRADE ST

1000 TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1004 Rape J H	Piedmont Directory Company
	Lee Catherine Mrs	Piedmont Directory Company
1925	Lee C T Mrs	Commercial Service Co.
1921	Lee T B Maj	Commercial Service Co.

1001 TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	Durhamrn Life Ins Co	Piedmont Directory Company

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1001 A Wash J W	Piedmont Directory Company
1925	A Wash J W	Commercial Service Co.
	B Fuller J P	Commercial Service Co.
1921	A Wash J W	Commercial Service Co.
	B Lindsay L T	Commercial Service Co.

1002 TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1925	Hunter Jas	Commercial Service Co.
1921	Faires Frankie Mrs	Commercial Service Co.
	Hunter J B	Commercial Service Co.

1003 TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1001 B Scarborough J H	Piedmont Directory Company
1925	Johnston A B	Commercial Service Co.
1921	Redfern W P	Commercial Service Co.

1004 TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	Mewshaw A W atty	Piedmont Directory Company
1925	Lawrence W A	Commercial Service Co.
1921	Lawrence W A	Commercial Service Co.

1005 TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1003 Cooley A S	Piedmont Directory Company
1925	Jenkins D W	Commercial Service Co.
1921	Jenkins D W	Commercial Service Co.

1006 TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1002 Hunter J B	Piedmont Directory Company
	Natl Life Ins Co	Piedmont Directory Company
	Johnson A A Mrs	Piedmont Directory Company
1925	Krueger M C Mrs	Commercial Service Co.
1921	Krueger G L	Commercial Service Co.

FINDINGS

1008 TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	Bailey J E	Piedmont Directory Company
	Christian Science Reading Room	Piedmont Directory Company
1925	Neal V E Mrs	Commercial Service Co.

1009 TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1005 Jenkins D W	Piedmont Directory Company
1925	Monty W H	Commercial Service Co.
1921	Monty W H	Commercial Service Co.

1010 TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1925	Mc Mamus W C	Commercial Service Co.
1921	Patterson J H	Commercial Service Co.

1011 TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	Goldberg E H dentist	Piedmont Directory Company
1925	Smith D	Commercial Service Co.
1921	Reed Emma J Mrs	Commercial Service Co.

1012 TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	Frick Co Inc mchry	Piedmont Directory Company

1013 TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1925	Thompson J J	Commercial Service Co.
1921	Thompson J J	Commercial Service Co.

1014 TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	Miller Eli	Piedmont Directory Company
	Nisbet T P dentist	Piedmont Directory Company
	Hull P C dentist	Piedmont Directory Company
	1010 Miss Polly Sandwich Sho	Piedmont Directory Company

1015 TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	Harper Method Shop	Piedmont Directory Company

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1925	Bomar J C	Commercial Service Co.
1921	Bomar J C	Commercial Service Co.

1016 TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	10061 Krueger Marie Mrs	Piedmont Directory Company

1017 TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1009 Montz W H	Piedmont Directory Company
1925	Harrison T L	Commercial Service Co.
1921	Harrison T L	Commercial Service Co.

1018 TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1012 Vacant	Piedmont Directory Company
	1008 1/2 Ward R L	Piedmont Directory Company

1019 TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1925	Mc Cord R C	Commercial Service Co.
1921	Mc Cord B R	Commercial Service Co.

1020 TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1008 Jenkins J L	Piedmont Directory Company

1021 TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1011 Berlin Hyman	Piedmont Directory Company
1925	Wilkinson J L	Commercial Service Co.
1921	Wilkinson J L	Commercial Service Co.

1022 TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1014 Stokes E C	Piedmont Directory Company

1023 TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1925	Privette H L	Commercial Service Co.
	Andrill Terrace begins	Commercial Service Co.

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1921	Smith R L	Commercial Service Co.

1024 TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1010 Cooper J c	Piedmont Directory Company

1026 TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1016 Stokes R A	Piedmont Directory Company

1027 TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1010 Joyner H M	Piedmont Directory Company

1031 TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1015 Bomar J C	Piedmont Directory Company

1033 TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1017 Buice J D	Piedmont Directory Company

1039 TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1019 Wilkes F A	Piedmont Directory Company

1041 TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1021 Mock W T	Piedmont Directory Company

1045 TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1003 Threatt W B	Piedmont Directory Company
	Sycamore intersects	Piedmont Directory Company

1101 TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	Vacant	Piedmont Directory Company

1102 TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	Century Furn Assn Inc adv agcy	Piedmont Directory Company

FINDINGS

1105 TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	Equitable Life Assurance Soc	Piedmont Directory Company

1106 TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	Equitable Life Assurance Society	Piedmont Directory Company

1108 TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	1932 Ferguson Annie c	Piedmont Directory Company
1925	Ivoy V C	Commercial Service Co.

1109 TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	Mc Donald Service Sta No Going West	Piedmont Directory Company Piedmont Directory Company

1112 TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	Hartford Accident & Indemnity Co	Piedmont Directory Company

1113 TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	Hartford Fire Ins Co	Piedmont Directory Company
	Citizens Ins Co of N J	Piedmont Directory Company
	Hartford Live Stock Ins Co	Piedmont Directory Company

1116 TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	Vacant	Piedmont Directory Company

1118 TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	Ayer Lewis adv artist	Piedmont Directory Company

1119 TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	Richardson M C Mrs C S P	Piedmont Directory Company

FINDINGS

W 5TH ST

1009 W 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1999	Anderson Frank J	City Publishing Company Inc.
1994	Anderson Frank J & Alice D res	R. L. Polk & Co.
1989	Anderson Frank J res	R. L. Polk & Co.
1984	Anderson Frank J res	R. L. Polk & Co.
1979	Anderson Frank J res	Hill's City Directory
1974	Anderson Frank J res	Hill's City Directory
1969	ANDERSON FRANK J res	Hill's City Directory
1964	Anderson Frank J res	Hill's City Directory
1959	Anderson Frank J res ED	Hill's City Directory
1953	Anderson Frank J res	Hill's City Directory

1010 W 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1969	VACANT	Hill's City Directory
1964	Claytons Auto Reprs	Hill's City Directory

1012 W 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1999	Sarratt Lauratte D	City Publishing Company Inc.
1994	Sarratt Laurette D res	R. L. Polk & Co.
1989	Sarratt Odell res	R. L. Polk & Co.
1984	Sarratt Odell res	R. L. Polk & Co.
1979	Sarratt Odell res	Hill's City Directory
1974	Sarratt Odell res	Hill's City Directory
1969	SARRATT ODELL res	Hill's City Directory
1964	No Return	Hill's City Directory
	a Sarratt Odell	Hill's City Directory
1959	Hunter Lawrence G res ED	Hill's City Directory
1953	5TH W Contd	Hill's City Directory
	Hunter Lawrence G res	Hill's City Directory
1949	Hunter Lawrence G res	Hill's City Directory
1944	Hunter Lawrence 44 res	Hill's City Directory

1013 W 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1959	Drummond Bess L Mrs ED	Hill's City Directory

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1959	1/2 Gathings Mary L ED	Hill's City Directory
1953	1/2 Cole Jack	Hill's City Directory
	Shuler Vernon	Hill's City Directory
1949	Mulroy Jos C	Hill's City Directory
	1/2 Dunean Donald W	Hill's City Directory
1944	Hunter Henry W	Hill's City Directory

1015 W 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1969	VACANT	Hill's City Directory
1964	Patterson Millie	Hill's City Directory
	Harrison Mary E Mrs	Hill's City Directory
1959	1/2 Sawyer John D	Hill's City Directory
	Pascute Jas res ED	Hill's City Directory
1953	1/2 Pascote Jas res	Hill's City Directory
	Hollingsworth Geo H	Hill's City Directory
1949	Sellers Roy R res	Hill's City Directory
1944	Sellers Ernest	Hill's City Directory

1016 W 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1969	WHITMORE JIMMY L	Hill's City Directory
1964	Whitmore Jimmie	Hill's City Directory
1959	Waldrep Mamie A Mrs	Hill's City Directory
	Frye Vera W Mrs res ED	Hill's City Directory
1953	Waldrep Mamie A Mrs res	Hill's City Directory
1949	Frye Vera W Mrs	Hill's City Directory
	Waldrop Mamie A Mrs	Hill's City Directory
1944	Frye V era W Mrs	Hill's City Directory
	Waldrep Mamie A Mrs	Hill's City Directory

1017 W 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1969	VACANT	Hill's City Directory
1964	Lawhorn John W	Hill's City Directory
1959	Love Bessie E Mrs res ED	Hill's City Directory
1953	Love Thos C	Hill's City Directory
	Loves Delicatessen	Hill's City Directory
1944	Spivey Thos F	Hill's City Directory

FINDINGS

1020 W 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1969	LEAK CARRIE MRS	Hill's City Directory
	JONES ESTELLA D MRS	Hill's City Directory
1964	Jones Estelle D Mrs Leak Carrie Mrs	Hill's City Directory
1959	Mc Fadden E Blanche ED	Hill's City Directory
1953	Mc Fadden E Blanche	Hill's City Directory
1949	Mc Fadden E Blanche	Hill's City Directory
1944	Mc fadden E blanch	Hill's City Directory

1021 W 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1969	VACANT	Hill's City Directory
1964	Truesdale James B	Hill's City Directory
1959	Mozeley Gradye E Mrs ED	Hill's City Directory
1953	Vacant	Hill's City Directory
1949	Universal Herable Studio	Hill's City Directory
	Thomas Theo F	Hill's City Directory
1944	Thomas T Franklin	Hill's City Directory
	universal Heraldic Studios	Hill's City Directory

1022 W 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1969	PRUITT OLLIE JR	Hill's City Directory
1964	Crosby Ganson	Hill's City Directory
1959	Dalhoff Nell M ED	Hill's City Directory
1953	Dalhoff Nell M	Hill's City Directory
1949	Dalhoff Nell	Hill's City Directory
1944	Dalhoff Nell	Hill's City Directory

1023 W 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1969	VACANT	Hill's City Directory
1964	Parks Jessie A Mrs	Hill's City Directory
1959	Hager Sarah M Mrs ED	Hill's City Directory
1953	Hager Clyde L	Hill's City Directory
1949	Hager Clvde L	Hill's City Directory
1944	Hager Clyde L	Hill's City Directory

FINDINGS

1026 W 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1969	JONES CLEANING SERVICE	Hill's City Directory
	SELLERS JAMES W	Hill's City Directory
1964	Sellers James	Hill's City Directory
1959	Dellinger Edgar H res ED	Hill's City Directory
1953	Dellinger E H res	Hill's City Directory
1949	Luton Elbert S	Hill's City Directory
1944	Sawyer Dalias D	Hill's City Directory

1027 W 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	No Return	Hill's City Directory
	N Sycamore intersects	Hill's City Directory
1959	N Sycamore intersects	Hill's City Directory
	Rowland Robt FR	Hill's City Directory
	Fowler Stella M Mrs res Fr	Hill's City Directory
1953	Fowler Stella M Mrs res	Hill's City Directory
	N Sycamore intersects	Hill's City Directory
1949	N Sycamore intersects	Hill's City Directory
	Fowler Stella M Mrs res	Hill's City Directory
1944	Bowler Jacs W res	Hill's City Directory

1028 W 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2005	Kennon Tolly DDS	Hill-Donnelly Information Services
	Kennon Tolly A II	Hill-Donnelly Information Services
	IRWIN PARK PROFESSIONAL	Hill-Donnelly Information Services
1999	Kennon Tolly DDS PA	City Publishing Company Inc.
	IRWIN PARK PROFESSIONAL CENTER Acute Care Chiropractic	City Publishing Company Inc.
	Ebner Michael C chiroprctr DC	City Publishing Company Inc.
	Merkel Jake G Chiroprctr d C	City Publishing Company Inc.
1994	KENNON TOLLY A oral surgeon	R. L. Polk & Co.
	SUNBELT FOOT SPECIALISTS podiatrist	R. L. Polk & Co.
1989	Kennon Tolly orthodontist	R. L. Polk & Co.

1108 W 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Mc Dowell John W	Hill's City Directory
	1/2 Roberts Vivian	Hill's City Directory

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1959	Hunter ruth K Mrs res ED	Hill's City Directory
	1/2 Gibbs Geo R ED	Hill's City Directory
1953	Hunter Henrv W res	Hill's City Directory
	1/2 Mc Connell Johnny C tile contr	Hill's City Directory
1949	Hunter Henry W res	Hill's City Directory
	1/2 Terrell Ralph H	Hill's City Directory
1944	Choate Hettie Mrs	Hill's City Directory
	1/2 campbell flake C	Hill's City Directory
	1/2 Hummel Geo K	Hill's City Directory
	Choute Blanche	Hill's City Directory

1111 W 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1949	Campbell Flake C res	Hill's City Directory

1113 W 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1953	Vacant	Hill's City Directory

1114 W 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Camobell Eug res	Hill's City Directory
1959	Warren Era D Mrs res ED	Hill's City Directory
1953	Warren Era D Mrs res	Hill's City Directory

1115 W 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Grady J P	Hill's City Directory
1959	Beam Arth A res ED	Hill's City Directory
1953	Beam Arth A res	Hill's City Directory
1949	Beam Arth A res	Hill's City Directory

1119 W 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Alder begins	Hill's City Directory
	Land Robt	Hill's City Directory
	Alexander Zack W	Hill's City Directory
	Brown Leonard	Hill's City Directory
	Davis Jimmie	Hill's City Directory
	Apartments	Hill's City Directory

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1959	Andrill ter intersects	Hill's City Directory
	White Franklin R	Hill's City Directory
	Simpson Robt Y	Hill's City Directory
	Alder begins	Hill's City Directory
	Elliott Margt R Mrs ED	Hill's City Directory
	Robinson Ruth A	Hill's City Directory
	Apartments	Hill's City Directory
1953	Apartments	Hill's City Directory
	Navey Robt S	Hill's City Directory
	Robinson Margt L	Hill's City Directory
	Hagler Adam L	Hill's City Directory
	Tarleton B G	Hill's City Directory
	Alder begins not open between Alder and Andrill ter	Hill's City Directory
1949	Andrill ter intersects	Hill's City Directory
	Apartments	Hill's City Directory
	Elliott J Flynn	Hill's City Directory
	Robinson Margt L	Hill's City Directory
	Smith J P jr	Hill's City Directory
	Moore Jas J jr	Hill's City Directory
	Alder begins	Hill's City Directory
	Not Open between Alder and Andrill ter	Hill's City Directory
	Andrill ter intersects	Hill's City Directory
	5TH W Contd	Hill's City Directory
1944	Aparments	Hill's City Directory

1125 W 5TH ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Segrest Clns & Launderers ofc	Hill's City Directory
1959	Segrest Clns & Launderers FR	Hill's City Directory

W TRADE ST

1000 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1994	HEARST CORP THE publ	R. L. Polk & Co.
	INTERSTATE JOHNSON LANE	R. L. Polk & Co.
1969	VACANT	Hill's City Directory
	VACANT	Hill's City Directory
1964	Holcombs Amcoc Serv gas sta	Hill's City Directory

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Alcoa br sis ofc	Hill's City Directory
	Vacant	Hill's City Directory
1959	Vacant	Hill's City Directory
	Alcoa dist sls ofc ED	Hill's City Directory
	Holcombs Amoco Serv FR	Hill's City Directory
1953	Vacant	Hill's City Directory
	Holcombs Amoco Serv Sta	Hill's City Directory
1949	Thompsons Friendly Service fill sta	Hill's City Directory
	Link Wm C ofc	Hill's City Directory
1944	Southwest Chair Co Inc ofc	Hill's City Directory
	Leonards Serv Sta	Hill's City Directory
1937	Sou Trucking Co	Hill's City Directory
	Hand Transfer	Hill's City Directory
	Nance Service Sta	Hill's City Directory
	Hunter Louis R mfrs agt	Hill's City Directory
	Hunter Thos M mfrs agt	Hill's City Directory

1001 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1974	No Return	Hill's City Directory
1969	WILSON PRESSLEY C OPTOM	Hill's City Directory
1964	Beas Beauty Shop	Hill's City Directory
	Wilson Pressley C optom	Hill's City Directory
1959	Blackmon Yancey L ED	Hill's City Directory
	Wilson Pressley C optom FR	Hill's City Directory
1953	Wilson Pressley C optom	Hill's City Directory
	Blackmon Yancey L	Hill's City Directory
1949	Blackmon Yancey L	Hill's City Directory
	Sou Dixie Life Ins Co	Hill's City Directory
1944	Blackmon Yancey L	Hill's City Directory
	Sou Dixie Life Ins Co	Hill's City Directory
1937	Wash Mattie Mrs	Hill's City Directory
	Vacant	Hill's City Directory

1002 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1969	BROTHERHOOD OF MAINTENANCE OF WAY EMPLOYEES	Hill's City Directory
1964	Brotherhood of Mtce of Way Emps	Hill's City Directory

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1959	Brotherhood of Mtce of Way Emps ED	Hill's City Directory
1953	Avon Products Inc cosmetics	Hill's City Directory
1949	Mass Protective Assn	Hill's City Directory
	Revere Paul Life Ins Co	Hill's City Directory
1944	Mass Protective Assn	Hill's City Directory
	Mass Protective Life Assur Co	Hill's City Directory
	Revere Paul Life Ins Co	Hill's City Directory
	Howard Jerry	Hill's City Directory

1003 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1974	Eves Flower & Gift Shop	Hill's City Directory
	Slater Harry E	Hill's City Directory
1969	SLATER HARRY E	Hill's City Directory
	EVES FLOWER & GIFT SHOP	Hill's City Directory
1964	Eves Flower & Gift Shop	Hill's City Directory
	Slater Harry E	Hill's City Directory
1959	Vacant	Hill's City Directory
1953	Schrum Mason K	Hill's City Directory
1949	Whitlock Carol H	Hill's City Directory
	Sou Life Ins Co	Hill's City Directory
1944	Davis Duncan T	Hill's City Directory
1937	Strutt W Logan	Hill's City Directory

1004 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Presby Foundation Ins The	Hill's City Directory
1953	Rowe Ins Agcy	Hill's City Directory
	World Ins Co	Hill's City Directory
1949	Bailey Meter Co	Hill's City Directory
1944	Dahlberg & Co accts	Hill's City Directory
1937	Vacant	Hill's City Directory

1005 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2005	Caller Alexis	Hill-Donnelly Information Services
	Chakravarty Sugata v	Hill-Donnelly Information Services
	Chapman A L Yv	Hill-Donnelly Information Services
	Chiselom LUnda wv	Hill-Donnelly Information Services

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2005	Delaney Tara v	Hill-Donnelly Information Services
	Esters T v7	Hill-Donnelly Information Services
	Jones Brian V	Hill-Donnelly Information Services
	Mastera Greg vv	Hill-Donnelly Information Services
	Nash Monte A v	Hill-Donnelly Information Services
	Reaves J v	Hill-Donnelly Information Services
	Sacoycie David v	Hill-Donnelly Information Services
	Sycamore Green	Hill-Donnelly Information Services
	Williams O R Jr v	Hill-Donnelly Information Services
	Wright Kenneth E V	Hill-Donnelly Information Services
	Young Deborah V	Hill-Donnelly Information Services
	Multi Unit Address Brazzell Susan C	Hill-Donnelly Information Services
	Brunson Tori v	Hill-Donnelly Information Services
	Burchett Emily	Hill-Donnelly Information Services
Burnmside John F Jr v	Hill-Donnelly Information Services	
1974	new Bell Fred res	Hill's City Directory
1969	LITTLEJOHN LAURA	Hill's City Directory
1964	Vacant	Hill's City Directory
1959	Presby Foundation Inc The FR	Hill's City Directory
	Francis Maude M Mrs bdg ED	Hill's City Directory
1953	Henley Cora L Mrs	Hill's City Directory
1949	Francis Cora L Mrs	Hill's City Directory
1944	Henley Cora L Mrs	Hill's City Directory
1937	Cooley Alex S	Hill's City Directory

1006 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1969	VACANT	Hill's City Directory
	NEWELL LEONE B PHYS	Hill's City Directory
1964	Vacant	Hill's City Directory
	Newell Leon B phys	Hill's City Directory
1959	Holcomb Jack A	Hill's City Directory
	Newell Leon B phys ED	Hill's City Directory
1953	Williams Dessie	Hill's City Directory
	Newell Leon B phys	Hill's City Directory
1949	Briekhouse Nettie M Mrs	Hill's City Directory
	Newell Leon B phys	Hill's City Directory
1944	Melton Eug	Hill's City Directory
	Newell Leon B phys	Hill's City Directory

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1937	Harris Walter C	Hill's City Directory

1007 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Am Appraisal Co The appraisers	Hill's City Directory

1008 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1959	N C Tex Mfrs Assn Inc ED	Hill's City Directory
1937	Newitt John G lawyer	Hill's City Directory

1009 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1974	Apartments	Hill's City Directory
	Howard James	Hill's City Directory
	Stewart Lorane Mrs	Hill's City Directory
	Moore Albert Jr	Hill's City Directory
	No Return	Hill's City Directory
1969	STEWART LORANE MRS	Hill's City Directory
	MOORE ALBERT JR	Hill's City Directory
	ROBINSON COLUMBIA	Hill's City Directory
	YORK MEMORIAL PARK CEMETERY OFC	Hill's City Directory
	PROVIDENCE MEMORIAL ASSN INC	Hill's City Directory
	APARTMENTS	Hill's City Directory
	HOWARD JAMES	Hill's City Directory
1964	Providence Memorial Assn Inc ofc	Hill's City Directory
	Sharon Memorial Park & Mausoleum ofc	Hill's City Directory
	York Memorial Park Cemetery ofc	Hill's City Directory
	Bankers Life Co The ins	Hill's City Directory
	Apartments	Hill's City Directory
	Padgett Russell W	Hill's City Directory
	Jenkins Clara K Mrs res	Hill's City Directory
	Vacant	Hill's City Directory
	Vacant	Hill's City Directory
	1959	Apartments
Queen A Tillman		Hill's City Directory
Jenkins Clara K Mrs res ED		Hill's City Directory
Biggs Lucille P Mrs		Hill's City Directory
Parker Jas		Hill's City Directory

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1959	Street continued	Hill's City Directory
	Providence Memorial Assn Inc ofc Sharon Mem Pk & Mausoleum of	Hill's City Directory
	York Mem Pk Cemetery ofc ED	Hill's City Directory
	CMC Finance Corp ED	Hill's City Directory
1953	Providence Memorial Assn Inc ofc	Hill's City Directory
	Sharon Mem Pk & Mausoleum ofc	Hill's City Directory
	Apartments	Hill's City Directory
	Casey John	Hill's City Directory
	Jenkins Clara K Mrs res	Hill's City Directory
	Vacant	Hill's City Directory
	Glenn Dallas W	Hill's City Directory
	Street continued	Hill's City Directory
1949	Textile Wkrs Union of Am	Hill's City Directory
	Apartments	Hill's City Directory
	Pruitt Oren A	Hill's City Directory
	Jenkins Clara K Mrs res	Hill's City Directory
	Knight Nelson E	Hill's City Directory
	Whitley Jos D	Hill's City Directory
	Street continued	Hill's City Directory
1944	Textile Wkrs Union of Am	Hill's City Directory
	Apartments	Hill's City Directory
	Vacant	Hill's City Directory
	Jenkins Clara K Mrs res	Hill's City Directory
	Knight Nelson E	Hill's City Directory
	Ware Oliver B	Hill's City Directory
	Street continued	Hill's City Directory
1937	Jenkins Clara K Mrs	Hill's City Directory

1010 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1959	Sou Heritage Ins Co reg ofc FR	Hill's City Directory

1011 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1969	FRICK CO REFRIGERATION EQUIPMENT	Hill's City Directory
1964	Investors Diversified Services Inc stocks and bonds	Hill's City Directory
	Vacant	Hill's City Directory

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1959	Lowrys Beauty Salon ED	Hill's City Directory
1937	Vacant	Hill's City Directory

1012 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1969	SIMS MARGT BEAUTY SALON	Hill's City Directory
1964	Jones Bessie L	Hill's City Directory
	Clyburn Geo W	Hill's City Directory
	Jankins Roy J	Hill's City Directory
	Sims Margt Beauty Salon	Hill's City Directory
	Apartments	Hill's City Directory
	Mills Annie M	Hill's City Directory
1959	Sims Margt Beauty Salon FR	Hill's City Directory
	Jacobs Martha L	Hill's City Directory
1953	Hubbard Earl J	Hill's City Directory
1949	Vacant	Hill's City Directory
1944	Holnos Perry Z	Hill's City Directory
1937	Frick Co Inc machy	Hill's City Directory
	Lawrence Win A	Hill's City Directory

1013 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1969	VACANT	Hill's City Directory
1964	Frick Co refgr	Hill's City Directory
1959	Frick Co Inc refgr ED	Hill's City Directory
1953	Frick Co Inc machy	Hill's City Directory
1949	Frick Co Inc machy	Hill's City Directory
1944	Frick Co Inc machy	Hill's City Directory

1014 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1969	VACANT	Hill's City Directory
1964	Vacant	Hill's City Directory
	Bradley Gebhardt Delaney & Millette lwys	Hill's City Directory
1959	Bell Bradley Gebhardt & De Laney lwys ED	Hill's City Directory
	Hull P Carter dentist ED	Hill's City Directory
	Hull Robt H dentist ED	Hill's City Directory
1953	Hull P Carter dentist	Hill's City Directory
	Biddle Clarence F dentist	Hill's City Directory

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1949	Hull P Carter jr dentist	Hill's City Directory
	Hull P Carter dentist	Hill's City Directory
1944	Hull P Carter Jr dentist	Hill's City Directory
1937	Hull P Carter dentist	Hill's City Directory

1015 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1969	VACANT	Hill's City Directory
	11TH FL ODELL A G JR & ASSOCS OVERFLOW	Hill's City Directory
1964	Vacant	Hill's City Directory
1959	Vacant	Hill's City Directory
1953	Vacant	Hill's City Directory
1949	Model Sewing Shop	Hill's City Directory
	Moss Isabel Mrs mlnr	Hill's City Directory
1944	Hull P Carter dentist	Hill's City Directory
	Exclusive Sewing Shoppe	Hill's City Directory
	Vacant	Hill's City Directory
1937	Deluxe Beauty Shop	Hill's City Directory

1016 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Krueger Lillian M	Hill's City Directory
1959	Kreuger Lillian M res ED	Hill's City Directory
1953	TRADE W Contd	Hill's City Directory
	Krueger Lillian Mrs	Hill's City Directory
1949	Krueger Henry E res	Hill's City Directory
1944	Krueger Henry E res	Hill's City Directory
1937	Krueger Marie C Mrs	Hill's City Directory

1017 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1974	Vacant	Hill's City Directory
1969	DAVIDSON MINNIE E FURN RMS	Hill's City Directory
1964	Clayton Wm J bdg	Hill's City Directory
1959	Simpsons Guest Home FR	Hill's City Directory
	Simpson Boyce G FR	Hill's City Directory
1953	Monty Sarah W Mrs res	Hill's City Directory
1949	Monty Sarah E Mrs res	Hill's City Directory
1944	Monty Sarah E Mrs res	Hill's City Directory

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1937	Monty Sarah E Mrs	Hill's City Directory

1018 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1969	YOUNG LILLIE M	Hill's City Directory
1964	Green Coree Y Mrs	Hill's City Directory
1959	Presley Woodrow W ED	Hill's City Directory
1953	Presley Woodrow W	Hill's City Directory
1949	Presley Woodrow W	Hill's City Directory
1944	Presley Woodrow W	Hill's City Directory
1937	Flowers Cecil A	Hill's City Directory

1020 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1969	COWANS MARTHA MRS	Hill's City Directory
1959	Harris Floyd H ED	Hill's City Directory
1953	Harris Floyd H	Hill's City Directory
1949	Harris Floyd H	Hill's City Directory
1944	Hiarris Floyd H	Hill's City Directory
1937	Deese Walter L	Hill's City Directory
	Freeman Delmo W	Hill's City Directory

1021 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1979	Hoover Mildred L Mrs res	Hill's City Directory
1974	Hoover Mildred L Mrs res	Hill's City Directory
1969	HOOVER MILDRED S MRS	Hill's City Directory
1964	Hoover Mildred S Mrs res	Hill's City Directory
1959	Hoover Mildred S Mrs res Fr	Hill's City Directory
1953	Hoover Lloyd L res	Hill's City Directory
1949	Berlin rosa Mrs res	Hill's City Directory
1944	Byrd Robt L	Hill's City Directory
	Berlin rosa Mrs res	Hill's City Directory
1937	Berlin Rosa Mrs	Hill's City Directory

1024 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1959	Vacant	Hill's City Directory
1953	Byrd Lula N Mrs	Hill's City Directory
1949	Byrd Robt L	Hill's City Directory

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1937	Gaines Robt A	Hill's City Directory

1025 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2005	Clarke Faye +v	Hill-Donnelly Information Services
	Multi Unit Address Brown Lakita V	Hill-Donnelly Information Services
	Clarke Faye	Hill-Donnelly Information Services
	Thomas Gerard v	Hill-Donnelly Information Services
	Sttt Rebekah v	Hill-Donnelly Information Services
	Staton Rachel v	Hill-Donnelly Information Services
	Noble Lorina v	Hill-Donnelly Information Services
	Gross Teresa v	Hill-Donnelly Information Services
	Crawford Bernice A	Hill-Donnelly Information Services
	David Sakeenah v	Hill-Donnelly Information Services

1027 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1984	Vacant	R. L. Polk & Co.
1979	Goodwin Mae S Mrs furnished rms	Hill's City Directory
1974	Goodwin Mae S Mrs furn rms res	Hill's City Directory
1969	GOODWIN MAE S MRS FURN RMS	Hill's City Directory
1964	Goodwin Mae S Mrs fumrn rms	Hill's City Directory
1959	Goodwin Mae S Mrs FR	Hill's City Directory
1953	Elms H Stroud r	Hill's City Directory
1949	Bourell Don	Hill's City Directory
1944	Green Carl E	Hill's City Directory
1937	Funderburk Thos A	Hill's City Directory

1031 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1974	Mark Mike	Hill's City Directory
1969	SATTERWHITE COLEY	Hill's City Directory
1964	Correll Mattie K Mrs	Hill's City Directory
1959	Correll Mattie K Mrs ED	Hill's City Directory
1953	Little Ralph C	Hill's City Directory
	Correll Mattie K Mrs	Hill's City Directory
1949	Vick Josie nurse	Hill's City Directory
	Correll Jas C	Hill's City Directory
1944	Correll Jas C	Hill's City Directory

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1937	White Chester A	Hill's City Directory

1033 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1969	UNCLE CHARLIES PLACE GROS CLEMS ELIZA	Hill's City Directory
1964	Uncle Charlies Place gros	Hill's City Directory
	Fodel Chas F	Hill's City Directory
1959	Uncle Charlies Pl gro ED	Hill's City Directory
	Fodel Chas F ED	Hill's City Directory
1953	Fodel Chas F gro res	Hill's City Directory
1949	Fodel Chas F	Hill's City Directory
1944	Taylor Jas C	Hill's City Directory
1937	Taylotr Jas C	Hill's City Directory

1039 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Allison Alvis W	Hill's City Directory
	Sycamore intersects	Hill's City Directory
1959	Allison Alva W FR	Hill's City Directory
1953	Allison Alvis W	Hill's City Directory
1949	Allison Alvih W	Hill's City Directory
1944	Allison Alvis W	Hill's City Directory
1937	Smith J Roy	Hill's City Directory

1041 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1953	Jeanete Mattie E Mrs	Hill's City Directory
1949	Mills Zeb H	Hill's City Directory
1944	Josephs Fadellah A	Hill's City Directory
1937	Josephs Fadellah A	Hill's City Directory

1045 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1953	Sycamore intersects	Hill's City Directory
	Smith Fred P	Hill's City Directory
1949	Schirum Mason K	Hill's City Directory
1944	Threatt Ward B	Hill's City Directory
1937	Threatt Ward B	Hill's City Directory
	Sycamore intersects	Hill's City Directory

FINDINGS

1101 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1994	ALLRIGHT PARKING INC	R. L. Polk & Co.
1969	IRWIN CREEK BRIDGE crosses	Hill's City Directory
	BISSELL H C & ASSOCIATES INC	Hill's City Directory
	VACANT	Hill's City Directory
1964	Home Elec Shop reprs	Hill's City Directory
	Irwin Creek bridge	Hill's City Directory
	Andrell ter begins	Hill's City Directory
1959	Beam J B & Co jwlrs ED	Hill's City Directory
	Home Elec Shop reprs ED	Hill's City Directory
	TRADE W Contd	Hill's City Directory
	Andrell ter begins	Hill's City Directory
1953	Hollingsworth C David chiropractor	Hill's City Directory
	Radio Doc radio reprs	Hill's City Directory
	Irwin Creek bridge	Hill's City Directory
	Andrell Terrace begins	Hill's City Directory
1949	Hollingsworth Chauncy D chiro	Hill's City Directory
	Modern Appliances Co radio reprs	Hill's City Directory
	Irwin Creek bridge	Hill's City Directory
	Andrill Terrace begins	Hill's City Directory
1944	Hollingsworth Chauncy D chiro	Hill's City Directory
	Mecklenburg Liidry Co br	Hill's City Directory
1937	Dickinson Secretarial Sch	Hill's City Directory
	West End Garage & Body Wks auto reprs	Hill's City Directory
	Andrill ter begins	Hill's City Directory

1103 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Phoenix Steel Corp	Hill's City Directory
1959	Pilot Life Ins Co ED	Hill's City Directory
1944	Andrill Terrace begins	Hill's City Directory
	Radio Doc reprs	Hill's City Directory

1104 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1964	Harkey Faggart Coira & Fletcher lwys	Hill's City Directory
1959	Carolinas Virginia Nuclear Power Assocs Inc	Hill's City Directory
	Vacant	Hill's City Directory

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1953	Gaylord Container Corp box mfrs	Hill's City Directory
1944	Hall Brown G watch repr	Hill's City Directory
1937	Vacant	Hill's City Directory

1105 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1959	Orchestras Management booking agts FR	Hill's City Directory
	Hutchinson Realty Co ED	Hill's City Directory
1953	Smith Mayme L pub sten	Hill's City Directory
	Hutchinson Realty Co	Hill's City Directory
1949	Hutchinson Realty Co	Hill's City Directory
1944	Hutchinson Realty Co	Hill's City Directory

1106 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1989	Vacant	R. L. Polk & Co.
1959	Communications Wkrs of Am AFL CIO ED	Hill's City Directory
	Am Federation of Lab & Congress of Industrial Orgs Region No 5 E10	Hill's City Directory
1953	Hosp Saving Assn of NC Inc	Hill's City Directory
1949	Gaddy R Bennett dentist	Hill's City Directory
1944	Henderson Harvey C dentist	Hill's City Directory
	Gaddy Risten B dentist	Hill's City Directory
1937	Local Brokerage Co loans	Hill's City Directory

1107 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1989	Comput Ability data processing	R. L. Polk & Co.
1964	Vacant	Hill's City Directory
1959	New England Mut Life Ins Co group dept FR	Hill's City Directory

1109 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1949	Rohm & haas Co Inc chenmical mfrs	Hill's City Directory
1944	Hohn & Haas Co Inc chemical mfrs	Hill's City Directory
1937	Rohm & Haas Co Inc chemical mfrs	Hill's City Directory

FINDINGS

1110 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1994	PRIRA COM INC long distant communication	R. L. Polk & Co.
1989	Kline Richd J lwyr	R. L. Polk & Co.

1111 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1969	ANDERSEN ARTHUR & CO ACCTS	Hill's City Directory
1964	Andersen Arth & Co accts	Hill's City Directory
1959	Natl Of Hartford Group ins ED	Hill's City Directory
	Andersen Arth & Co accts FRO 2471	Hill's City Directory
1937	Vacant	Hill's City Directory

1112 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1959	US Small Business Admn ED	Hill's City Directory
1953	Potter E Lindsey jr phys	Hill's City Directory
1949	Hartford Fire Ins Co	Hill's City Directory
	Citizens Ins Co of N J	Hill's City Directory
1944	Hartford Fire Ins Co	Hill's City Directory
	Citizens Ins Co of N J	Hill's City Directory
	Met Life Ins Co	Hill's City Directory

1113 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1959	Vacant	Hill's City Directory
1937	Citizens Ins Co of N J	Hill's City Directory
	Hartford Fire Ins Co	Hill's City Directory

1114 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1953	Northrop Harry Ca acet	Hill's City Directory
1949	Northrop Harry C acct	Hill's City Directory
1944	Northrop Harry C acct	Hill's City Directory

1115 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1953	Beam Jas B whol Jwlr	Hill's City Directory
1949	Beam Jas B jwlr	Hill's City Directory
1944	De Luxe Beauty Shop	Hill's City Directory

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1937	Vogue Beauty Shop	Hill's City Directory

1116 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1994	Vacant	R. L. Polk & Co.
1989	Hunter Pickard & Cannon Iwys	R. L. Polk & Co.
1937	Vacant	Hill's City Directory

1124 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1994	Not Verified	R. L. Polk & Co.
1989	Charter Walker Company real est	R. L. Polk & Co.

1127 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1994	Vacant	R. L. Polk & Co.
1989	Making Connections Inc mkt research	R. L. Polk & Co.

1129 W TRADE ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1994	EASTMAN KODAK CO	R. L. Polk & Co.

WACCAMAW ST

1001 WACCAMAW ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1989	Pulley Edith	R. L. Polk & Co.
1984	Pulley Edith	R. L. Polk & Co.
1979	Pulley Edith	Hill's City Directory
1974	Pulley Edith	Hill's City Directory
1969	PULLEY EDITH V	Hill's City Directory
1964	Pulley Edith V	Hill's City Directory

1003 WACCAMAW ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1989	Woods David	R. L. Polk & Co.
1984	new Alexander Elizabeth E	R. L. Polk & Co.
1979	Alexander Eliz	Hill's City Directory
1974	No Return	Hill's City Directory
1969	HANCOCK WILLIE	Hill's City Directory
1964	Carson Annie	Hill's City Directory

FINDINGS

1005 WACCAMAW ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1989	Vacant	R. L. Polk & Co.
1984	new Gardner Margaret	R. L. Polk & Co.
1979	Vacant	Hill's City Directory
1974	new Atkins Lee	Hill's City Directory
1969	WILLIAMS JOHNNY L	Hill's City Directory
1964	Williams Johnny L	Hill's City Directory

1007 WACCAMAW ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1989	new Mc Manus Danny	R. L. Polk & Co.
1984	Harris Lawrence	R. L. Polk & Co.
1979	Durham Jo Anne	Hill's City Directory
1974	new Jacaon James	Hill's City Directory
1969	WILLIAMS CORNELL	Hill's City Directory
1964	Taylor Walter B jr	Hill's City Directory

1009 WACCAMAW ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1989	Vacant	R. L. Polk & Co.
1984	Harris Mary	R. L. Polk & Co.
1979	Funchess John	Hill's City Directory
1969	MC CULLOUGH ROTTIS	Hill's City Directory
1964	Wooten Evelyn Mrs	Hill's City Directory

1012 WACCAMAW ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1989	Vacant	R. L. Polk & Co.
1984	No Return	R. L. Polk & Co.
1979	new Brownlee Jesse	Hill's City Directory
1974	Freeman Charles L	Hill's City Directory
1969	FREEMAN CHARLES L	Hill's City Directory
1964	Freeman Chas L	Hill's City Directory

1016 WACCAMAW ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1989	Satterwhite Rosa Lee G Mrs	R. L. Polk & Co.
1984	Satterwhite Rosa Lee G Mrs	R. L. Polk & Co.
1979	Satterwhite Rosalee G Mrs	Hill's City Directory
1974	Satterwhite Coley res	Hill's City Directory

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1969	PLATTS JEROME res	Hill's City Directory
1964	Platts Jerome	Hill's City Directory

1021 WACCAMAW ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1989	Burkhalter ruth res	R. L. Polk & Co.
1984	Me Ilwain Nancy P res	R. L. Polk & Co.
1979	Vacant	Hill's City Directory
1974	Gwynne Arth W	Hill's City Directory
1969	VACANT	Hill's City Directory
1964	Campbell Clara	Hill's City Directory

1024 WACCAMAW ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1989	Davis Beulah M	R. L. Polk & Co.
1984	Davis Beulah M	R. L. Polk & Co.
1979	Vacant	Hill's City Directory
1974	Ballard Henry Jr	Hill's City Directory
1969	BALLARD HENRY JR	Hill's City Directory
1964	Nelson Minnie H Mrs	Hill's City Directory

1025 WACCAMAW ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1989	Johnson Emma J	R. L. Polk & Co.
1984	Vacant	R. L. Polk & Co.
1979	Vacant	Hill's City Directory
1974	Vacant	Hill's City Directory
1969	CRAWFORD TATE	Hill's City Directory
1964	Miller Willie H	Hill's City Directory

1028 WACCAMAW ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1989	Adams Carl	R. L. Polk & Co.
1984	new Adama Carl	R. L. Polk & Co.
1979	Dunlap Wallace	Hill's City Directory
1974	Alexander Eliz Mrs	Hill's City Directory
1969	ALEXANDER ELIZ MRS	Hill's City Directory
1964	Martin Tobias W res	Hill's City Directory

FINDINGS

1034 WACCAMAW ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1989	Baxter Maybelle Mrs	R. L. Polk & Co.
1984	new Baxter Eddie	R. L. Polk & Co.
1979	Byers Maybelle Mrs	Hill's City Directory
1974	Byers Maybelle Mrs	Hill's City Directory
1969	BYERS MAYBELLE MRS	Hill's City Directory
1964	Clark Verla H Mrs	Hill's City Directory

1040 WACCAMAW ST

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1989	Webber Larry	R. L. Polk & Co.
1984	new Pharr Minnie	R. L. Polk & Co.
1979	new Davis Nannie	Hill's City Directory
1974	Cole Elwood	Hill's City Directory
1969	VACANT	Hill's City Directory
1964	Crawford Annie Mrs	Hill's City Directory
	Sycamore intersects	Hill's City Directory

FINDINGS

TARGET PROPERTY: ADDRESS NOT IDENTIFIED IN RESEARCH SOURCE

The following Target Property addresses were researched for this report, and the addresses were not identified in the research source.

Address Researched

1100 W. Trade Street

Address Not Identified in Research Source

2005, 1999, 1991, 1975, 1931, 1925, 1921

ADJOINING PROPERTY: ADDRESSES NOT IDENTIFIED IN RESEARCH SOURCE

The following Adjoining Property addresses were researched for this report, and the addresses were not identified in research source.

Address Researched

1000 5TH ST

1000 E 5TH ST

1000 E TRADE ST

1000 TRADE ST

1000 W TRADE ST

1001 5TH ST

1001 E TRADE ST

1001 TRADE ST

1001 W TRADE ST

1001 WACCAMAW ST

1002 5TH ST

1002 TRADE ST

1002 W TRADE ST

1003 5TH ST

1003 TRADE ST

1003 W TRADE ST

1003 WACCAMAW ST

1004 5TH ST

Address Not Identified in Research Source

2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931

2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1931, 1925, 1921

2005, 1999, 1994, 1991, 1975, 1931, 1925, 1921

2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937

2005, 1999, 1991, 1989, 1984, 1979, 1975, 1974, 1931, 1925, 1921

2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931, 1921

2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1937, 1931, 1925, 1921

2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937

2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1931, 1925, 1921

2005, 1999, 1994, 1991, 1975, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921

2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931, 1921

2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931

2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1937, 1931, 1925, 1921

2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931

2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937

2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1931, 1925, 1921

2005, 1999, 1994, 1991, 1975, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921

2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931

FINDINGS

Address Researched

Address Not Identified in Research Source

1004 TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937
1004 W TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1959, 1931, 1925, 1921
1005 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931, 1921
1005 TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937
1005 W TRADE ST	1999, 1994, 1991, 1989, 1984, 1979, 1975, 1931, 1925, 1921
1005 WACCAMAW ST	2005, 1999, 1994, 1991, 1975, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
1006 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937
1006 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1931, 1925, 1921
1006 E TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1931, 1925, 1921
1006 TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937
1006 W TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1931, 1925, 1921
1007 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931
1007 W TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
1007 WACCAMAW ST	2005, 1999, 1994, 1991, 1975, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
1008 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937
1008 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1931, 1925, 1921
1008 E TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1931, 1925, 1921
1008 TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1921
1008 W TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1953, 1949, 1944, 1931, 1925, 1921
1009 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931
1009 E TRADE ST	2005, 1999, 1994, 1991, 1989, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
1009 TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937
1009 W 5TH ST	2005, 1991, 1975, 1949, 1944, 1937, 1931, 1925, 1921
1009 W TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1931, 1925, 1921
1009 WACCAMAW ST	2005, 1999, 1994, 1991, 1975, 1974, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
1010 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931

FINDINGS

Address Researched

Address Not Identified in Research Source

1010 E TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1937, 1931, 1925, 1921
1010 TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931
1010 W 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
1010 W TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1953, 1949, 1944, 1937, 1931, 1925, 1921
1011 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931
1011 TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937
1011 W TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1953, 1949, 1944, 1931, 1925, 1921
1012 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937
1012 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1931, 1925, 1921
1012 E TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1931, 1925, 1921
1012 TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1012 W 5TH ST	2005, 1991, 1975, 1937, 1931, 1925, 1921
1012 W TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1931, 1925, 1921
1012 WACCAMAW ST	2005, 1999, 1994, 1991, 1975, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
1013 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937
1013 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1949, 1931, 1925, 1921
1013 TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931
1013 W 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1937, 1931, 1925, 1921
1013 W TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1937, 1931, 1925, 1921
1014 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937
1014 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1944, 1937, 1931, 1925, 1921
1014 E TRADE ST	2005, 1999, 1994, 1991, 1975, 1931, 1925, 1921
1014 TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1014 W TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1931, 1925, 1921
1015 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925
1015 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1931, 1925, 1921

FINDINGS

Address Researched

Address Not Identified in Research Source

1015 TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937
1015 W 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1937, 1931, 1925, 1921
1015 W TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1931, 1925, 1921
1016 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937
1016 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1944, 1937, 1931, 1925, 1921
1016 TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1016 W 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1937, 1931, 1925, 1921
1016 W TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1931, 1925, 1921
1016 WACCAMAW ST	2005, 1999, 1994, 1991, 1975, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
1017 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937
1017 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1931, 1925, 1921
1017 TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937
1017 W 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1949, 1937, 1931, 1925, 1921
1017 W TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1931, 1925, 1921
1018 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937
1018 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1931, 1925, 1921
1018 E TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1931, 1925, 1921
1018 TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1018 W TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1931, 1925, 1921
1019 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931
1019 TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931
1020 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937
1020 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1937, 1931, 1925, 1921
1020 E TRADE ST	2005, 1999, 1994, 1991, 1984, 1979, 1975, 1974, 1969, 1937, 1931, 1925, 1921
1020 TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1020 W 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1937, 1931, 1925, 1921
1020 W TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1964, 1931, 1925, 1921

FINDINGS

Address Researched

Address Not Identified in Research Source

1021 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937
1021 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1931, 1925, 1921
1021 E TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1949, 1944, 1937, 1931, 1925, 1921
1021 TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937
1021 W 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1937, 1931, 1925, 1921
1021 W TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1975, 1931, 1925, 1921
1021 WACCAMAW ST	2005, 1999, 1994, 1991, 1975, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
1022 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937
1022 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1931, 1925, 1921
1022 TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1022 W 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1937, 1931, 1925, 1921
1023 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1023 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1944, 1931, 1925, 1921
1023 TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931
1023 W 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1937, 1931, 1925, 1921
1024 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1024 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1931, 1925, 1921
1024 E TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1931, 1925, 1921
1024 TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1024 W TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1944, 1931, 1925, 1921
1024 WACCAMAW ST	2005, 1999, 1994, 1991, 1975, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
1025 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1921
1025 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1931, 1925, 1921
1025 W TRADE ST	1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
1025 WACCAMAW ST	2005, 1999, 1994, 1991, 1975, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
1026 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1026 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1931, 1925, 1921

FINDINGS

Address Researched

Address Not Identified in Research Source

1026 E TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1931, 1925, 1921
1026 TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1026 W 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1937, 1931, 1925, 1921
1027 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1027 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1931, 1925, 1921
1027 TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1027 W 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1937, 1931, 1925, 1921
1027 W TRADE ST	2005, 1999, 1994, 1991, 1989, 1975, 1931, 1925, 1921
1028 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1028 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1931, 1925, 1921
1028 W 5TH ST	1991, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
1028 WACCAMAW ST	2005, 1999, 1994, 1991, 1975, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
1029 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1931, 1925, 1921
1031 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1937, 1931, 1925, 1921
1031 TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1031 W TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1931, 1925, 1921
1033 TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1033 W TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1931, 1925, 1921
1034 WACCAMAW ST	2005, 1999, 1994, 1991, 1975, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
1039 TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1039 W TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1931, 1925, 1921
1040 WACCAMAW ST	2005, 1999, 1994, 1991, 1975, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
1041 TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1041 W TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1931, 1925, 1921
1045 TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1045 W TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1931, 1925, 1921

FINDINGS

Address Researched

Address Not Identified in Research Source

105 S SYCAMORE ST	1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
106 N SYCAMORE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1931, 1925, 1921
106 SYCAMORE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
107 N SYCAMORE ST	2005, 1999, 1994, 1991, 1989, 1975, 1931, 1925, 1921
107 SYCAMORE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
108 IRWIN AVE	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1925, 1921
108 N IRWIN AVE	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
108 S IRWIN AVE	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
108 S SYCAMORE ST	2005, 1999, 1994, 1991, 1989, 1984, 1975, 1944, 1937, 1931, 1925, 1921
109 IRWIN AVE	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1931, 1925, 1921
109 N IRWIN AVE	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
109 N SYCAMORE ST	2005, 1999, 1994, 1991, 1989, 1975, 1959, 1931, 1925, 1921
109 SYCAMORE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
110 IRWIN AVE	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1925, 1921
110 N IRWIN AVE	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
1101 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1949, 1944, 1937, 1931, 1925, 1921
1101 E TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1944, 1937, 1931, 1925, 1921
1101 TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1101 W TRADE ST	2005, 1999, 1991, 1989, 1984, 1979, 1975, 1974, 1931, 1925, 1921
1102 TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1103 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931, 1921
1103 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1949, 1944, 1937, 1931, 1925, 1921
1103 W TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1953, 1949, 1937, 1931, 1925, 1921
1104 W TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1949, 1931, 1925, 1921
1105 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1105 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1931, 1925, 1921

FINDINGS

Address Researched

Address Not Identified in Research Source

1105 E TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1944, 1937, 1931, 1925, 1921
1105 TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1105 W TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1937, 1931, 1925, 1921
1106 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1944, 1937, 1931, 1925, 1921
1106 TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1106 W TRADE ST	2005, 1999, 1994, 1991, 1984, 1979, 1975, 1974, 1969, 1964, 1931, 1925, 1921
1107 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1107 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1931, 1925, 1921
1107 W TRADE ST	2005, 1999, 1994, 1991, 1984, 1979, 1975, 1974, 1969, 1953, 1949, 1944, 1937, 1931, 1925, 1921
1108 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1108 TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1921
1108 W 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1937, 1931, 1925, 1921
1109 E TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1931, 1925, 1921
1109 TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1109 W TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1931, 1925, 1921
111 N SYCAMORE ST	2005, 1999, 1994, 1991, 1989, 1975, 1931, 1925, 1921
111 S IRWIN AVE	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
111 SYCAMORE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1110 W TRADE ST	2005, 1999, 1991, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
1111 W 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1944, 1937, 1931, 1925, 1921
1111 W TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1953, 1949, 1944, 1931, 1925, 1921
1112 TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1112 W TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1937, 1931, 1925, 1921
1113 TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1113 W 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1949, 1944, 1937, 1931, 1925, 1921

FINDINGS

Address Researched

Address Not Identified in Research Source

1113 W TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1953, 1949, 1944, 1931, 1925, 1921
1114 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1114 W 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1949, 1944, 1937, 1931, 1925, 1921
1114 W TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1937, 1931, 1925, 1921
1115 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1115 W 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1944, 1937, 1931, 1925, 1921
1115 W TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1931, 1925, 1921
1116 TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1116 W TRADE ST	2005, 1999, 1991, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1931, 1925, 1921
1118 TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1119 TRADE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1119 W 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1937, 1931, 1925, 1921
112 IRWIN AVE	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1925, 1921
112 N IRWIN AVE	2005, 1994, 1991, 1975, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
112 N SYCAMORE ST	2005, 1999, 1994, 1991, 1989, 1975, 1931, 1925, 1921
112 S IRWIN AVE	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
112 SYCAMORE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1124 W TRADE ST	2005, 1999, 1991, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
1125 W 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1953, 1949, 1944, 1937, 1931, 1925, 1921
1127 W TRADE ST	2005, 1999, 1991, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
1129 W TRADE ST	2005, 1999, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
113 N SYCAMORE ST	2005, 1999, 1994, 1991, 1989, 1975, 1931, 1925, 1921
113 S SYCAMORE ST	1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
113 SYCAMORE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
114 S SYCAMORE ST	2005, 1999, 1994, 1991, 1989, 1984, 1975, 1944, 1937, 1931, 1925, 1921

FINDINGS

Address Researched

Address Not Identified in Research Source

115 IRWIN AVE	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1931, 1925, 1921
115 N IRWIN AVE	2005, 1999, 1994, 1991, 1989, 1984, 1975, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
115 N SYCAMORE ST	2005, 1999, 1994, 1991, 1989, 1975, 1931, 1925, 1921
115 S IRWIN AVE	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
115 S SYCAMORE ST	1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
115 SYCAMORE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
116 IRWIN AVE	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1953, 1949, 1944, 1937, 1931, 1925, 1921
116 N IRWIN AVE	2005, 1999, 1994, 1991, 1989, 1984, 1975, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
118 N SYCAMORE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1931, 1925, 1921
118 S SYCAMORE ST	1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
118 SYCAMORE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
119 IRWIN AVE	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1925, 1921
119 N IRWIN AVE	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
119 N SYCAMORE ST	2005, 1999, 1994, 1991, 1989, 1975, 1931, 1925, 1921
119 S IRWIN AVE	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
119 SYCAMORE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
120 N SYCAMORE ST	2005, 1999, 1994, 1991, 1989, 1975, 1937, 1931, 1925, 1921
120 SYCAMORE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1200 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931
1201 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1201 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1931, 1925, 1921
1207 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1207 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1937, 1931, 1925, 1921
1208 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1208 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1931, 1925, 1921
121 N SYCAMORE ST	2005, 1999, 1994, 1991, 1989, 1975, 1931, 1925, 1921

FINDINGS

Address Researched

Address Not Identified in Research Source

121 SYCAMORE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1211 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1921
1211 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1931, 1925, 1921
1212 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1212 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1931, 1925, 1921
1213 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931, 1921
1215 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1215 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1931, 1925, 1921
1218 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1218 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1931, 1925, 1921
1219 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
122 IRWIN AVE	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1925, 1921
122 N IRWIN AVE	2005, 1999, 1994, 1991, 1975, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
122 N SYCAMORE ST	1999, 1994, 1991, 1989, 1975, 1931, 1925, 1921
122 S SYCAMORE ST	2005, 1999, 1994, 1991, 1989, 1984, 1975, 1937, 1931, 1925, 1921
122 SYCAMORE ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1221 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1931, 1925, 1921
1222 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1222 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1931, 1925, 1921
1223 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1223 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1931, 1925, 1921
1224 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1224 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1931, 1925, 1921
1227 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1931, 1925, 1921
123 S SYCAMORE ST	1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
1230 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1230 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1931, 1925, 1921
1231 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921

FINDINGS

Address Researched

Address Not Identified in Research Source

1231 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1931, 1925, 1921
1232 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1949, 1944, 1937, 1931, 1925, 1921
1234 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1234 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1931, 1925, 1921
1235 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1235 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1931, 1925, 1921
1236 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1236 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1931, 1925, 1921
1239 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921
1239 E 5TH ST	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1931, 1925, 1921
124 S SYCAMORE ST	1999, 1994, 1991, 1989, 1984, 1979, 1975, 1959, 1944, 1937, 1931, 1925, 1921
125 IRWIN AVE	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1931, 1925, 1921
125 N IRWIN AVE	1994, 1991, 1975, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
125 N SYCAMORE ST	1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
127 N SYCAMORE ST	2005, 1999, 1994, 1991, 1989, 1975, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
127 S IRWIN AVE	2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
129 N SYCAMORE ST	2005, 1999, 1994, 1991, 1989, 1975, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
129 S IRWIN AVE	2005, 1999, 1994, 1991, 1989, 1984, 1975, 1974, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
131 N SYCAMORE ST	1999, 1994, 1991, 1989, 1975, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
131 S IRWIN AVE	2005, 1999, 1994, 1991, 1989, 1984, 1975, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
131 S SYCAMORE ST	1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
134 S SYCAMORE ST	1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
135 S SYCAMORE ST	1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
137 S IRWIN AVE	2005, 1999, 1991, 1975, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
143 S IRWIN AVE	2005, 1999, 1991, 1975, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
146 S SYCAMORE ST	1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921
149 S SYCAMORE ST	1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921

FINDINGS

Address Researched

150 S SYCAMORE ST

151 IRWIN AVE

156 S SYCAMORE ST

162 S SYCAMORE ST

200 S IRWIN AVE

201 IRWIN AVE

201 N IRWIN AVE

201 S IRWIN AVE

201 SYCAMORE ST

202 S IRWIN AVE

203 SYCAMORE ST

204 S IRWIN AVE

204 S SYCAMORE ST

205 N SYCAMORE ST

205 S IRWIN AVE

205 S SYCAMORE ST

205 SYCAMORE ST

206 S IRWIN AVE

207 N SYCAMORE ST

207 SYCAMORE ST

208 N SYCAMORE ST

208 S IRWIN AVE

208 S SYCAMORE ST

208 SYCAMORE ST

209 S IRWIN AVE

209 SYCAMORE ST

210 N SYCAMORE ST

Address Not Identified in Research Source

1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921

2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921

1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921

1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921

2005, 1999, 1991, 1975, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921

2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964

2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921

2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921

2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937

2005, 1999, 1994, 1991, 1975, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921

2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931, 1921

2005, 1999, 1994, 1991, 1975, 1974, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921

1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921

2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1931, 1925, 1921

2005, 1991, 1975, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921

1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921

2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931

2005, 1999, 1991, 1984, 1975, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921

2005, 1999, 1994, 1991, 1989, 1975, 1931, 1925, 1921

2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921

2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1931, 1925, 1921

2005, 1999, 1994, 1991, 1989, 1975, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921

2005, 1999, 1994, 1991, 1989, 1984, 1975, 1953, 1931, 1925, 1921

2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921

2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921

2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931, 1921

2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1931, 1925, 1921

FINDINGS

Address Researched

210 S IRWIN AVE

210 SYCAMORE ST

211 N SYCAMORE ST

211 SYCAMORE ST

212 N SYCAMORE ST

214 S SYCAMORE ST

215 S IRWIN AVE

216 S SYCAMORE ST

217 S IRWIN AVE

218 S SYCAMORE ST

220 S SYCAMORE ST

221 N SYCAMORE ST

221 S IRWIN AVE

221 S SYCAMORE ST

221 SYCAMORE ST

225 S SYCAMORE ST

226 S SYCAMORE ST

Address Not Identified in Research Source

2005, 1999, 1994, 1991, 1989, 1984, 1975, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921

2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921

2005, 1999, 1994, 1991, 1975, 1931, 1925, 1921

2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921

2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1944, 1937, 1931, 1925, 1921

2005, 1999, 1994, 1991, 1989, 1975, 1937, 1931, 1925, 1921

2005, 1999, 1991, 1975, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921

1999, 1994, 1991, 1989, 1975, 1937, 1931, 1925, 1921

2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921

2005, 1999, 1994, 1991, 1989, 1984, 1975, 1937, 1931, 1925, 1921

2005, 1999, 1994, 1991, 1989, 1984, 1975, 1974, 1949, 1937, 1931, 1925, 1921

2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1949, 1931, 1925, 1921

2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921

2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1944, 1937, 1931, 1925, 1921

2005, 1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1925, 1921

1999, 1994, 1991, 1989, 1984, 1979, 1975, 1974, 1969, 1964, 1959, 1953, 1949, 1944, 1937, 1931, 1925, 1921

2005, 1999, 1994, 1991, 1989, 1979, 1975, 1944, 1937, 1931, 1925, 1921

ARCADIS

Historical Topographic Maps



Gateway Area

1100 W. Trade Street
Charlotte, NC 28202

Inquiry Number: 2999896.4
February 25, 2011

EDR Historical Topographic Map Report

EDR Historical Topographic Map Report

Environmental Data Resources, Inc.s (EDR) Historical Topographic Map Report is designed to assist professionals in evaluating potential liability on a target property resulting from past activities. EDRs Historical Topographic Map Report includes a search of a collection of public and private color historical topographic maps, dating back to the early 1900s.

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report AS IS. Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2011 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

Historical Topographic Map




N ↑	TARGET QUAD	SITE NAME: Gateway Area	CLIENT: ARCADIS U.S., Inc.
	NAME: CHARLOTTE	ADDRESS: 1100 W. Trade Street Charlotte, NC 28202	CONTACT: Sean Drain
	MAP YEAR: 1905	LAT/LONG: 35.236 / -80.8531	INQUIRY#: 2999896.4
	SERIES: 15		RESEARCH DATE: 02/25/2011
	SCALE: 1:62500		

Historical Topographic Map




N ↑	TARGET QUAD	SITE NAME: Gateway Area	CLIENT: ARCADIS U.S., Inc.
	NAME: CHARLOTTE	ADDRESS: 1100 W. Trade Street Charlotte, NC 28202	CONTACT: Sean Drain
	MAP YEAR: 1942	LAT/LONG: 35.236 / -80.8531	INQUIRY#: 2999896.4
	SERIES: 30		RESEARCH DATE: 02/25/2011
	SCALE: 1:125000		

Historical Topographic Map

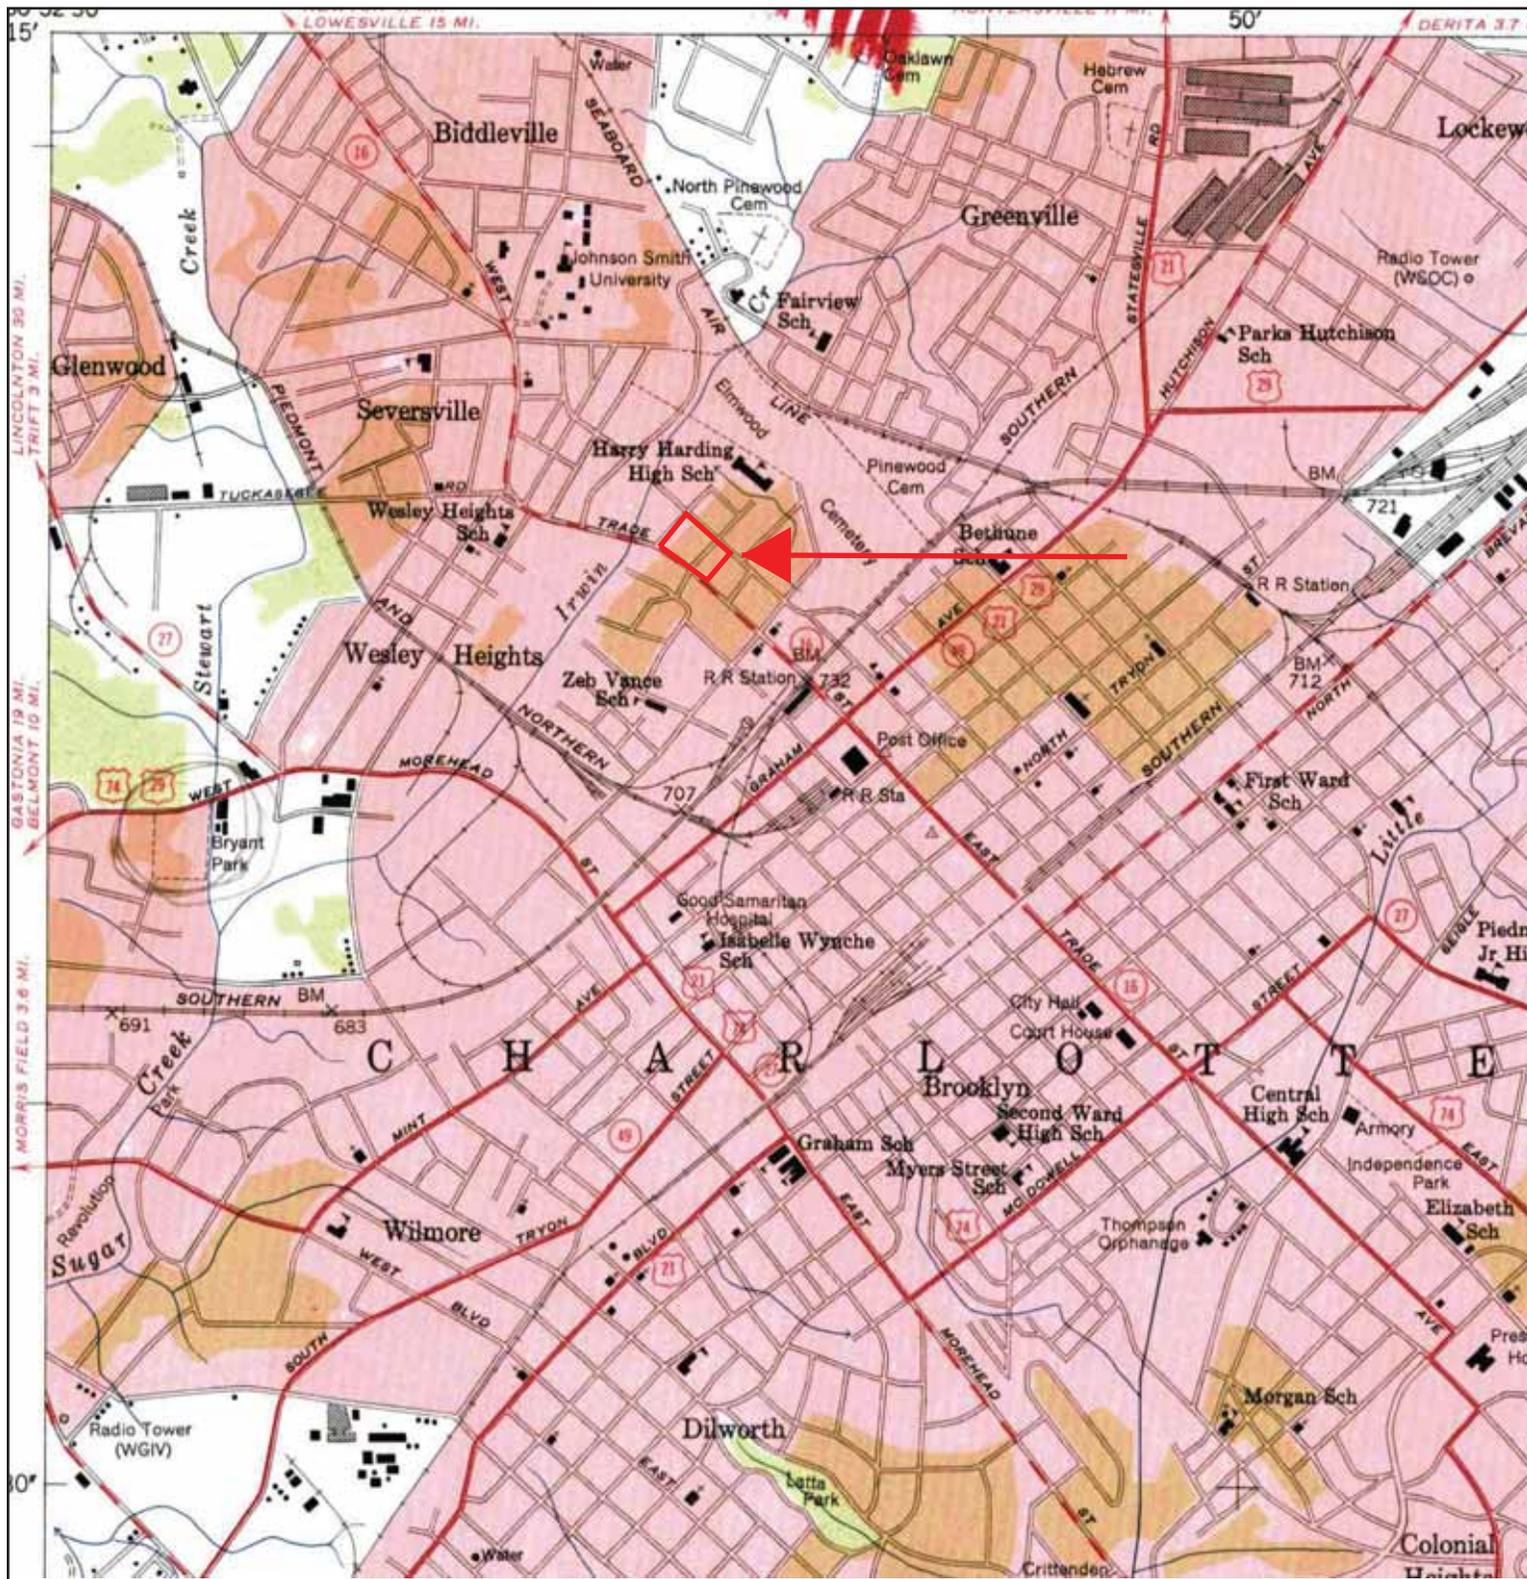


	TARGET QUAD	SITE NAME: Gateway Area	CLIENT: ARCADIS U.S., Inc.
	NAME: CHARLOTTE EAST	ADDRESS: 1100 W. Trade Street	CONTACT: Sean Drain
	MAP YEAR: 1949	CHARLOTTE, NC 28202	INQUIRY#: 2999896.4
	SERIES: 7.5	LAT/LONG: 35.236 / -80.8531	RESEARCH DATE: 02/25/2011
	SCALE: 1:24000		

Historical Topographic Map

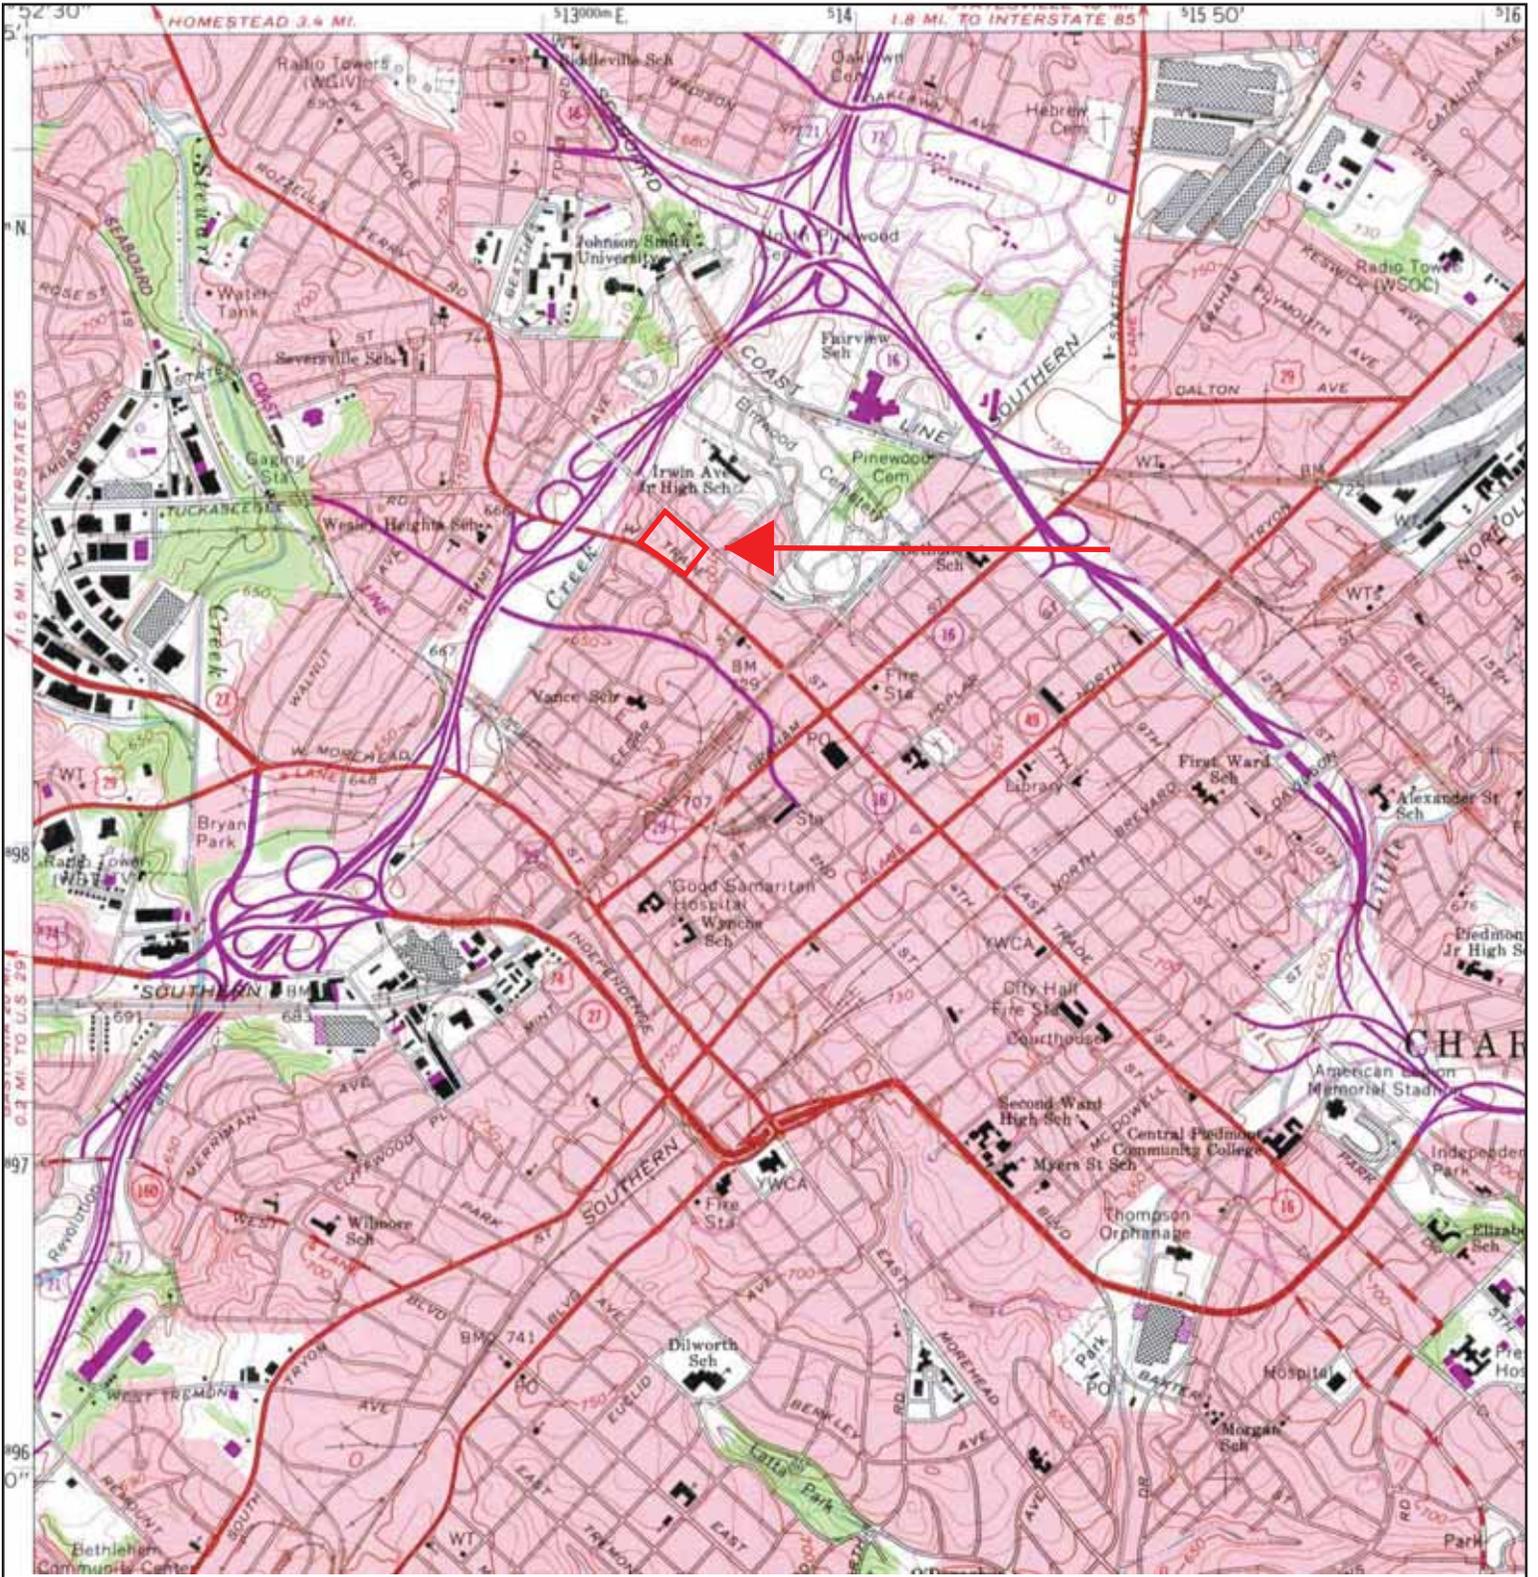

<p>N ↑</p>	TARGET QUAD	SITE NAME: Gateway Area	CLIENT: ARCADIS U.S., Inc.
	NAME: CHARLOTTE EAST	ADDRESS: 1100 W. Trade Street	CONTACT: Sean Drain
	MAP YEAR: 1980	Charlotte, NC 28202	INQUIRY#: 2999896.4
	PHOTOREVISED: 1967	LAT/LONG: 35.236 / -80.8531	RESEARCH DATE: 02/25/2011
	SERIES: 7.5		
	SCALE: 1:24000		

Historical Topographic Map

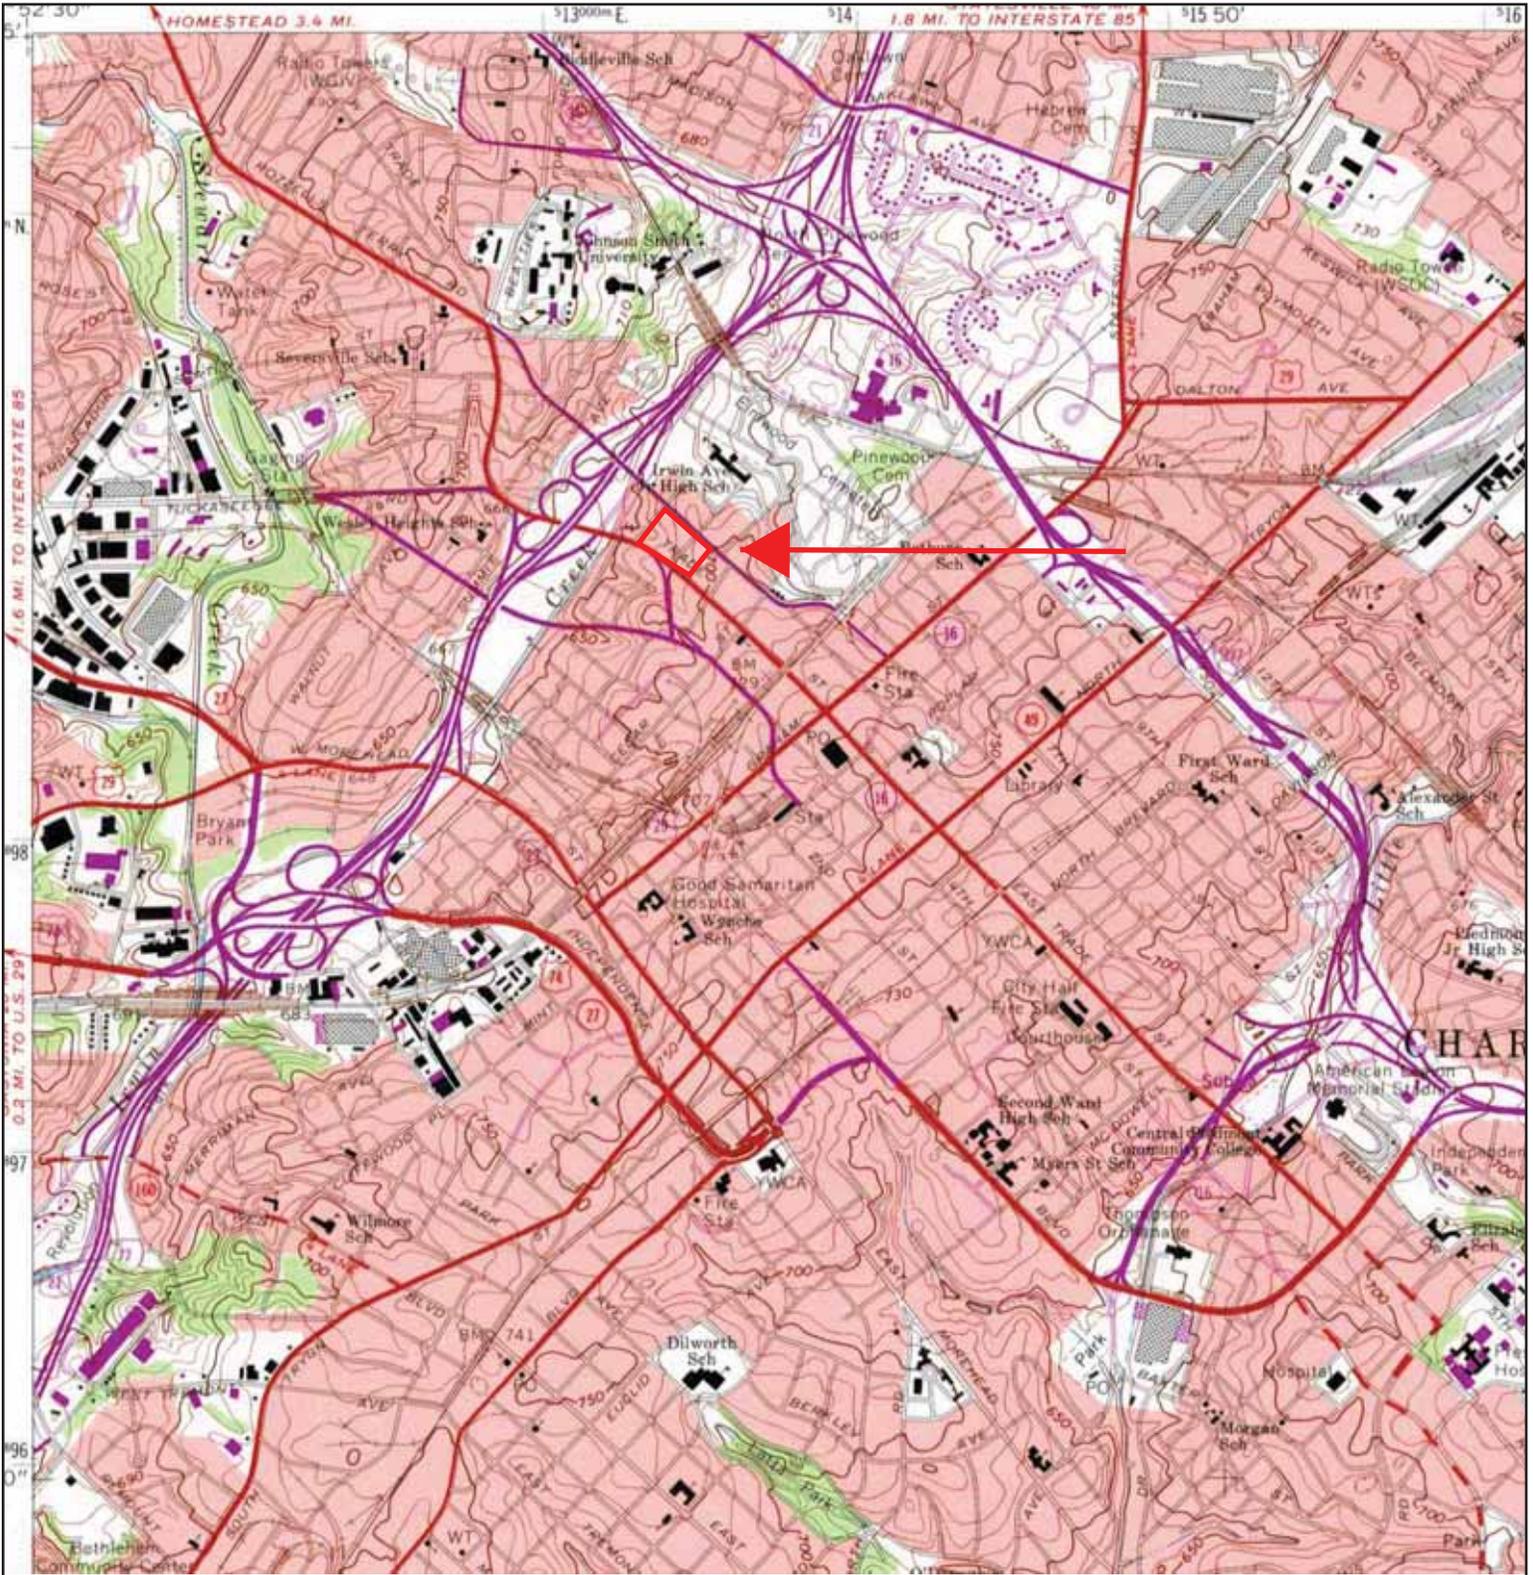

	TARGET QUAD	SITE NAME: Gateway Area	CLIENT: ARCADIS U.S., Inc.
	NAME: CHARLOTTE EAST	ADDRESS: 1100 W. Trade Street	CONTACT: Sean Drain
	MAP YEAR: 1988	Charlotte, NC 28202	INQUIRY#: 2999896.4
	PHOTOREVISED: 1967	LAT/LONG: 35.236 / -80.8531	RESEARCH DATE: 02/25/2011
	SERIES: 7.5		
	SCALE: 1:24000		

ARCADIS

NCDENR Records

Certified
by Mail or Priority Mail
in two years

North Carolina
Department of Environment and Natural Resources
Mooresville Regional Office

Michael F. Easley, Governor
William G. Ross Jr., Secretary
William L. Meyer, Director



DIVISION OF WASTE MANAGEMENT
April 17, 2001

CERTIFIED MAIL
RETURN RECEIPT REQUESTED

Bank of America, Corporate Real Estate
NC1-023-04-04
525 North Tryon Street
Charlotte, North Carolina 28255
Attention: Andrea Eller

RE: Notice of Regulatory Requirements
15A NCAC 2L .0115(d)
RISK-BASED ASSESSMENT AND CORRECTIVE ACTION
FOR PETROLEUM UNDERGROUND STORAGE TANKS

Gateway Village
950 Block of West Trade Street
Mecklenburg County, North Carolina
Incident # 21745
Low Risk Classification

Dear Ms. Eller:

Information received by this office on March 24, 2000 confirms a release or discharge from a petroleum underground storage tank (UST) system at the above-referenced site. Records indicate that you are the owner of this UST system. This letter is a standard notice explaining the actions you must take as a result of the release or discharge in accordance with North Carolina statutes and rules. The UST Section of the Division of Waste Management (the Division) administers the state's rules for USTs and the required response for petroleum releases. Those rules are located in Title 15A, Subchapter 2L and Title 15A, Subchapter 2N of the North Carolina Administrative Code (NCAC).

The risk-based rule for petroleum USTs, 15A NCAC 2L .0115(d), states that the department shall classify the risk of each known discharge or release from the UST system. A review of the March 30, 2001 Limited Site Assessment (LSA) Report indicates that the discharge or release poses no significant risk to human health of the environment.

Based on the information contained in the LSA report, the discharge or release at the subject site has been classified as "low risk." In addition, the land use at the site has been classified as industrial/commercial. Please note that 15ANCAC 2L .0115(e) requires you to notify the Division of any changes that might affect the risk or land use classifications that have been assigned.

Bank of America
April 17, 2001


Based on information provided in your March 30, 2001 LSA report, confirmatory soil samples collected during the time of tank closure were beneath the water table and therefore are not necessarily representative of soil contamination that remains in place at the site. Samples along the sidewalls of the UST excavation are necessary to determine the level of soil contamination that remains on site. Samples must be analyzed for methods EPA 8260 and 8270 as well as MADEP VPH and EPH. A report detailing the location, depth and results of the soil samples is due in this office within **60 days** of receipt of this letter.

Your prompt attention to the items described herein is required. Failure to comply with the state's rules in the manner and time specified, may result in the assessment of civil penalties and /or the use of other enforcement mechanisms available to the state. Each day that a violation continues may be considered a separate violation.

Also note that performing assessment and cleanup work that is not required under 15A NCAC 2L.0115 is not reimbursable from the Commercial or Noncommercial Leaking Petroleum Underground Storage Tank Cleanup Funds.


If you have any questions regarding the actions that must be taken or the rules mentioned in this letter, please contact me at the letterhead address and/or at (704) 663-1699 ext. 248. If you have any questions regarding trust fund eligibility or reimbursement, please contact the UST Section at (919) 733-8486.

Sincerely,

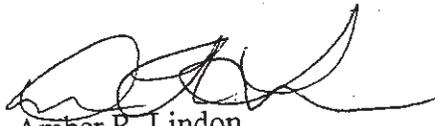
Amber R. Lindon
Hydrogeological Technician II


cc: Ruth Strauss - Central Office
Robert Foster, P.G. - Law Engineering & Environmental Services, Inc.

First-Class
USPS
Postage &
Permit No. G

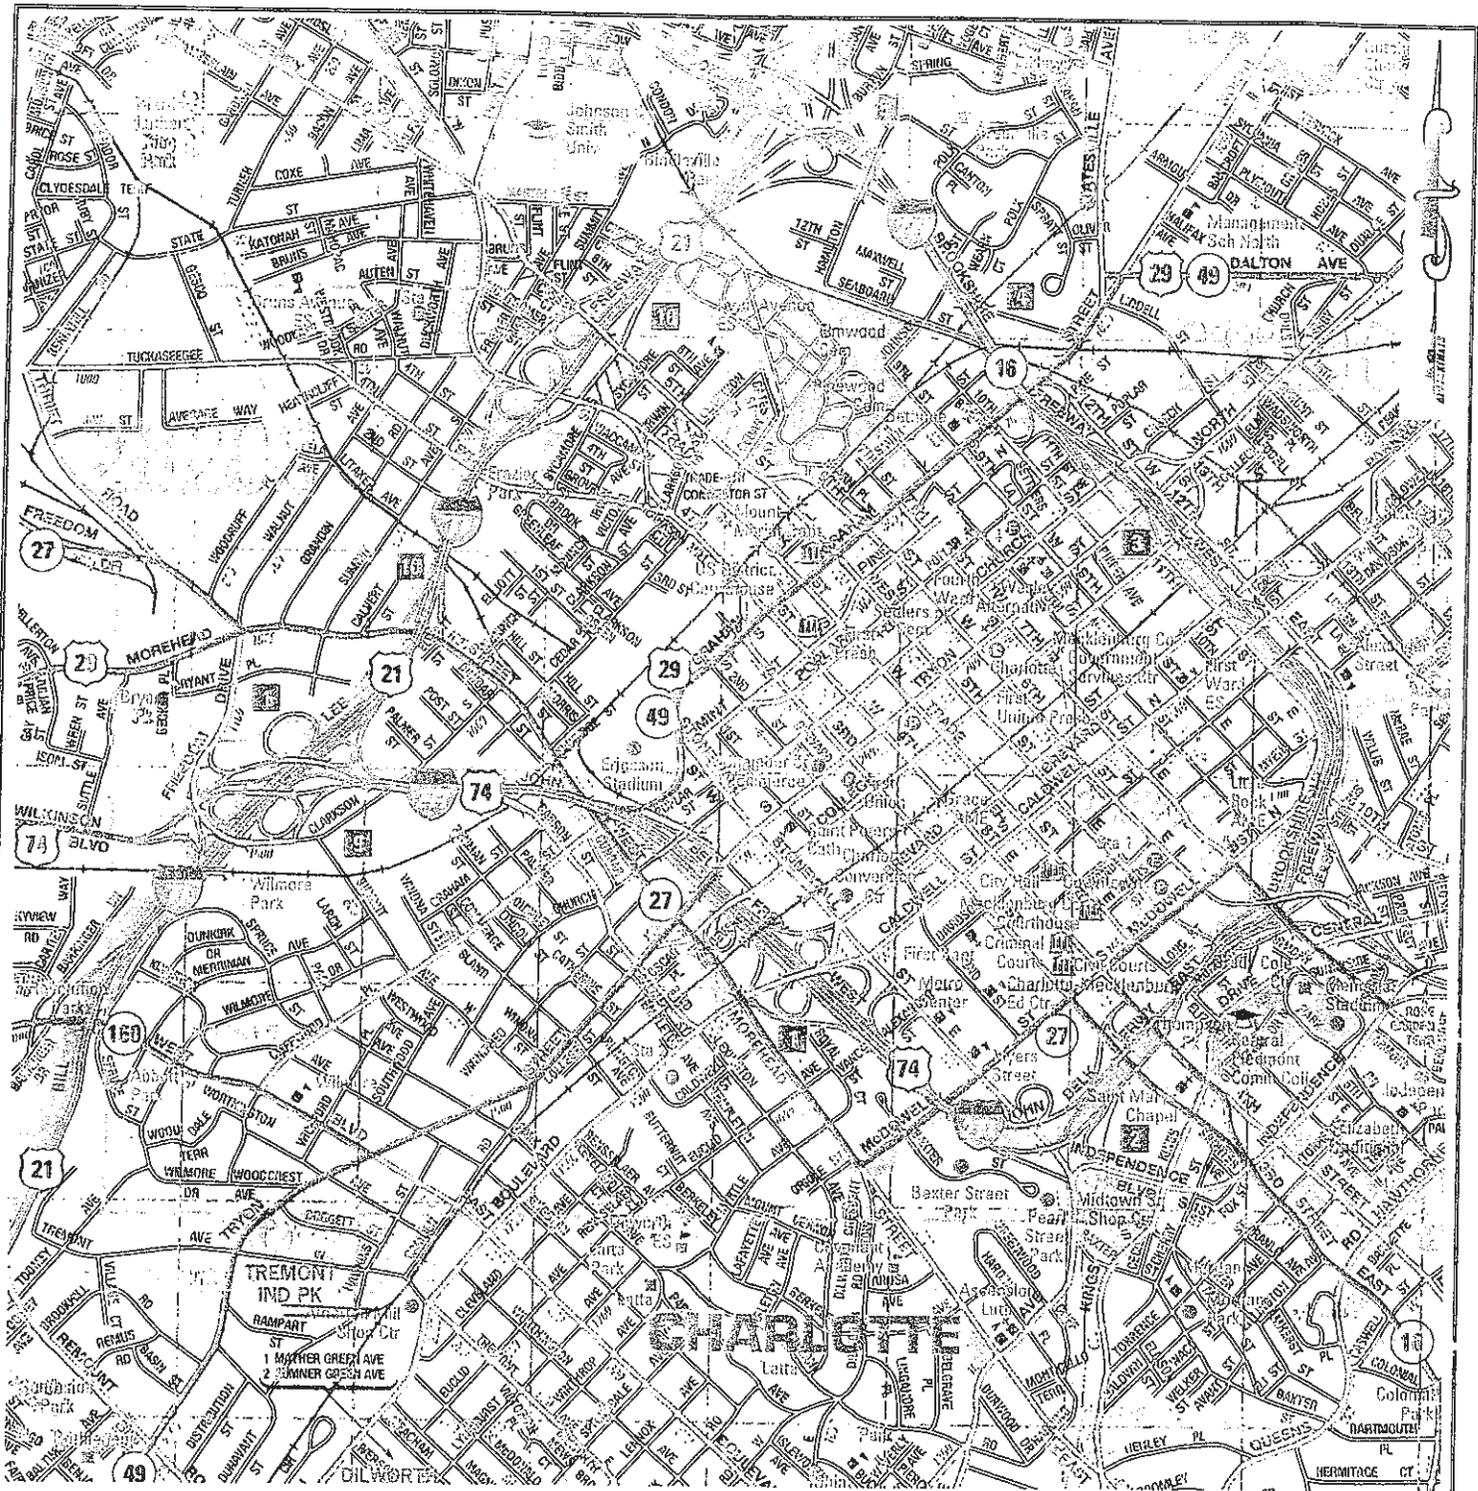

EXPLANATION

 APPROXIMATE SITE LOCATION



APPROXIMATE SCALE IN FEET


EF: MECKLENBURG COUNTY, N.C. STREET MAP BOOK, 2ND EDITION; DATED 1988.



LAW
ENGINEERING AND ENVIRONMENTAL SERVICES
CHARLOTTE, NORTH CAROLINA

SITE LOCATION MAP
GATEWAY VILLAGE DEVELOPMENT
CHARLOTTE, NORTH CAROLINA


PREPARED <i>CVN</i>	DATE <i>1/27/00</i>	CHECKED <i>RCF</i>	DATE <i>2/1/2000</i>	JOB NO.	30100-7-3245	FIGURE	1
---------------------	---------------------	--------------------	----------------------	---------	--------------	--------	---

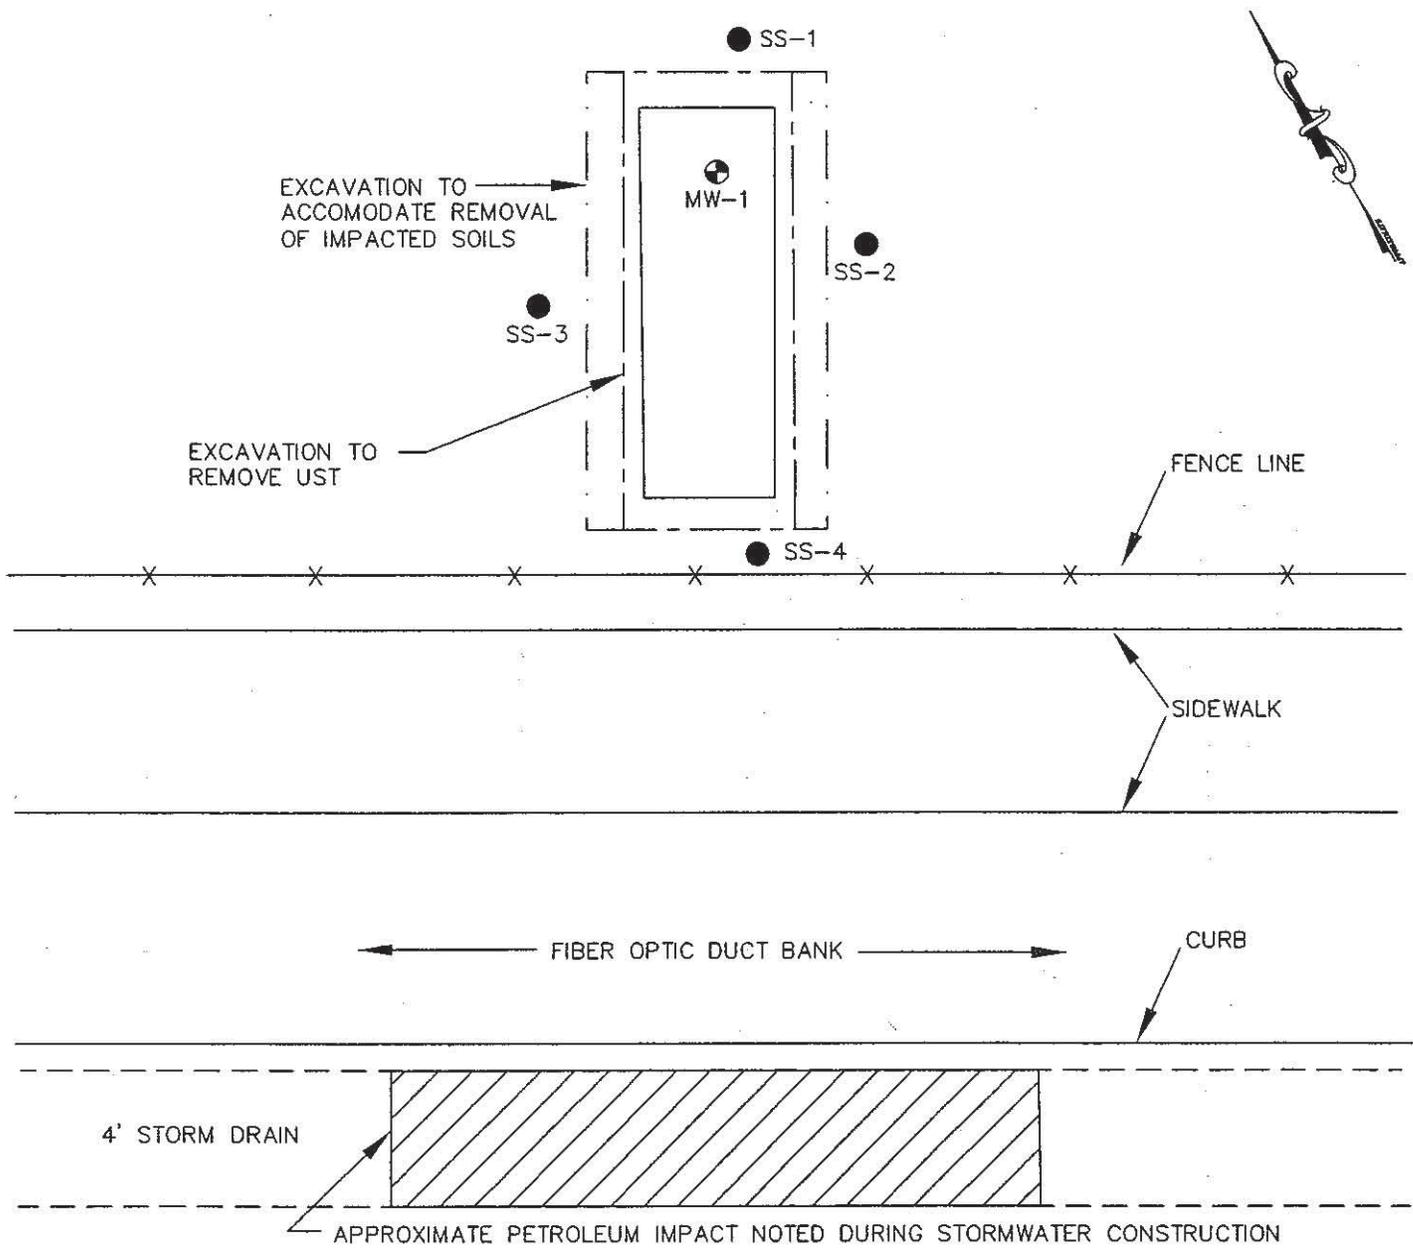


W. TRADE STREET

EXPLANATION

- ⊕ APPROXIMATE LOCATION OF MONITORING WELL
- APPROXIMATE LOCATION OF SOIL SAMPLE



REF: SITE SKETCH PREPARED FROM FIELD NOTES BY LAW ENGINEERING PERSONNEL.



SAMPLE LOCATION PLAN
 GATEWAY VILLAGE
 CHARLOTTE, NORTH CAROLINA

PREPARED BY	DATE	CHECKED <i>Raf</i>	DATE <i>5-31-01</i>	JOB NO.	30100-7-3245	FIGURE	2
-------------	------	--------------------	---------------------	---------	--------------	--------	---



**UST CLOSURE REPORT
GATEWAY VILLAGE
950 BLOCK OF WEST TRADE STREET
CHARLOTTE, NORTH CAROLINA**

Prepared for:

**BANK OF AMERICA
C/O COUSINS PROPERTIES
CHARLOTTE, NORTH CAROLINA**

Prepared by:

**Law Engineering and Environmental Services, Inc.
Charlotte, North Carolina**

**July 15, 2002
LAW Project 30100-2-2544**



LAW

RESOURCES CREATING SOLUTIONS

f2

July 15, 2002

RECEIVED

JUL 19 2002

NC DEPT. OF ENVIRONMENT
AND NATURAL RESOURCES
MOORESVILLE REGIONAL OFFICE

Mr. Rob Speice
Bank of America
C/o Cousins Properties
800 West Trade Street, Suite 100
Charlotte, North Carolina 28202

Subject: **UST Closure Report**
Gateway Village
950 Block of West Trade Street
Charlotte, North Carolina
LAW Project 30100-2-2544

Dear Mr. Speice:

Law Engineering and Environmental Services, Inc. (LAW) is pleased to submit this UST Closure Report. The report was prepared in the GW/UST-12 format requested by the North Carolina Department of Environment and Natural Resources (NCDENR), Division of Waste Management (DWM) UST Section. LAW appreciates the opportunity to be of service on this project. If you have any questions concerning this report, please contact us at (704) 357-8600.

Sincerely,

LAW ENGINEERING AND ENVIRONMENTAL SERVICES, INC.

Flora J. Elliott, CHMM
Senior Scientist

Christopher L. Corbett, P.C.
Principal Geologist
Registered, NC #

FJE/CLC:fje

BY WITH PERMISSION

Attachment

cc: Mr. Allen Schiff, Mooresville NCDENR

**UNDERGROUND STORAGE TANK CLOSURE REPORT
GATEWAY VILLAGE
950 WEST TRADE STREET
CHARLOTTE, NORTH CAROLINA**

I. General Information

A. Ownership of UST(s)

1. Name of UST owner, owner address and telephone number:

**Bank of America
800 West Trade Street, Suite 100
Charlotte, North Carolina 28202
704-683-0102**

B. Facility Information

1. Facility name: **Gateway Village**
2. Facility ID #: **N/A**
3. Facility address, telephone number and county:
**950 West Trade Street
Charlotte, North Carolina 28202**

C. Contacts

1. Name, address, telephone number and job title of primary contact person:

**Mr. Rob Speice
800 West Trade Street, Suite 100
Charlotte, North Carolina 28202
704-683-0102**

2. Name, address and telephone number of closure contractor:

**Rodgers Builders
5701 North Sharon Amity Road
Charlotte, North Carolina 28215
(704) 537-6044**

3. Name, address and telephone number of primary consultant:

**Mr. Chris Corbitt, P.G.
Law Engineering and Environmental Services, Inc.
2801 Yorkmont Road
Charlotte, North Carolina 28208
(704) 357-8600**

4. Name, address, telephone number, and State certification number of laboratory:

Prism Laboratories, Inc.
449 Springbrook Road
Charlotte, North Carolina 28224
(704) 529-6364
North Carolina Certification No. 402

D. UST Information

Tank no.	Installation Dates	Size in Gallons	Tank Dimensions	Last Contents	Previous Contents (if any)
1	Unknown	2,000	12'2" x 5'4"	Heating Oil	Unknown

E. Site Characteristics

1. Describe any past releases at this site:

Laboratory results from tank closure activities on the 950 block of West Trade Street in December 1999 exhibited petroleum hydrocarbons in the soils above state action levels (Incident No. 21745). LAW installed a 2-inch monitor well to sample groundwater at the tank location as part of a Phase I LSA. Groundwater analytical results for the well indicated the presence of benzene at 1.1 ug/L and various tentatively identified compounds that were below the interim standards. No further assessment was required and the site was closed out by the NCDENR.

2. Is the facility active or inactive at this time? If the facility is inactive note the last time the USTs were in operation:

The area is currently used as a parking lot for Gateway Village. The UST was formerly used to store fuel oil. The UST was inactive at the time of removal.

3. Describe surrounding property use (for example, residential, commercial, farming, etc.)

The site is located at the east corner of West Trade Street and North Irwin Avenue in downtown Charlotte. The surrounding property use is residential and commercial. A site Location Map is included as Figure 1.

4. Describe site geology/hydrogeology

The project site is located in the Piedmont Physiographic Province. The Piedmont Province has been divided into five parallel belts:

from east to west, the Carolina Slate Belt, Charlotte, King's Mountain, Inner Piedmont and Brevard Belts. These Belts represent the major litho-tectonic features of the Piedmont. The site is located within the Charlotte Belt of the Piedmont Physiographic Province consisting generally of low rounded hills and long rolling northeast to southwest trending ridges with incised creek channels. Based on a review of the Geologic Map of the Charlotte 1° x 2° Quadrangle, North and South Carolina (1988), the site is underlain by rocks consisting of metamorphosed volcanic rocks. No major geologic features are documented in published literature in the site area. Since no geologic features were identified on or near the site, it is reasonable to assume that the direction of near-surface ground-water flow under static conditions (no pumping interference) approximates the surface topography of the site.

Surface and subsurface drainage patterns within the Piedmont typically indicate the direction contaminants would be transported by surface water or ground water. The direction and movement of ground water through soil is dependent on soil type and the presence of relict structures and textures of the underlying rock. Fractures, faults, folds and foliation planes affect the migration of ground water in rock.

Ground-water recharge within the Piedmont region generally occurs on upland areas. The residual soils and saprolite act as an infiltration medium and reservoir for water to seep into the fractures and joints of the underlying rock. Discharge from the system occurs at surface water features such as streams and lakes or at the base of slopes.

II. Closure Procedures

- A. Describe preparations for closure including the steps taken to notify authorities, permits obtained and the steps taken to clean and purge the tanks:

The tank was a non-regulated tank.

- B. Note the amount of residual material pumped from the tank(s):

On June 11, 2002, approximately 250 gallons of fuel oil and water was recovered from the UST.

- C. Describe the storage, sampling and disposal of the residual material:

HAZ-MAT Transportation and Disposal removed the contents of the tank prior to closure. About 250 gallons of water with residual fuel oil was pumped from the tank by HAZ-MAT Transportation and Disposal. A waste manifest for the disposed liquids is included in Appendix A.

D. Excavation

1. Describe excavation procedures noting the condition of the soils and the dimensions of the excavation in relation to the tanks, piping and/or pumps:

The UST was removed on June 12, 2002. The top of the tank was exposed during site grading activities. Soil was excavated from the sides of the tank using a backhoe. Soil beside and below the UST was discolored and exhibited a strong fuel oil odor. The excavation dimensions were approximately 22 feet by 15 feet with a depth of about 10.5 feet. The UST did not exhibit evidence of surface corrosion. A tank disposal manifest is attached in Appendix A. The former tank location is shown on Figure 2. Photographs of UST closure activities are provided in Appendix C.

Note the depth of tank burial(s) (from land surface to top of tank):

The top of the tank was exposed at the ground surface due to grading activities. It is unknown how deep the tank was originally buried.

2. Quantity of soil removed:

Soil was removed from the sides and beneath the tank. During sampling activities, soil was excavated to a depth of about five feet below the tank or about 10.5 feet below land surface and five feet laterally from each side of the tank. Approximately 128.13 tons of petroleum-impacted soil was removed from the excavation and transported to Environmental Soils, Inc. in Lattimore, North Carolina for land application treatment on June 12, 2002. Copies of the Certificate of Non-Hazardous Waste Disposal and the individual soil manifests from this tank closure are provided in Appendix A.

3. Describe soil type(s):

The soil from about 2 feet to 10 feet was a discolored tan brown fine to medium sandy silt.

4. Type and source of backfill used:

Soil from the site grading activities was used as backfill.

E. Contaminated Soil

1. Describe how it was determined to what extent to excavate the soil:

After removal of the tank, soil was excavated to a depth of approximately 5 feet below the bottom of the tank and five feet laterally from each side of the tank in accordance with the Groundwater Section Guidelines.

2. Describe method of temporary storage, sampling and treatment/disposal of soil:

The petroleum-impacted soil was loaded directly onto dump trucks and transported to Environmental Soils, Inc. in Lattimore, North Carolina for land application treatment on June 12, 2002. Copies of the Certificate of Non-Hazardous Waste Disposal and the individual soil manifests from this tank closure are provided in Appendix A.

III. Site Investigation

- A. Provide information on field screening and observations, include methods used to calibrate field screening instrument(s):

Soils that were observed to have petroleum staining were excavated and transported to Environmental Soils, Inc.

- B. Describe soil sampling points and sampling procedures used.

According to the Groundwater Section Guidelines, two soil samples were collected from no more than five feet below the base of the UST. Soil samples SS-1 and SS-2 were collected from a depth of 10.5 feet and are representative of soils at approximately 5 feet below the bottom of the UST. These samples represent soil that remains at the site. The samples were analyzed by EPA Methods 5035/8260 and 8270 and MADEP EPH and VPH. Sample SS-1 was also analyzed by the laboratory for total petroleum hydrocarbons, diesel range (TPH-DRO) and gasoline range organics (TPH-GRO), using EPA Methods 3550/8015M and 5030/8015M, respectively. Sample locations are presented on Figure 2.

- C. Describe groundwater or surface water sampling procedures used.

No evidence of groundwater was noted during the removal activities.

- D. Quality control measures

The samples were collected from the bucket of the backhoe using a new pair of disposable gloves, placed into laboratory-prepared sample containers, and stored on ice. The samples were delivered under chain-of-custody protocol to Prism Laboratories, Inc. in Charlotte, North Carolina.

- E. Investigation results

The laboratory results are summarized in the table below.

Constituent	Units	SS-1	SS-2	Soil-to-Water Maximum Soil Contaminant Concentration (MSCC)	Residential Maximum Soil Contaminant Concentration (MSCC)
Sec-butylbenzene	mg/kg	0.021	ND	3	156
Naphthalene	mg/kg	0.024	ND	0.58	63
C9-C12 Aliphatics	mg/kg	7.4	ND	3255	9386
C9-C10 Aromatics	mg/kg	4.2	ND	34	469
C9-C18 Aliphatics	mg/kg	72	ND	3255	9386
C11-C22 Aromatics	mg/kg	39	ND	34	469

Notes: mg/kg - milligrams per kilogram
 NS - not sampled
 ND - not detected above laboratory reporting limit
 Shaded area exceeds the soil-to-water MSCCs

Copies of the laboratory analytical data reports are provided in Appendix B. TPH analyses were conducted for Environmental Soils, Inc. as part of their disposal requirements.

IV. Conclusions and Recommendations


The laboratory results did not identify detectable concentrations of petroleum constituents above the respective Residential Maximum Soil Contaminant Concentrations. Only C11-C22 Aromatics exceeded the Soil to Groundwater Maximum Contaminant Concentrations.

It is our understanding of the current guidelines that any of the detected petroleum constituents that exceed the currently established standards would require additional assessment to obtain closure (No Further Action Letter) at the site.


V. Signature of Professional Engineer or Licensed Geologist



Licensed Geologist/License Number: Christopher L. Corbitt, P.G./NC# 1015

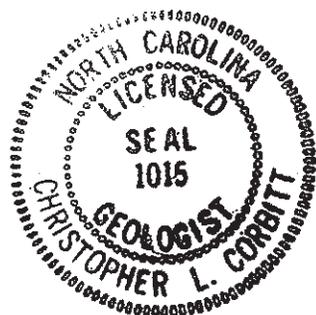

G:\PROJECTS\30140 ENVIRONMENTAL\JOBS\2002\2544 GATEWAY T-SITE.dwg 07/11/02 MHARRISON

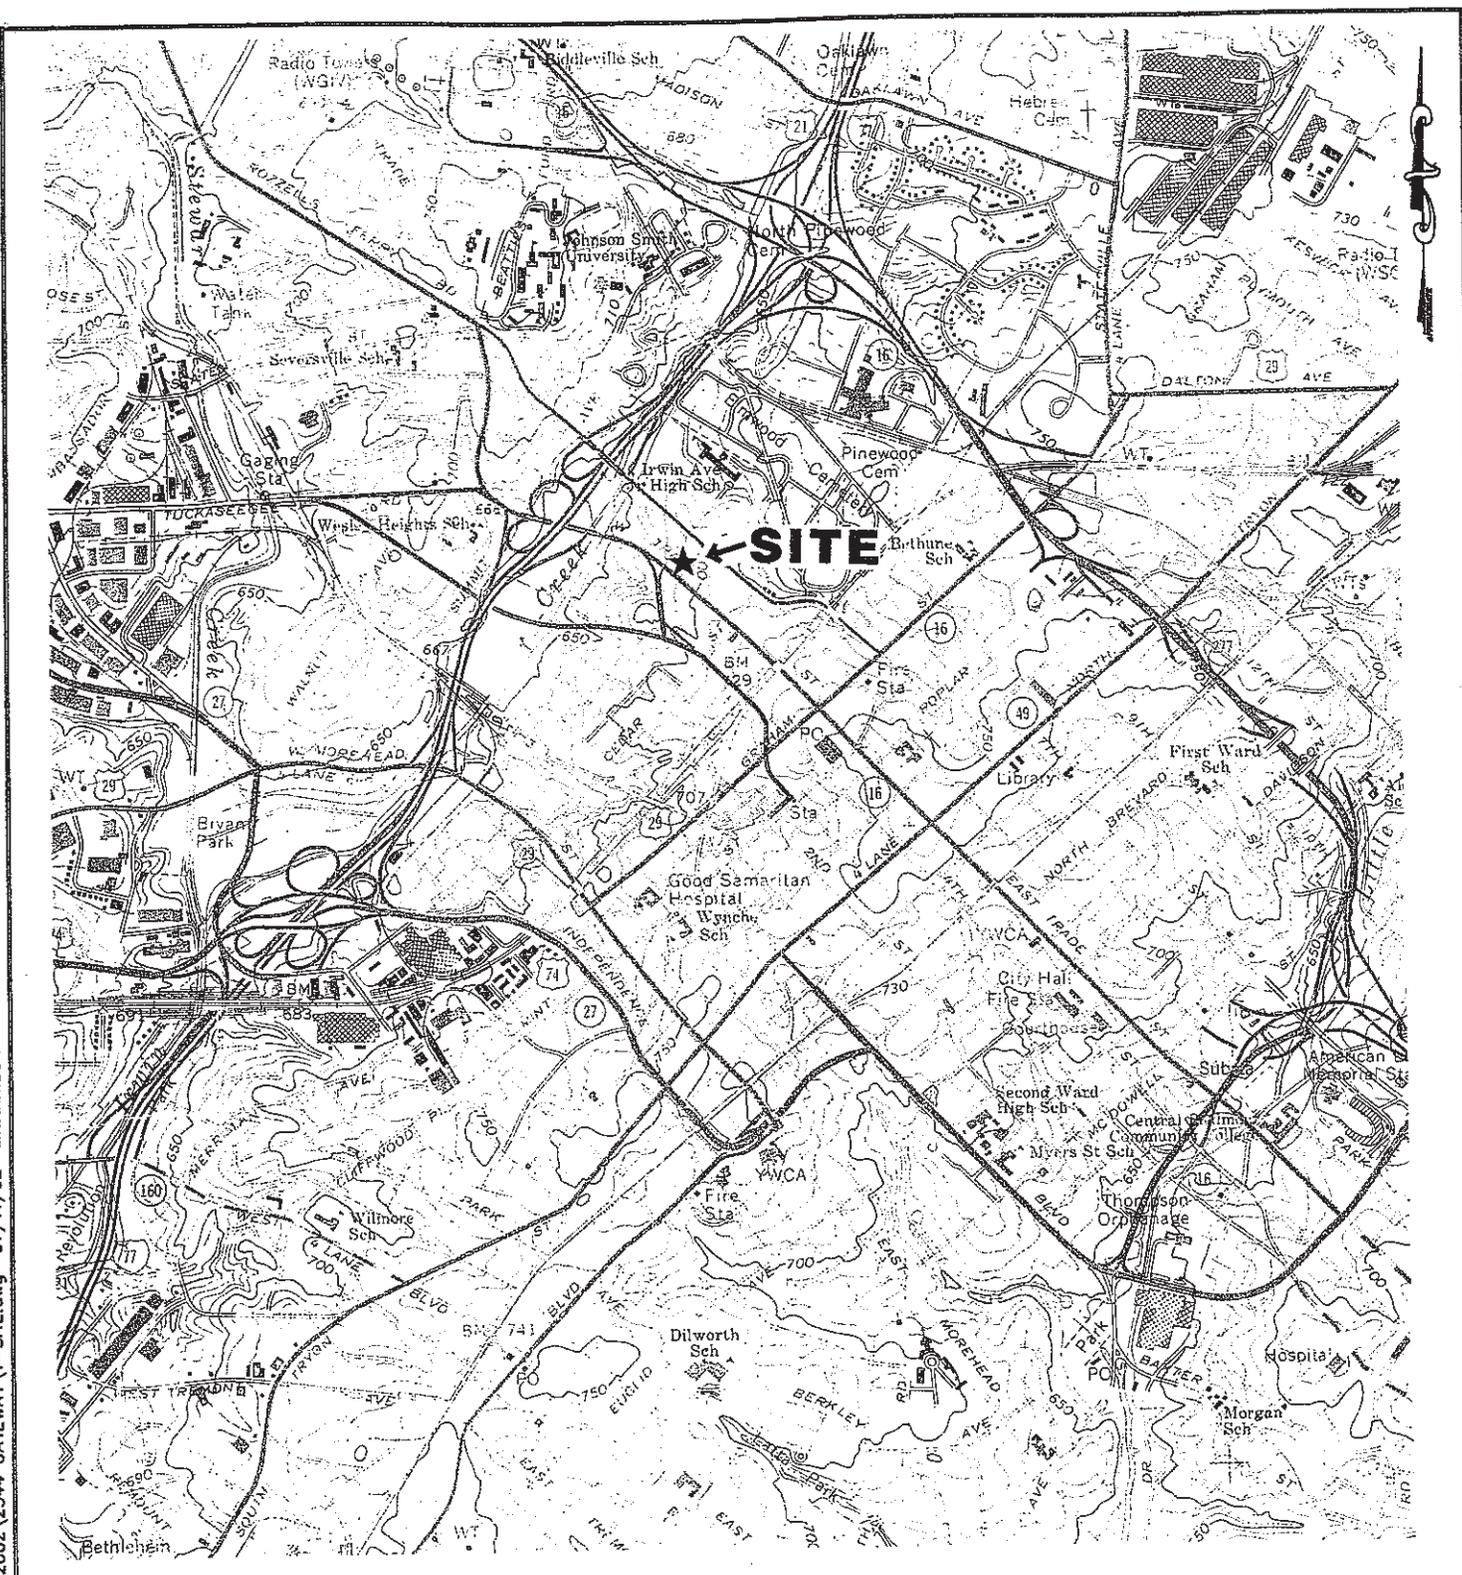

EXPLANATION

★ APPROXIMATE SITE LOCATION



APPROXIMATE SCALE IN FEET

REF.: U.S.G.S. 7.5 MINUTE TOPOGRAPHIC MAP OF CHARLOTTE EAST, N.C. QUADRANGLE, DATED 1967, PHOTOREVISED 1988.

LAW
ENGINEERING & ENVIRONMENTAL SERVICES
CHARLOTTE, NORTH CAROLINA


SITE LOCATION/SURROUNDING PROPERTIES

950 BLOCK GATEWAY VILLAGE
CHARLOTTE, NORTH CAROLINA

PREPARED BY FJE	DATE 7/11/02	CHECKED CU	DATE 7/12/02	JOB NO. 30100-2-2544	FIGURE 1
--------------------	-----------------	---------------	-----------------	-------------------------	-------------

TRADE STREET

GATEWAY BUILDING

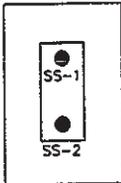

EXPLANATION

- APPROXIMATE LOCATION OF SOIL SAMPLE



APPROXIMATE SCALE IN FEET

REF.: SITE SKETCH PREPARED FROM FIELD NOTES BY LAW ENGINEERING PERSONNEL.



LAW
 ENGINEERING & ENVIRONMENTAL SERVICES
 CHARLOTTE, NORTH CAROLINA

SITE PLAN

950 BLOCK GATEWAY VILLAGE
 CHARLOTTE, NORTH CAROLINA

PREPARED BY <i>FSE</i>	DATE <i>7/3/02</i>	CHECKED <i>cu</i>	DATE <i>7/12/02</i>	JOB NO. 30100-2-2544	FIGURE 2
---------------------------	-----------------------	----------------------	------------------------	-------------------------	-------------

G:\PROJECTS\30140 ENVIRONMENTAL\JOBS\2002\2544 GATEWAY\SITE.dwg 07/05/02 MHARRISON

North Carolina Department of Environment
and Natural Resources

Division of Waste Management

Michael F. Easley, Governor
William G. Ross Jr., Secretary
Dexter R. Matthews, Director



July 23, 2002

Bank of America
800 West Trade Street, Suite 100
Charlotte, North Carolina 28202
Attention: Rob Speice

Re: Notice of Regulatory Requirements
15A NCAC 2L .0115(c)
Risk-based Assessment and Corrective Action for Petroleum
Underground Storage Tanks
Gateway Village *2
950 Block of West Trade Street
Charlotte, Mecklenburg County
Incident # Pending

Dear Mr. Speice:

Information received by this office on July 19, 2002 confirms a release or discharge from a petroleum underground storage tank (UST) system at the above-referenced location. Records indicate that you are the landowner of this UST system. This letter is a standard notice explaining the actions you can take as a result of the release or discharge in accordance with North Carolina statutes and rules. The UST Section of the Division of Waste Management administers the state's rules for USTs and the required response for petroleum releases. Those rules are located in Title 15A, Subchapter 2L and Title 15A, Subchapter 2N of the North Carolina Administrative Code (NCAC).

If you wish to act as the responsible party, you are required to comply with the release response and corrective action requirements of 15A NCAC 2L .0115(c), which include the requirements established in 15A NCAC 2N. Listed is a general description of actions you must take to comply with State rules. For a detailed description of your requirements please refer to the enclosed rules and the most recent version of the UST Section guidelines for assessment and corrective action. The guidelines are available on the Internet at <http://ust.enr.state.nc.us> or may be purchased from the UST Section for a fee of \$8.50. To purchase a copy of the guidelines, please send a check made payable to DENR to:

DENR/DWM/UST Section
1637 Mail Service Center
Raleigh, NC 27699-1637

919 North Main Street, Mooresville, North Carolina 28115
Phone: 704-663-1699 \ FAX: 704-663-6040 \ Internet: <http://ust.enr.state.nc.us/>

AN EQUAL OPPORTUNITY \ AFFIRMATIVE ACTION EMPLOYER - 50% RECYCLED / 10% POST CONSUMER PAPER

Required Actions:

- 1) Submit a Limited Site Assessment (LSA) Report in accordance with 15A NCAC 2L .0115(c)(4), containing information needed by the Department to classify the level of risk to human health and the environment posed by the discharge or release. The LSA Report is due in this office **within 120 days** of the date of this letter. Based on a review of the information submitted in the LSA, the Department will classify the risk of the discharge or release as high, intermediate or low. At that time, the Department will also classify the land use of the site as either residential or industrial/commercial. You will be notified of the risk and land use classifications once review of your LSA Report is completed.

- 2) Please note that before you sell or request a "No Further Action" determination for a property that has not been remediated to below "unrestricted use" standards, you must file a Notice of Residual Petroleum ("Notice") with the Register of Deeds in the county where the property is located (NCGS 143B-279.9 and 143B-279.11). Unrestricted use standards for groundwater and soil are the groundwater quality standards and interim standards contained in 15A NCAC 2L .0202 and the residential maximum soil contaminant concentrations established in 15A NCAC 2L .0115, respectively. The Notice must first be approved and notarized by the UST Section prior to conveyance of a property or prior to receiving a "No Further Action" determination, whichever occurs first. The Notice must contain a legal description of the property containing the source of contamination and legal descriptions of any other properties that you own (or control) that are contaminated by the release. The Notice must include appropriate land use restrictions for these properties. In addition, the Notice must identify all other properties (adjacent, adjoining, downgradient, etc.) on which contamination is known to exist at the time the Notice is prepared. If contamination is located on more than one parcel or tract, the UST Section may require that a composite map or plat be prepared. After the Notice is filed with the Register of Deeds, a certified copy of the filed Notice must be submitted to the UST Section. Additional guidance including the language and format of the Notice is available by calling this regional office or visiting the UST Section web site at <http://ust.enr.state.nc.us>.

If you believe that any of the information requested above has already been submitted, please notify me of the date, title, and content of the documents that contain the information.

Your prompt attention to the items described herein is required. Failure to comply with the State's rules in the manner and time specified, may result in the assessment of civil penalties and /or the use of other enforcement mechanisms available to the State. Each day that a violation continues may be considered a separate violation. If you believe you are not the responsible party notify the UST Section **within 15 days** of the date of this letter.

Please note that performing assessment and cleanup work that is not required under 15A NCAC 2L.0115 is not reimbursable from the Commercial or Noncommercial Leaking Petroleum Underground Storage Tank Cleanup Funds.

Bank of America
July 23, 2002
Page 3

If you have any questions regarding the actions that must be taken or the rules mentioned in this letter, please contact me at the letterhead address and/or at (704) 663-1699 ext. 248. If you have any questions regarding trust fund eligibility or reimbursement, please contact the UST Section Trust Fund Branch at (919) 733-8486.

Sincerely,

A handwritten signature in black ink, appearing to read 'A. Lindon', written in a cursive style.

Amber R. Lindon
Hydrogeological Technician II

Enclosures: 15A NCAC 2L .0115

ARCADIS

Appendix D

User Provided Information



Infrastructure, environment, buildings

Phase I Environmental Site Assessment Questionnaire

(User Provided Information Questionnaire)

Date: 2/25/11
 Site Name: NCW-481 Your Name: Shirley Cato
 Site Location: 950 West Trade St. + 1000 West Trade St.
 Your Title: Senior Manager Property Manager
 Relationship to Site: Owner Occupant Purchaser Other
 Length of Time Associated with Site: 34RS

Please review and complete this questionnaire which will assist ARCADIS in completing our site assessment. If sufficient space is not provided, please complete your response on a separate sheet of paper and attach it to this questionnaire.

1. Are you aware of any environmental cleanup liens against the Site that are filed or recorded under federal, tribal, state or local law?

Yes No Unknown N/A

If Yes, please explain: _____

2. Are you aware of any activity or land use limitations, such as engineering controls (for contaminant control), land use restrictions or institutional controls, that are in place at the Site and/or have been filed or recorded in a registry under federal, tribal, state or local law?

Yes No Unknown N/A

If Yes, please explain: _____

ARCADIS

3. Do you have any specialized knowledge or experience related to the Site or nearby properties? For example, are you involved in the same line of business as the current or former occupants of the Site or an adjoining property so that you would have specialized knowledge of the chemicals and processes used by this type of business?

Yes No Unknown N/A

If Yes, please explain: _____

4. Are you aware of commonly known or reasonably ascertainable information about the Site that would help the environmental professional to identify conditions indicative of releases or threatened releases? For example, as user,

a) Do you know the past uses of the Site?

Yes No Unknown N/A

If Yes, please explain: _____

b) Do you know of specific chemicals that are present or once were present at the Site?

Yes No Unknown N/A

If Yes, please explain: _____

c) Do you know of chemical spills that have taken place at the Site?

Yes No Unknown N/A

If Yes, please explain: _____

d) Do you know of any environmental cleanups that have taken place at the Site?

Yes No Unknown N/A

If Yes, please explain: _____

e) Do you know if any fill material has been imported to the Site?

ARCADIS

Yes No Unknown N/A

If Yes, please explain: _____

5. Do you know of any pending, threatened, or past litigation relevant to hazardous substances or petroleum products in, on, or from the Site?

Yes No Unknown N/A

If Yes, please explain: _____

6. Do you know of any pending, threatened, or past administrative proceedings relevant to hazardous substances or petroleum products in, on or from the Site?

Yes No Unknown N/A

If Yes, please explain: _____

7. Do you know of any notices from any governmental entity regarding any possible violation of environmental laws or possible liability relating to hazardous substances or petroleum products at the Site?

Yes No Unknown N/A

If Yes, please explain: _____

8. Based on your knowledge and experience related to the Site are there any obvious indicators that point to the presence or likely presence of contamination at the Site?

Yes No Unknown N/A

If Yes, please explain: _____

9. Does the Site's purchase price reasonably reflect the fair market value of the property?

ARCADIS

Yes No Unknown N/A

If No, do you know the reason for lower purchase price? Is it possible that the lower purchase price is because of contamination known or believed to be present at the Site?

Yes No Unknown N/A

If Yes, please explain: _____

Appendix E

Qualifications of Environmental
Professionals

Education

Bachelors of Science -
Massachusetts Maritime
Academy

Licenses

Asbestos Inspector –
Massachusetts '09, '10
Michigan '10
New York '10
Nevada '10

Mold Awareness Training
OSHA 40

10-hr OSHA Supervisor

Years of Experience

Total - 5

With ARCADIS - 3

Sean D. Drain

Environmental Scientist

Mr. Drain serves as a Staff II Scientist in the Environmental Department of ARCADIS' office in Braintree, Massachusetts. His responsibilities include field services for environmental site assessments, ASTM phase I due diligence evaluations, industrial hygiene (including asbestos), and health and safety.

Project Experience

Various Mold Remediation Projects

Monitored the removal of mold and fungal contaminated material and build-back for numerous telecommunications facilities around the country. Completed closeout reports for the various job sites for the clients.

Conducted Various Building Inspections for Asbestos

Building inspections and report writing at various buildings and facilities located in Charlestown, MA, Cambridge, MA, Danbury, CT, St. Paul, MN, Massena, NY, Detroit, MI, Buffalo, NY, Las Vegas, NV, Bayonne, NJ, Baltimore, MD, and Boston, MA.

Environmental Site Assessments

Conducted various ASTM Phase I Due Diligence site assessments at various facilities. Completed reports for sites in Fall River, MA, Las Vegas, NV, Atlanta, GA, Detroit, MI, Cincinnati, OH, Fayetteville, AR, Jackson, MS, Charleston, SC, Gettysburg, PA, Fredericksburg, VA, Washington, DC, Annapolis, MD, Welch, WV, Nashua, NH, Waterville, ME, Philadelphia, PA, Hickory, NC, Queensbury, NY, New York City, NY, Providence, RI, and Worcester, MA.

Environmental Site Cleanup

Contaminated soil remediation at sites in Sandwich, MA, along Rt. 3 Northbound side in Plymouth, and Oxford, MA

Operated cleanup equipment to remove contaminated soil from sites. Assisted with emergency response call to Auburn, MA to cleanup a home heating oil tank rupture. Applied absorbent to remove bulk of oil from basement, along with contaminated building materials such as carpet, wall board, and flooring.

Braintree Power Plant

Braintree, MA

Assisted with the cleaning of storm drain pipes using a jet-rod system and a vector truck, to remove contaminated soils and water from the concrete pipes.

Education

BA, History, Providence
College, 1986

Years of Experience

Total - 24
With ARCADIS - 24

Professional Registrations

Asbestos Inspector,
AHERA Management Planner,

Stephen P. McCarthy

Principal Scientist

As Director of Site Assessments at ARCADIS Braintree, Massachusetts office, Mr. McCarthy is responsible for the technical supervision of all personnel performing Phase I Environmental Site Assessments (ESAs). His responsibilities include technical oversight, logistics, scheduling and cost control, interface with clients and regulatory agencies, quality control of environmental assessments conducted within the branch and conducting Phase I ESAs throughout the United States.

With over 20 years of experience in the environmental consulting field, Mr. McCarthy has provided his technical expertise on a wide-range of projects for property owners, financial institutions, school departments, governmental agencies and hospitals. Mr. McCarthy has conducted environmental assessments on commercial/retail, residential and industrial properties in accordance with the American Society for Testing and Materials (ASTM) standard practice for Environmental Site Assessments E 1527 and client specific scopes of work. In addition, Mr. McCarthy has conducted asbestos identification surveys, prepared Operations and Maintenance programs, developed asbestos abatement technical specifications, monitored removal of asbestos-containing materials, performed indoor air quality investigations, managed the removal of underground petroleum storage tanks and prepared Spill Prevention, Control and Countermeasure (SPCC) plans.

Project Experience

Environmental Assessment Projects

Various Properties (Client Confidential), Nationwide

As Project Manager, was responsible for the overall project management of multi-site/multi-state environmental assessment projects. These projects ranged in size from a single site up to 36 different sites located across the United States. Mr. McCarthy was responsible for project scheduling, cost control, technical oversight and review of all final reports prior to issuance to ensure they complied with ASTM standards and client specific requirements.

Phase I ESAs

NationsBank, Dallas, Texas

As Project Manager, was responsible for the overall project management of the performance of 50 Phase I ESAs of bank buildings located throughout the State of Texas within a six-week time frame. The ESAs consisted of inspections of current site operations and a reconnaissance of

abutting/adjacent properties, historical research and review of federal, state and local regulatory records.

Phase I ESAs

NationsBank, Corsicana, Texas

Performed a Phase I ESAs on three tracts of land in downtown Corsicana, TX. Project involved a detailed historical research on former uses of the tracts of land revealed numerous suspect underground storage tank (UST) locations. Designed and coordinated performance of a geophysical survey on the three tracts of land to identify the likely presence of USTs to aid in the preparation of the scope of work for a Phase II subsurface investigation. The geophysical survey consisted of the use of a combination of electromagnetic induction (EM31) and ground magnetics. Based upon the findings of the geophysical survey, prepared a scope of work and cost estimates for the performance of the subsurface investigation.

Asbestos Identification Surveys

NCNB Texas National Bank, Dallas, Texas

Provided asbestos identification surveys on 110 buildings containing over 8 million square feet of space located throughout the state of Texas. Responsibilities consisted of design of the survey strategy, on-site inspection and collection of bulk material samples, assessment of asbestos-containing materials, interpretation of data and preparation of final reports. Project included preparation of recommendations for further action at each facility, if warranted, and associated cost estimates.

Asbestos Abatement Project

First Republic Bank, Dallas, Texas

Managed a \$2 million dollar asbestos abatement project at an occupied high rise office building. Responsibilities included project design, specification preparation, conducting pre-bid conferences, collection and analysis of air samples, daily inspections of abatement contractor's work practices and consultation with owner's representative on all aspects of the abatement project.

Asbestos-Containing Material Survey

First Republic Bank, Dallas, Texas

Performed an asbestos-containing material survey of the 50-story, 1.8 million square foot, First Republic Bank complex in Dallas, Texas. Responsibilities consisted of design of the survey strategy, overall management of the five person survey team, on-site inspection and collection of bulk material samples, assessment of asbestos-containing materials, interpretation of data and preparation of a final report.

Underground Storage Tank Removal

NationsBank, Dallas, Texas

Coordinated the emergency removal of four underground storage tanks, which were uncovered during construction of a highly publicized branch bank facility. Successfully coordinated with state regulatory officials and a tank removal contractor for the removal of the USTs within 48 hours of detection so as to not impede bank construction. Performed project oversight which included preparation of a health and safety plan, collection of appropriate soil samples from the tank excavation, interpretation of analytical data and preparation of the tank closure report for submission to state regulatory officials.

Spill Prevention Control and Countermeasures (SPCC) Plans**NYNEX**

various locations throughout New England. Performed facility inspections and prepared SPCC plans in compliance with regulations of the Environmental Protection Agency (EPA) for various NYNEX facilities located throughout New England.