



FACILITY COMPLIANCE INSPECTION REPORT
Division of Waste Management
Solid Waste Section

UNIT TYPE:

Lined MSWLF		LCID		YW		Transfer		Compost		SLAS		COUNTY: Dare PERMIT NO.: 28-03 FILE TYPE: COMPLIANCE
Closed MSWLF		HHW		White goods	X	Incineration		T&P		FIRM		
CDFL	X	Tire T&P / Collection	X	Tire Monofill		Industrial Landfill		DEMO		SDTF		

Date of Site Inspection: 29 October 2013

Date of Last Inspection: 2 August 2013

FACILITY NAME AND ADDRESS:

Dare County C&D Landfill
 1603 Cub Road
 Manns Harbor, NC 27953

GPS COORDINATES: **N:** 35.83498 **E:** 75.82002

FACILITY CONTACT NAME AND PHONE NUMBER:

Edward L Mann; Director, Dare County Public Works
 252.475.5880

FACILITY CONTACT ADDRESS:

Director
 Dare County Department of Public Works
 PO Box 1000
 Manteo, NC 27954
 e-mail: edwardlee@darenc.com

PARTICIPANTS:

Barry Cahoon; Dare County Solid Waste
 Ray Williams; DENR-Solid Waste

STATUS OF PERMIT:

Active; Permit to Operate (PTO) Cell 4 issued 13 April 2011, expires 28 November 2016. A complete permit review request including all updated facility, operations, and waste screening plans is due on or before 28 July 2016. This application must comply with the rules and regulations in effect at the time of the application.

PURPOSE OF SITE VISIT:

Partial Facility Compliance Inspection

STATUS OF PAST NOTED VIOLATIONS:

None applicable

OBSERVED VIOLATIONS:

None

ADDITIONAL COMMENTS:

- 1) This Facility is permitted to receive Construction and Demolition (C&D) waste, inert debris, land-clearing debris, asphalt, and scrap tires generated in Dare County.
- 2) This Facility is currently operating in cell 4.
- 3) The Facility is secured by means of a locked gate at the facility entrance.
- 4) The hours of operation are Monday through Friday 7:00 AM to 5:00 PM and Saturday 7:00 AM to 12:00 PM. Three Holidays are observed: New Year's Day, Thanksgiving Day, and Christmas Day.
- 5) Proper signage including the Facility permit number, accepted waste types, banned or excluded items, hours of operation, and the emergency contact number is posted at the facility entrance.
- 6) The Facility access road is of all-weather construction and is being maintained in overall good condition.
- 7) This Facility is currently receiving +/- 60 tons of waste per day for disposal.
- 8) This Facility screens all incoming loads of waste; two random waste screenings are currently being recorded per week.
- 9) This Facility requires 24 hour advance notice for the disposal of asbestos containing materials. All asbestos containing waste is disposed in an active area separate from the working face and is covered immediately upon receipt.
- 10) Permanent Edge of Waste markers are in place and are being maintained as required.


FACILITY COMPLIANCE INSPECTION REPORT
Division of Waste Management
Solid Waste Section

2803-20131029INSP

Page 2 of 3



- 11) The waste type in the landfill was reviewed; no unpermitted wastes were noted at the working face during this Facility Compliance Inspection.
- 12) All recyclable metals and white goods are screened from incoming waste, removed from the working face, and transported to the white goods/metal recycling area daily.
- 13) The white goods/metal recycling area is being well managed at this time.
- 14) Facility monitoring wells were reviewed during this Facility Compliance Inspection. All the wells were secured with functioning locks.
- 15) Overall, the closed areas of the landfill have a well-established cover crop of native warm season type grasses and no areas of erosion were observed during this Facility Compliance Inspection.

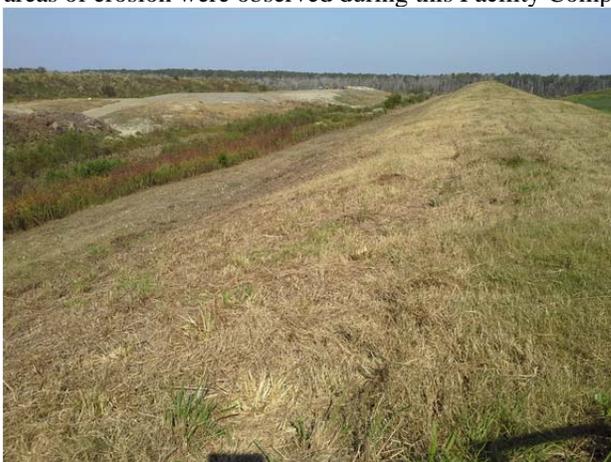

- 16) Brush and other woody vegetation were observed growing on the sideslopes of closed Cells #1, #2, and #3. Mowing operations were underway during this Facility Compliance Inspection.



- 17) Ground wood waste mixed with soil has been staged adjacent to the Cell 4 access ramp for use in erosion repair/control.
- 18) Vegetative waste is staged in an area adjacent to Cell 4 for future grinding and removal from the site for use as boiler

FACILITY COMPLIANCE INSPECTION REPORT
Division of Waste Management
Solid Waste Section


2803-20131029INSP

Page 3 of 3

fuel.

- 19) The active working face is being maintained in a compact and manageable size.
- 20) The working face is being covered weekly.
- 21) Soil is stockpiled adjacent to the active working face for use as cover.
- 22) Windblown debris is being well managed at this time. Windblown debris was minimal and none was observed leaving the Facility.
- 23) No violations were observed during this Facility Compliance Inspection.

Please contact me if you have any questions or concerns regarding this Facility Compliance Inspection Report.



Ray Williams; Environmental Senior Specialist Phone: 252.948.3955 E-mail: ray.williams@ncdenr.gov

Regional Representative

Delivered on : <u>31 October 2013</u> by	X	Electronic delivery		US Mail		Certified No. []
---	---	---------------------	--	---------	--	-------------------

cc: Dennis E Shackelford; Eastern District Supervisor/SWS: dennis.shackelford@ncdenr.gov
Jessica Montie; Chief Compliance Officer/SWS: jessica.montie@ncdenr.gov
Clyde Gard; Assistant Director/Dare County Public Works: clydeg@darenc.com

C: \2013\Dare\Facilities\28-03\Inspections\2803-20131029INSP
NCDENR CARA Portal: <https://edm.nc.gov/DENR-Portal/>

 Go Green! Thank you for helping NCDENR be environmentally responsible.

One
North Carolina
Naturally